State of Wisconsin

Jean F. Resvick

County of Forest

certify that on the 10th day of July , 19 63, I found

Township......34...., North, Range

14 East, Fourth Principal Meridian,

as described hereon; and that from this evidence

I established a new monument and accessories

evidence of the Northwest Section

corner of Section 2

O = Corner monument restored.

## CERTIFIED LAND CORNER RESTORATION

Index No.

History of original corner establishment:

Surveyed in 1859 by James McBride

80.00 chains west between sections 2 and 35

Set wood post from which

Tamarack 12", bears N26°W, 17 Lks

1.00 ch. east leave swamp

Y. Birch 10", bears N40°E, 74 Lks

Tamarack, 14", bears S15°E, 24 Lks

Y. Birch 6", bears S67°W, 28 Lks

9.00 ch north leave cedar swamp

Description of corner evidence found:

At a point north, 181 feet from south edge of swamp, found top of post under moss and tag alder roots. From top of post found point of original post in place. From point of post Tamarack snag 16", bears \$15°E, 16.65 feet which has evidence of both top and lower blazes with the interior completely rotted out. Rotted tamarack stump under moss bears N26°W, 11 feet from point. From point edge of swamp bears east 85 feet.

Description of monument and accessories I established to perpetuate the original location of this corner. Replaced point of post with 2-inch inside diameter galvanized iron pipe, 5-feet long, flanged at bottom, filled with concrete, tamped in sand, with brass cap marked.

	T35N	RILE	
	S34 S 3	<b>S35</b>	
A	<b>S</b> 3	S 2	. )
id	<b>ТЗ</b> 4N		
	1963		
. /	S-80	2	

From which the following new bearing trees bear:
Spruce 6", N40°E, 29.85 feet (45 Lks)
W. Pine 13", S74°E, 26.50 feet (40 Lks)
Maple 8", S75°W, 29.60 feet (45 Lks)
Tamarack 6", N53°W, 10.70 feet (16 Lks)

Dated at Rhinelander	, Wis., this.	10 th	day of	December	19 63
			<b>~</b>		on No. S-802
(County Surveyor, Register	ered Land Surve	eyor, or other dul	ly authorized offi	icial)	
County Surveyor, Register of Deeds, County of nstrument was filed in this office for restruction. M.	cord on the	ce at	day of	, I hereby certif	y that the within
it 9:00 o'clock A. M.					
anna Cet	erson		<b>-</b>	88138	
(Register of Deed	ds)				

## U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through 1).

reference to the U.S. public land survey system.


O - Corner monument restored.

NORTHWEST CORNER OF SECTION 2, TWP.

34 N., R. 14 E. ALSO BEING THE SECTION

CORNER TO SECTIONS 2-3-34-35 TWP. 34-35

N., R. 14 E.

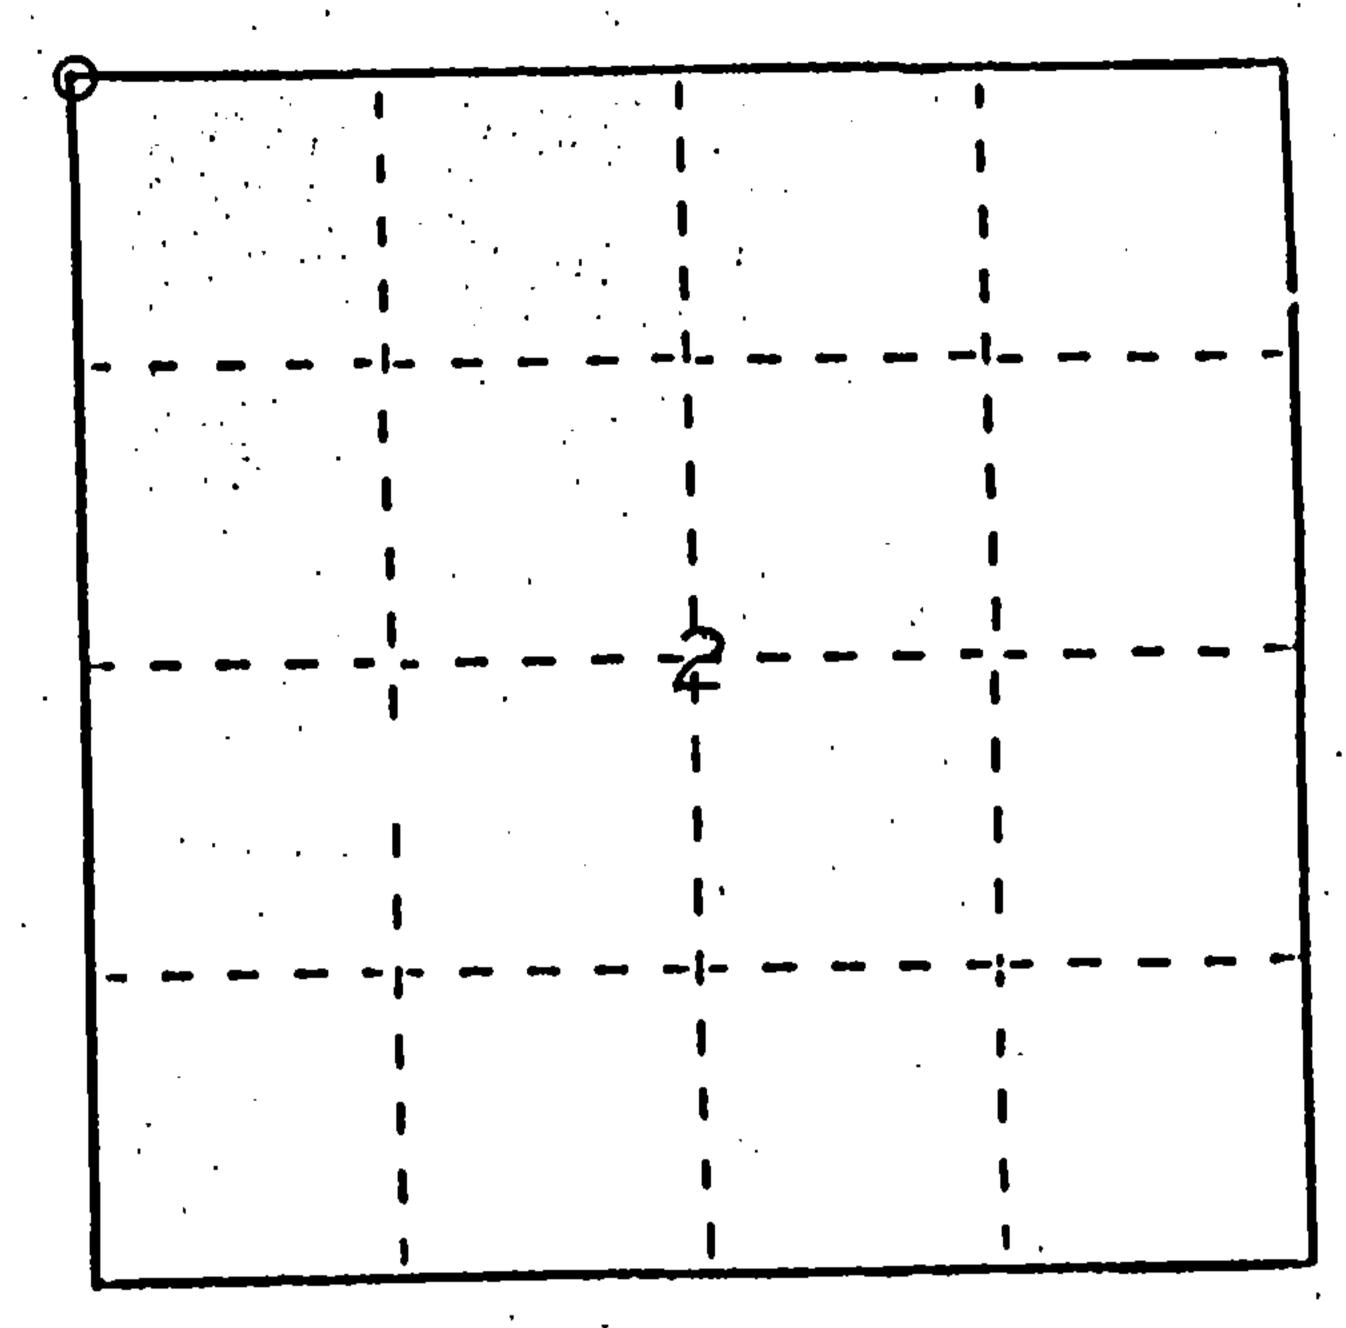

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

ORIGINAL SURVEY OF SECTION 2

RESURVEY BY RESVICK R.L.S. NO. S-802, FOUND EVIDENCE OF ORIGINAL

CORNER, SET 2" DIA. IRON PIPE WITH BRASS CAP.

B.T.s SPRUCE 6" N.40° E. 29.85FT., WHITE PINE 13" S.74° E. 26.50FT.,

MAPLE 8" S.75° W. 29.60FT., TAMARACK 6" N.53° W. 10.70FT.

DOBBRATZ R.L.S. NO. S-973, FOUND B.T.S AND MONUMENT AS NOTED BY

RESVICK IN 1963, 1 B.T. DOWN.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)


  Describe witness monuments.
- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

B.T.s 1 WHITE PINE 13" S.74 E. 26.50FT. (EXISTING)


- 2) YELLOW BIRCH 7" S.9"W. 22.95FT. (NEW)
- (3) MAPLE 8" S.75°W. 29.60FT. (EXISTING)
- (4) TAMARACK 6 " N.53° W. 10.70 (EXISTING)

WITTNESS MONUMENT

- 6) STEEL SIGN POST 0.50 EAST (EXISTING)
- DIA. IRON PIPE WITH BRASS CAP STAMPED TO IDENTIFY CORNER AT SECTION CORNER (EXISTING)

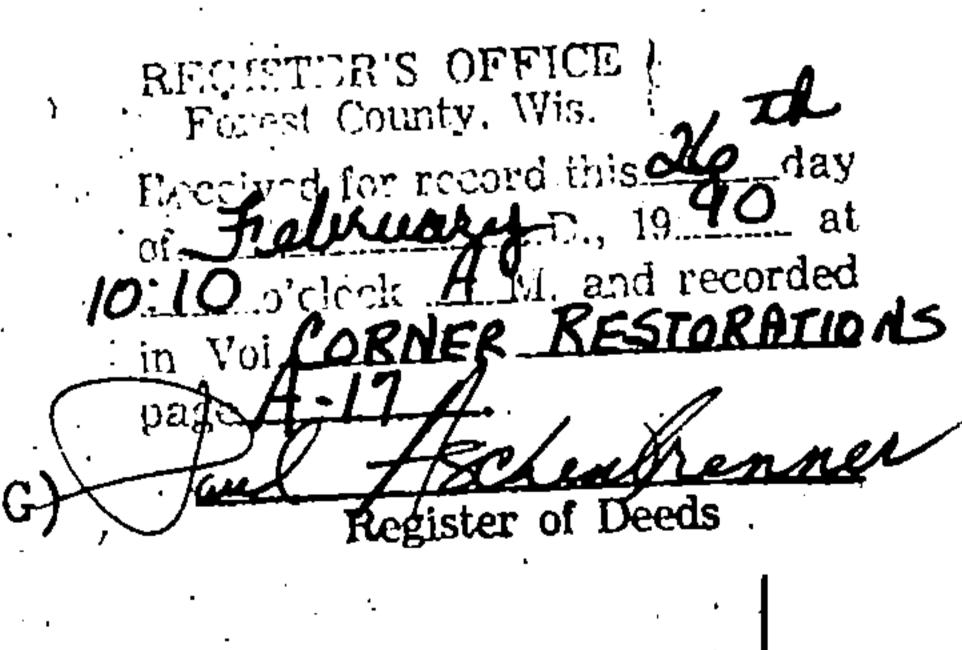

and the state of the

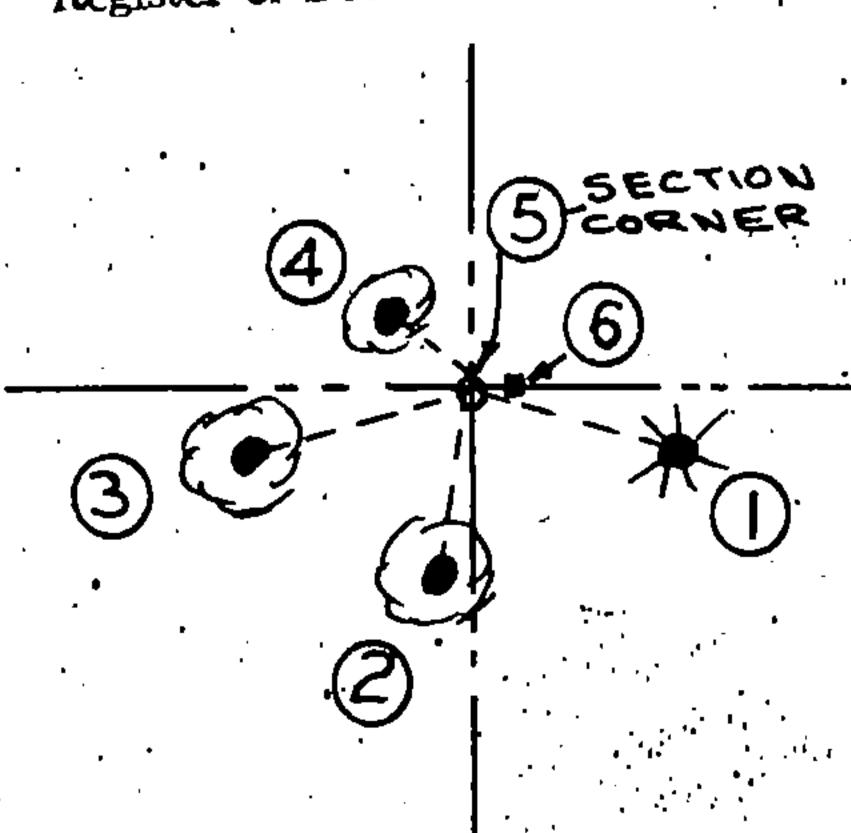

(e) Describe any material discrepancy between the location of the corner as restored or reastablished and the location of that corner as previously restored or reastablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reastablished and (1) the corner as restored or reastablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

(f) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) FOUND PERPETUATED LOCATION

(gan) was the corner reestabilished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Affix Land Surveyor Seal

OF WISCOLUMN

WAYNE G.

DOBBRATZ

S-00973

TOWNSEND,

WIS.

Itype or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Honument Record is correct and complete to the best of my knowledge and bellef.

Signatuje // //////////

10/6/89

CERTIFICATE READY FOR FILTING:

District Ranger