LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The South Quarter corner of Section 35, T. 33 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply) 4331135 0020

- ☐ Restored through acceptance of an obliterated evidence location.
- ☒ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re-established through proportionate methods.
  Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- ☐ Restored/recovered/re-established in a location that differs from a previously established position.
  (Show difference in plan view below).
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1859 by Hiram Fellows. Original bearing trees: birch, 10", S23E, 12 links and a sugar, 9", N07W, 7 links. In the resurvey of 33-11 in 1939, Hintz: "fnd old plain stake & BT by unknown surveyor and BT ..... by Dorr & stake hole corresponding to same. Used cor. by Dorr". He marked three BO's, being "+" cut in stones at: N82E, 5.6 ft; S2 1/2E, 6.7 ft. and at S84 1/2E, 6.3 ft. He also noted "Brass cap set 9-29-36"
5/21/02 D. Tlusty, D. Williams found 4" iron pipe with brass cap. Pipe as found is frost heaved and leaning at fence corner, fences N-S-E & W. Found all three BO's in good condition. Reset the existing monument using the 3 recovered BO's. Added bearing trees as shown below.

Physical description of the monument set:

I left the existing 4" iron pipe with brass cap in place. Set sign post south, 0.5'

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

FB 17-145

LEGEND

- ◉ 4" iron pipe w/brass cap found
- ◎ 2" iron pipe w/brass cap set

Bearing trees are blazed and painted blue and have "Bearing Tree" sign facing corner. Measurment is to an aluminum nail as noted. Bearings magnetic with hand compass.

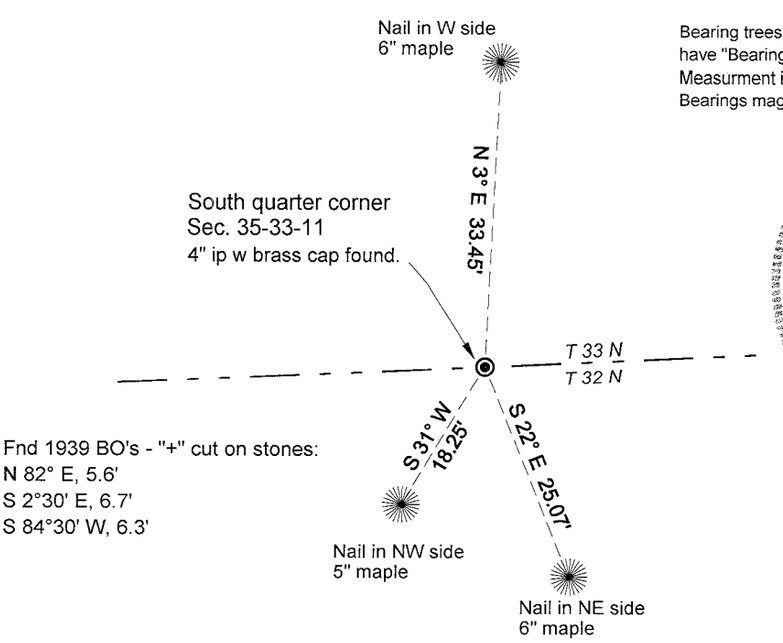

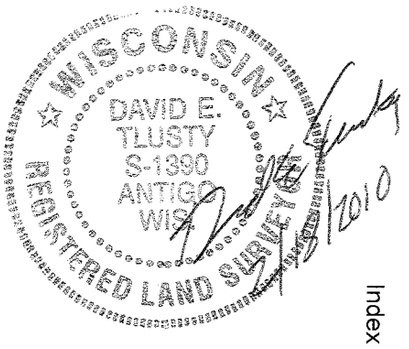

Index No.

35

Z 19 33-11

O = corner perpetuated

The South Quarter corner of Section 35, T. 33 N., R. 11 E., Langlade County, WI

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.