

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.

A-E 7.08(3)(a) Identity of the corner:

S 1/4 Corner Section 33

Township 35 North

Range 13 East

Town of Lincoln

County of Forest

WISCORS - Forest County

N: 532051.555 USFT

E: 844018.276 USFT

Datum: NAD 83 (2011)

GNSS Method: WISCORS VRS Direct Observation

Original Corner Information:


Original Surveyor: Alfred Millard

Date of Survey: August 1857

Original B.T.'s: Tamarack 10 N13°E 12 links

Tamarack 12 S8°W 25 links

Corner ID: 43513330020

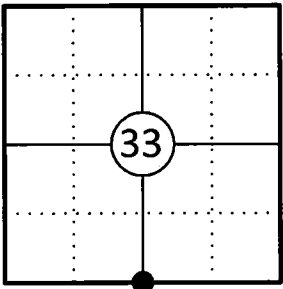

A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.



11/14/1961 Joseph C. Kirby, Forest County Survey File # 351333-19611114 indicated iron pipe (Original 1/4 Corner). 2613.92' to SE corner and 2639.02' to SW corner.

05/14/2002 Kip W. Soder Forest County Survey File # 351333-20020514 indicates a 2" dia. Iron pipe found in place


06/05/2015 Timothy J. Rusch Forest County Survey File # 341303-20150605 shows a 1.05" dia. iron pipe set. I reached out to Rusch and he said that he did not find Kirby's pipe. He set his pipe by proportioning in Kirby's section breakdown vs his measurements between the southwest, southeast and north quarter corners of Section 33. He indicated that Kirby's distances were all longer than his measurements, but somewhat proportional.

03/28/2025 I found and accepted a 1" dia. iron pipe 10" above grade at the corner location and two existing bearing trees not of record. I made two additional bearing trees to witness the corner as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning.

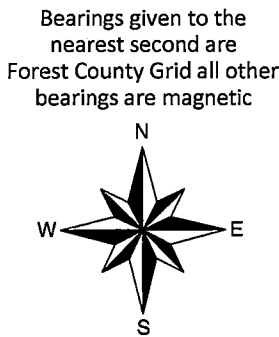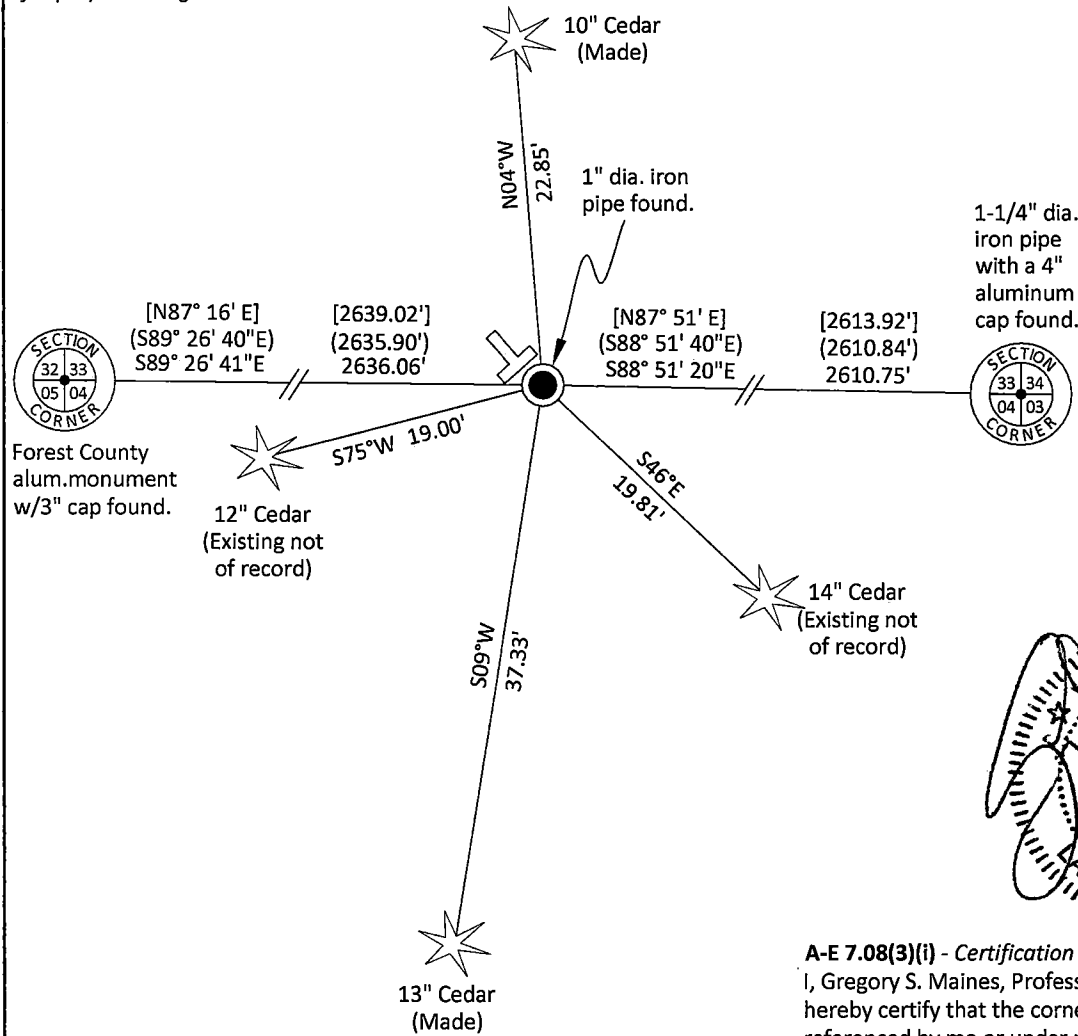

- * Bearings given to the nearest second are Forest County Grid all other bearings are magnetic
- * Vinyl "T" post 0.9' northwest of corner.
- * Distances to bearing trees are to nail in side with BT tag on tree.
- * Sketch is not to scale
- [00] Kirby's record measurement
- (00) Rusch's record measurement

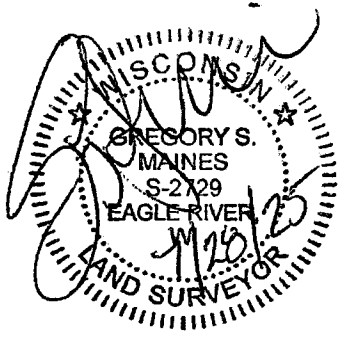

A-E 7.08(3)(i) - Certification
I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.

43513330020

Index No.: 211