

CERTIFIED LAND CORNER RESTORATION

Index No. P-5

State of Wisconsin }  
County of Forest } ss.

I Milo E. Stefan, do hereby  
certify that on the 14th day  
of December, 1993, I found  
evidence of the 1/4  
corner ~~at~~ to Sections 19 & 20  
Township 36, North, Range  
12 East, Fourth Principal Meridian,  
as described hereon; and that from this evidence  
I established a new monument and accessories  
as described hereon to perpetuate the original  
location of this corner.

Resident witnesses:

Myron Smith


Charles Blomdahl

History of original corner establishment: By James L. Nowlan, 8/8/1859 at 40.00 chains set  
1/4 Section Post/two BTs:  
8" Fir, N63°E, 13 Lks  
7" Hemlock, S62°W, 25 Lks

Description of corner evidence found:  
May 2, 1921 - I.R. Ritter's "Record of Survey" as filed with the Forest County Register  
of Deeds indicate he found evidence of this corner and restored it. As this corner fell  
in the road, two new BTs were made:  
14" Cedar, N65°E, 79 Lks 10" Cedar, S25°W, 81 Lks

12/14/1993 - We found corner position marked with iron pipe below road surface.

Description of monument and accessories I established to perpetuate the original location of this corner.  
We placed a railroad spike in road surface with a 1" x 24" aluminum monument Reference  
Monument, West, 24.75 feet and BTs as follows:  
5" White Pine, S18°E, 131.26 Feet  
16" White Spruce, N89°W, 153.17 Feet  
10" White Spruce, N28°W, 48.27 Feet  
Power Pole #3612-19R1, S34°W, 39.14 Feet

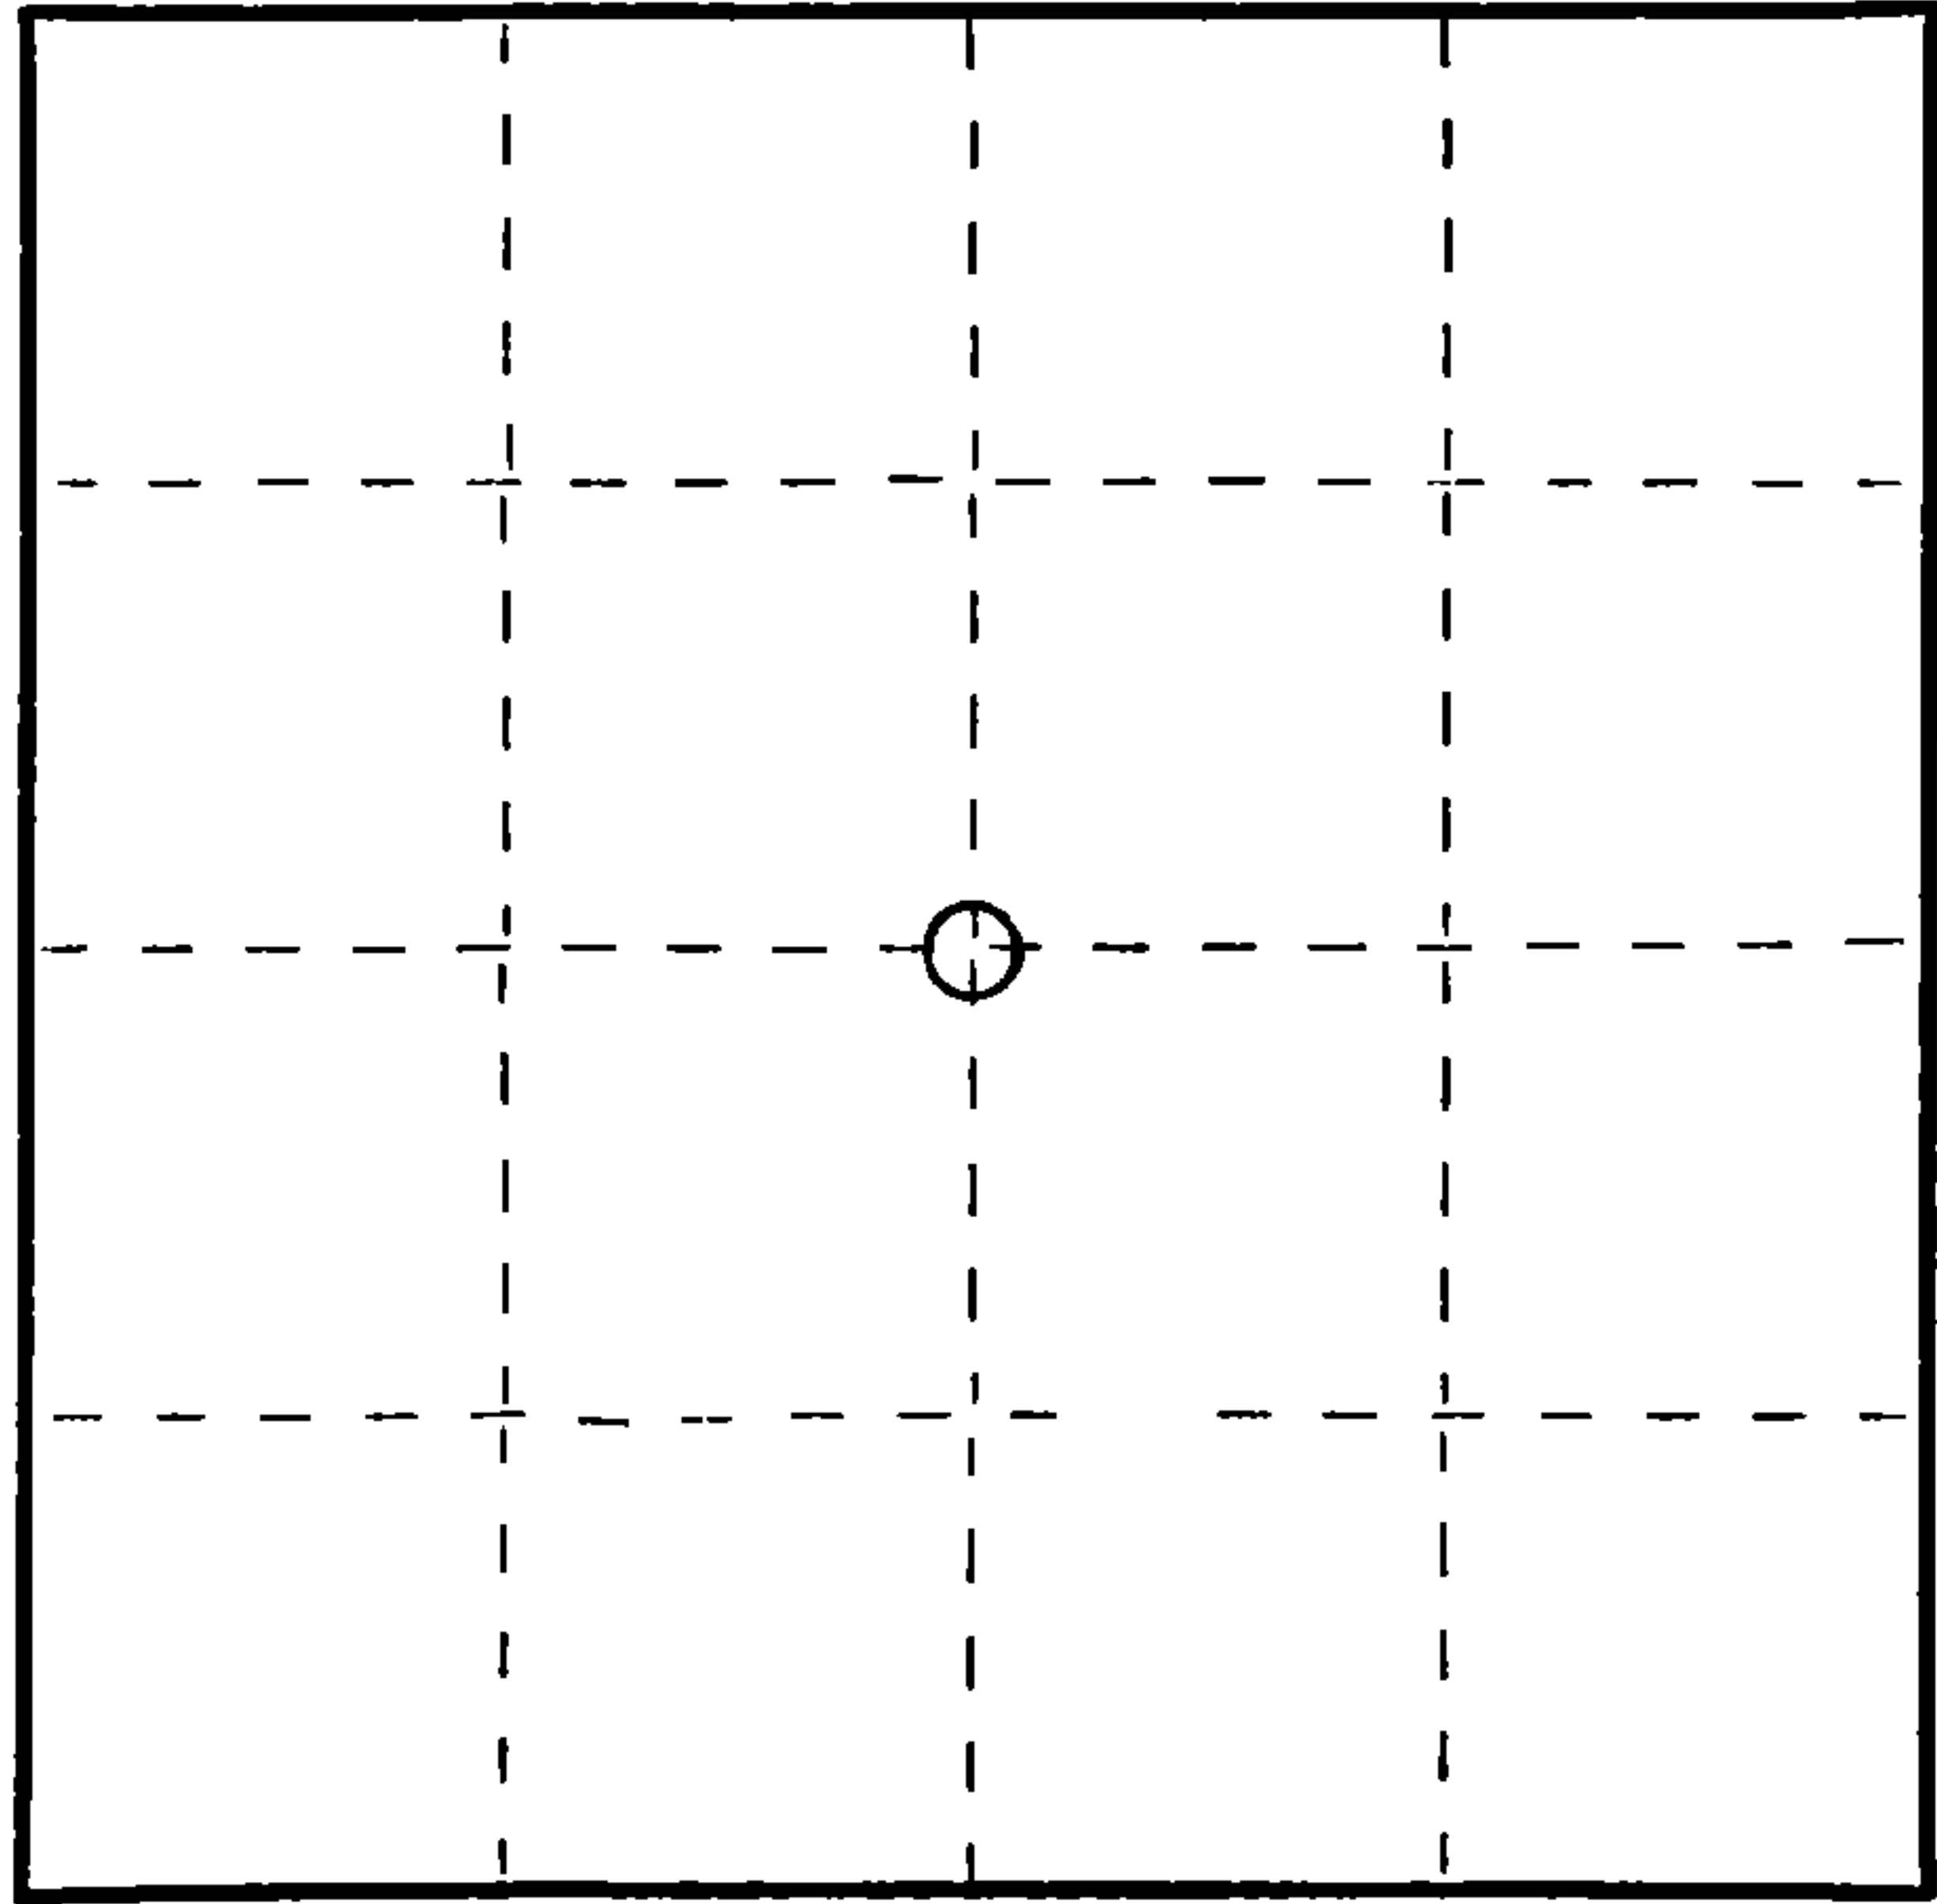

○ = Corner monument restored.

Dated at Rhinelander, Wis., this 30th day of December, 1993

Signature Milo E. Stefan Title Registered Land Surveyor Registration No. 1558  
(County Surveyor/Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of \_\_\_\_\_, I hereby certify that the within  
instrument was filed in this office for record on the 7th day of FEBRUARY, 1994  
at 1:30 o'clock P M.

Paul Aschbacher  
(Register of Deeds)

By \_\_\_\_\_ Deputy

DOCUMENT NUMBER  
149574

FORM 985 M. C. MILLER CO., MILWAUKEE

43612192000

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

Affix Land Surveyor Seal



(i) 1. Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan  
Signature

12/30/93  
Date