

4311420 2000 2026

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to it if necessary to conform with said requirements.

(a) Corner Location:

Wisconsin Corner ID: 43114202000

Type of Monument: RR Spike

Location: East Quarter Corner

Section 20, Township 31 North, Range 14 East,
Village of White Lake, Langlade County, Wisconsin

Langlade County Coordinates NAD83(2011):


Northing: 345305.50

Easting: 720341.00

RTK GPS direct observation

Calibrated to HMP DP864 (Wolf River S GPS)

3 position average on 5/8/2026

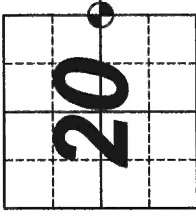

(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablishment through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- ORIGINAL - Sep. 1857 - McBride, J. - Set quarter section post. Birch 15 S46E 19 lks, Hemlock 18 S69W 24 lks.
- May 1898 - B. F. Dorr - Old FB 4A page 32, Oneida Co records - did not find E1/4 post section 20.
- 1918 - Hutchinson FB 149 page 28 - Stone 8x8x14 with + on top.
- Sept. 1944 - Map #40272 - Henry Olk shows corner at CL intersection of 50' wide roads.
- April 1987 - Map #40502 - Thomas Arnott shows corner 2630.27' from center of section.
- July 1987 - Seymour - found RR spike in intersection of streets.
- Dec. 1987 - William F Kelly - Tie Sheet - found and accepted RR spike as corner. Distance to SE corner Section 20 checks 2636.05'
- April 1993 - Map #20076 - Wayne Dobbratz found RR spike 5302.50' from W 1/4 corner.
- April 1992 - Map #20026 - Wayne Dobbratz found RR spike 5302.50' from W 1/4 corner.
- Jan. 1993 - CSM V.6 P.13 - Doc. #309760 - David Osterbrink found RR spike 5291.11' from E 1/4 corner of Section 21.
- Jan. 1993 - CSM V.6 P.60 - Doc. #311856 - David Osterbrink found RR spike 5291.11' from E 1/4 corner of Section 21.
- Jan. 1993 - CSM V.6 P.61 - Doc. #311857 - David Osterbrink found RR spike 5291.11' from E 1/4 corner of Section 21.
- Nov. 1994 - CSM V.6 P.69 - Doc. #312340 - David Tilusty found RR spike.
- Aug. 1996 - CSM V.7. P.49 - Doc. #320706 - Thomas Arnott found a corner 5302.41' from W 1/4 corner.
- Dec. 1997 - CSM V.7 P.171 - Doc. #328311 - Daniel Higginbotham found ¾" iron rod 5291.03' from E corner of section 21.
- Sept. 2004 - CSM V.12 P.51 - Doc. #377046 - Dean Williams found RR spike 2635.40' from SE corner.
- Nov. 2004 - Map #20278 - Dean Williams found RR spike 2629.96' from center.
- Oct. 2004 - Map #20277 - Dean Williams found RR spike at CL intersection.
- May 2009 - CSM V.15 P.125 - Doc. #404427 - Timothy Rusch computed corner from ties 5291.02' from E 1/4 corner of section 21, and 2635.30' from SW corner of Section 21.
- Dec. 2009 - Map #20390 - Timothy Rusch - Found RR spike 2630.02' from center, 2635.32' from SE corner.
- June 2010 - CSM V.16 P.27 - Doc. #409555 - Timothy Rusch computed corner from ties 5291.02' from E 1/4 corner of section 21 and 2635.30' from SW corner of Section 21.
- Oct. 2012 - CSM V.16 P.174 - Doc. 419993 - Timothy Rusch found a RR spike 5302.30' from W 1/4 corner, and 2635.32' from SE corner.
- Oct. 2012 - CSM V.16 P.175 - Doc. #420018 - Timothy Rusch found a RR spike 5302.30' from W 1/4 corner, and 2635.32' from SE corner.
- Jan. 2013 - CSM V.16 P.186 - Doc. #421057 - Charley Brinkmeier set gear spike 2630.24' from center of section.
- June 2017 - CSM V.18 P.101 - Doc. #442409 - Timothy Rusch found RR spike 5291.02' from E 1/4 corner of section 21.
- Aug. 2017 - CSM V.18 P.86 - Doc. 441413 - Timothy Rusch found RR spike 2630.02' from center of section and 5302.30' from W 1/4 corner.
- July 2018 - CSM V.18 P.143 - Doc. 445595 - Charley Brinkmeier found gear spike 2518.64' from unlabeled corner.
- Oct. 2018 - CSM V.18 P.164 - Doc. #446331 - Timothy Rusch found RR spike 5291.02' from E 1/4 corner of section 21.
- Dec. 2020 - Map #11174 - Timothy Rusch found RR spike 5291.02' from the E 1/4 corner of Section 21.
- Jan. 2025 - CSM V.21 P.71 - Doc. #475301 - Michael Hoffman found RR spike 2635.32' from SE corner.
- Aug. 2025 - CSM V.21 P.127 - Doc. #477506 - Michael Hoffman found RR spike 2635.32' from SE corner.
- 5/8/2026 - Chad Besaw - Found RR Spike at corner location, matched NE witness to church foundation corner well, and matched well with Rusch's and Hoffman's distances to the SE corner. Made new references.


T31N-R14E

(i) I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Chad A. Besaw

6/11/2026

Date

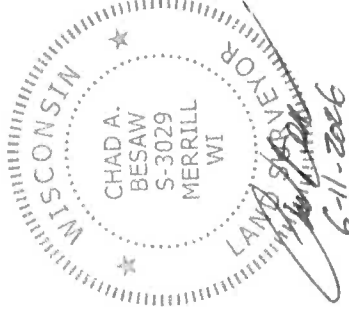

SEE SHEET 2 OF 2

SHEET 1 OF 2

P9 31-14

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to if necessary to conform with said requirements.

(a) Corner Location:

Wisconsin Corner ID: 43114202000

Type of Monument: RR Spike

Location: East Quarter Corner

Section 20, Township 31 North, Range 14 East,

Village of White Lake, Langlade County, Wisconsin

Langlade County Coordinates NAD83(2011):


Northing: 345305.50

Eastng: 720341.00

RTK GPS direct observation

Calibrated to HMP DP8864 (Wolf River S GPS)

3 position average on 5/8/2026

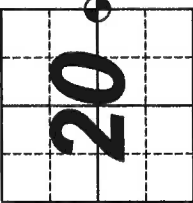

T31N-R14E


(i) I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Chad A. Besaw


6/11/2026

Date

SEE SHEET 1 OF 2

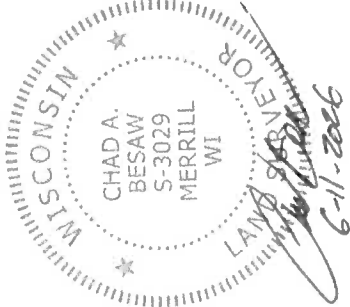

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

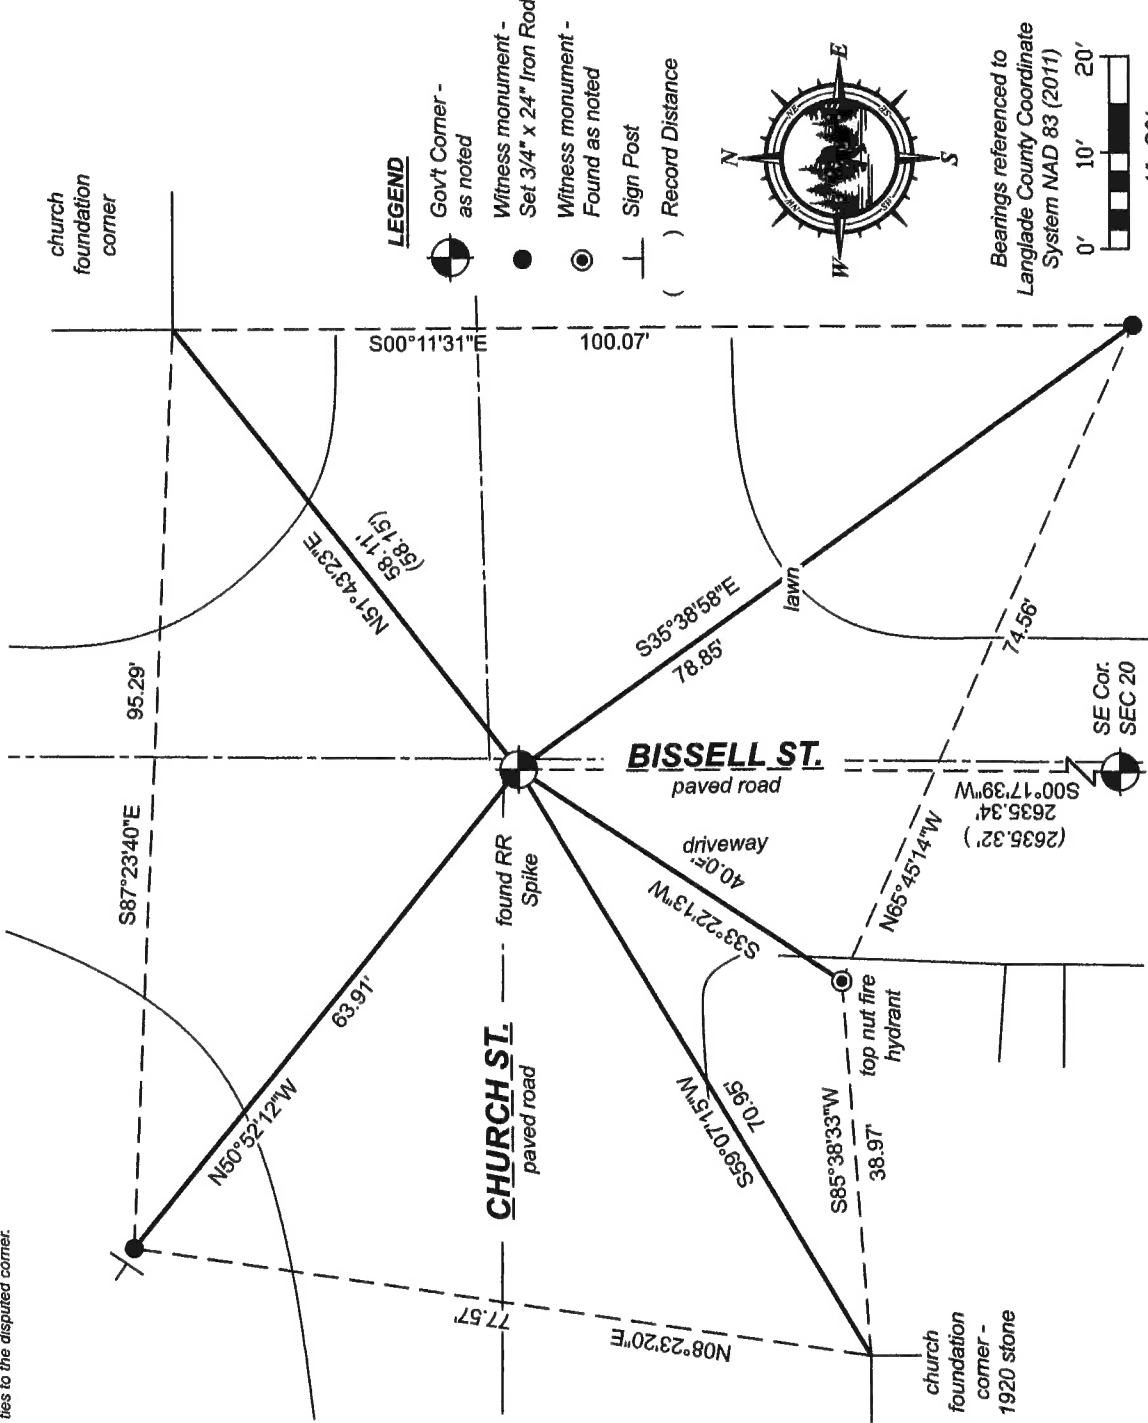

SEE SHEET 2 OF 2

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

LANGLADE COUNTY

(a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

ORIGINAL CORNER EST.
BY JAMES MCBRIDE IN
1857

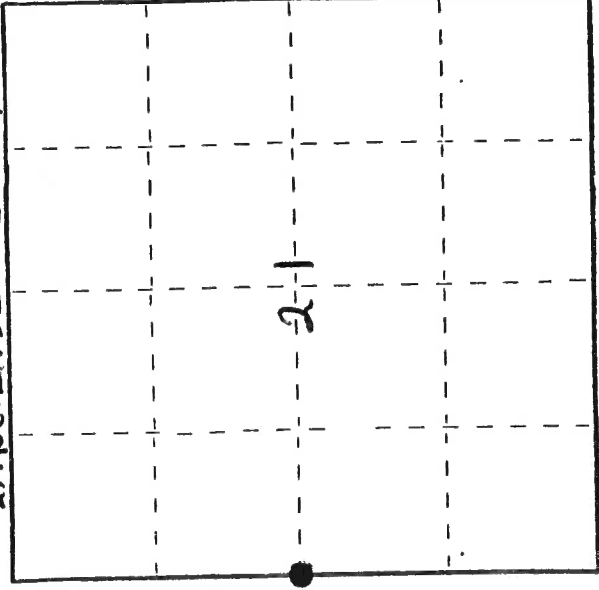

M. SEYMOUR LOCATED R.R.
SPIKE IN INTERSECTION
OF STREETS IN VILLAGE
OF WHITE LAKE JULY 1987

T 31 N - R 14 E


(b) Describe any record evidence, monument evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

R.R. SPIKE ACCEPTED AS CORNER - DISTANCE TO S.W.
COR. SECT CHECKS


(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

16" NERWAY PINE
NAIL IN BASE

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

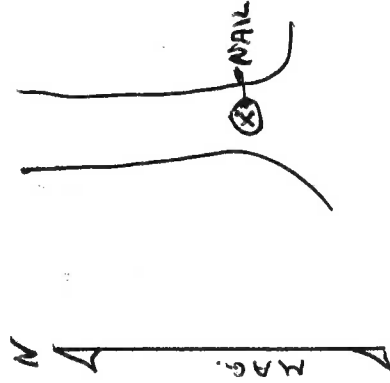

Q. CO. H.G.W. M.

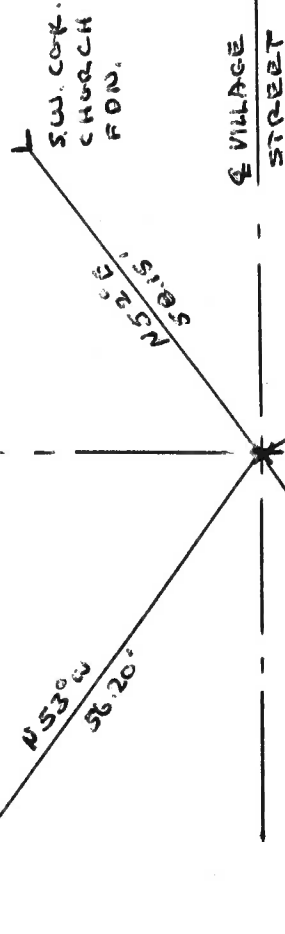

P-9

16" RED
MAPLE

N.E. CORNER
CHURCH FDN.

Q. VILLAGE
STREET

S.W. COR.
CHURCH
FON.


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

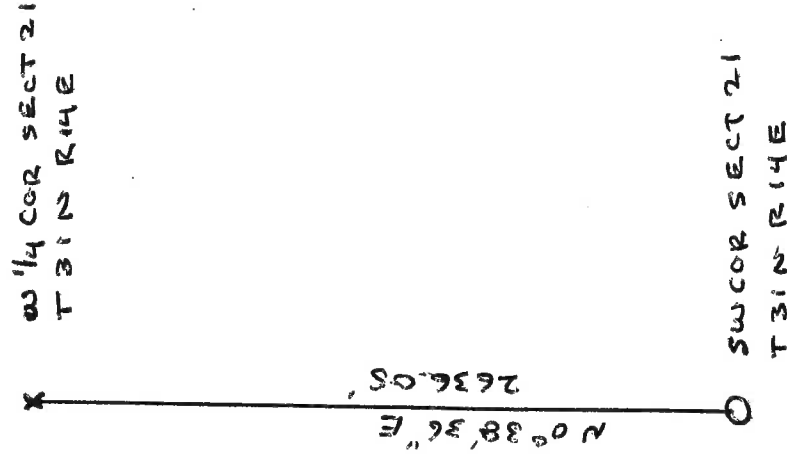

(1) I, WILLIAM F. KELLY (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature William F. Kelly Date 12-23-87

