

4331012 0000 2026

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to if necessary to conform with said requirements.

(e) Corner Location:

Wisconsin Corner ID: 43310120000

Type of Monument: 4" Brass Capped Iron Pipe

Location: Southeast Corner


Section 12, Township 33 North, Range 10 East,

Town of Upham, Langlade County, Wisconsin

Langlade County Coordinates NAD83(2011):

Northing: 417380.23

Easting: 614472.80

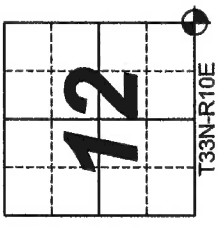

RTK GPS direct observation

Calibrated to HMP DP1713 (Koenig GPS)

3 position average on 5/1/2026

(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablishment through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- ORIGINAL - May 1859 - Fellows, Hiram C. - Set post common to Sections 1, 6, 7, 12. Fir 6 S80W 15 lks, Birch 12 N10W 18 lks, Birch 10 N30E 20 lks, Elm 6 S50E 40 lks.
- Oct. 1902 - B.F. Dorr - Old FB 4A page 133, Oneida Co records - did not find it. BT's Hemk stp 13 S35°E 60.5 lks, Hemk stp 24 N1.5°E 86.5 lks
- Sept. 1915 - Hutchinson FB 94 pages 141-142 - set 3' long pipe with shoe on bottom and cap on top with corners marked on. No BT's for this corner.
- 1936 - Map #50005 - Kowalko shows corner 40.00 chains from E 1/4 of section 12 and 40.50 chains from the E 1/4 of section 13, and 41.57 chains from the S 1/4 of section 7.
- March 1939 - Map #40516 - D.A. Hintz shows corner 40.00 chains from E 1/4 and 41.03 chains from S 1/4, and 40.50 chains from the E 1/4 of section 13.
- April 1939 - A.J. Lytle Old FB #18 page 19-20, Oneida Co records - at corner for location of road through White Birch Park.
- Oct. 1977 - Raymond J Hallisy - Tie Sheet - notes corner set in 1930 resurvey. Found 4" Iron Pipe with brass cap. Made references.
- Sep. 1983 - Map #30404 - William Kelly found a 4" brass cap at corner 2740.29' from S1/4 section 7, and 2636.77' from E 1/4 section 12.
- Aug. 1992 - Map #40102 - Thomas Arnott found 4" steel pipe filled with concrete with brass cap 2742.02' from N1/4 section 18, and 2674.36' from W 1/4 section 18.
- Sept. 1992 - Thomas Arnott - Tie Sheet - notes found C.C.C. concrete filled steel monument with brass cap that was set in the 1930's was found. The BT's that were made by Hallisy in Nov. 1977 are now gone. Made references.
- Dec. 1998 - Map #10490 - Thomas Arnott found 4" brass cap 2674.36' from W 1/4 of section 18, and 2742.02' from the N 1/4 of section 18.
- July 2002 - Map #30422 - David Tlusty found iron pipe with 4" brass cap 2674.46' from W 1/4 of section 18, and 2741.61' from the N 1/4 of section 18.
- Oct. 2005 - Map #10761 - Timothy Rusch found brass capped monument 2674.25' from W 1/4 of section 18, and 2741.79' from the N 1/4 of section 18.
- Dec. 2011 - Map #30588 - David Tlusty found 3" iron pipe with brass cap 2703.29' from S 1/4.
- 5/1/2026 - Chad Besaw - Found 4" brass capped iron pipe at corner location. Found all 4 of Arnott's 1992 references, and possible BT's from Hallisy's 1977 tie sheet (bearings and distances match fairly well to face of tree from monument). Made references.

(i) I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Chad A. Besaw

6/11/2026

Date



(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

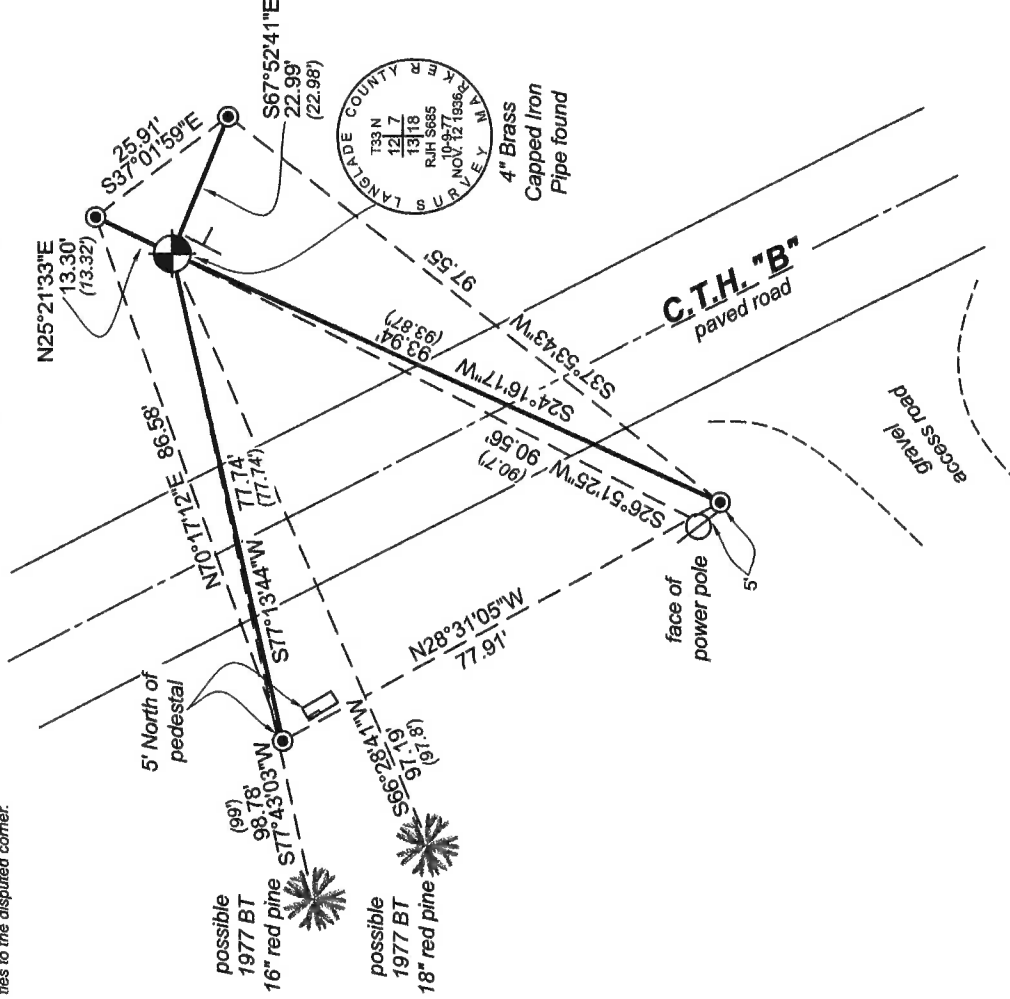

J25 33-10

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Sec. Cor. 7, 12, 13 and 18

T33N, R10-11E

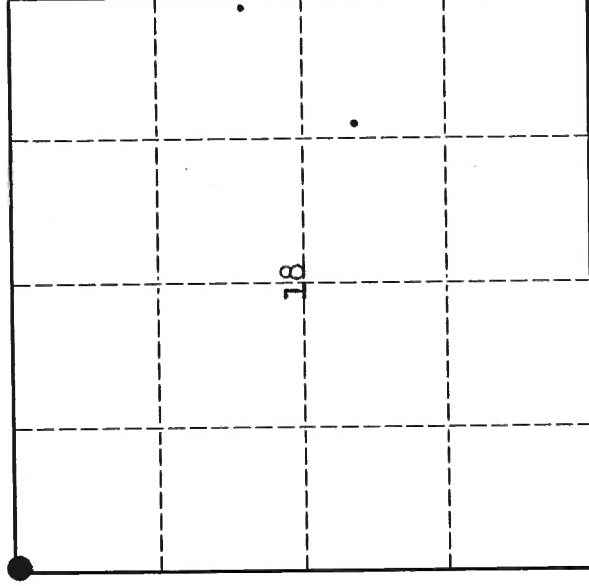


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

C.C.C. concrete filled steel monument with brass cap that was set in the 1930's was found. The BT's that were made by Hallisy in Nov. 1977 are now gone.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

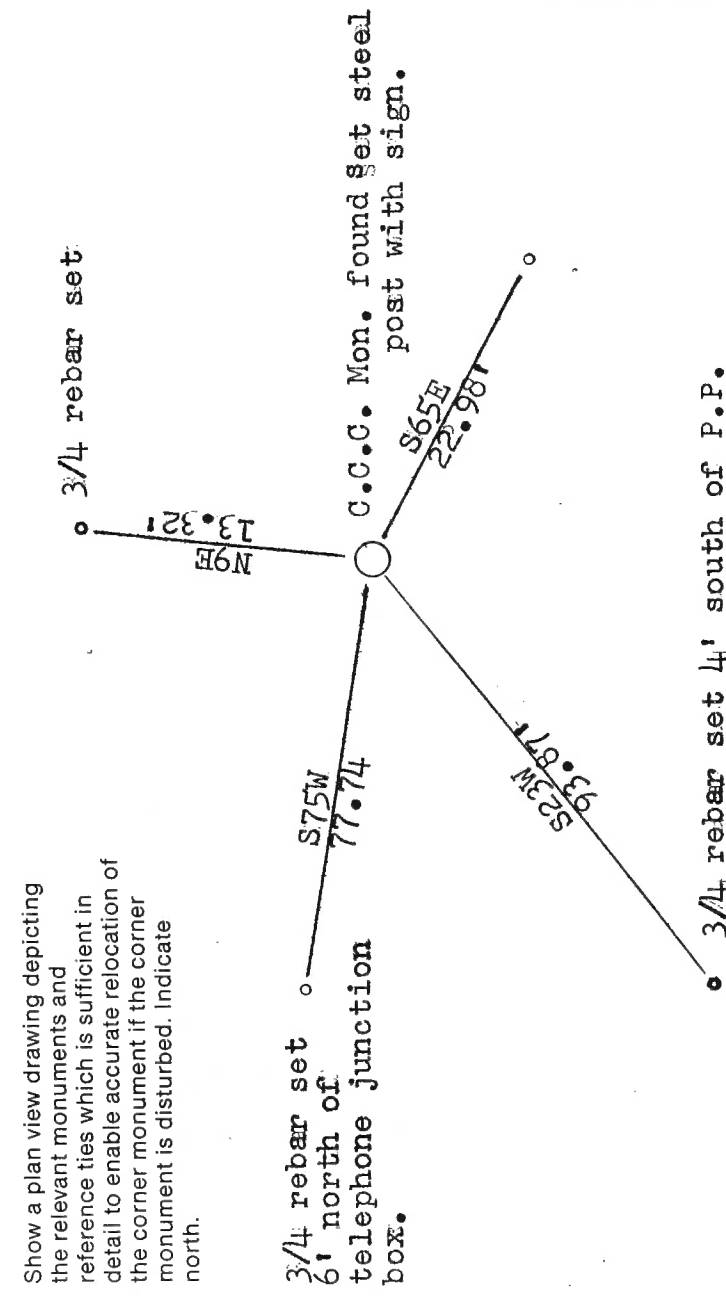

JH
J25 (33-10)

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No. 2

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.


No

(i) I, Thomas Arnott S-887
(type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Thomas Arnott
Signature

16 Sept. 1992
Date

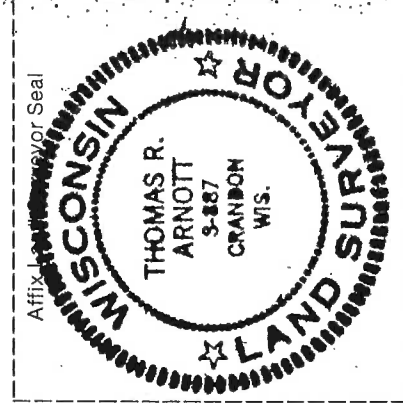


CERTIFIED LAND CORNER RESTORATION

Index No. J-25
33-10

State of Wisconsin }
County of Langlade } ss.

I Raymond J. Hallisy, do hereby
certify that on the 9th day
of October, 1977, I found
evidence of the Section
corner of 12, 7, 13, & 18
Township 33, North, Range
10E & 11E, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

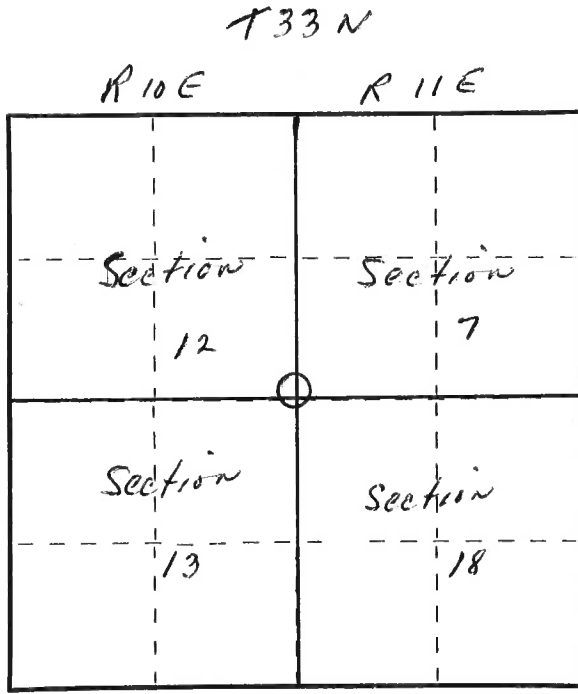

○ = Corner monument restored.

History of original corner establishment:


Corner set in the 1930 resurvey.

Description of corner evidence found:

4" iron pipe with brass cap
CNW RR Tracks East
County Highway "B" West

Description of monument and accessories I established to perpetuate the original location of this corner.

12" Red Pine S72 W 99 Ft.
16" Red Pine S56W 97.8 Ft.
WPS Light Pole #3311 - 721 S21W 90.7 Ft.

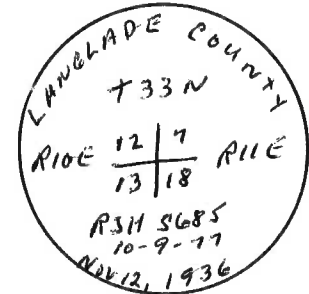

Dated at Antigo, Wis., this 9th day of October, 1977.

Signature Raymond J. Hallisy Title Land Surveyor Registration No. S685
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within
instrument was filed in this office for record on the _____ day of _____, 19____
at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy

FORM 985 H. C. MILLER CO., MILWAUKEE