


178968



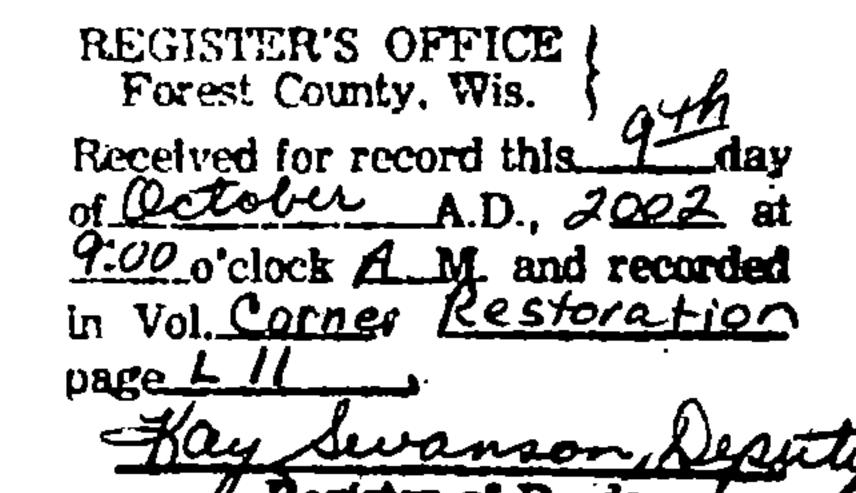

U.S. PUBLIC LAND SURVEY MONUMENT RECORD


NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added if necessary to conform with said requirements.

(a) Corner location: Township 36 North

Range/Z East

Town of CRANDON

County, Wisconsin

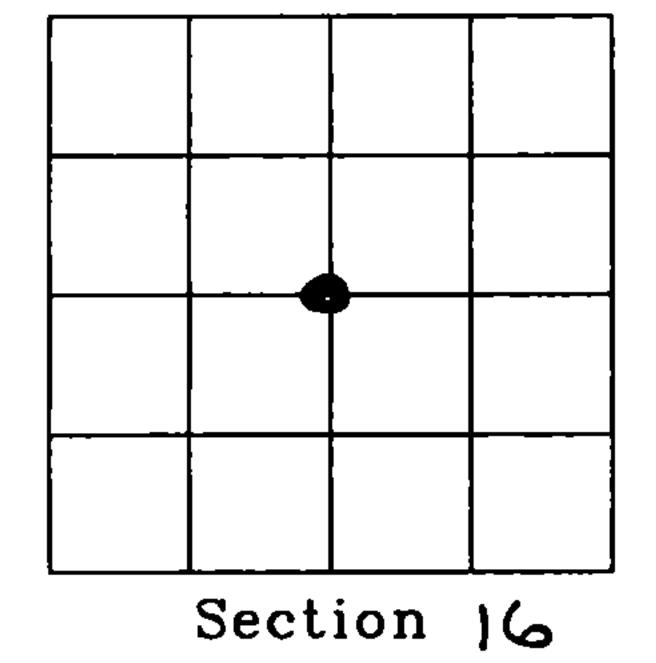

(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablished through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- SEE BACK FOR DESCRIPTION -

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the

(i) I, Eugene C. Uttech, Registered Land Surveyor *S-1451, SURVEY, Walter Minimum 6. 1/9 hereby certify that the corner location on this record was determined by me or under my direction and control and that the complete to the best of my knowledge and belief.

Signature Date

EUGENE C.
UTTECH
S-1451
RHINELANDER,
WI
SILIFIER OF SI

idex No.

176968

CENTER OF SECTION 16-36-12

Researched records, Found field notes by A.J. Lytle, dated 7-19-1937 in the Oneida County Land Information Office for survey of Section 16. On 11-17-1937 Lytle referenced that he measured from the East ¼ corner to the West ¼ corner and intersected N-S ¼ line and set Center of Section. Also found letter and old notes that the Department of Natural Resources surveyed the boat landing on Little Rice Lake around 1961. The landing is described as being the North 100 feet of the NW.1/4 of the SW.1/4 of Section 16. These notes referenced to iron stake at the Northeast corner of said NW.1/4 of the SW.1/4. We found 1 ¼" dia. pipe with 10' extension at said Northeast corner of NW.1/4 of the SW.1/4. Extension was broke off but 1 ¼" iron pipe was in good shape. I measured to East ¼ corner of Section 16 and was 0.58' short of distance called for by Lytle and the DNR. I established the Center of Section by running a straight line from the iron pipe found to the East ¼ corner and held called distance of 1194.1 feet from the iron pipe.