26273	NUMBER	
Š	IN	ļ
Stock	OCUMENT	4
<b>U</b> ,	ŏ	

110		LAND	CHOVEY	RAORII IRAERIT	
U. S.	PUBLIC	LAND	SURVEI	MONUMENT	RECURL

		V-21
Index	No	Y <b>Z</b> .I.

State of Wisconsin	History of original corner	esta blishment.	•.	••	•
County of Forest				,	
	0	_	•	igherty. North between	
William B. Cochrane, do here	-	at 80.00 chains	s, see Section Con	rner Post, from which	tne
certify that on the 28th d	•	5 <b>''</b>	N69°W	27 1ks.	
cvidence of the Northwest Section	Aspen	4''	N73°E.	9 1ks.	
corner of Section 36	••••		•	<b>.</b>	
Township40, North, Ran	ge				
13 East Fourth Principal Meridia		-			
as described hereon; and that from this eviden	•	lence found:	•		
I established a new monument and accessorial as described hereon to perpetuate the origin		nost with locati	on tag attached	from which fence line	e hear
location of this corner.	East and South, and		<del>-</del>		.s bear
	nan	Calo College Arine	3 01 11mg 33 30d13	,	
Resident witnesses:	I accept the fence	corner, the fend	e linés East and	South, and the Center	-Line of
•	Hwy 55 as the best	available evider	ce for restoring	the corner position.	
BB		- m 1 m - 1 - 1	-1 <b>-</b> 1		5 4-1 <del>-</del> -1
	Center-Line of Hwy	•	<del>-</del>	ostion to be in line w	athrene
***************************************	Genter-hine of nwy	DO THE MOTTH.	•		
·	Description of monument	and accessories I est	ablished to perpetuate	the original location of this	corner.
	In place of fence p	ost, set a 2½ in	nch diameter alumi	inum pipe monument, 3	feet long,
		•	• •	; T40N R13E, S25, S26,	· -
			_	nd scribed bearing tre	es bear;
1 1	Spruce	12"	N65°E S72°E	25.82 feet	
	Aspen Aspen	Q11	NO4°W	19.98 feet 12.40 feet	•
	дарсп		S89°-50'-44'		
	Steel Sign Pos	it	Northeast	1.00 feet	
		.•			
SECT;ION 36 ;	Dated at Hiles	, Wis.	, this 19th	day of February	19 <sup>92</sup>
	Signature William	B Packson	fitle Land Surv	zevor b	N S-1107
	County S	urveyor, Registered Land	Surveyor, or other duly a	· · · · · · · · · · · · · · · · · · ·	ration No.S-1107
	Office of Register of Deed				ertify that the within
<del></del>	instrument was filed in th	is office for record on	the 3/27	day of August	<i></i>
l i	at Dil 5 o'clock				
l t	\P	450 han 1/2	rer		
		(Register of Deeds)	3.4		
<u> </u>	<b></b>	· • · · · · · · · · · · · · · · · · · ·	•		
O = Corner monument restored.	Ву		Deputy		

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


A survey was made in 1979 by James D. Rein, RLS of the section line between sections 35 and 36 to restore the Northwest Section Corner of Section 36, the West Quarter Corner of Section 36 and to establish the North Sixteenth Corner between Sections 35 and 36. Mr. Rein's Northwest Section Corner located the improvements near the section corner in Section 35. Areagresidents claimed that these improvements should actually be in Section 36. After an extensive search of the tax records in the Forest County Court House and the deeds of the properties in the NW 1/4 of Section 36 and the NE 1/4of Section 35 and a set of survey field notes of Raymond Leigh from 1939, the corner positions as set by James D. Rein were found to be out of position.

(r) was the corner restored through acceptance or (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from accepted evidence.

Survey requested by;

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

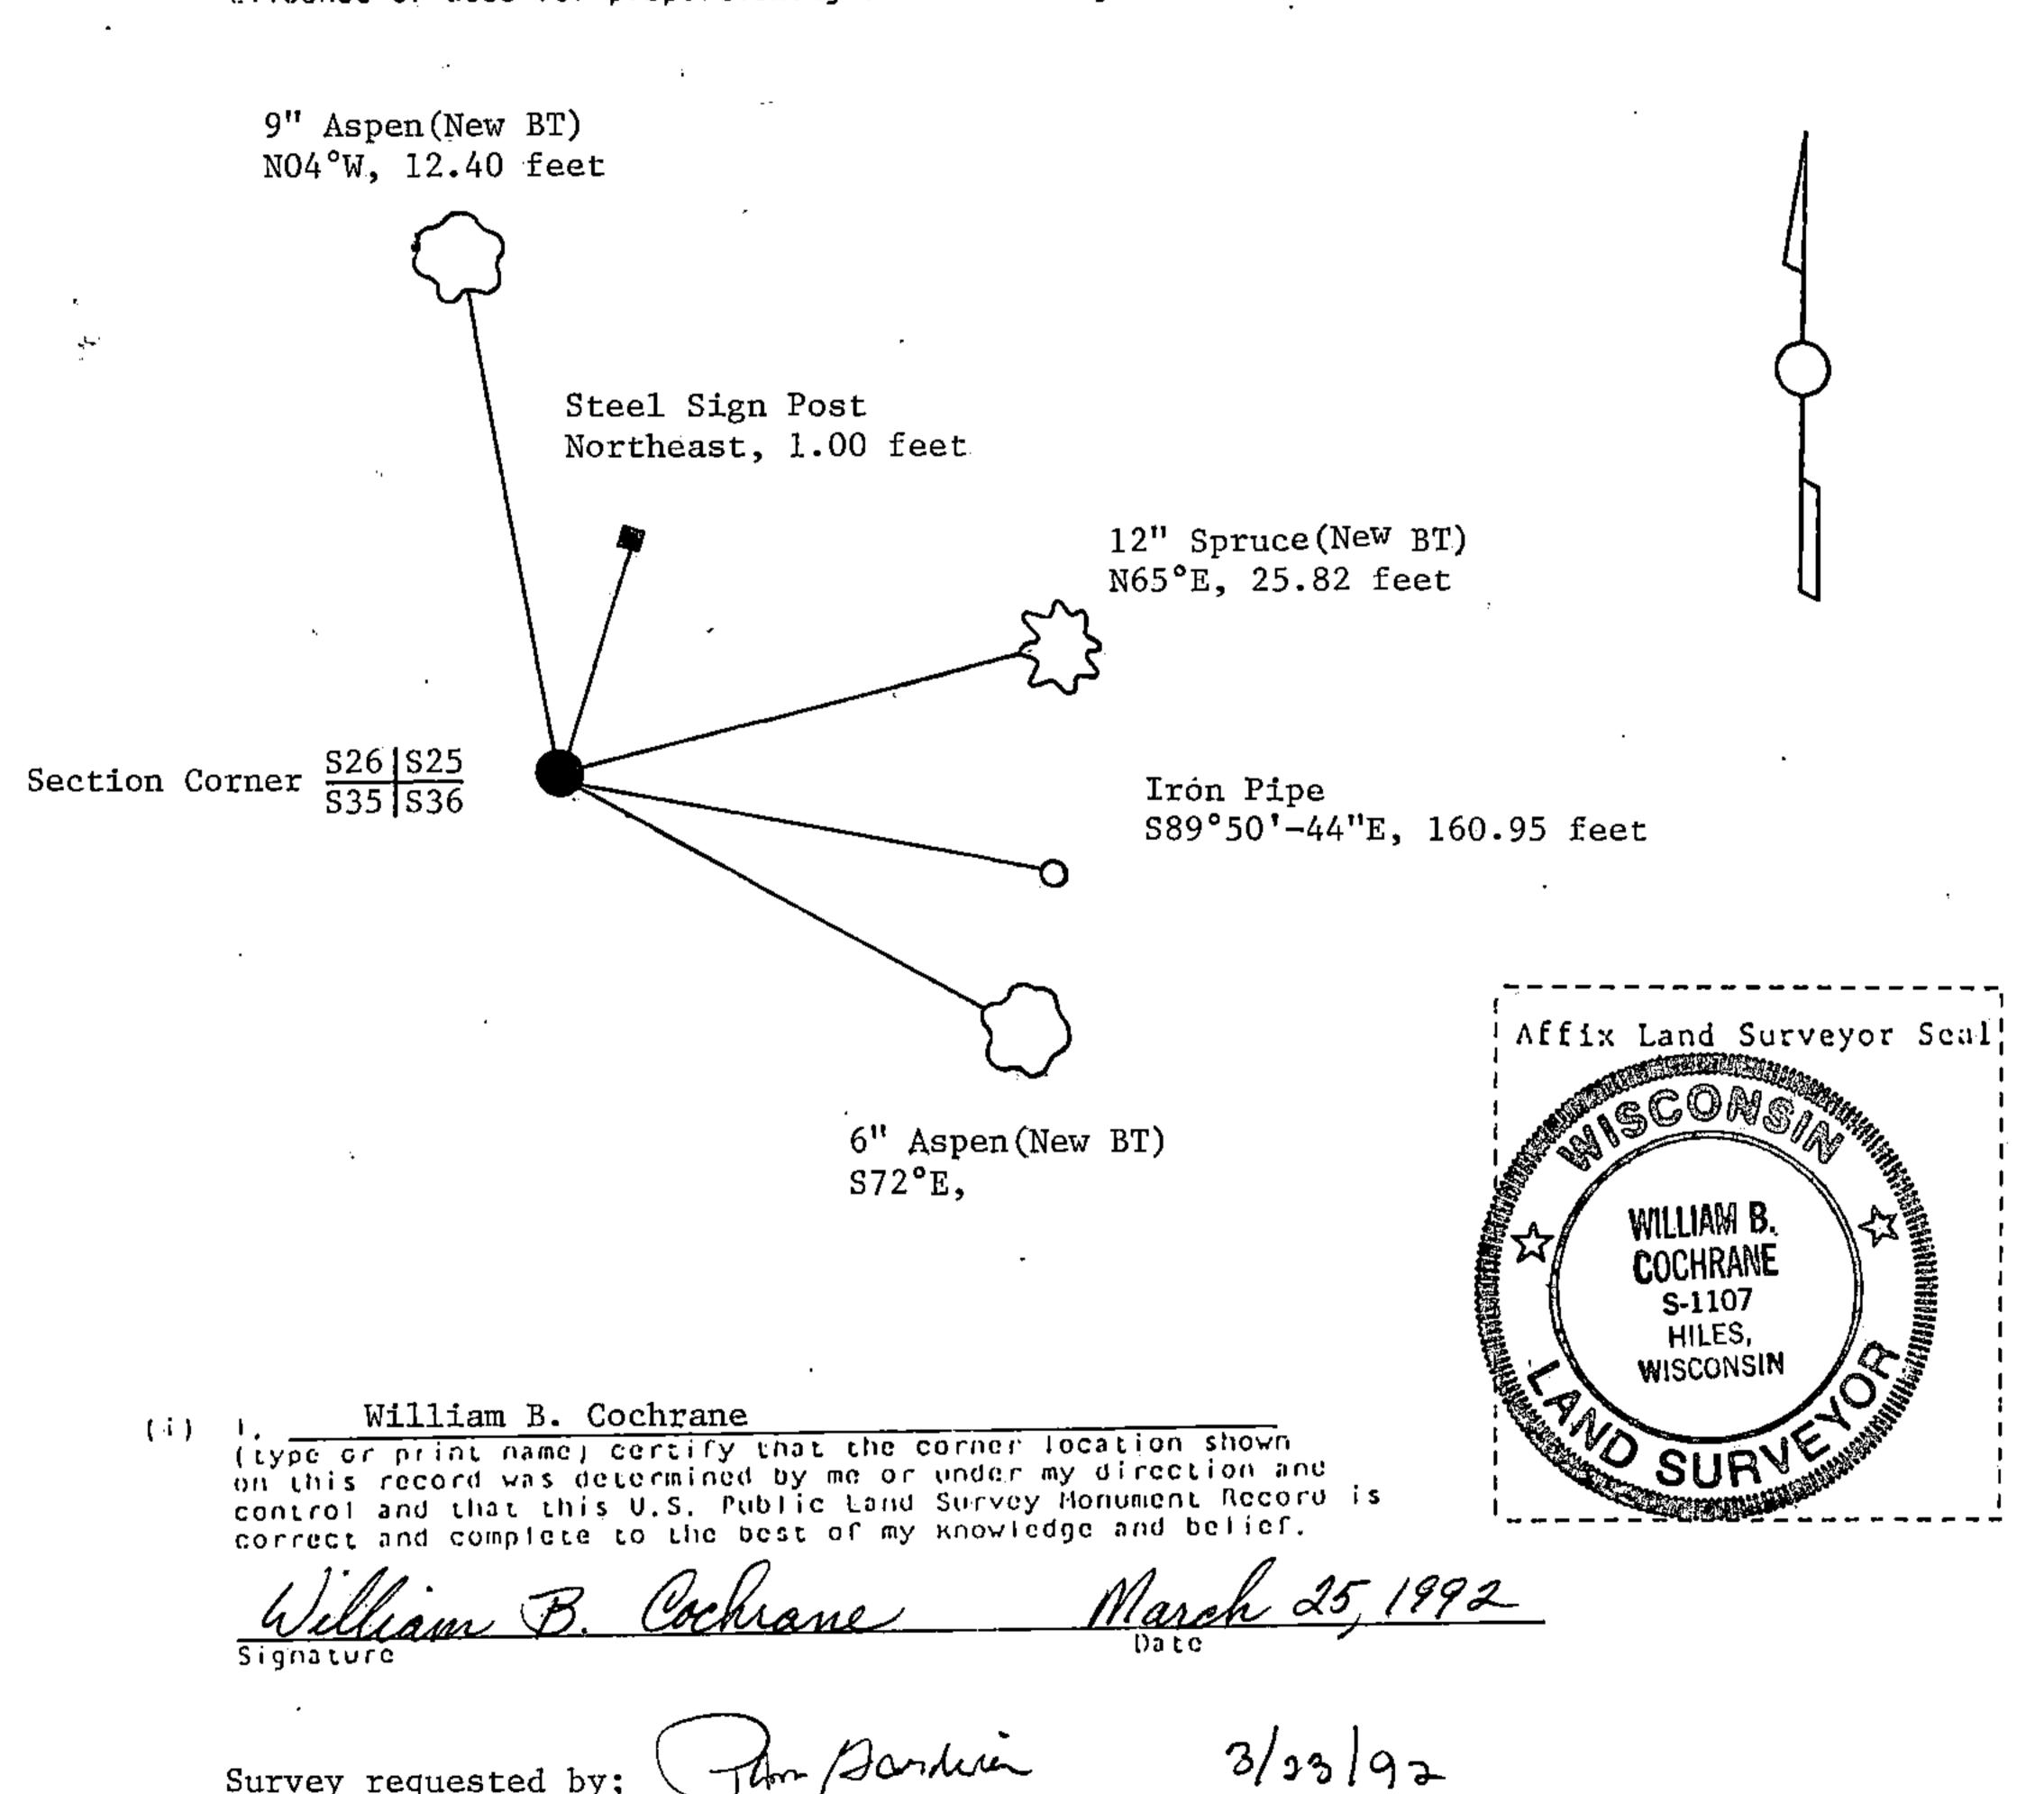

District Ranger

Date