Σ	26273	82
H.C.Miller Company	Š	393
HCA	tock	rel.

Corner monument restored.

U.Š.	PUBLIC LAND SUF	RVEY MONUMEN	IT RECORD	In	dex No. X-17
State of Wisconsin } ss.	History of original corn	er establishnient:			
County of Forest	Original Governmen 34 and 35, at 40.0	nt Survey in 1865   00 chains, set Qua		augherty. North between at to Sections 34 and 3	
I Gary L. Pisoni do hereby certify that on the 1st day of August 19.91, I found evidence of the West Quarter	which the followin Spruce Spruce	6'' 4''	\$46° E \$48° W	37 links 6 links	
corner of Section 35  Township 41 North, Range 14 East Fourth Principal Meridian,	44.40 chains North	, creek 25 links v	Wide NE		
as described hereon; and that from this evidence	Description of corner e	vidence found:			
I established a new monument and accessories as described hereon to perpetuate the original	No original corner	evidence was reco	overed.		
location of this corner.  Resident witnesses:	and finding the to finding that the d dist. and the old	tal actual distance ist. from Gaspardo blazed lines seem	ce for these lin Creek to the B to match the di	tion lines of Sections es to be approx. 677' rule River is within 89 st. from Gaspardo Creel of Gaspardo Creek. T	to long and 5' of GLO k to the Brule
opinion is held by the	U.S.F.S. for work they	have done further	West.   used	Gaspardo Creek and the	wood post on
the Brule River as fixe	d points and proportio	nate from there.	Since the West	1/4 cor. of Sec. 35 is	so close to the
creek, I proportioned t remaining error South of the Vest 1/4	the 1/4 cor. by extending of manufactures	ng the bearing tro	om the North to Sablished to perpetus	the South and Teft all ite the original location of thi	or the .
of Section 35.	At the corner posi	tion, set a $2\frac{1}{2}$ d	iameter aluminun	n pipe monument, 5 feet	long,
	3 inches above the	ground, with an a	aluminum cap sta	amped; T41N R14E,1/4, S	34, S35,
	1991, S-1634. From	n which the follow	ing new blazed a	and scribed bearing tre	es bear;
1	(Measurements are Tamarack	7''	N59 W	10.60 feet	
	B. Spruce	i	N87º E	35.27 feet	
	Tamarack	811	S33 <sup>0</sup> E	24.04 feet	
	Tamarack	·* 7 <sup>11</sup>	S52 <sup>O</sup> W	23.38 feet	
	Steel Sig	n Post	South	0.85 feet	
SECTION 35	Dated at Iron R	iver, MI , WAS	., this 16th	day ofFebruary	, 1992
	Simon Same	L. Rism	Title Land Sur	veyor Rcgis	tration No. S-1634
	Signature(Count	ty Surveyor, Registered Lan	d Surveyor, or other dul	y authorized official)	
1 1 1	Office of Register of D	eeds, County of	nest	day of Thereby of	ertify that the within
	instrument was filed in at 10:45 o'clock	this office for record of	n tne		d 17
	facel	Hochenbra	nnev		
		(Register of Deeds)			

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.


Signature

Survey requested by;

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored through lost corner proportionate methods.

(gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

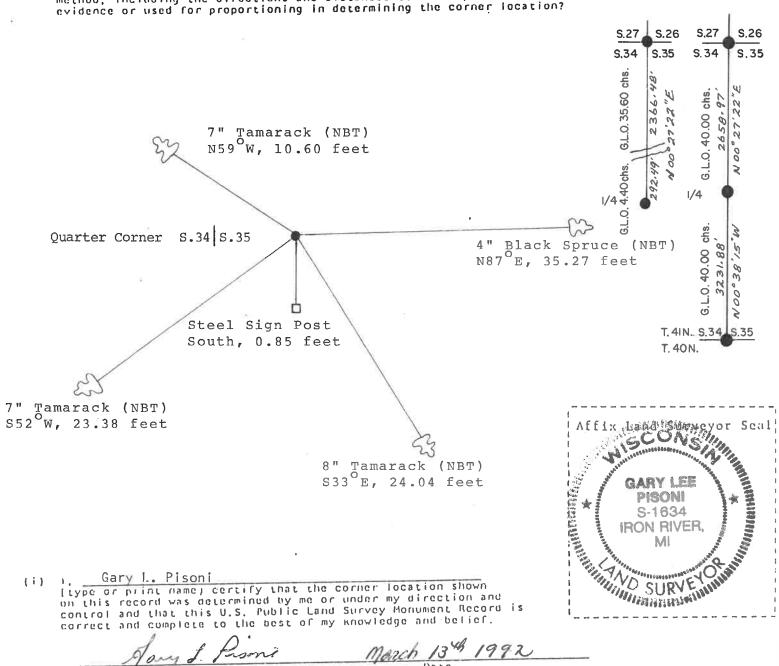

Date

District Ranger