

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to if necessary to conform with said requirements.

(a) Corner Location:

Wisconsin Corner ID: 43212320000

Type of Monument: 0.75" Iron Rod

Location: Southeast Corner

Section 32, Township 32 North, Range 12 East,

Town of Price, Langlade County, Wisconsin

Langlade County Coordinates NAD83(2011):


Northing: 363641.88

Easting: 657291.09

RTK GPS direct observation

Calibrated to HMP DQ4953 (Lawrence Lake GPS)

3 position average on 5/2/2025

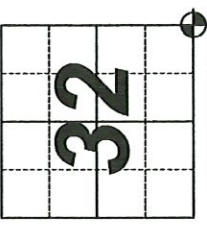

T32N-R12E

(i) I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Chad A. Besaw

Chad A. Besaw

6/6/2025

Date




Chad A. Besaw
6-6-2025

(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablishment through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- Original - 6/1857 - Alfred Millard - Set post, made references: elm 18 N32°W - 115 links, sugar 14 N59°E - 25 links, elm 17 S19°E - 52 links, Y. birch 18 S27°W - 52 links.
- 1989 - Highway Department - Map#40470 - Shows corner monument, no description.
- 3/7/2011 - Charley Brinkmeier - Map#20105 - Shows corner monument, no description.
- 12/29/1983 - William Kelly - Tie Sheet - Set RR Spike over existing iron in road intersection. Made references: 4" aluminum witness monument N45°W - 50.0 feet, 2" iron pipe N45°E - 60.0 feet, 2" iron pipe S45°E - 60.0 feet, 2" iron pipe S45°W - 50.0 feet.

5/2/2025 - Chad Besaw - Found and accepted a 0.75" iron rod approximately 0.3' below road surface and 1' SE of CL-CL intersection of County Highway S and Price Polar Road. Found Kelly's NW aluminum monument bent and broken measured distance to base of plumb position. Made references shown below.

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

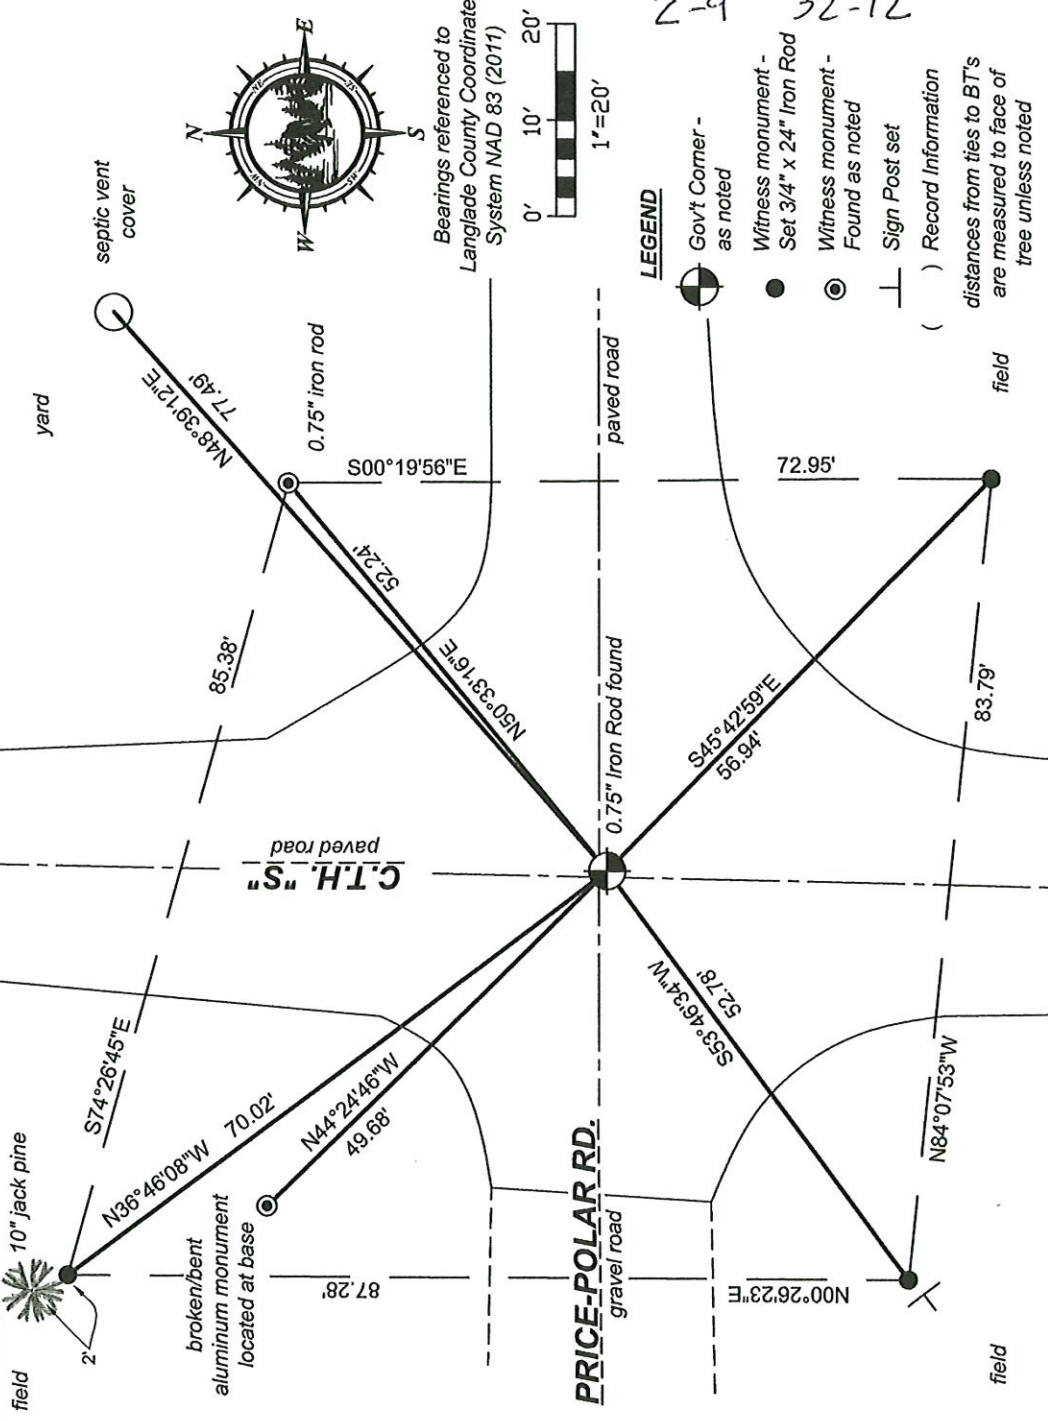

4921232 0000 1983

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

ORIGINAL CORNER ESTABLISHED

By ALFRED MILLARD IN AUG. 1857.

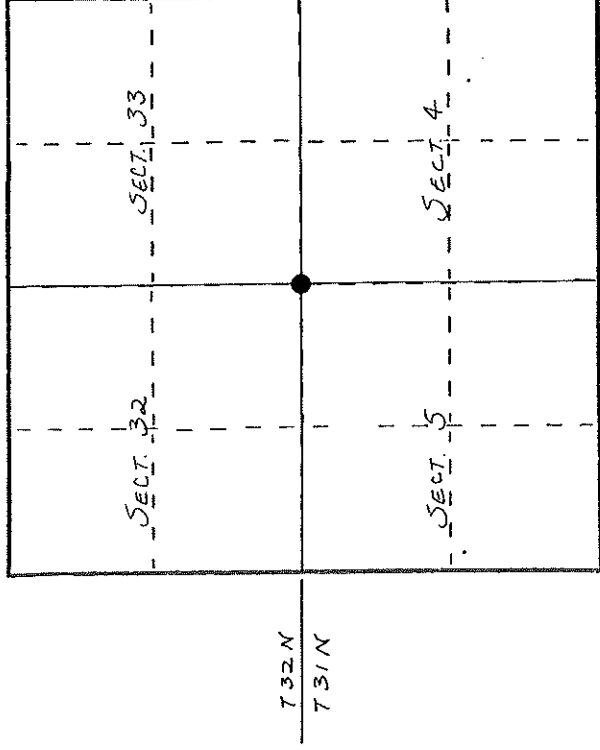


R 12 E

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence you considered, and whether the monument was found or placed.

SET R.R. SPIKE OVER EXISTING IRON IN ROAD INTERSECTION.

SET 4" ALUMINUM WITNESS MONUMENT.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

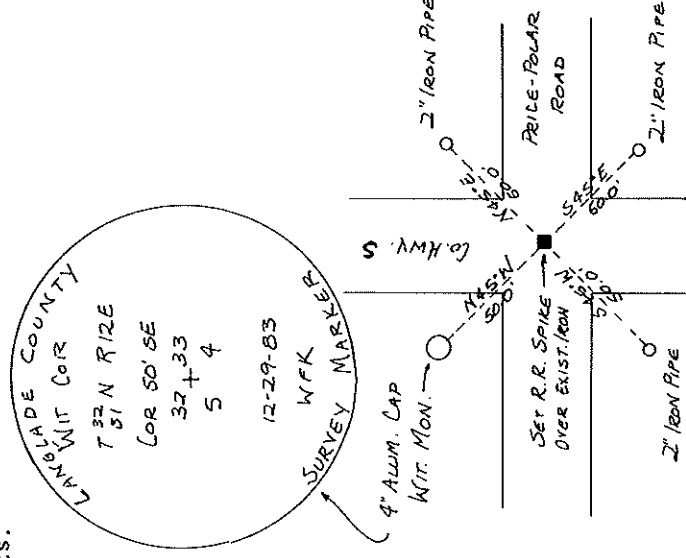

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

NORTH

Z-9
T 32 N R 12 E

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) 1. William F. Kelly
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

William F. Kelly
Signature

12-29-83
Date

