

CERTIFIED LAND CORNER RESTORATION

34-9
Index No. X-145

State of Wisconsin }
County of LANGLADE } ss.

I RAYMOND J. HALLISY, do hereby certify that on the 13-14 day of APRIL, 1966, I found evidence of the E 1/4 AND W 1/4 corner of 31 Township 34 N, North, Range 9E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

- JERRY KRYKA - W.C.D. - ANTIGO
- STAN BANASH - W.C.D. - ANTIGO

History of original corner establishment:

LOCATED W 1/4 - BRASS CAP - RESURVEY OF 1937 BY T.H. KILROG AND D.A. HINTZ

LOCATED AND RESET E 1/4 - BRASS CAP - HISTORY - RESURVEY BY T.H. KILROG AND D.A. HINTZ IN 1937 AND BOOK 162-163 OF STATG. HWY COHM - RHINELANDER, WISC. THE LATTER INFORMATION DESCRIBES CORNERS AND WORK IN RELOCATION OF CTH. "H."


Description of corner evidence found:

- BRASS CAPS FOR E 1/4 AND W 1/4
- E 1/4 RESET
 - W 1/4 LOCATED

Description of monument and accessories I established to perpetuate the original location of this corner.

TRANSIT SURVEY - CHAINS - PINS - AXES
(SEE BACK)

RESET E 1/4 - CHAIN BETWEEN NE SEC. COR. AND SE. SEC. CORNER. DISTANCE 79.36 CHAINS CORRES PONDING TO 1937 RESURVEY. LOCATE 2 REFERENCE CORNERS (DATA FROM ABOVE BOOK) AND RESET E 1/4 COR. ON EAST SIDE OF CTH H

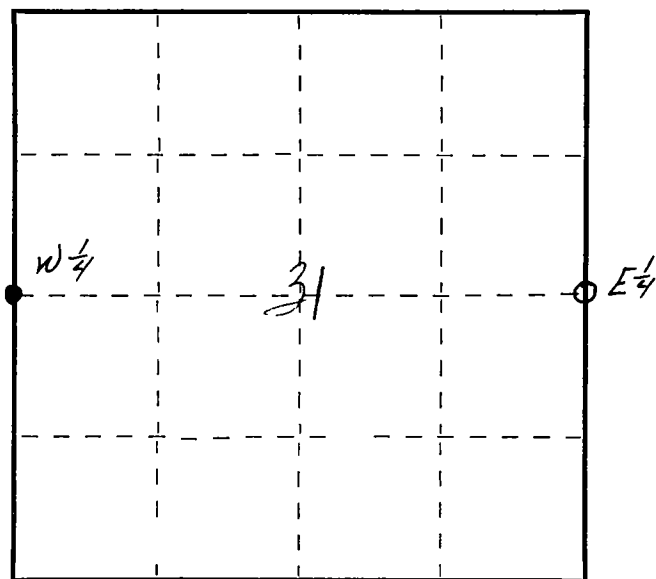

○ = Corner monument restored.

Dated at ANTIGO, Wis., this 3 day of MAY, 1966.


Signature Raymond J. Hallisy Title Asst Dist Forester and Reg. Wild Land Surveyor Registration No. 5-685
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____ at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy

Wisc. Highway Dept - Box 162-163 Leland - Reference corners
to E $\frac{1}{4}$ corner

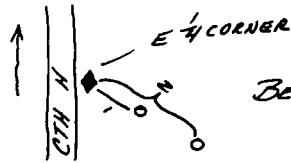

BEARING $523^{\circ}24'E$? Further confirmation
needed - I believe bearing should
be Complementary Angle of $566^{\circ}36'E$
to correspond with 1934 Survey
DIST ON REFERENCE COR
1 36.85 FT
2 63.88 FT

COMMENCING AT E $\frac{1}{4}$ CORNER USING $2^{\circ}E$ DEC

COMMENCE TRANSIT RANDOM LINE AT $587^{\circ}45'W$

LENGTH OF RANDOM 86.735 CHAINS FELL 94 LINKS
NORTH OF CORNER

CORRECTION 1.08 LINKS SOUTH/CHAIN TO TRUE
LINE

BEARING OF TRUE LINE $587^{\circ}7'15''W$

CORRECTED LINE EAST TO WEST

5 LKS	EAST EDGE OF CTH "N" (BLACKTOP)
1.0 CHAINS	WEST EAST EDGE OF FIELD
11.50 "	WEST " " "
20.00 "	SET SQUARE POST (21.60 LKS SO. OF RANDOM) THIS "IS NOT" A CORNER - ONLY <u>MARKS</u> LINE
40.00 "	SET SQUARE POST (43.20 LINKS SO. OF RANDOM) THIS "IS NOT" A CORNER - ONLY MARKS LINE BT ELH 8" N $40^{\circ}15'W$ 37 LKS ELH 10" N $52^{\circ}W$ 88 LKS
60.00 "	SET SQUARE POST (64.80 LINKS) SO. OF RANDOM THIS "IS NOT" A CORNER - ONLY MARKS LINE BT ASPEN 12" N $57^{\circ}W$ 17.5 LKS
80.00 "	PICKET ON LINE 86.40 LINKS SO OF RANDOM
86.74 "	W $\frac{1}{4}$ corner.

POSTS AT 20.00, 40.00 AND 60.00 ARE NOT CORNERS. THEY ONLY
MARK LINE AND DISTANCE FROM E $\frac{1}{4}$ CORNER.