


U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-h)

A-E 7.08(3)(a) Identity of corner
SOUTHEAST CORNER OF SECTION 27
TOWNSHIP 34 NORTH
RANGE 11 EAST OF THE 4TH PM
TOWN OF ELCHO,
COUNTY OF LANGLADE

WISCONSIN - LANGLADE COUNTY
N: 432,945.613 USft (432,950.00)
E: 635,908.340 USft (635,906.00)
Datum: NAD83 (2011)
GNSS Method RTN - Direct
GNSS Control WISCONSIN VRS

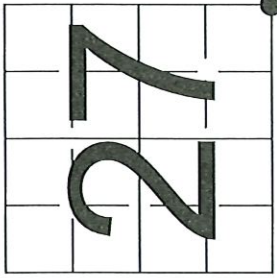

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Values shown in parenthesis, are previously published measurements.

A-E 7.08(3)(b) Description of any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence.

Original Surveyor: William E. Daugherty

Date of Original Survey
Commenced: July 18, 1859
Completed: July 24, 1859

Original Accessories:
Cedar 8 S 87° W 7
Tamarac 10 S 11° E 14

See Previous Monument Record: Index No. V-17 - September 29, 1977 - Surveyor 1098 - William F. Kelly - THENCE:

April 9, 2020 - Luke Williams - found the monument to be tilted, and no bearing trees found, on PLSS field condition report V-17.

A-E 7.08(3)(f) Whether the corner was restored through acceptance of an obliterated location or a found perpetuated location.


November 16, 2021 - I found a 2 1/4" diameter iron pipe with a 2 1/2" brass tablet affixed to the top & stamped to identify the corner. Monument was leaning southeast, in a wet area with heavy wind fallen trees. I straightened the monument and pounded it to ±0.5' above grade.

I did not find any BT's recovered or established as noted on Certified Land Corner Restoration V-17.

I accept this monument as a FOUND PERPETUATED LOCATION OF THE CORNER and established 3 new witnesses as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with references to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed. The directions and distances to other public land survey corners used as evidence or used for determining the corner location.

BEARINGS LISTED TO THE NEAREST SECOND ARE REFERENCED TO WISCONSIN COUNTY COORDINATE REFERENCE SYSTEM - LANGLADE COUNTY ZONE. ALL OTHER BEARINGS ARE MAGNETIC.

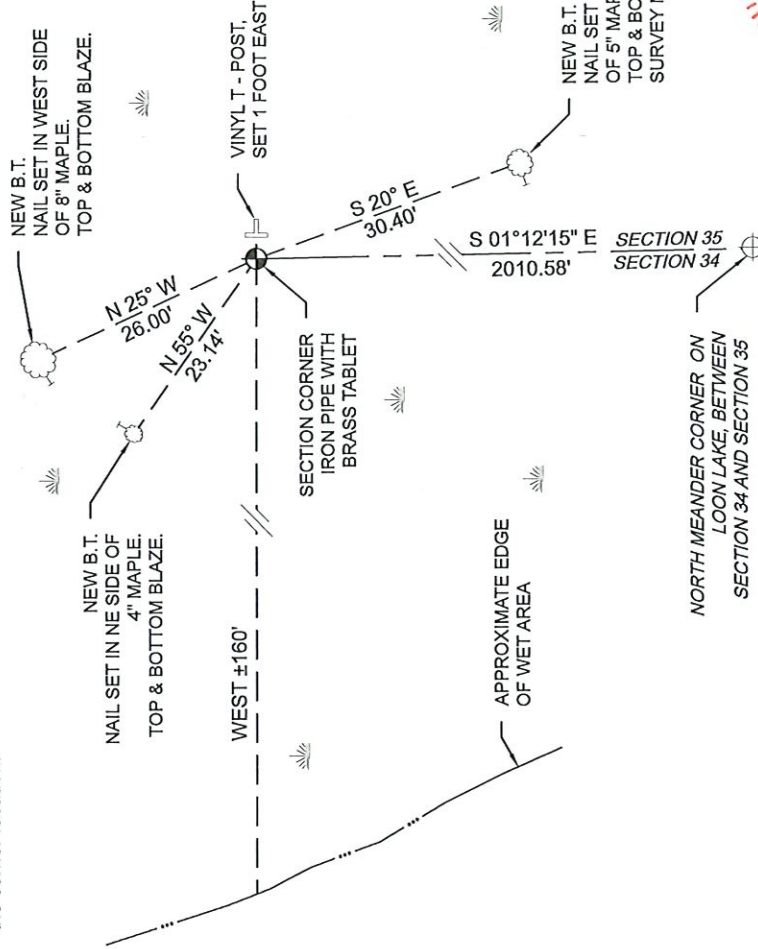

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief



[Signature]

SIGNATURE August 10, 2022 DATE

PLSS field condition report

Date: 4-9-20 Time of day: 12:00 ^{pm}

By: Luke Williams

Section 26 Town 34 Range 11
(circle corner location on diagram)

Does the monument appear to be tilted, smashed,

uprooted, covered or otherwise damaged by the windstorm?

☒ YES NO A large birch tree was uprooted immediately adjacent to monument, causing the monument to tilt.

Are any bearing trees broken, uprooted, missing or otherwise

damaged by the windstorm? ☒ YES NO No bearing trees were found, but severe damage

occurred at corner location. Several white birch and balsam were down near where

TAKE PICTURES they were described on tie sheet.

For the first four pictures, do them in this order:

Looking north, looking east, looking south, looking west and, by standing about 6 feet behind the monument, include the monument in each picture.

Then take a picture of the top of the monument, close enough to be able to read what is stamped on the cap. Make sure all pictures are in focus.

North



4341127 0000

V17
~~421~~

34-11

CERTIFIED LAND CORNER RESTORATION


Index No. V-17

State of Wisconsin }
County of LANGLADE } ss.

I, WILLIAM F. KELLY, do hereby certify that on the 29TH day of SEPTEMBER, 1977, I found evidence of the SECTION corner of SECTIONS 27, 26, 34 & 35 Township 34, North, Range 11 E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.


Resident witnesses:

FORM 985 H. C. MILLER CO., MILWAUKEE

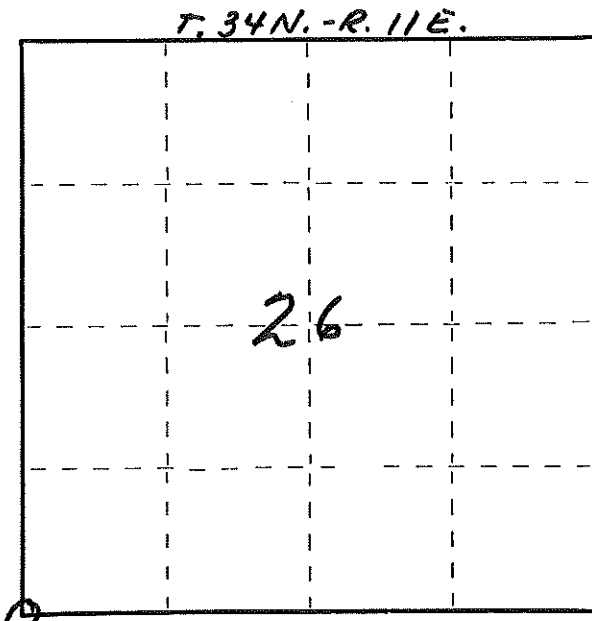

○ = Corner monument restored.

History of original corner establishment:

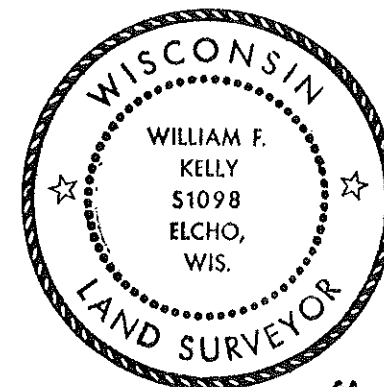


William F. Kelly 9-29-77


Description of corner evidence found:

LOCATED S.W. CORNER SECTION 26 T. 34 N. - R. 11 E. - 4" CEDAR POST IN SWAMP. FOUND ONE SCRIBED BEARING TREE.

Description of monument and accessories I established to perpetuate the original location of this corner.

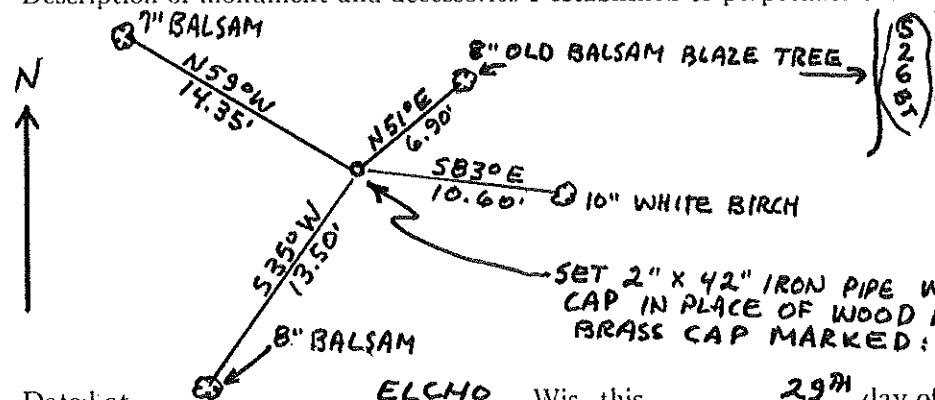

SCRIBED NEW BEARING TREES: ✓

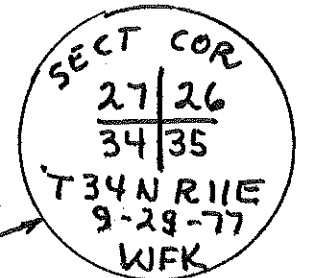

Dated at ELCHO, Wis., this 29TH day of SEPTEMBER, 1977.

Signature William F. Kelly Title REGISTERED LAND SURVEYOR Registration No. S1098
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____ at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy