

RECORD # 10320

LANGLADE COUNTY SURVEYORS OFFICE

DATE FILED: 6-28-93 BY: SJF

Resurvey - Section 32, Township 33 North, Range 10 East, Langlade County

Survey line between:

1. Northeast Section corner and Southeast section corner of Section 32, Township 33 North, Range 10 East.

Set North 1/16, 1/4 and South 1/16 corner on above corrected line.

2. Run line East between SW NW and NW SW of Section 33, T 33 N, R 10 E. Set squared elm post at 20 chain point. (This is not the true corner)

This line was run off established Northeast Section corner of Section 32, T 33 N, R 10 E which was set by Genisot Engineering Company, to old fence corner along Highway "J" which was described by local resident as being the Southeast section corner of Section 32, T 33 N, R 10 E and has been used as such for the past 60 years.

December 17, 1963

Staff compass and picket line survey - 2 chain tape - 200 links
Commence at squared cedar post - Northeast Section corner of Section 32, T 33 N, R 10 E. Run Random line at $177\frac{1}{2}$ degrees (magnetic at γ with) to Southeast section corner of Section 32, T 33 N, R 10 E (Old Fence Corner). Random line 82.92 chains and fell 52 links east of corner.

Corrected line and set corners as follows:

20.73 Chains Set South 1/16 corner 39 links west of random line (Squared cedar post)

41.46 Chains Set 1/4 corner 26 links west of random line (Squared cedar post)

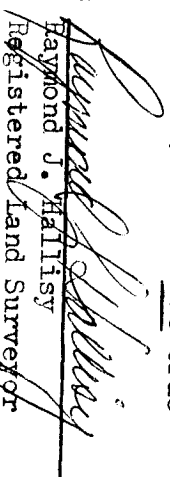
62.19 Chains Set north 1/16 corner 13 links west of random line (Squared cedar post)

82.92 To section corner 28, 29, 32, 33 - T 33 N, R 10 E

December 17, 1963

Commence at established East 1/4 corner of Section 32, T 33 N, R 10 E. Run random line east at N 87 degrees East. 20.00 chains - set squared elm post approximate corner (This is not true corner)

By:


Raymond J. Hallissy
Registered Land Surveyor