

FILED ON:
11/11/2025 04:02 PM
CORTNEY BRITTEN CLEEREMAN
REGISTER OF DEEDS
FOREST COUNTY WI
PAGES: 1

U.S. PUBLIC LAND SURVEY MONUMENT RECORD


This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.

A-E 7.08(3)(a) Identity of the corner:

Meander Corner Section 28	WISCRS - Forest County
Township 34 North	N: 506584.188 USFT
Range 13 East	E: 845818.101 USFT
Town of Nashville	Datum: NAD 83 (2011)
County of Forest	GNSS Method: WISCORS VRS Direct Observation

Corner ID: 43413280400

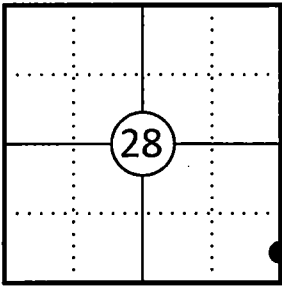

Original Corner Information:


Original Surveyor: J.L. Nowlin	Original B.T.'s: Tamarack 4" - S50°E, 20 links
Date of Survey: October 1865	Tamarack 5" - S51°W, 14 links

A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.



- 09/21/1979 William F. Kelly, Forest County Certified Survey Map Vol. 3, Pg. 2 shows a found iron pipe in place for the Meander Corner.
- 05/21/1985 Norman A. Harrison, Forest County Survey File # 341328-19850424 shows the east line of Section 28 as a straight line between the northeast and southeast corners of Section 28 and does not show any Meander Corners.
- 01/25/2010 Robert O. Kamps, Forest County Certified Survey Map Vol. 8, Pg. 122 shows the east line of Section 28 as a straight line between the northeast and southeast corners of Section 28 and does not show any Meander Corners.
- 03/02/2000 Kim H. Pritzlaff, Forest Co Surveyor File # 341327-20000302 shows an existing 1" dia. iron pipe for the Meander Corner.
- 10/09/2025 I search for and could not find the iron pipe indicated as the meander corner on Kelly or Pritzlaff's surveys. I positioned the corner by projecting a line north from the Southeast corner of Section 28 through Kelly's iron pipe 259.77 feet north of the Section Corner and then extended it north a record distance of 505.99 feet north from the Section Corner as shown on the Pritzlaff survey. I set a Forest County aluminum monument with a 3" dia. cap stamped to identify the corner 2" above the swamp and made four new bearing trees to witness the monument as shown below. Note: This corner falls online between a straight line between the northeast and southeast corners of Section 28.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning.

Bearings given to the nearest second are Forest County Grid. All other bearings are magnetic

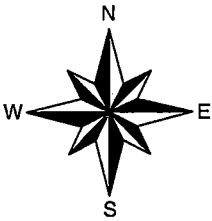

- * Vinyl "T" post 0.9' south of corner.
- * Distances to bearing trees are to nail in side with BT tag on tree.
- * Sketch is not to scale
- () Record dimensions - Kelly
- { } Record dimensions - Pritzlaff

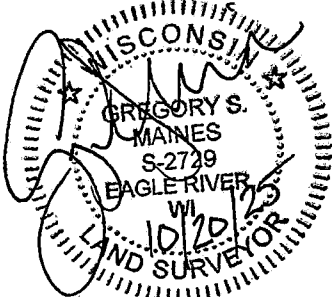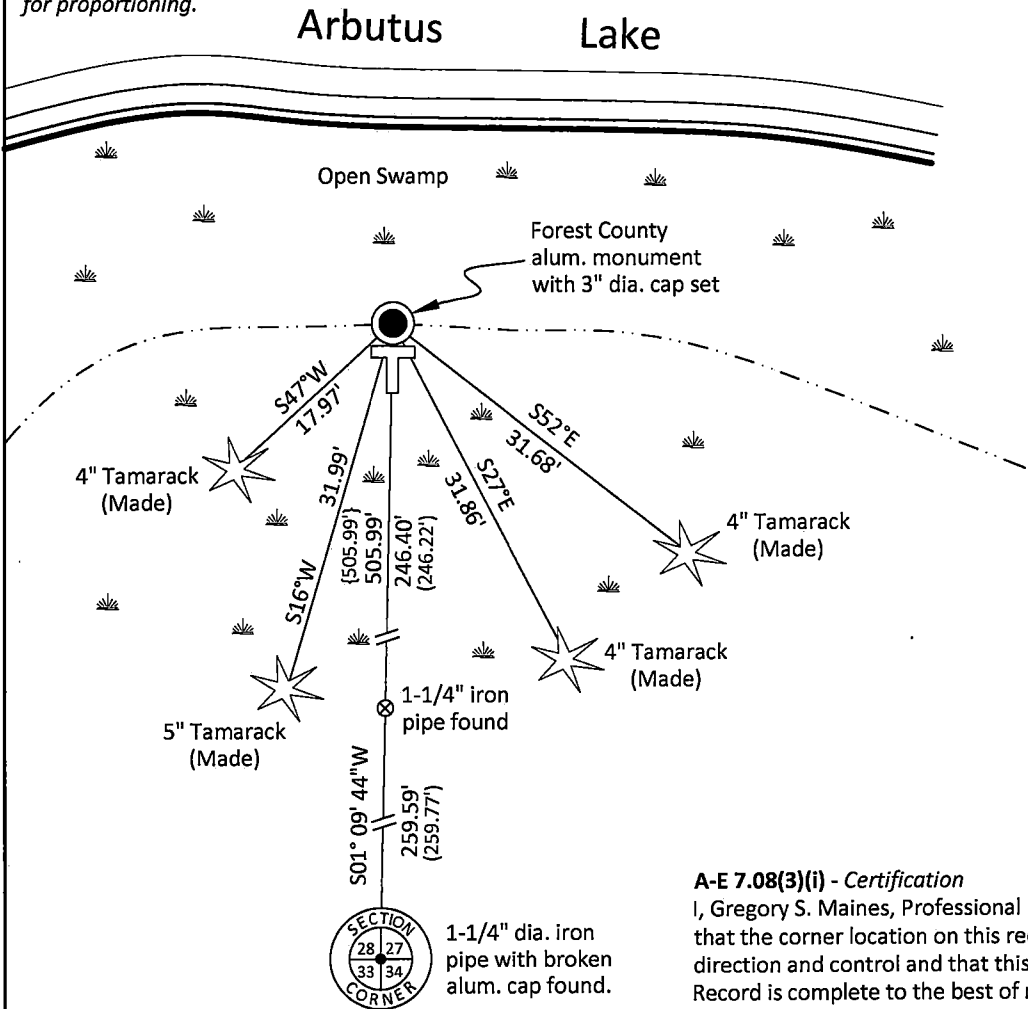

A-E 7.08(3)(i) - Certification
I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.

43413280400

Index No.: 113