State	of Wisc	onsin	} ss.				
County of	Forest	- - 	} 33.				
County of Forest I Gary L. Pisoni do hereby certify that on the 26th day of July 19 89 I found evidence of the North Quarter corner of Section 36 Township 40 North Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.							
Resident wi	tnesses:						
		-					
			·				
	1 	·					
	¡ ¡ ! SECTIO	N 36 _ 1					
	! ! !	! ! ! ! ! ! ! ! ! ! ! ! ! ! ! ! ! ! !					
	 	; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ;					

= Corner monument restored.

LAND SURVEY MONUMENT RECORD PUBLIC

History of original corner establishment:

Original Government Survey in 1865 by William E. Daugherty.

Dependent Resurvey in 1945 by Hugh B. Crawford. West between Sections 25 and 36, at 38.99 chains, found a 32" Cedar post scribed 1/4 on the East face. The corner position was not monumented.

Description of corner evidence found:

No corner evidence was recovered.

The corner position is restored at proportionate distance and on line between the Northeast and Northwest Section corners of Section 36.

Description of monument and accessories I established to perpetuate the original location of this corner.

At the corner position, set a $2\frac{1}{2}$ inch diameter aluminum pipe monument, 3 feet_long, 33 inches in the ground, with an aluminum cap stamped; T40N, R14E, 1/4, S25, S36, 1989, S-1634. From which the following new blazed and scribed bearing trees bear (all measurements taken to a nail in side of tree):

Tamarack	6 "		N.13°W.	11	.53	feet
Tamarack	9"		N.82°E.	12	.70	feet
Tamarack	10 ''	•	s.59°W.	. 6	.00	feet
Steel Sign Post			South	C	.60	feet

Dated at Iron River, MI	,*\\XXXXX., this	day o	of November	19
Signature (County Surveyor, Register Office of Register of Deeds, County of instrument was filed in this office for recent with a colories.	Title	Land Surveyor	Registrati	on No.S-1634
(County Surveyor, Registe	red Land Surveyo	r, or other duly authoriz	red official)	
Office of Register of Deeds, County of	Fore	it.	I hereby certif	v that the within
instrument was filed in this office for re-	cord on the	620 d	ay of September	CLL
at 10:45 o'clock M.				

(Register of Deeds)

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


See drawing below.

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored through lost corner proportionate methods.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

6" Tamarack(NBT) N.13°W., 11.53 feet

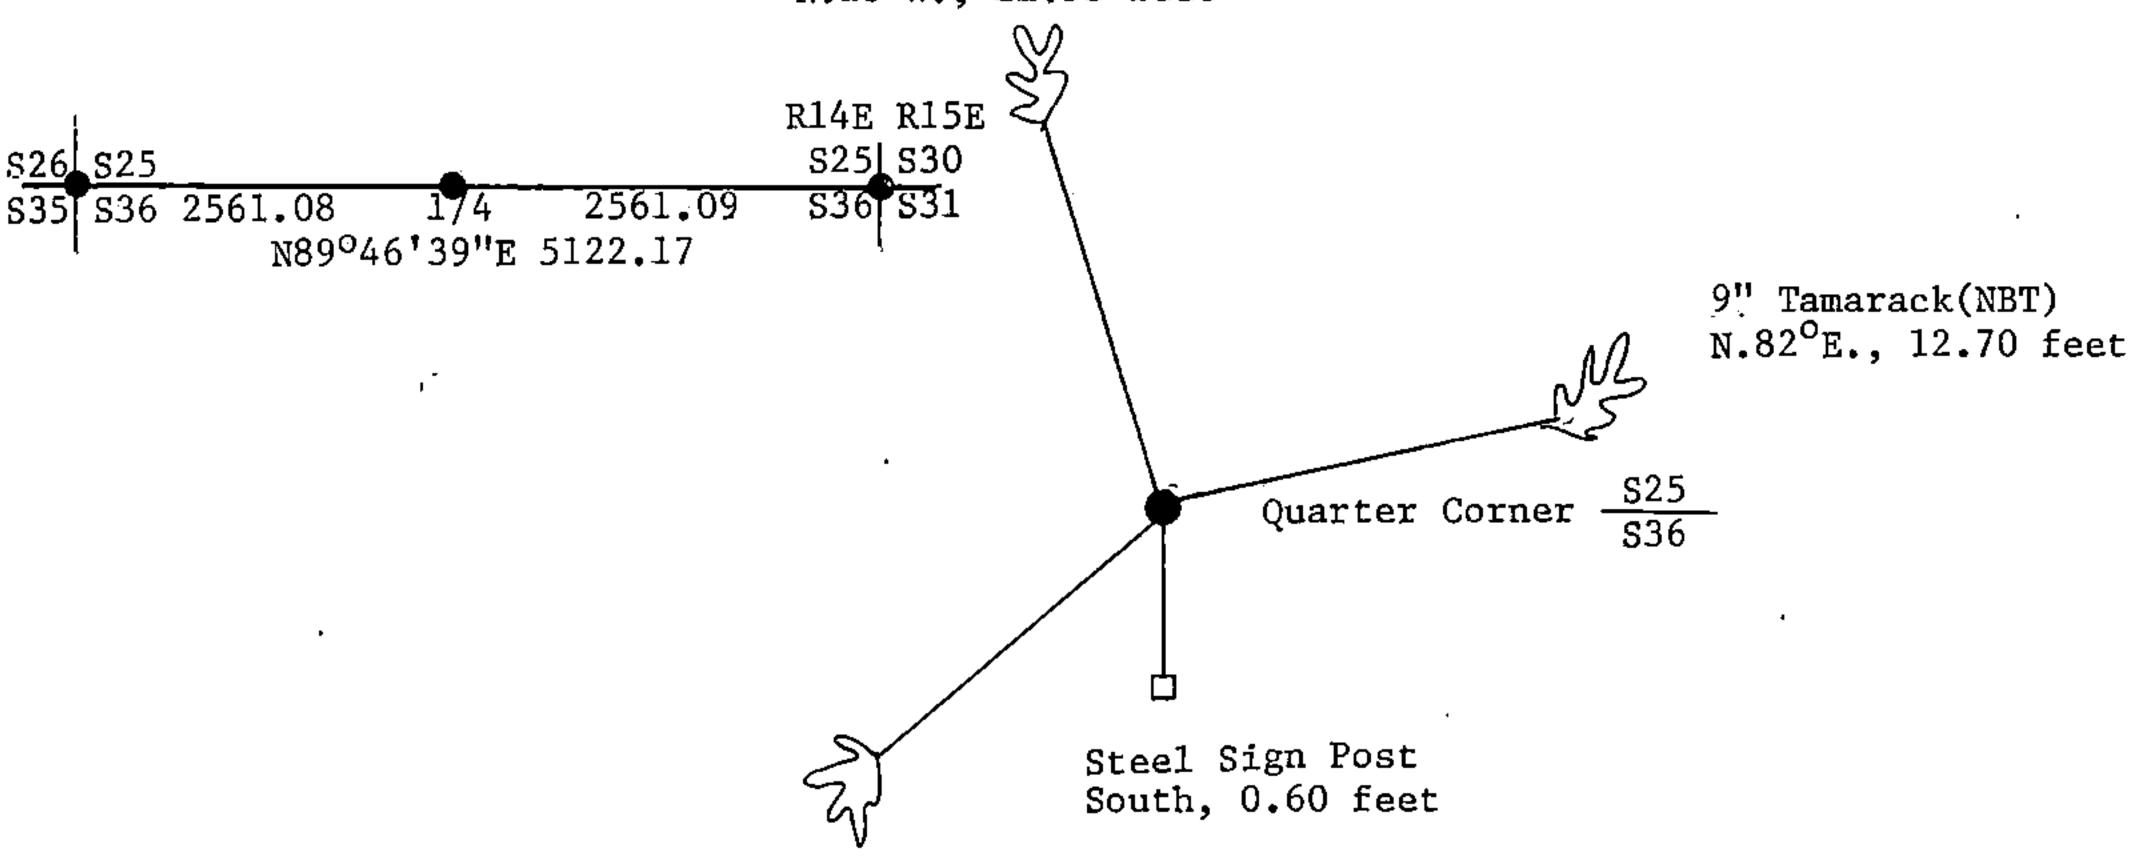

10" Tamarack(NBT) S.59°W., 6.00 feet

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Jan 12 1990

Survey requested by;

Signature

(i)

District Ranger

5-18-50

AND THE PROPERTY OF THE PARTY O

GARY LEE

PISONI

S-1634

IRON RIVER,

MI

Date