FORM NO. 985-A

Stock No. 26273


FOREST	CO SI	URVEYOR
FILE # 34	1520	-1983
DATE		BY

SHEET I OF 5

PLAT OF SURVEY U.S. GOVERNMENT LAND

Being the NE1/4; SE1/4, SE1/4; NE1/4, SW1/4; W1/2, SW1/4; and NW1/4, Section 20
Township 34 North, Range 15 East, Fourth Principal Meridian
FOREST COUNTY, WISCONSIN



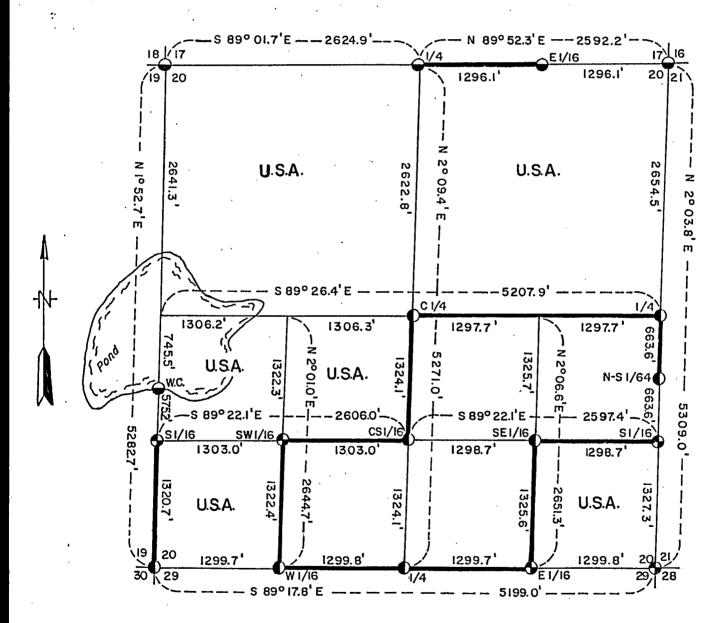

LEGEND

- 2" Diameter Aluminum Monument, 36" Long.
- ₱ 2" Diameter Aluminum Monument, 60" Long.
- ⇒ 2" Diameter Aluminum Monument, 30" Long.
- Marked Boundary Line of U.S. Government Lands.

Sheet 2 of 5

SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 20, for establishing subdivisional corners within Section 20, and for locating and marking the boundaries of U. S. Government lands on their perimeter and within Section 20, Township 34 North, Range 15 East, Fourth Principal Meridian, Forest County, Wisconsin.

The U. S. Government lands in this section were acquired from 1935 to 1951.

The original government subdivision survey of this township was made in 1859.

The corner positions recovered, restored, and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 3000.

The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Section Corner to Sections 20, 21, 28, and 29, T.34N., R.15E.

Corner position restored by double proportionate measure from section corners in all four directions. Monument below road surface.

Corner References:

Red Pine	· 5"	N.29°E.	136.50	feet
Elm	14"	N.62°E.	85.14	feet
Pwr. Pole	#3514 - 28W25	S.47°E.	45.55	feet
Steel Sign	Post	North	11.30	feet

2. Section Corner to Sections 19, 20, 29, and 30, T.34N., R.15E.

Corner position restored from remains of original bearing trees and post point.

Corner References:

Black Spr	uce 6"	N.19°E.	20.30	feet
Cedar	6"	S.48°E.	21.51	feet
Black Spr	uce 6"	S.6°E.	9.89	feet
Black Spr	ruce 6"	N.67°W.	17.55	feet
Steel Sig	n Post	North	4.40	feet

3. Section Corner to Sections 16, 17, 20, and 21, T.34N., R.15E.

Corner position restored by proportionate measure from section corner two miles southerly, one-half mile northerly and from the centerline of Chicago Northwestern Railway right-of-way plat, dated 1916, 274 feet westerly.

Corner References:

Sugar	Maple	6"	N.77°E.	82.12	feet
Black	Cherry	6"	S.30°E.	85.28	feet
Sugar	Maple	6"	s.72°W.	260.72	feet
Sugar	Maple	20"	N.48°W.	266.09	feet
Steel	Sign Post		East	3.30	feet
Steel	Sign Post		North	2.00	feet



Sheet 3 of 5

4. Section Corner to Sections 17, 18, 19, and 20, T.34N., R.15E.

Corner position restored by double proportionate measurement from quarter corners one-half mile north and east, one mile west, and two miles southerly.

Corner References:

Sugar Maple	5 ¹¹ .	и.89°E.	47.07	feet
Yellow Birch	5"	S.40°E.	31.38	feet
Hickory	8"	West	95.90	feet
Sugar Maple	5 "	N.28°W.	50.90	feet
Steel Sign Post	-	West	16.60	feet

5. Quarter Corner to Sections 17 and 20, T.34N., R.15E.

Corner position found marked by an iron pipe in mound of stone, supported by evidence of the original bearing trees.

Corner References:

Basswood ·	8"	S.25°E.	53.05	feet
Hemlock	18"	s.89°w.	24.01	feet
Sugar Maple	14"	N.23°W.	49.98	feet
Steel Sign Pos	t ·	North	1.90	feet

6. Quarter Corner to Sections 20 and 21, T.34N., R.15E.

Corner position restored by single proportionate measurement from section corners one-half mile north and south.

Corner References:

Black Ash	5 ''	s.80°E.	8.69	feet
Cedar	5"	s.89°w.	17.50	feet
Cedar	7"	N.17°W.	11.64	feet
Steel Sign Post		South	1.90	feet

7. Quarter Corner to Sections 20 and 29, T.34N., R.15E.

Corner position restored by single proportionate measurement between the northwest and northeast corners of Section 29.

Corner References:

Cedar ·	6"	East	16.83	feet
Cedar	6"	S.37°E.	9.02	feet
Cedar	8"	s.28°W.	14.61	feet
Steel Sign Post		East	2.30	${ t feet}$

8. Witness Corner to Quarter Corner to Sections 19 and 20, T.34N., R.15E.

Quarter corner position restored by single proportionate measure between section corners one-half mile north and south. Corner position witnessed 745.5 feet south on section line.

Corner References:

Sugar	74 11	S.33°E.	46.75	${ t feet}$
Sugar	7 ¹¹ ·	s.7°W.	60.76	feet
Basswood	14"	N.75°W.	49.27	feet
Steel Sign Post		East	1.80	${ t feet}$



Sheet 4 of 5

CORNERS ESTABLISHED

1. West Sixteenth to Sections 20 and 29.

Corner established midpoint and on line between the northwest corner and the north quarter corner of Section 29. Corner References:

Black Spruce	դ"	N.23°E.	75.14	feet
Black Spruce	5"	N.18°W.	85.00	feet
Steel Sign Post		North	1.30	feet

2. East Sixteenth to Sections 20 and 29.

Corner position established at midpoint and on line between the north quarter and northeast section corner of Section 29. Corner References:

Sugar	7"	N.30°E.	28.23	feet
Sugar	6"	s.76°E.	17.01	feet
Black Cherry	9"	s.78°w.	20.58	feet
Steel Sign Post		West.	1.10	feet

3. South Sixteenth to Sections 19 and 20.

Corner established midpoint and on line between the southwest corner and the west quarter corner of Section 20. Corner References:

Basswood ·	5"	N.86°E.	13.48	feet
Sugar	7"	s.38°E.	17.18	feet
Sugar	26"	N.33°W.	4.75	${ t feet}$
Steel Sign Post		South	1.30	${ t feet}$

4. East Sixteenth to Sections 17 and 20.

Corner established midpoint and on line between the northeast corner and the north quarter corner of Section 20. Corner References:

Black Ash	5"	N.7°E.	43.74	feet
Red Maple	5 ''	S.43°E.	39.89	feet
Black Ash	5''	s.49°W.	7.73	${ t feet}$
Steel Sign Post		West	2.10	feet
Steel Rod11"		S.12°E.	34,90	feet

5. South Sixteenth to Sections 20 and 21.

Corner established midpoint and on line between the southeast corner and the east quarter corner of Section 20. Corner References:

Balsam	8"	N.42°E.	14.67	${ t feet}$
Yellow Birch	14 11	s.89°E.	9.43	feet
Pwr. Pole #3415	-21L5	s.20°W.	57.04	${ t feet}$
Steel Sign Post		East	1.30	${ t feet}$

6. Center South Sixteenth to Section 20.

Corner established midpoint and on line between the center quarter corner and the south quarter corner of Section 20. Corner References:

Cedar	4"	s.36°E.	6.20	feet
Cedar	4"	s.44°W.	11.37	${ t feet}$
Cedar	· 6"	N.40°W.	11.40	feet
Steel Sign	Post	West	2.20	feet

Sheet 5 of 5

7. Southeast Sixteenth to Section 20.

Corner established at the intersection of the south and east one-sixteenth lines of Section 20.

Corner References:

Cedar	9"	N.45°E.	73.83 feet
Cedar	8"	s.42°W.	4.75 feet
Cedar	5"	N.14°W.	74.08 feet
Steel Sign Post		East	1.10 feet

8. Southwest Sixteenth to Section 20.

Corner established at the intersection of the south and west one-sixteenth lines of Section 20.

Corner References:

Sugar	4"	N.45°E.	33.69	feet
Sugar	15"	S.81°E.	49.06	feet
Sugar	7"	n.63°W.	8.24	feet
Steel Sign Post		South	1.30	feet

9. Center Quarter to Section 20, T.34N., R.15E.

Corner established at the intersection of the one-quarter lines of Section 20.

Corner References:

Black Ash	5 ''	N.41°E.	47.71 feet
Cedar	10"	S.27°E.	38.36 feet
Black Ash	5"	s.45°W.	4.15 feet
Steel Sign	Post	East	1.60 feet

10. North-South Sixty-Fourth to Sections 20 and 21.

Corner established midpoint and on line between the east quarter corner and south sixteenth of Section 20.

Corner References:

\mathtt{Cedar}	6"	N.14°E.	18.95	${ t feet}$
Cedar	11"	South	1.68	feet
Cedar	8"	s.70°W.	19.14	feet
Steel Sign	Post	North	1.80	feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin County of Forest

SS

I, Milo E. Stefan, Cadastral Surveyor, U. S. Forest Service and a registered surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 20, Township 34 North, Range 15 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the

State of Wisconsin.

MILO E.

STEFAN

S-1558

RHINELANDER

MAR 2 0 1986

Crandon, WI Cadastral Surveyor, U. S. Førest Service

R.L.S., State of Wisconsin

Certificate S-1558

Plat Ready For Filing:

District Ranger

Date of Survey: 1983

NO SURV