

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.


A-E 7.08(3)(a) Identity of the corner:

SE Corner Section 18	WISCRS - Forest County
Township 34 North	N: 516768.427 USFT
Range 13 East	E: 835657.655 USFT
Town of Nashville	Datum: NAD 83 (2011)
County of Forest	GNSS Method: WISCRS VRS Direct Observation

Original Corner Information:

Original Surveyor: J.L. Nowlin	Original B.T.'s: Hemlock 10" - N18°W, 18 links
Date of Survey: October 1865	Hemlock 10" - N61°E, 20 links

Corner ID: 43413180000

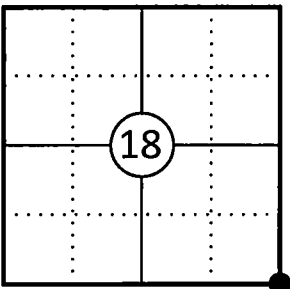


A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.


1966 W.H. Stuth, Owens - Illinois indicates an iron pipe by others as shown on the survey prepared on March 5, 1987.

05/14/2025 I found and accepted a 2-1/2" dia. iron pipe 6" above grade at the corner location. I found two existing bearing trees not of record. I made two new bearing trees to witness the corner as shown below.


A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning.

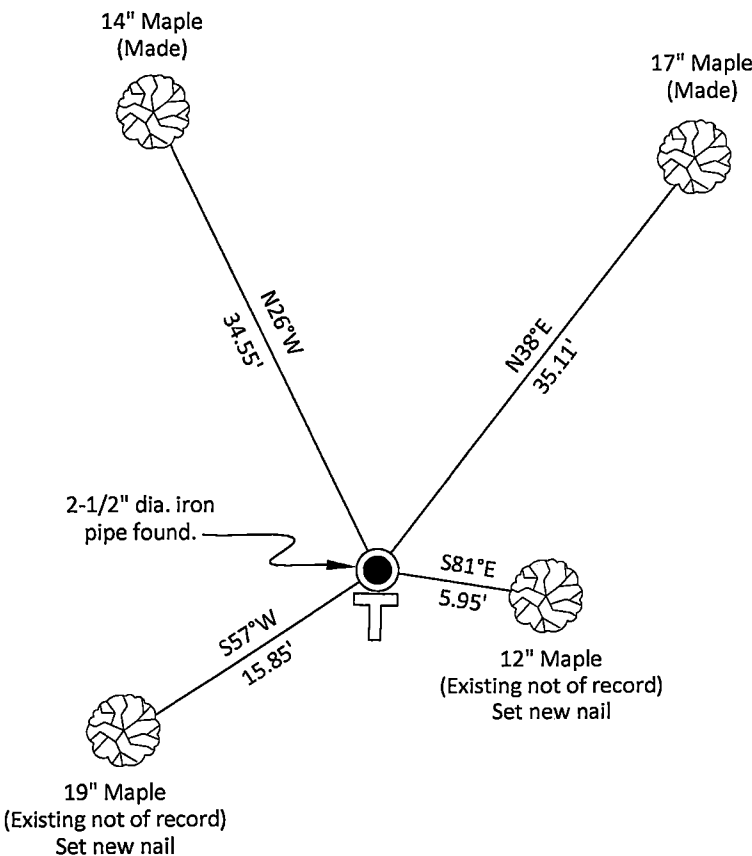

Bearings given to the nearest second are Forest County Grid. All other bearings are magnetic

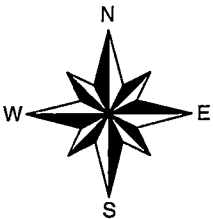

- * Vinyl "T" post 0.9' south of corner.
- * Distances to bearing trees are to nail in side with BT tag on tree.
- * Sketch is not to scale

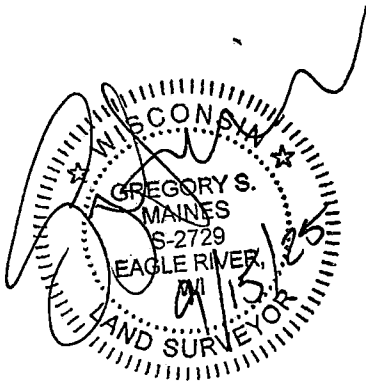

A-E 7.08(3)(i) - Certification
I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.