

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.


A-E 7.08(3)(a) Identity of the corner:

S 1/4 Corner Section 18	WISCORS - Forest County
Township 34 North	N: 516724.399 USFT
Range 13 East	E: 833009.220 USFT
Town of Nashville	Datum: NAD 83 (2011)
County of Forest	GNSS Method: WISCORS VRS Direct Observation

Original Corner Information:

Original Surveyor: J.L. Nowlin	Original B.T.'s: Sugar 12" - N6°W, 12 links
Date of Survey: October 1865	Hemlock 14" - S26°E, 20 links


Corner ID: 43413180020

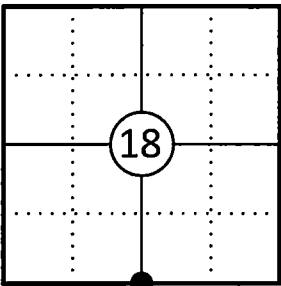


A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.

- 1966 W.H. Stuth with Owens Illinois shows a computed position for this corner on his survey map prepared on 03-05-1987.
- Unknown Forest County Surveyor File # 341319 is a partial copy of a map by an unknown surveyor in the southwest quarter of Section 19. The map shows a bearing on the north-south quarter line that lines up with the found 1-1/4" dia. iron rod.
- 10/08/2025 I found and accepted a 1-1/4" dia. iron rod 3" above grade at the corner location along with four existing iron pipes as reference monuments next to bearing trees with blazes and tags. The found iron rod is online between the southeast and southwest corners of Section 18 and seems to match up with the partial survey map in the southwest quarter of Section 19. (File #341319) . The corner is witnessed as shown below.


A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning.

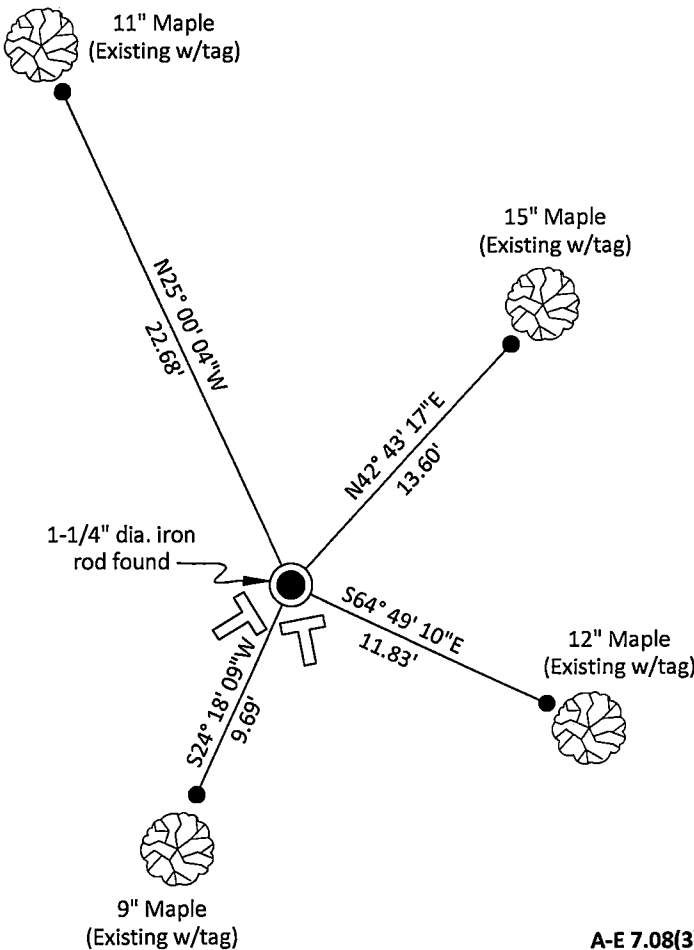

Bearings given to the nearest second are Forest County Grid. All other bearings are magnetic

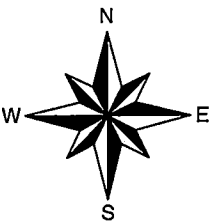

- Vinyl "T" post 1.0' southeast and 0.4' southwest of corner
- * Steel fence post found 0.6' east of corner.
- * Distances to iron pipe near tree
- * Sketch is not to scale
- 1-1/4" iron pipe found

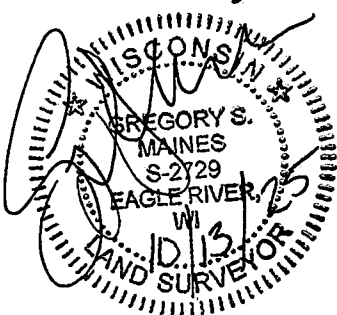

A-E 7.08(3)(i) - Certification
I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.