

136612

## U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner Common to Sections 3 and 10  
T34N, R15E, Forest County, Wisconsin.

REGISTER'S OFFICE  
Forest County, Wis.

Received for record this 9th day


of December A.D., 1988 at

2:50 o'clock P.M. and recorded

in Vol. CORNER RESTORATIONS

page E-15

Paul A. Schenck  
Register of Deeds

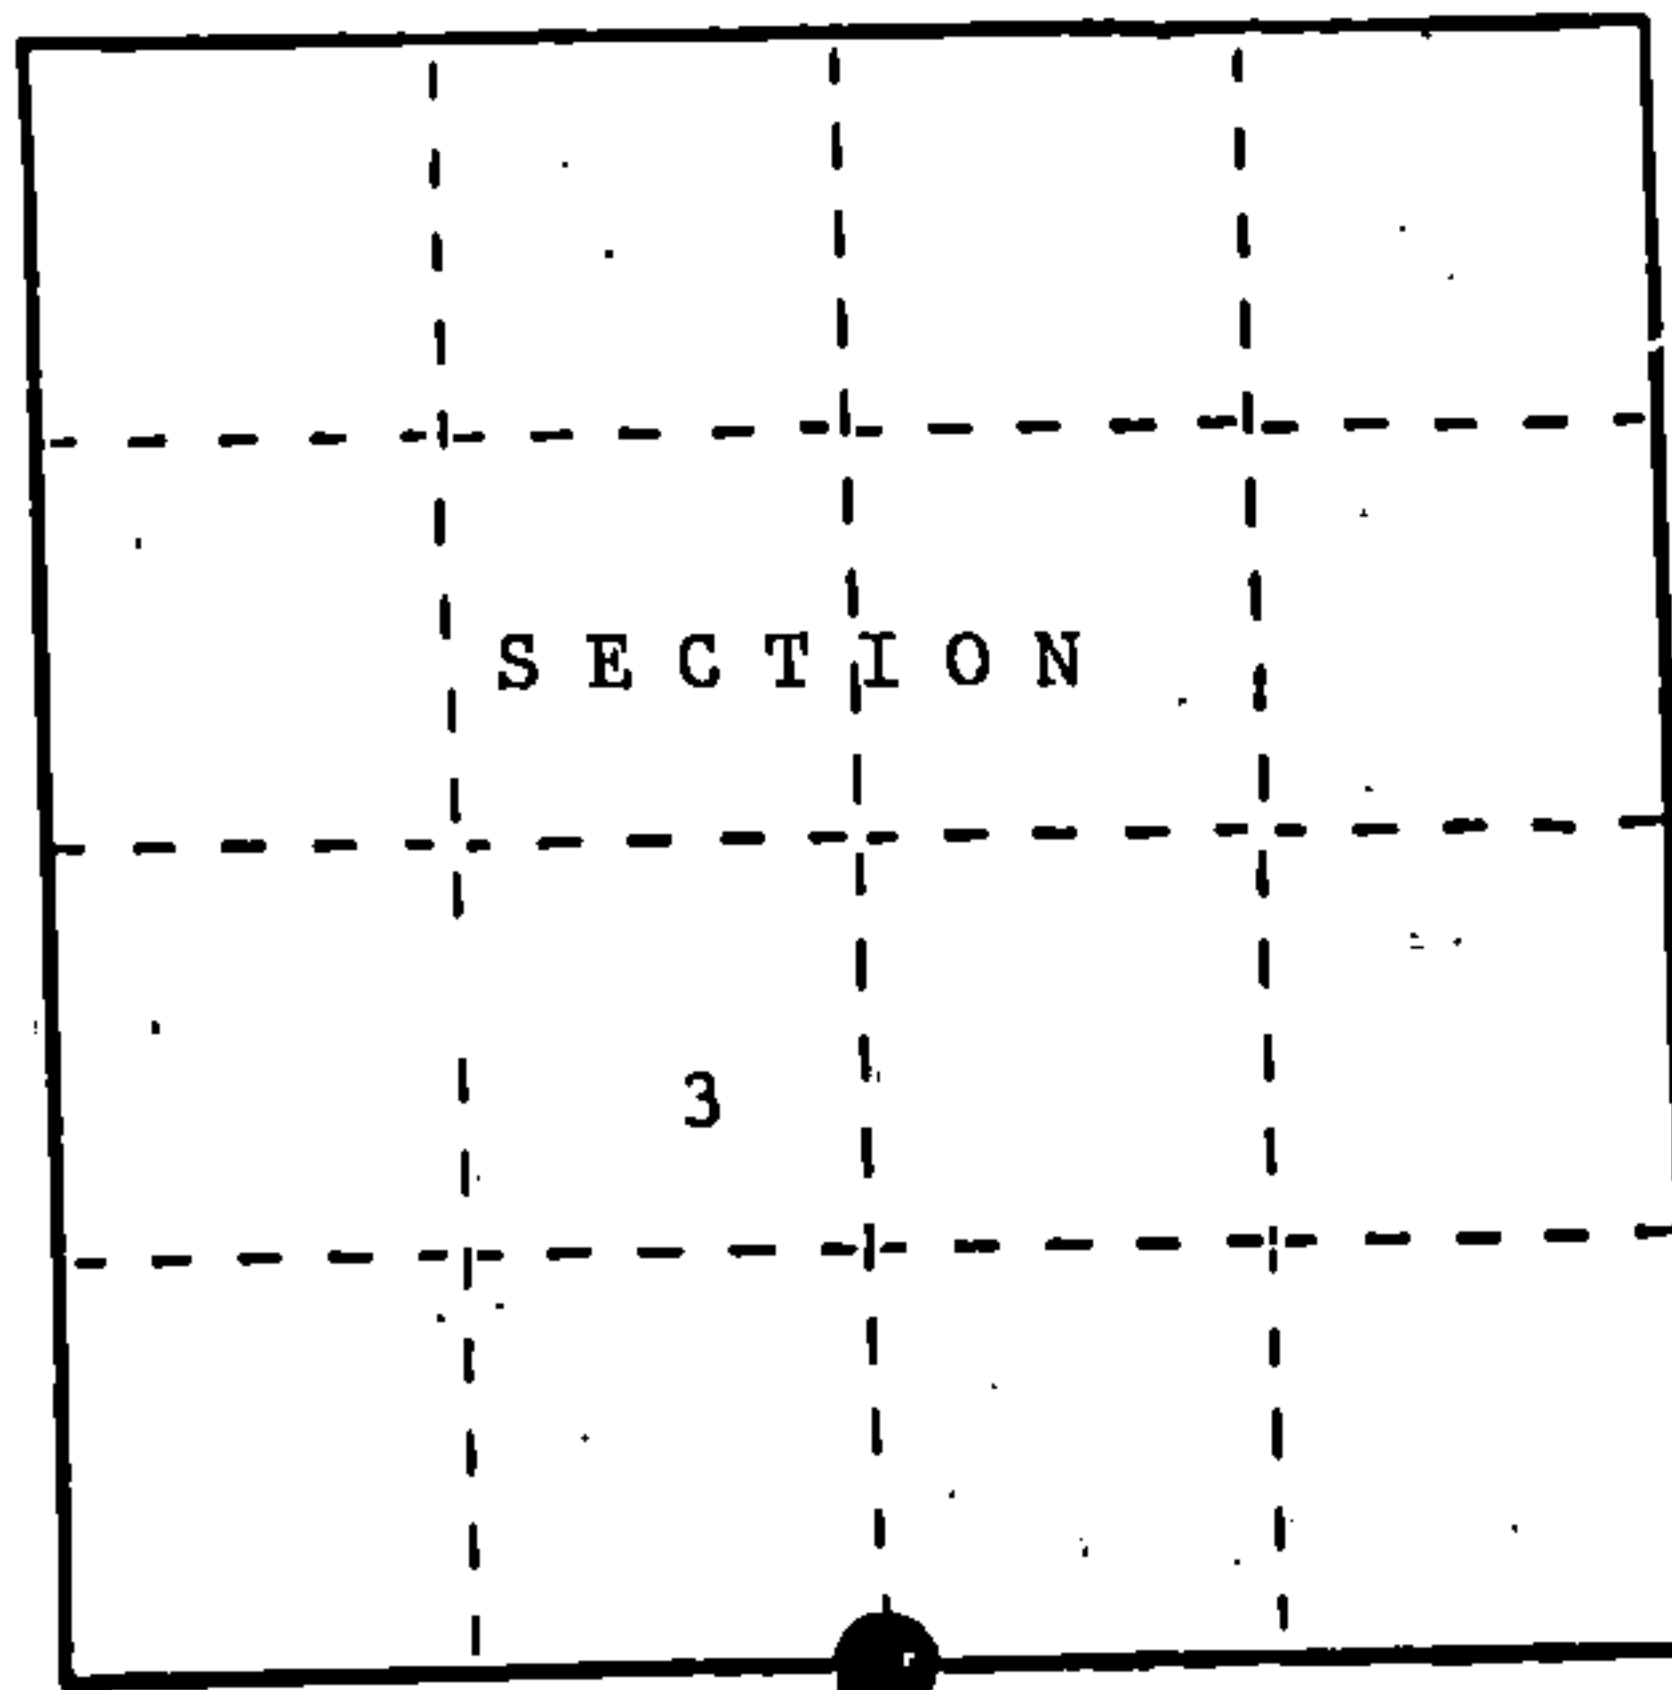

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1959, J. McBride set a wood post for the corner and the following corner references:


Sugar Maple	12"	S53°E	24 lks.
Sugar Maple	18"	N14°E	30 lks.

In 1988, Found no evidence in the area which has been heavily logged.  
Placed a 2 1/2' X 36" aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)  
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" X 36" aluminum magnetic cap monument stamped to identify the corner.
2. Sugar Maple 10" S69°E 25.16 ft.
3. Sugar Maple 5" S67°W 11.98 ft.
4. Sugar Maple 14" N21°W 39.71 ft.
5. Sugar Maple 6" N55°E 5.15 ft.
6. Steel sign post East 1.2 ft.

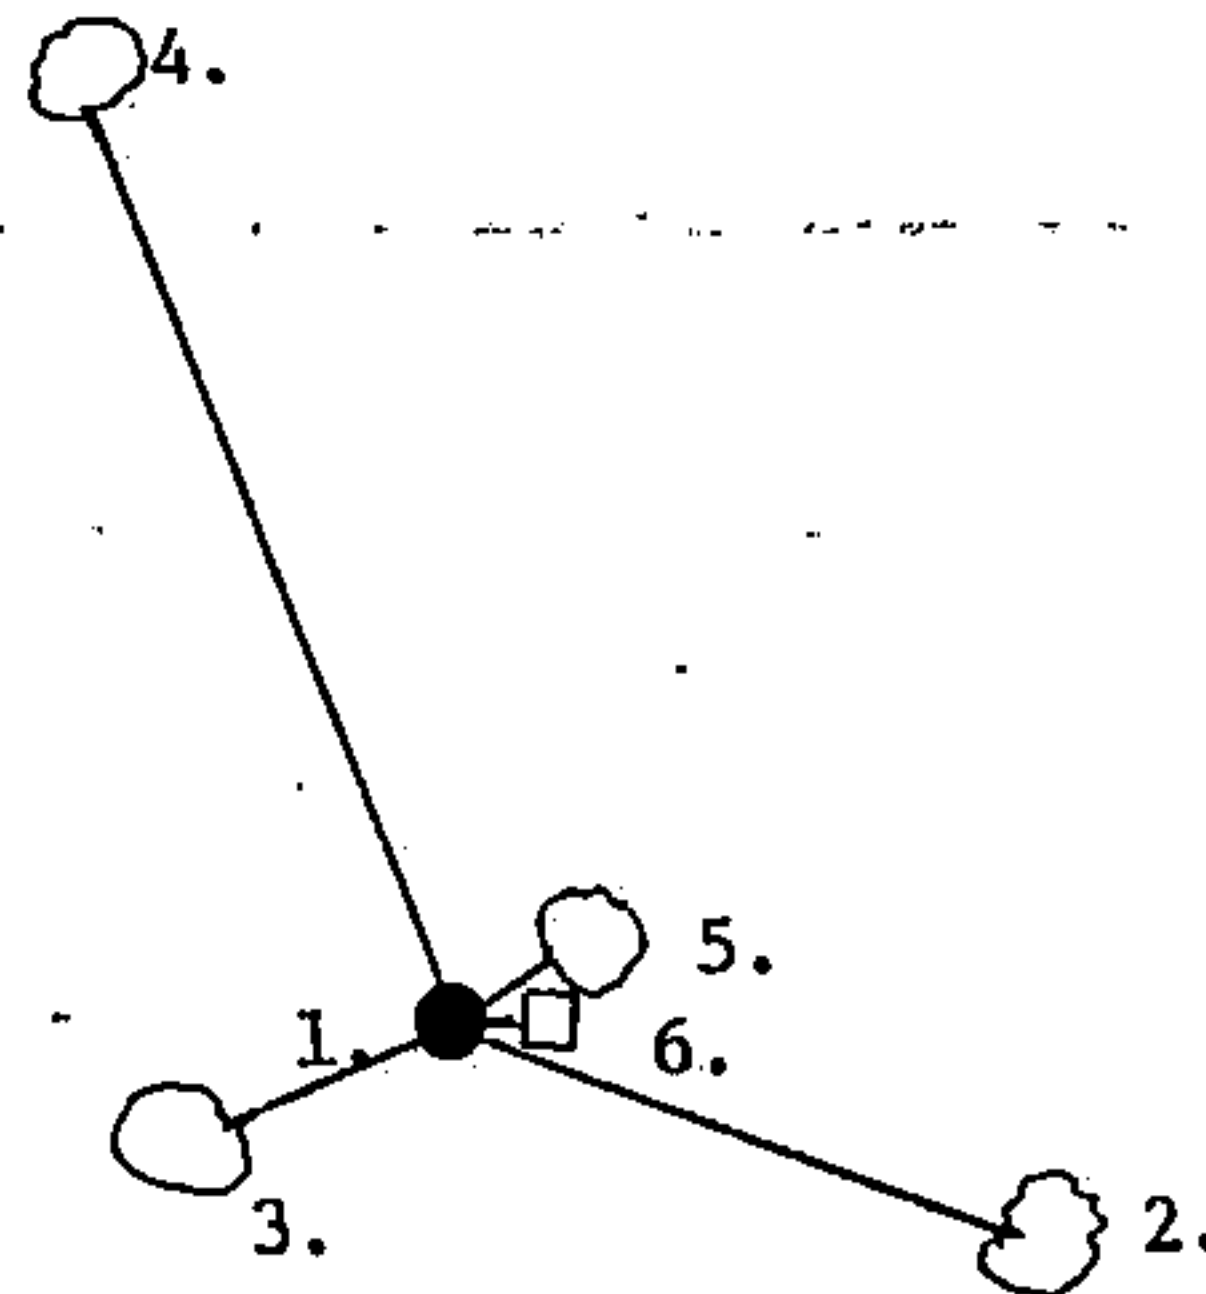

43415030020

E-15 34-15

E-15

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished, by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No discrepancy, first corner restoration.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No, see g and h.

- (gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Corner restored by proportionate methods.

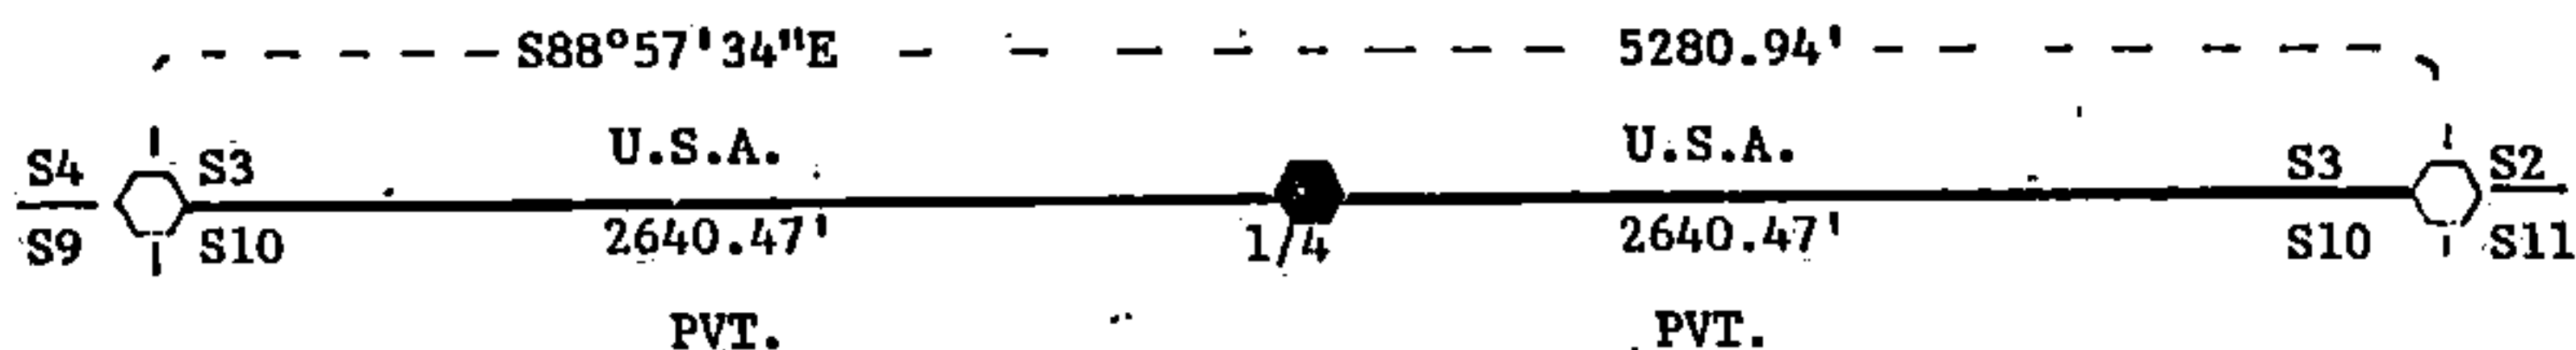

— Boundary line marked to standard.

- (1) John C. Schulke  
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature John C. Schulke Date Oct 16, 1988

Certificate ready for filing: Dale B. Staege  
District Ranger

