

State of Wisconsin
County of FOREST

ss. RESTORATION OF LOST ORIGINAL GOVERNMENT SURVEY CORNER.

I NEAL SPERHAKE, do hereby certify that on the SECOND day of SEPTEMBER, 1964, I ~~established~~ found the NORTHWEST SECTION CORNER OF SECTION 9, TOWNSHIP 35 NORTH, RANGE 13 EAST, Fourth Principal Meridian, as described hereon.


History: This corner was established during the original survey of this township, as noted in the original field notes for the original survey of T35N-R13E, 4th. p.m.

Description of monument and accessories I established to perpetuate the location of this corner:


At the point determined for the location of the corner I found emplaced a:
GALVANIZED IRON PIPE, FIVE FEET LONG, TWO INCHES IN DIAMETER, WITH BRASS CAP DENOTED AS;
"FOREST COUNTY FOREST CROP SURVEY T35N-R13E SEC. COR 5, 4, 8, 9 C.E. WALKER
8/1/1940."

The pipe is witnessed by:
W. Birch 4 N 54°E 40 links. (SCRIBED S 4 NBT).
W. Birch 8 N 64°W 37 links. (SCRIBED S 5 NBT).
W. Ash 7 S 8°W 28½ links. (SCRIBED S 8 NBT).
W. Birch 4 S 64°E 55½ links. (SCRIBED S 9 NBT).

Description as to how corner was located: There has been no question of Walker's corner being correct. However, no record of his survey has been located, and in order to substantiate the position of the corner for recording, the section line between 4 and 5 was run, as was the section line between 5 and 8, westward to Lake Metonga. The townline corner of 4 and 5 had been previously located. The original length of the line between 4 and 5 was 75.60 chains. The actual distance between the town line corner of 4 and 5, and the corner in question is 75.03 chains. This difference of 57 links in a mile is compatible with findings from retracement surveys in this vicinity. The original length of the line between 5 and 8 from the corner of 4, 5, 8, 9, to the meander corner on the east side of Lake Metonga was 27.90 chains. The actual distance is 27.23 chains. This difference of 67 links is relatively greater than the difference that was noted on the line between 4 and 5, but this probably could be interpreted as being a discrepancy between where the original high water mark of the lake was over 100 years ago, and where it is thought today that it was. All in all, the discrepancy in measurements between the original survey and present measurements is not, in my opinion, of significance. I believe that Walker's positioning of the corner of 4, 5, 8, 9, is either at the site of the original corner, or as close as any retracement survey, lacking original evidence, could place it. I have accepted it, rewitnessed it, and recorded it.

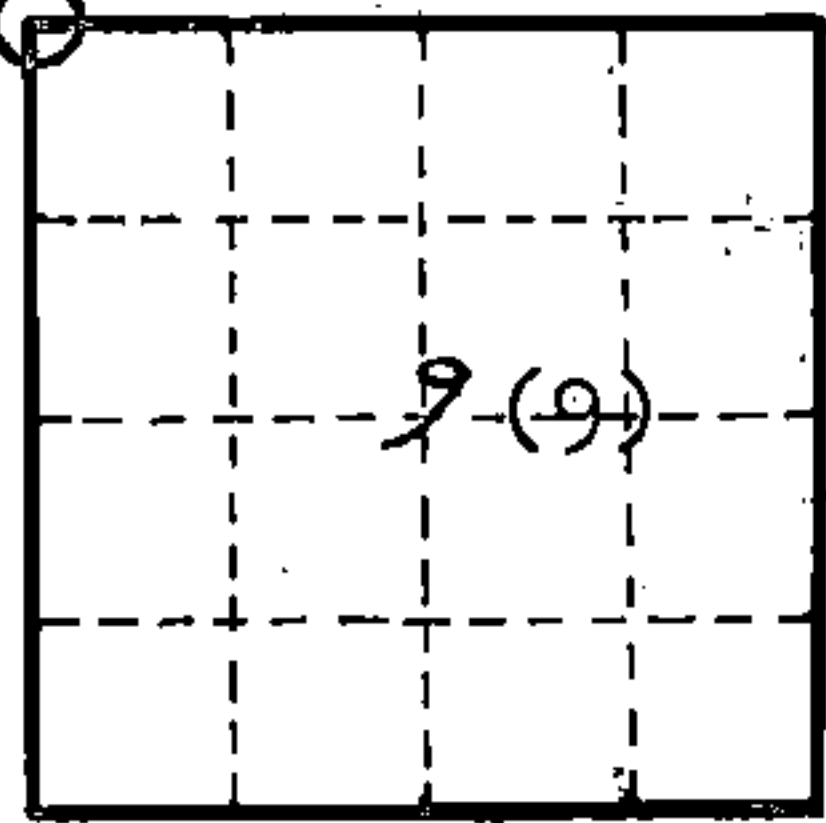

0 = Corner monument restored

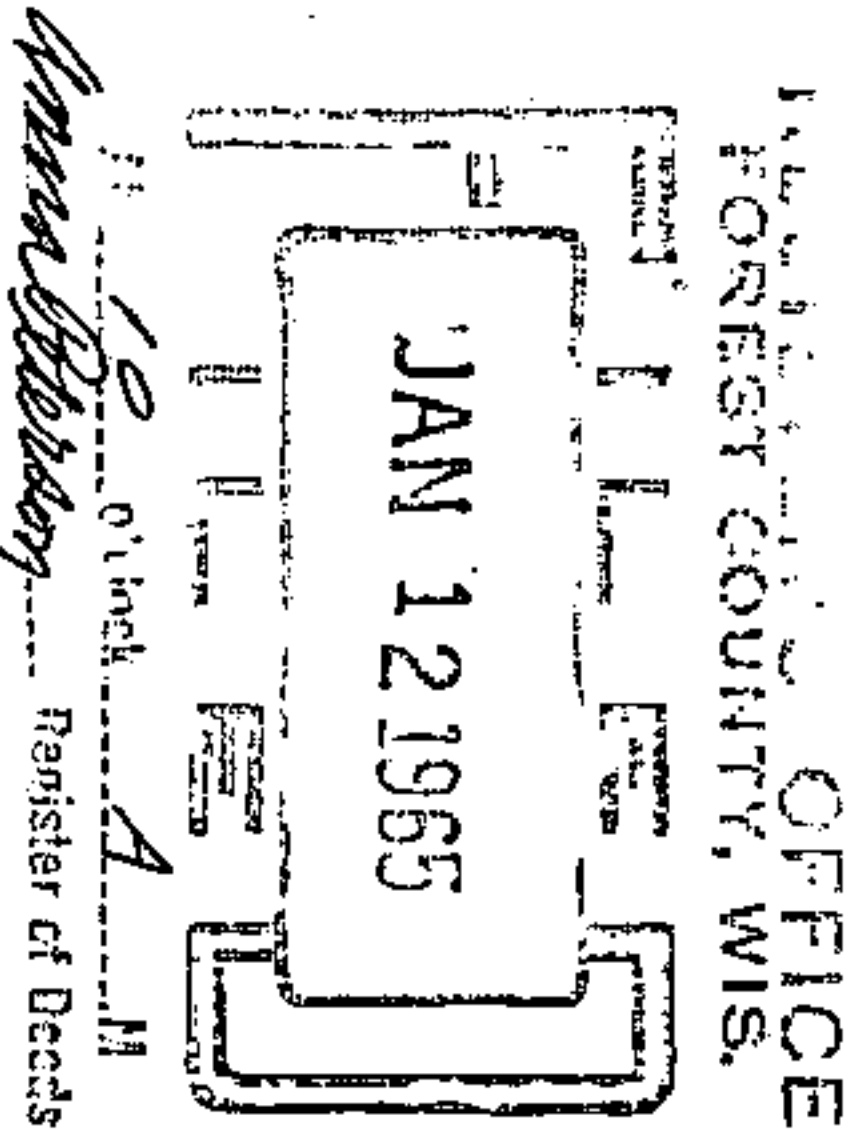

Resident witnesses _____

Dated at Crandon, Wisconsin, this 12th day of January, 1965.

Signature Neal Sperhake

Title Registered Land Surveyor Registration No. 463

~~Office of~~ Forest County of Wisconsin

I hereby certify that the within instrument was ~~filed for record~~ filed for record on the 12th day of January 1965, and was ~~filed in Book No.~~ signed and ~~Page No.~~ sworn to ~~in County Records.~~ before me.

Surveyor's Seal

Signature Anna Peterson Title Notary Public

43513050000

Index No. 11