

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

East One-Sixteenth Corner between Sections 4 and 33, T.35-36N., R.15E., Forest County, Wisconsin.

State Plane Coordinates

Wisconsin North Zone


N - 174321.42986

E - 2321802.61844

Geographic Coordinates

N - 45 - 38 - 10.68380

W - 088 - 37 - 07.56825

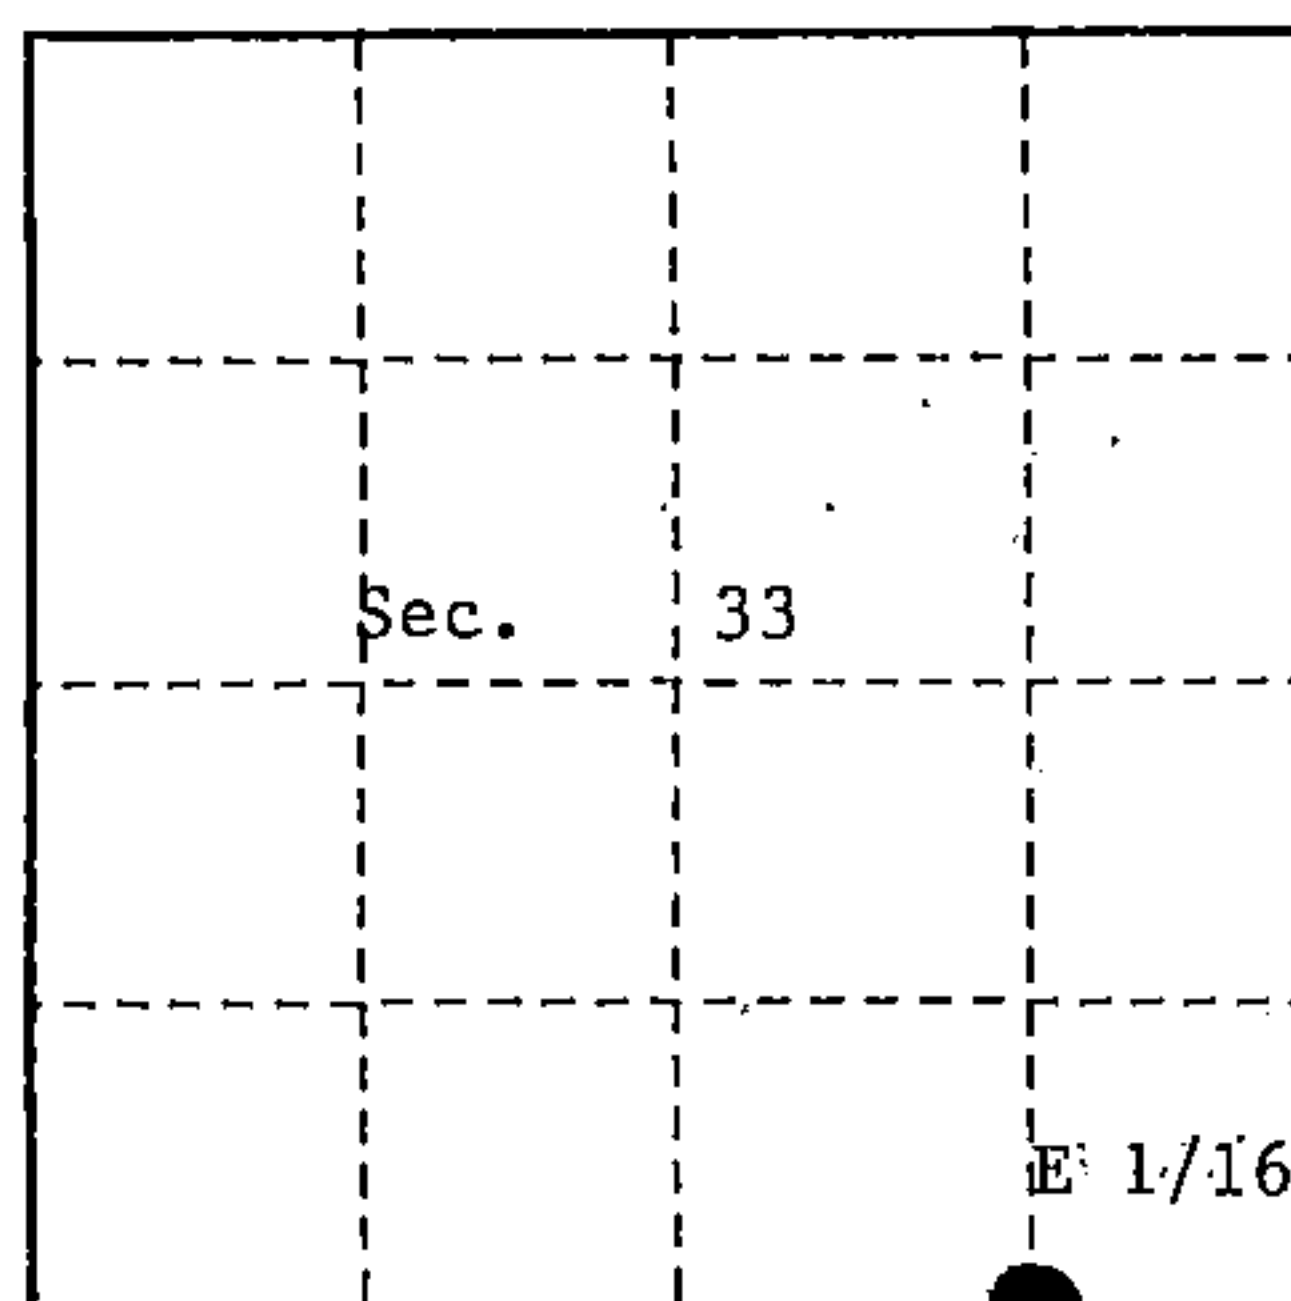

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence you considered, and whether the monument was found or placed.


In 1986 Glen Barker, RLS, with Consolidated Paper Industries established the corner at mid-point and on line between the South Quarter Corner and the Southeast Section Corner of Section 33. Set a 1" diameter iron pipe with a 2" diameter alloy cap stamped to identify corner. Made the following B.T.'s; Red Maple, 7", S.43°E., 33.95 feet, Spruce, 14", S.46°W., 23.28 feet.

In 1994, Alan Harrison, RLS, found monument and B.T.'s as set by Barker in 1986. Cut down all bearing trees for G.P.S. observations and made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 1" diameter iron pipe with alloy cap stamp to identify corner.
2. Red Maple, 13", North, 180.16 feet.
3. Cherry, 6", N.61°W., 43.28 feet.
4. Steel Sign Post, West, 2.00 feet.

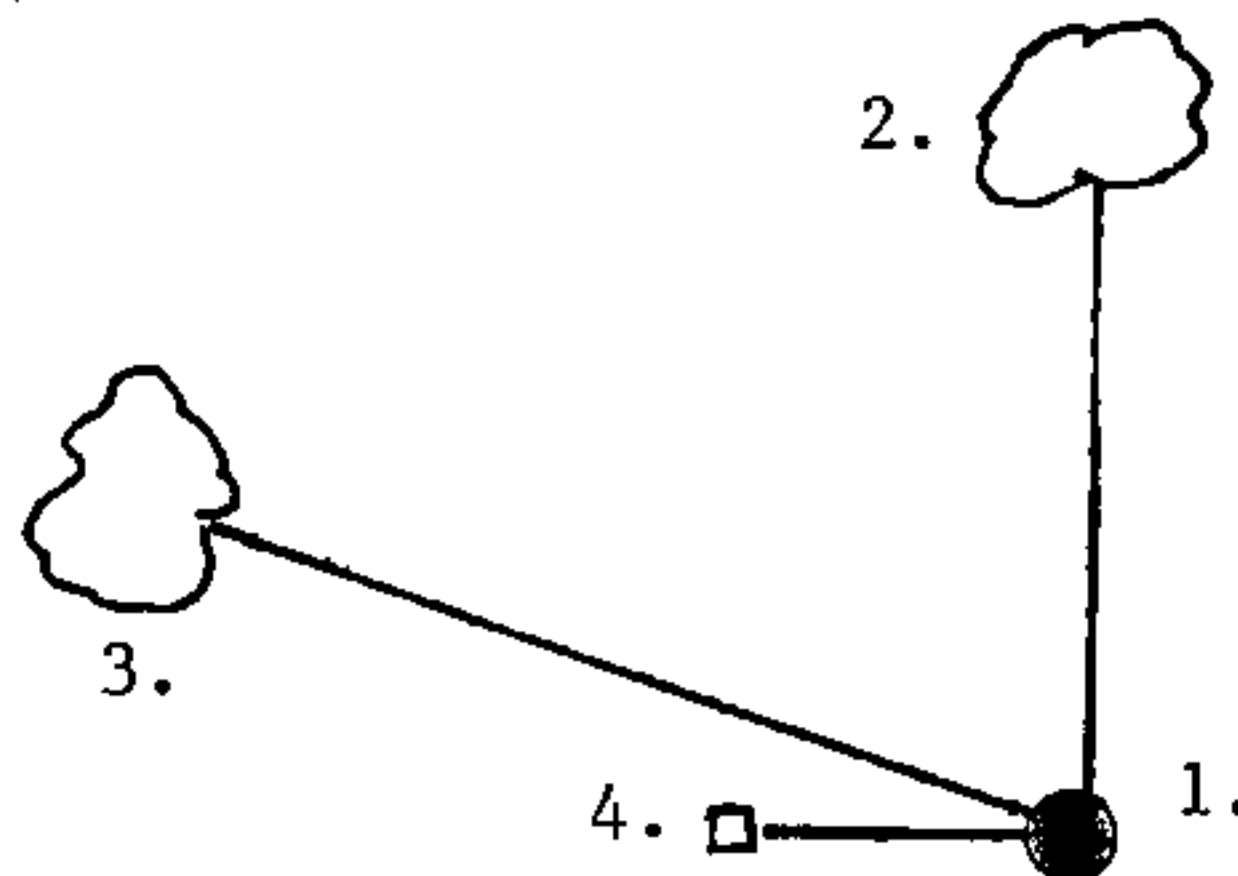

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE {
Forest County, Wis. {
Received for record this 10th day
of May A.D., 19 95 at
8:30 o'clock A.M. and recorded
in Vol. Corner Restorations
page 35-36-15, 2-12
Shel Chitt, Deputy
Register of Deeds



(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Randy Schueber
District Ranger