
NOV 082023

CORTNEY BRITTEN CLEEREMAN REGISTER OF DEEDS

U S PUBLIC LAND SURVEY MONUMENT RECORD-ADDENDUM

NOTE: This form is intended and designed to fufill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-i)

A-E 7.08(3)(a) Identity of corner: EAST 1/4 CORNER SECTION 36, TOWNSHIP 36 NORTH, RANGE 12 EAST OF THE 4TH PM. CITY OF CRANDON, COUNTY OF FOREST WISCRS - FOREST COUNTY N: 566,114.841 USft (XXX,XXX.XXX) E: 830,815.240 USft (XXX,XXX.XXX) Datum: NAD83 (2011) **GNSS Method RTK** GNSS Control WISCORS VRS

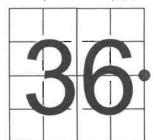

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Coordinates shown in parenthesis are previously published values.

A-E 7.08(3)(b)

Original Surveyor: Alfred Millard

Date of Original Survey Commenced:

Completed:

May 1858 June 1858 Original Accessories

Hemlock 10 N 42° W Elm

S 82° E 12

22 Links 17 Links

See previous Record and Certification of U.S. Public Land Survey Control Station X-25 (X-1) -February 27, 1992 - Survey Crew Chief -R. Johnson THENCE:


November 06, 2007 - Surveyor 1451 - Eugene C. Uttech - indicates this position as "3/4" rebar found" on Forest Co. Certified Survey Map -Volume 8, Page 19-19B.

August 30, 2011 - Surveyor 2656 - Jeffrey L. DeMuth - indicates this position as "computed" on Forest Co. Surveyor File #361331-20110830.

July 19, 2019 - Surveyor 3127 - James E. Anderson - indicates this position as "5/8" IR found" on Forest Co. Surveyor File #361331-20190719.

July 20, 2023 - I found a 0.60" iron rod near the southerly extension of the Rosa Road centerline. I also found 4 iron rods as indicated on Record and Certification of U.S. Public Land Survey Control Station X-25, being 5/8" in diameter and having red WisDOT plastic caps affixed to the top of each, as shown below.

A-E 7.08(3)(c)(d) Plan view of corner with references to at least 4 witness monuments.

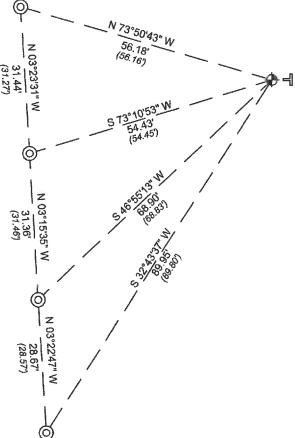

BEARINGS LISTED TO THE NEAREST SECOND ARE REFERENCED TO WISCONSIN COUNTY COORDINATE REFERENCE SYSTEM - FOREST COUNTY ZONE. ALL OTHER BEARINGS ARE MAGNETIC.



This corner

5/8" diameter iron rod with red plastic WisDOT cap, found

Vinyl T-post, set ±1 foot east of corner



A-E 7.08(3)(e) 1858 Surveyor set a post, 1992 Surveyor found an iron pipe, 2007 surveyor found a 3/4" diameter rebar, 2019 Surveyor found a 5/8" iron rod. 2023l found a 0.60" diameter iron rod.

A-E 7.08(3)(f) I accept this monument as a FOUND PERPETUATED LOCATION of the corner. A-E 7.08(3)(g)(h) This corner was not determined through tost-corner-proportionate methods.

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief.

September 19, 2023

DATE



SIGNATURE


ORIGINAL ON FILE IN CO CLERK'S OFFICE COPY HERE FOR REFERENCE


RECORD AND CERTIFICATION OF U.S. PUBLIC LAND SURVEY CONTROL STATION E-D-716-72

State of Wisconsin / Department of Transportation

District	Project 1. D. 9155-02	2-10	Located by	కలం/ క	MRYEY	CREW C	CHIEF	
Corner E 14 Con	36 SECTION	Township N	Range (E,W)		unty OREST	•		
Wisconsin Cor CORNE	ordinates	Eost (X) 2,275,9	37.40	North (Y) 630,5	551.27	Elevation	(Z)	Zone CENT.
Control Station	n Name	East (X)		North (Y)		Elevation	(Z)	Zone
Horizontal —	NORTH A	MERICAN, 1927	CONTROL	DATUM Vertical —	MEAN SEA	LEVEL, 1929	ADJUSTMEN'	T
Horizontal —	·	Order	SURVEY	CONTROL Vertical —		Order		

SKETCH

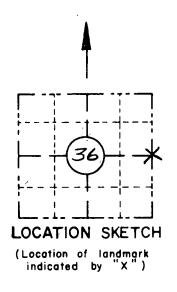

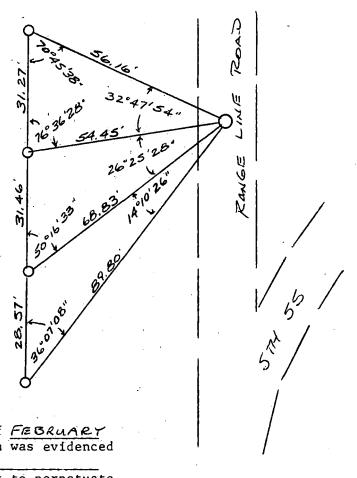

I hereby certify that on the 27 74 day of FEBRUARY
1972, that I did locate the above corner which was evidenced
by IRON PIPE (COCHRANE)
: I further certify that to perpetuate
the location of such corner I did, at the exact location
thereof, place a permanent marker consisting of
; I further certify that I did
establish 4 references or witness monuments consisting
OF 5/8"x 24" REINFORCING BAR WITH RED
PLASTIC WDOT CAP
located as shown above:
Tocated as shown above.

Signature Registered Land Surveyor

SEAL

Registration No.

= Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

WILLIAM B

COCHRANE

S-1107

HILES.

WISCONSIN

History of original corner establishment:

Hemlock, 10", N 42° W, 22 links Elm, 12", S 82° E, 17 links

Description of corner evidence found:

North-South gravel road. Fence line west. Iron pipe buried below the road surface. No original evidence could be recovered.

This position was tied into the subdivision of section 31 and found to agree with other measurements.

Description of monument and accessories I established to perpetuate the original location of this corner.

I set a reference monument N 89° W, 29.70 feet from the corner. The reference monument is a 2½ inch diameter aluminum pipe, 30 inches long, with a Forest County aluminum cap stamped: T36N, R12E, R13E, 14, S31, S36, 1980, S-1107, REFERENCE MONUMENT

A power pole #3613-31L6, bears N 46° E, 41.97 feet from the corner.

Dated at Hiles	, Wis., this.	8 th	day of	December	, 19.80
Signature William B. Cochr	aul Title	Land Su	rveyor	Re	
(County Surveyor Regist	ored Land Surve	evor or other di	ily authorized offic	·ial)	
Office of Register of Deeds, County of	For	est		, I hereb	y certify that the within
instrument was filed in this office for re	ecord on the	19th	day of	Decembe	r 19 80
Office of Register of Deeds, County of instrument was filed in this office for reat 11:30 o'clock A. M. (Register of Dee				ÆNT NO.	119138