


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Section corner to Sections 11, 12, 13, and 14,
T.36N., R.15E.

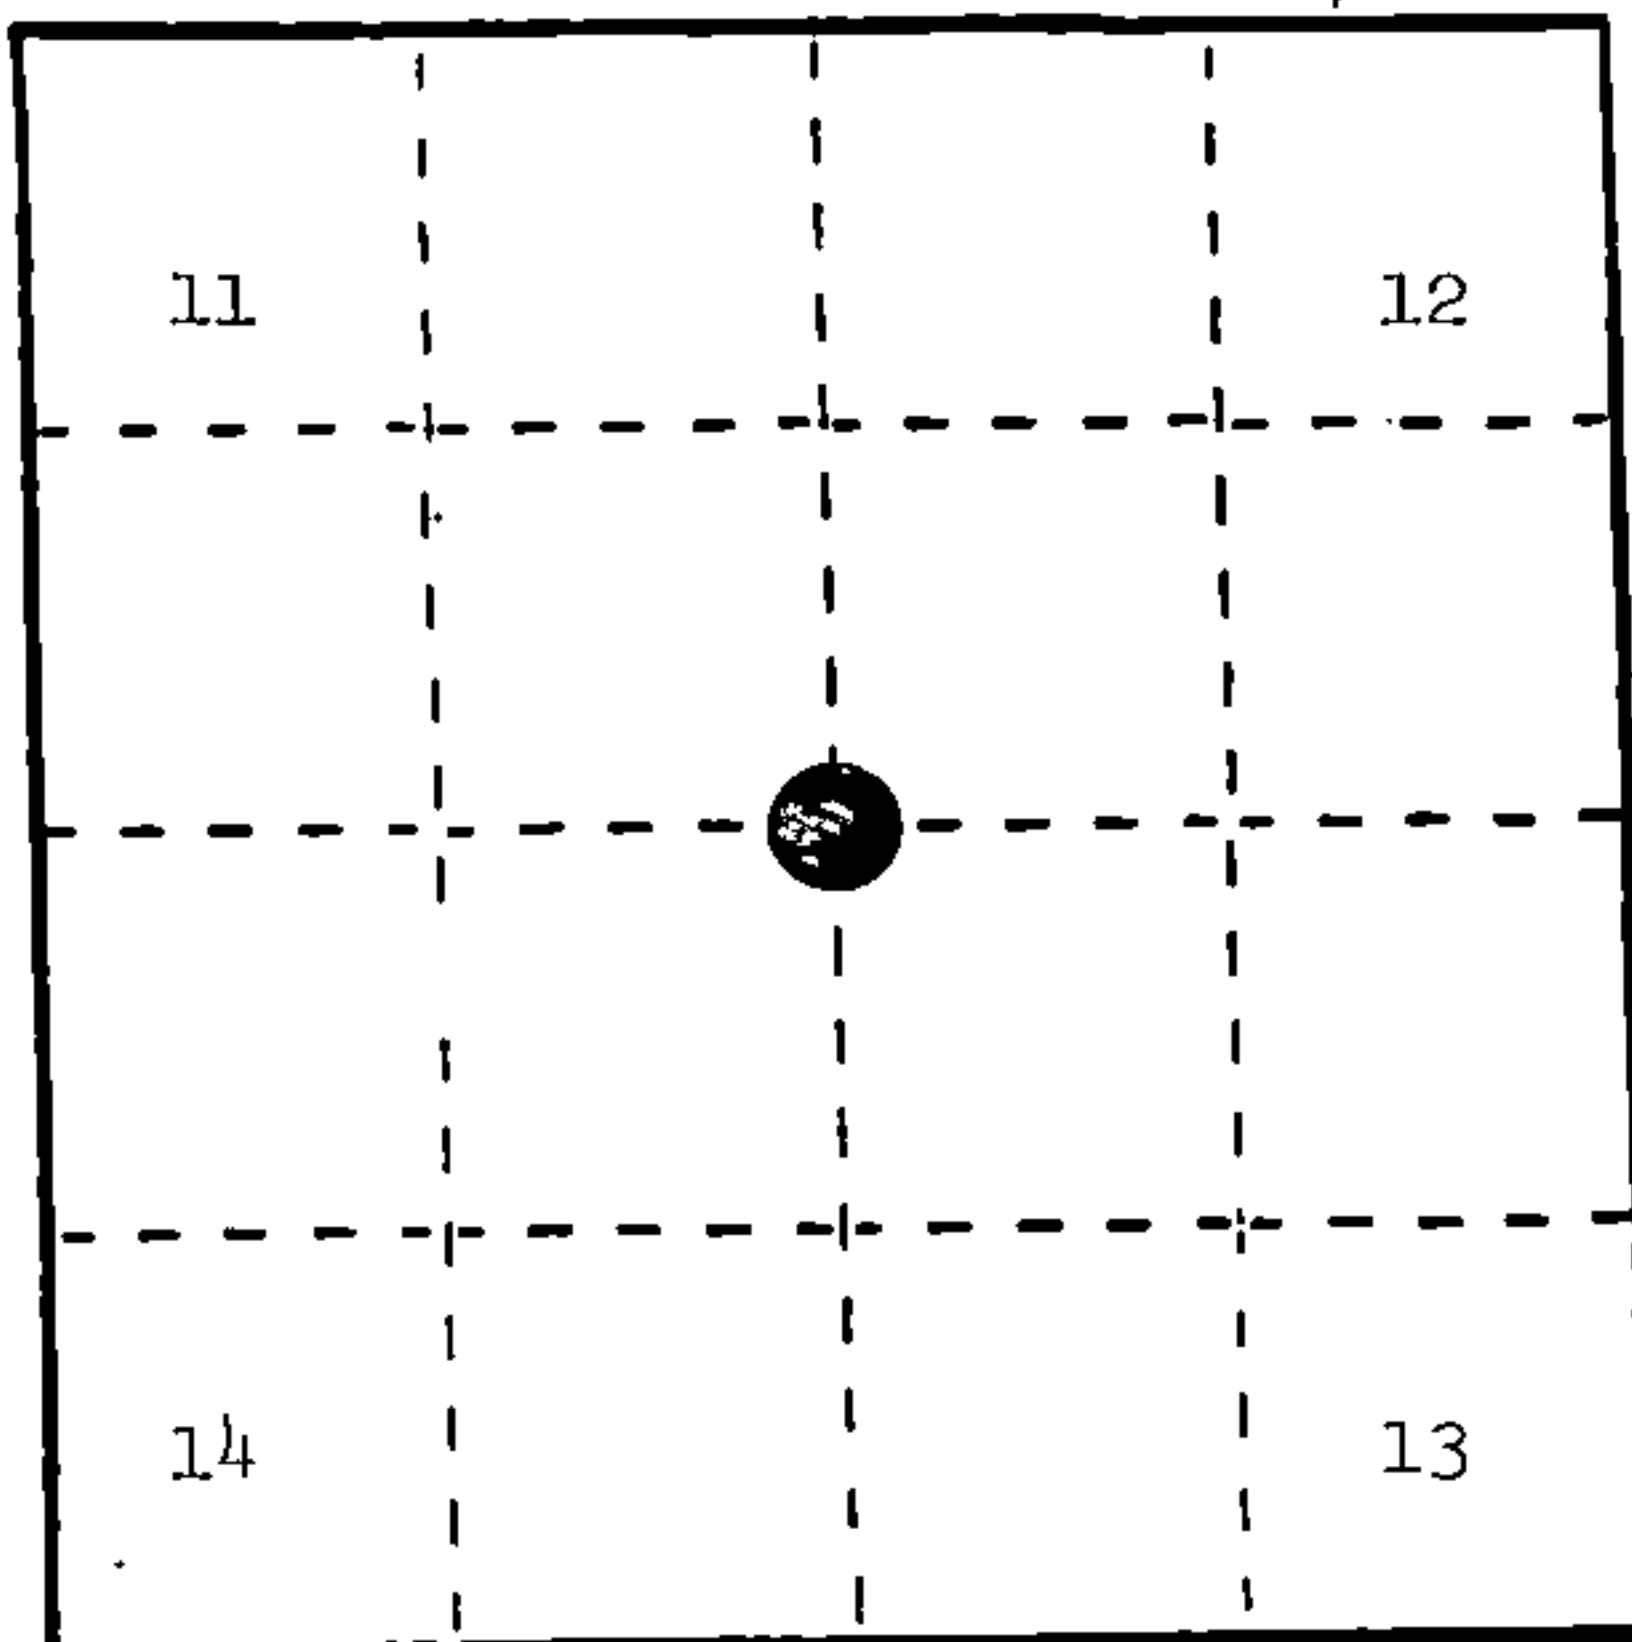

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 17th day
of March A.D., 1986 at
10:40 o'clock A.M. and recorded
In Vol. CORNER RESTORATIONS
page 21
Paul Aschenbrenner
Register of Deeds


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set post with the following BTs: Aspen, 10", N.55°W., 50 links; Aspen, 12", S.74°E., 27 links; Aspen, 10", N.28°E., 25 links; Aspen, 8", S.57°W., 24 links. October, 1915, J. J. Melindy found original Aspens, northwest and southeast--down and decayed. Old blazed line runs east. At 4 chains east is a Tamarack swamp. Set 5" x 5" Cedar post and made the following new BTs: Pine, 14", N2½°E., 61 5/8 links; Spruce, 11", S3¼°E., 36½ links; Pine, 14", N.89½°E., 43 1/8 links; Spruce, 12", N.56½°W., 14 5/8 links. In 1967, Kleppek found iron pipe by Connor Company. Old CCC tag on Cedar stake on north side of road. Blazed line south. No original evidence found. June 27, 1985, H. Neider found iron pipe taken out by road grading. Found stumps of Melindy's Pine BTs fit blazed lines which run east and south.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Balsam, 6", N.60°E., 32.44 feet
2. Sugar, 6", S.18°E., 51.11 feet
3. Sugar, 11", S.31°W., 57.44 feet
4. Sugar, 11", N.33°W., 30.43 feet
5. Steel Sign Post, Northeast, 0.69 feet
6. 2"x36" aluminum monument stamped to identify the corner

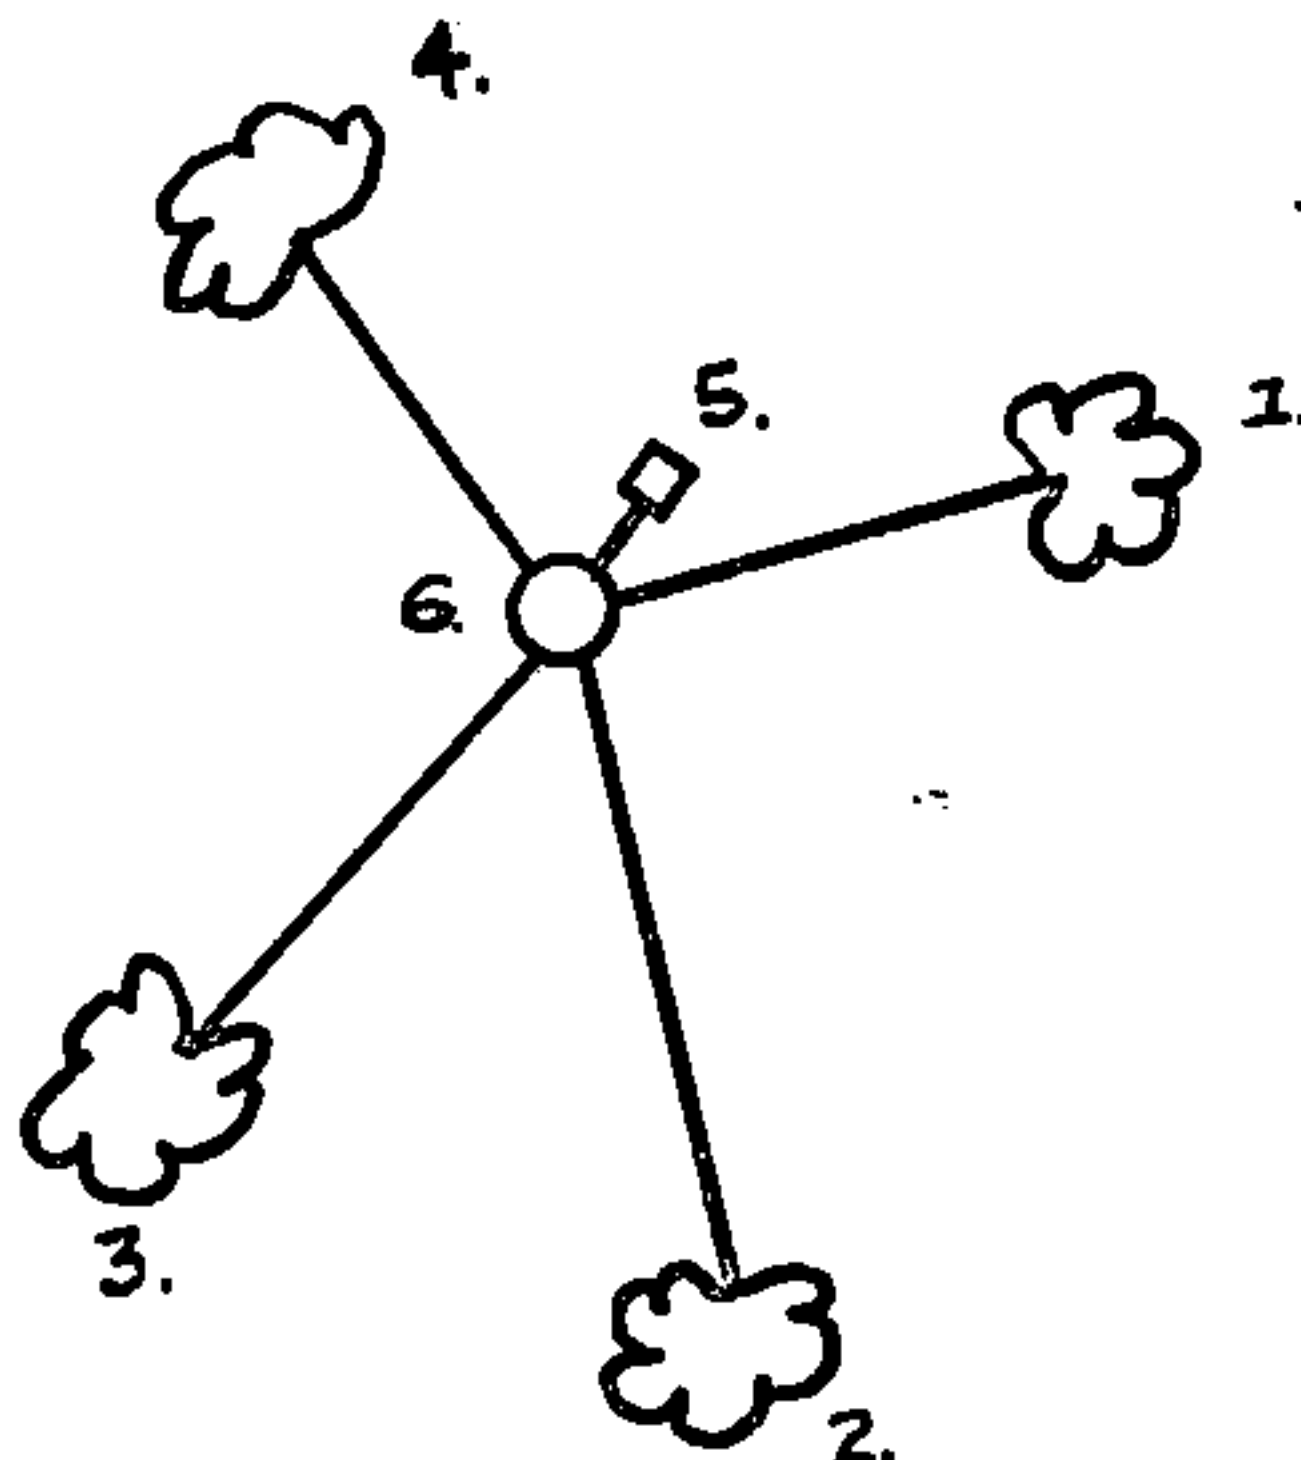

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.



Alan D. Harrison
Signature

1/3/86
Date