

147755


## U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.  
 ○ = Corner monument restored.

Quarter Corner, Common to Sections 7 and 18,  
 T.36N., R.16E., Forest County, Wisconsin.

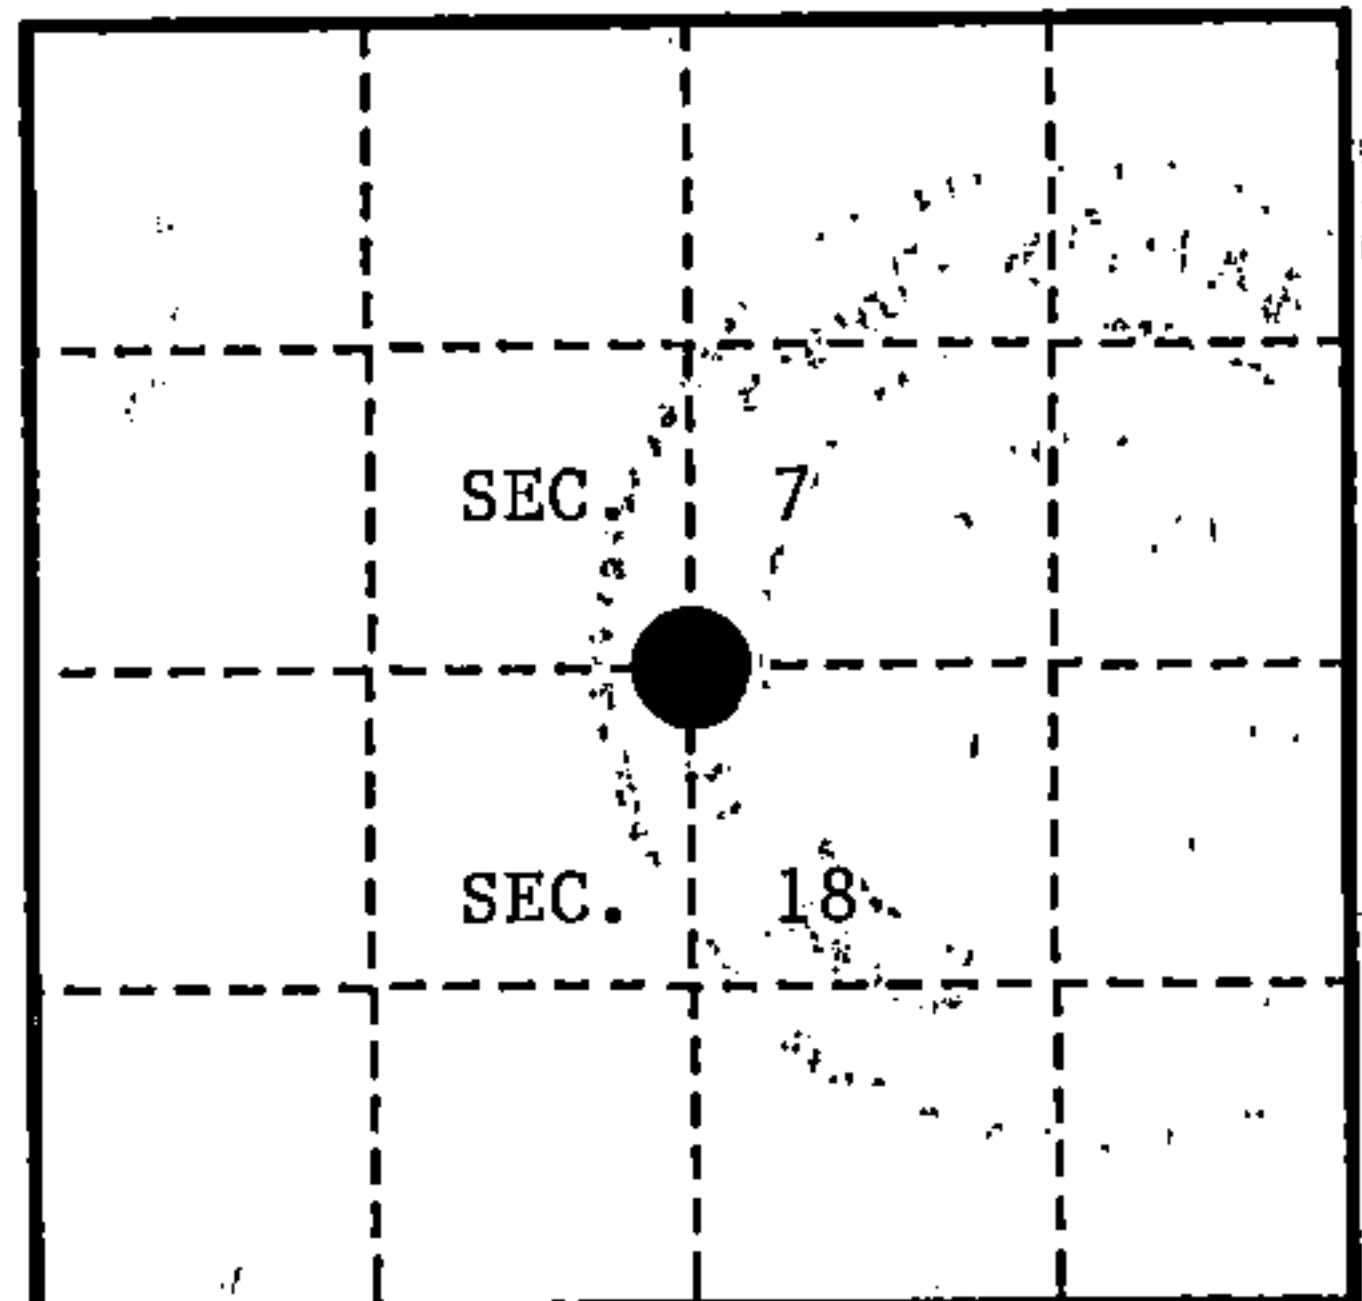

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set  $\frac{1}{4}$  post at 49.50 chains from West and made the following references: Aspen, 14", S.38°W., 18 links (11.88'); Aspen, 12", N.58°W., 18 links, (11.88').


In 1928, Goodman Company makes no notes of what found at this corner. At E.  $\frac{1}{8}$  found 4" Hemlock post set by Blackwell (Company). Set flue pipe 2" x 32".

In 1993, Alan Harrison searched area for corner. Found location tag on 4" sugar tree. Tag rusted and unreadable. Found no evidence of original or subsequent corner. Restored corner at double distance through E.  $\frac{1}{8}$  pipe as best location of corner. Fits proportion by 3.9 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" Aluminum Monument stamped to identify corner location.
2. Sugar, 10", S.58°E., 13.00 feet
3. Sugar, 9", S.38°W., 27.15 feet
4. Sugar, 9", N.30°W., 24.86 feet
5. Steel Sign Post, South, 0.90 feet

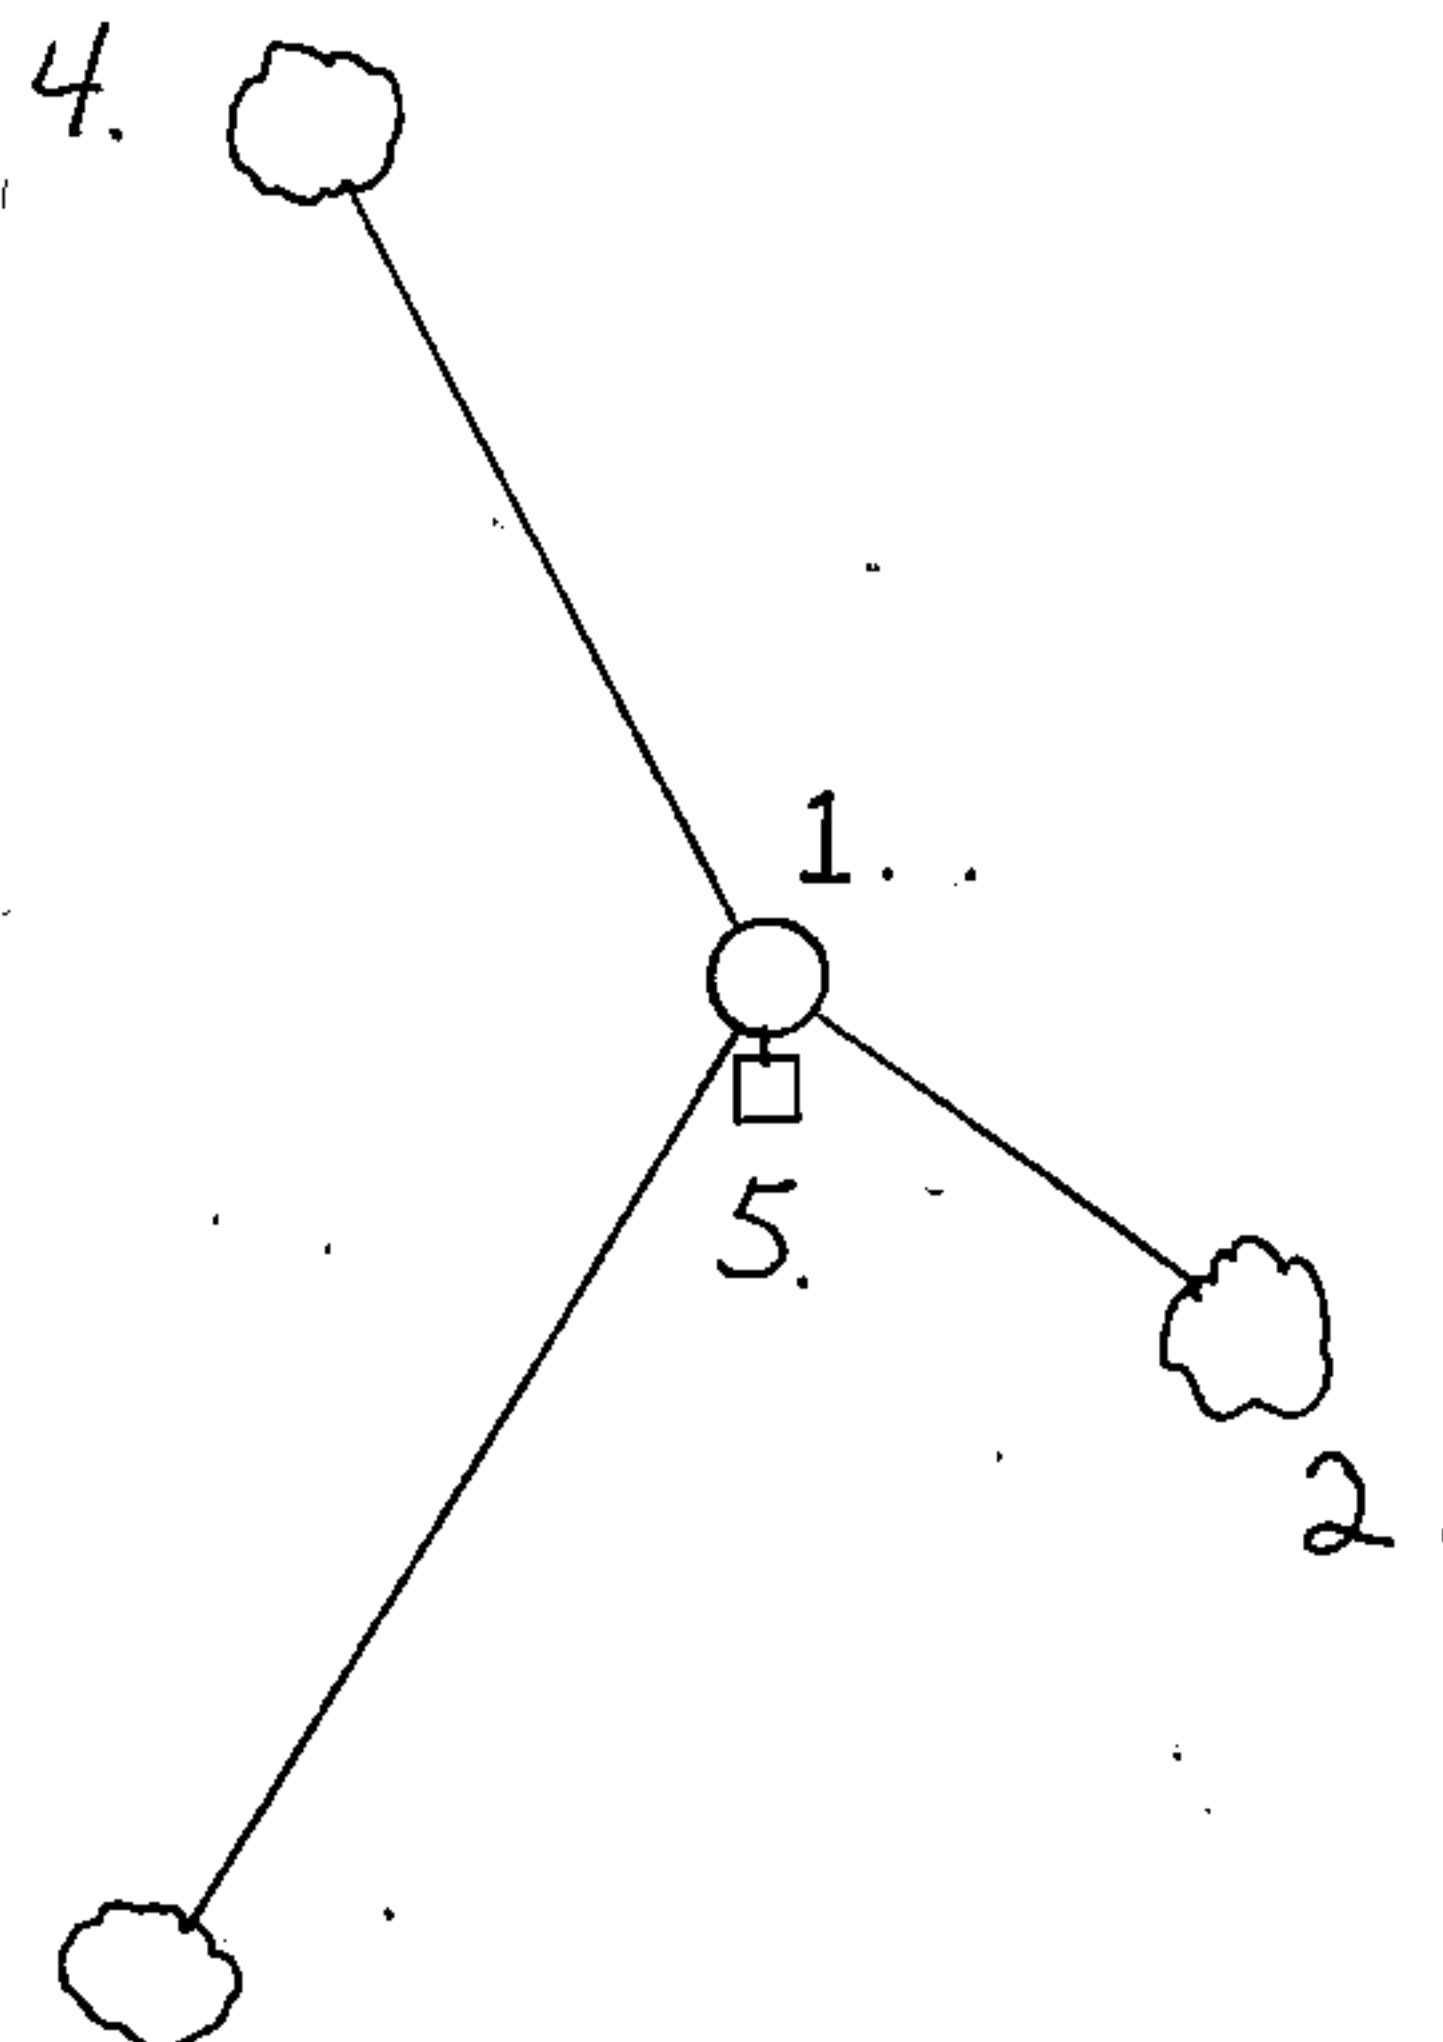

REGISTER'S OFFICE  
 Forest County, Wis.

Received for record this 30th day  
 of JUNE A.D., 19 93 at  
2:00 o'clock P.M. and recorded  
 in Vol. CORNER RESTORATIONS  
 page 3

Paul A. Schumacher  
 Register of Deeds

43616070020

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

An obliterated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison

Signature

6/16/93

Date

CERTIFICATE READY FOR FILING:

Sue Vap  
District Ranger

