


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Section Corner to Sections 22-23-26-27, T.36N., R.16E., Forest County, Wisconsin.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 10th day
of August A.D., 1987 at
8:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page R-17
Paul Scheafer
Register of Deeds

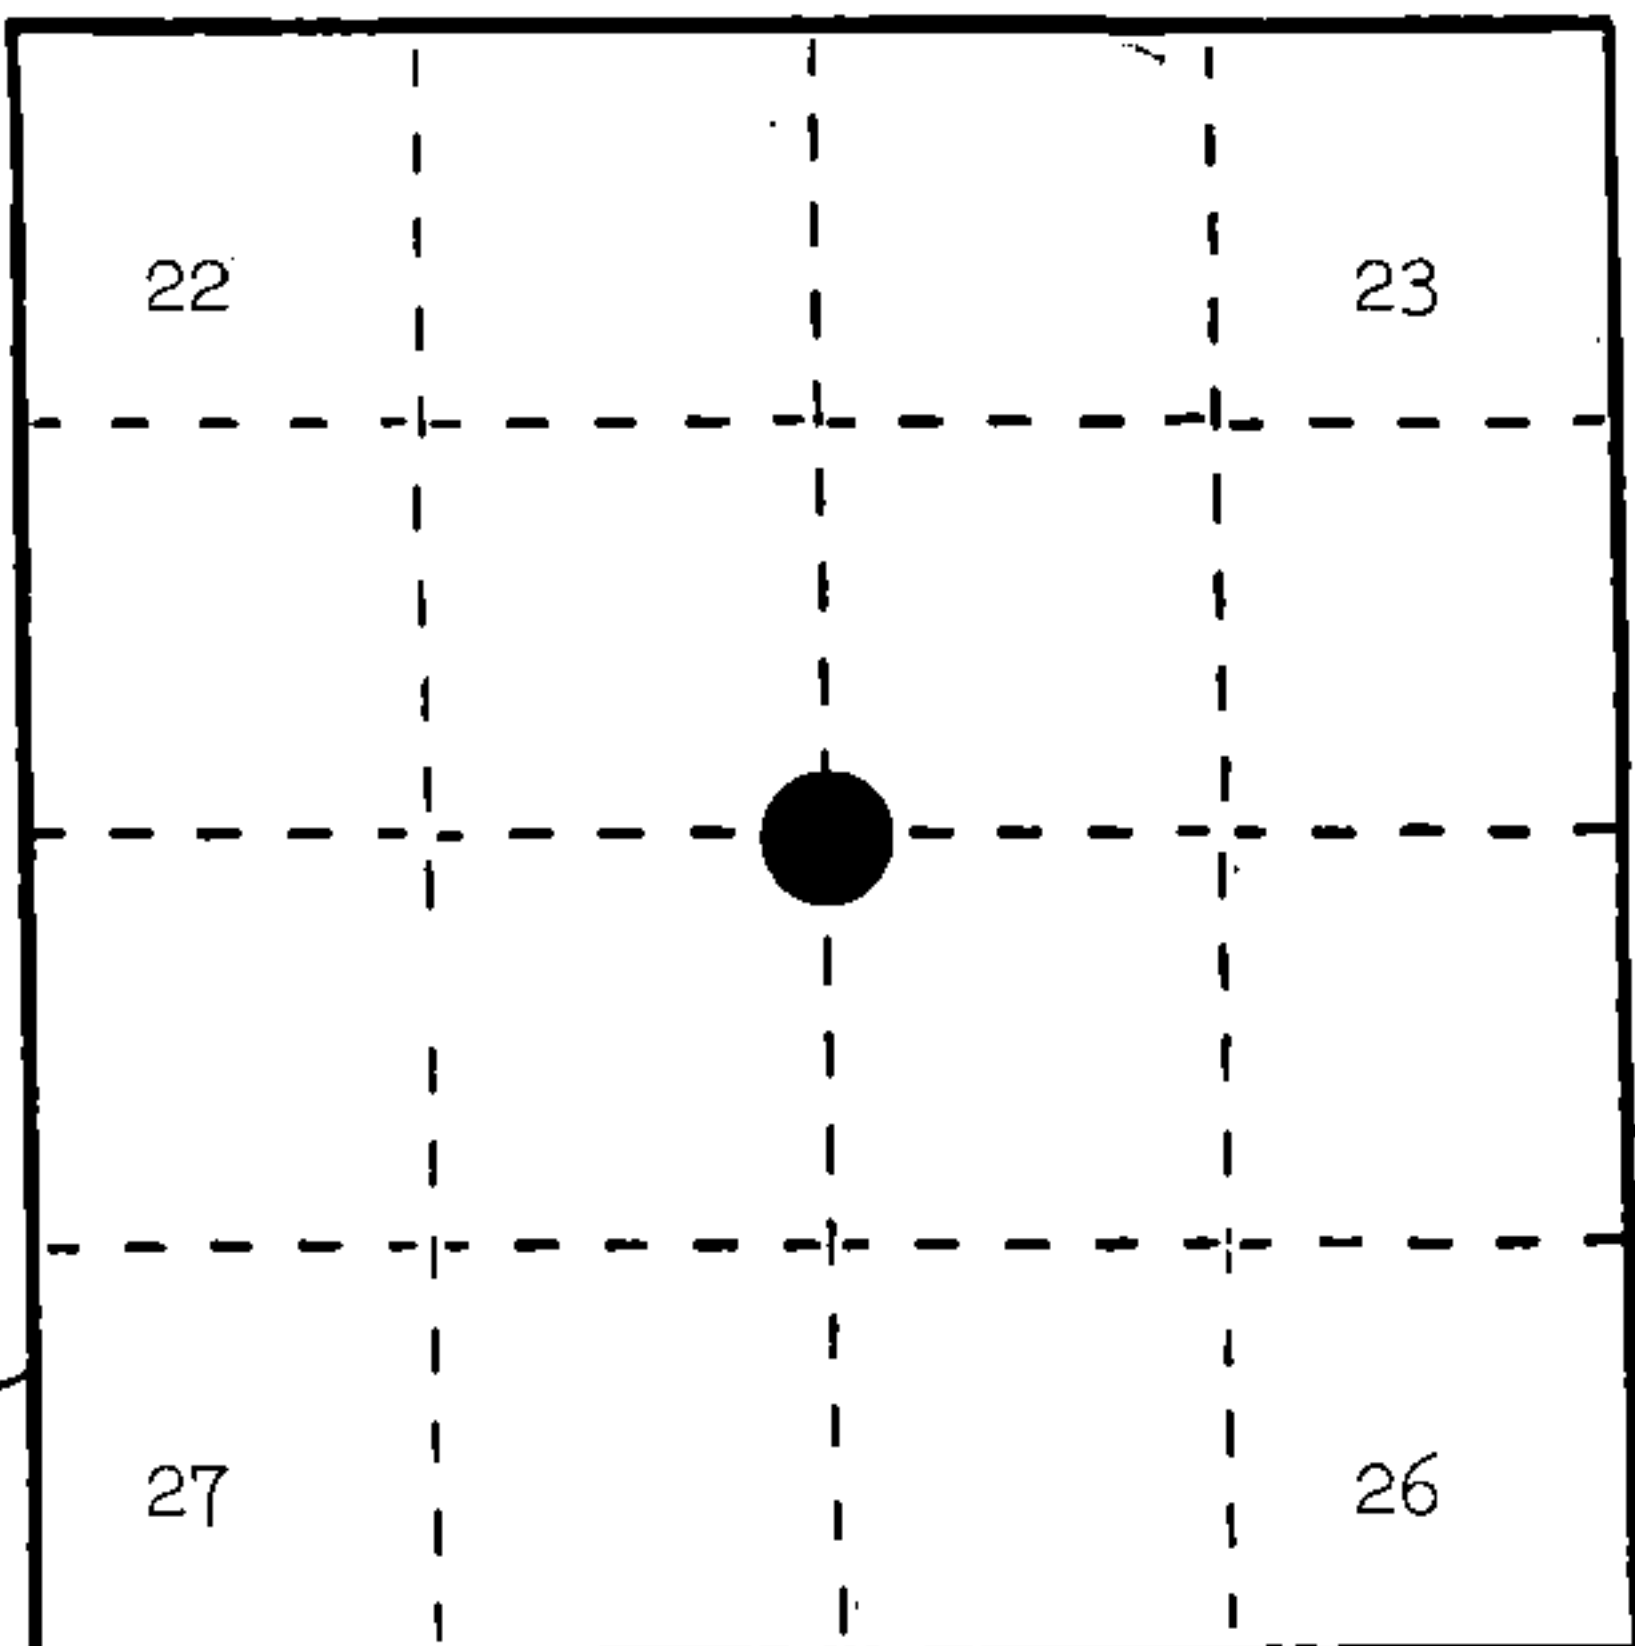

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Hemlock, 12", N.30°W., 27 links; Tamarack, 8", N.40°E., 32 links; Birch, 10", N.32°E., 46 links; Hemlock, 8", S.13°W., 38 links.

In 1923, Goodman Company set 5" Hemlock post and flue pipe 5' high. Original Birch BT alive, but all others dead.


In 1934, John Laird "874" found iron pipe and put location tag on Maple stump, 26", S.30°E., 99 feet.

In 1987, Alan Harrison found 5' flue pipe and location tag. Pulled to corner position and found post hole. From post hole, pulled S.32°E., 30.36 feet, found 15" Birch stump, pulled N.30°W., 17.8 feet, found root holes of tree, pulled N.40°E., 21.1 feet, found Tamarack stump. Appears someone pulled pipe and set it by location poster years ago.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2½" x 36" aluminum monument stamped to identify the corner.
2. Aspen, 6", N.83°E., 9.51 feet.
3. Spruce, 3", S.48°E., 29.18 feet.
4. Aspen, 8", S.05°E., 4.04 feet.
5. Aspen, 7", S.68°W., 7.95 feet.
6. Steel Sign Post, 6', Northwest, 1.15 feet.

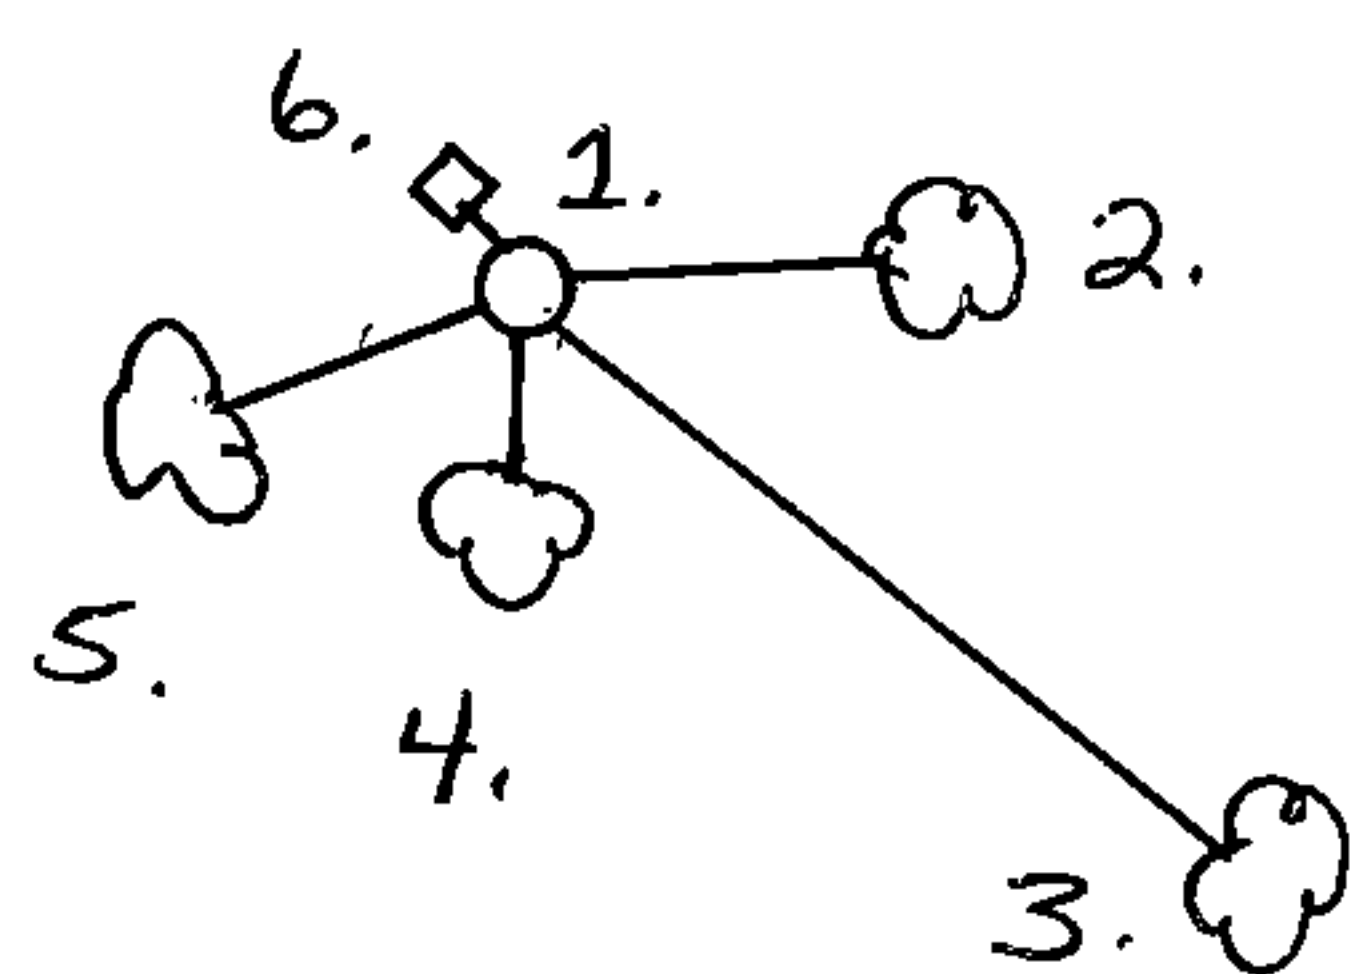

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished, by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

[Faint, illegible handwritten notes]

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

8/5/87
Date

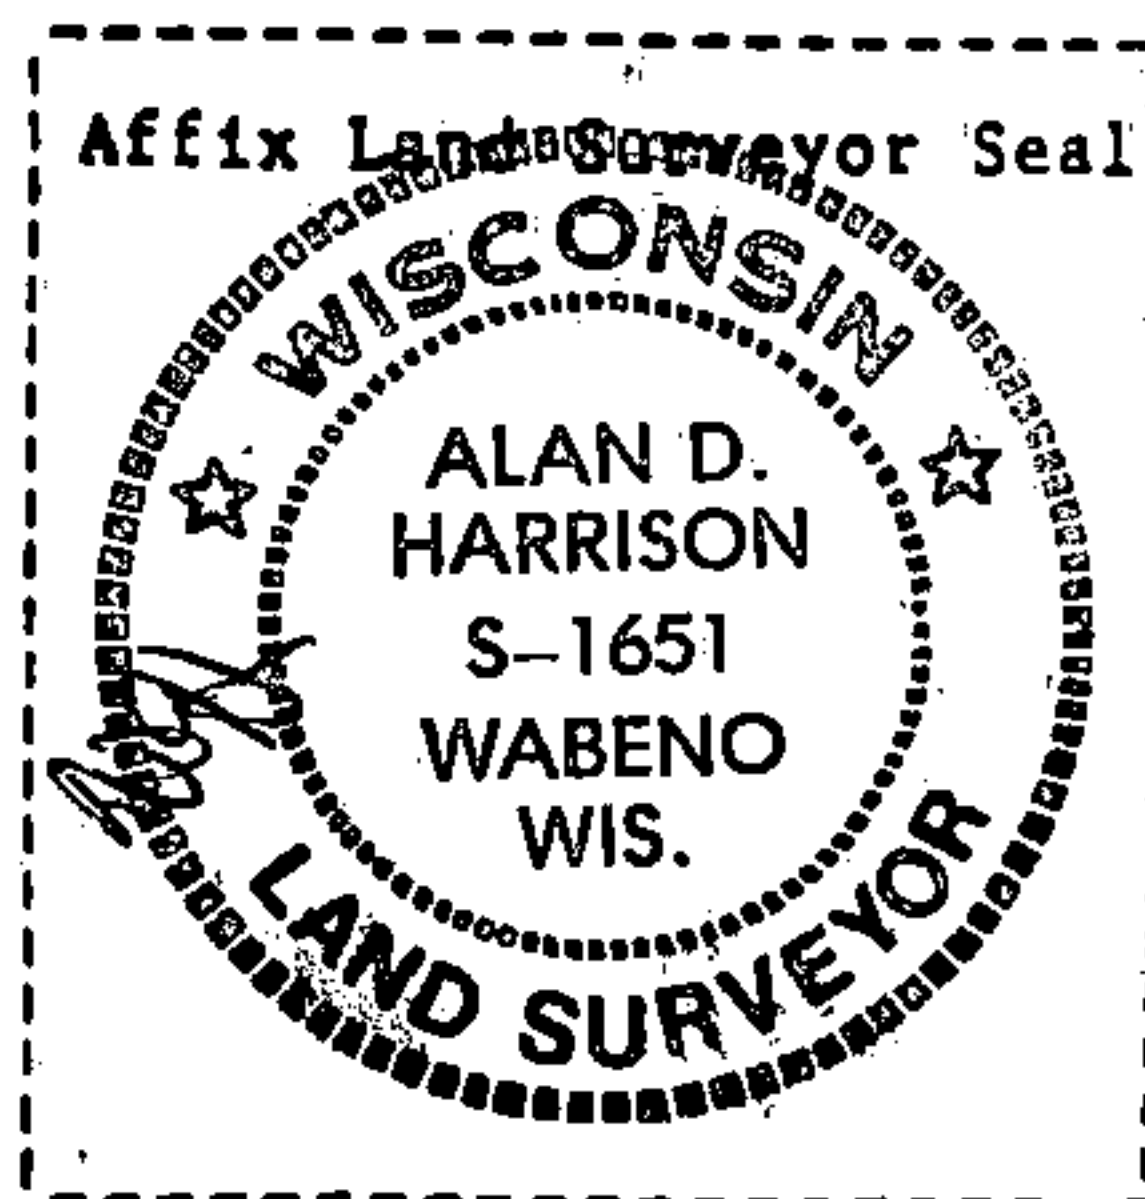

137112

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 22, 23, 26 & 27
T. 36N. R. 16E.
Forest Co. Wisconsin

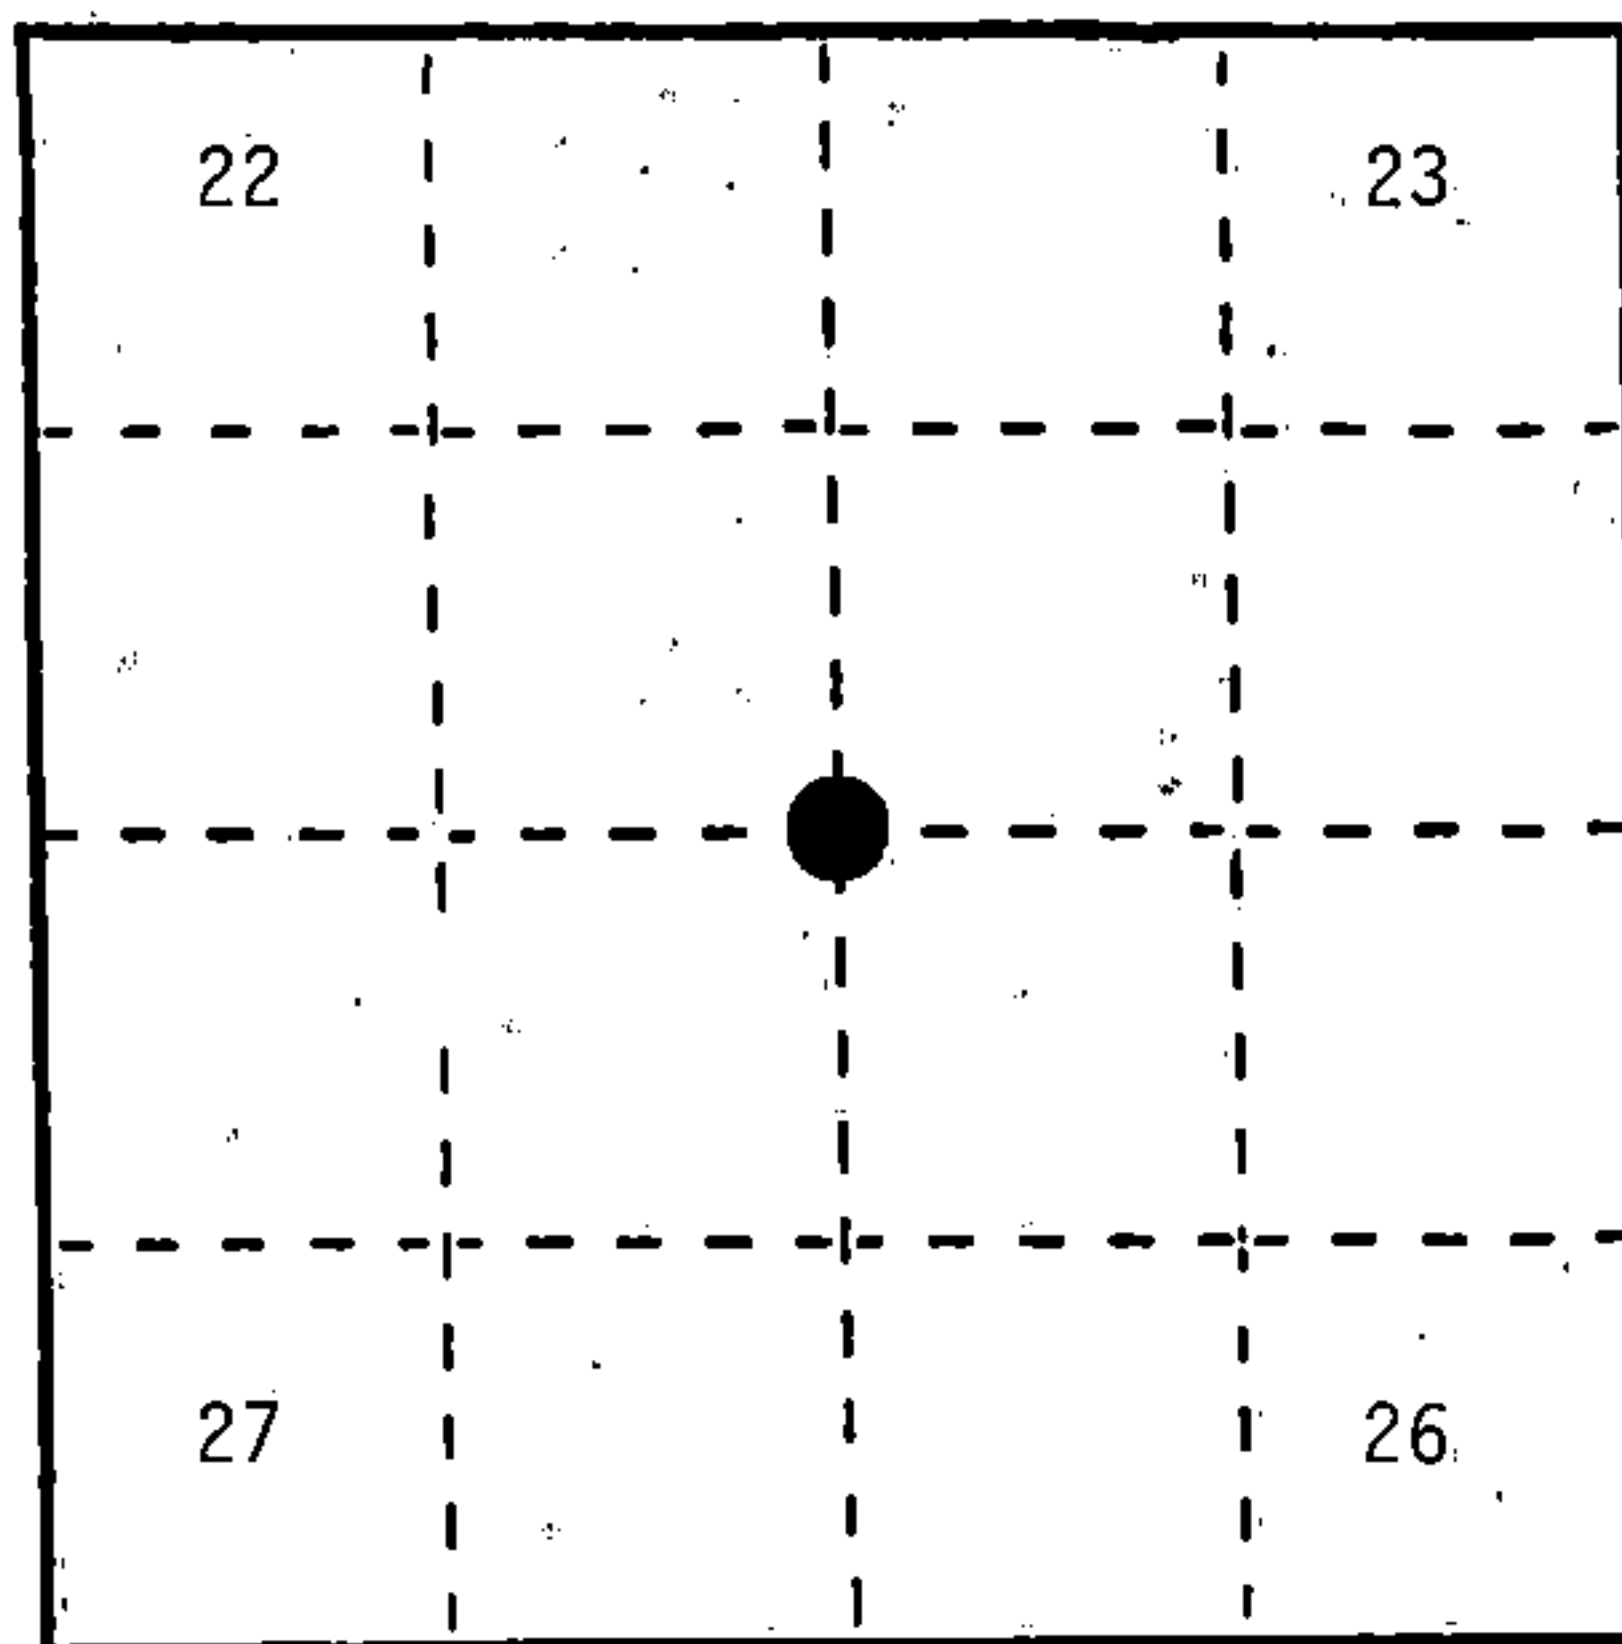

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 29th day
of March A.D. 1989 at

9:00 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

page R-17

Paul Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following BTs: Hemlock, 12", N.30W., 17.82 feet; Tamarack, 8", N.40E., 21.12 feet; Birch, 10", S.32E., 30.36 feet; Hemlock, 8", S.13W., 25.00 feet.

In 1923, Goodman Company Set 5" Hemlock post, original Birch is alive, other BTs dead. Set 5 foot flue pipe.

In 1934, John Laird found iron pipe. Put location poster on a Maple stump 26" from which the corner bears S.30E., 1.5 chains.

In 1987, Al Harrison found "874" tag and flue pipe laying by a large Maple stump remains.


Pulled S30E 99' to corner location, found a post hole. From post hole S. 32E., 30.4 feet, Found a Birch stump 15+ ". At N. 40E., 21.1 feet a Tamarack stump. Accept as corner location

In 1988, Don Huettl found Northeast BT tipped out, added new BT. Aspen, 5", N.12W., 17.53 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2 1/2 x 36" aluminum monument stamped to identify the corner.
2. Spruce, 3", S.48E., 29.18 feet.
3. Aspen, 8", S.05E., 4.04 feet.
4. Aspen, 7", S.68W., 7.95 feet.
5. Aspen, 5", N.12W., 17.53 feet.
6. Steel Sign Post, Northwest, 1.15 feet.

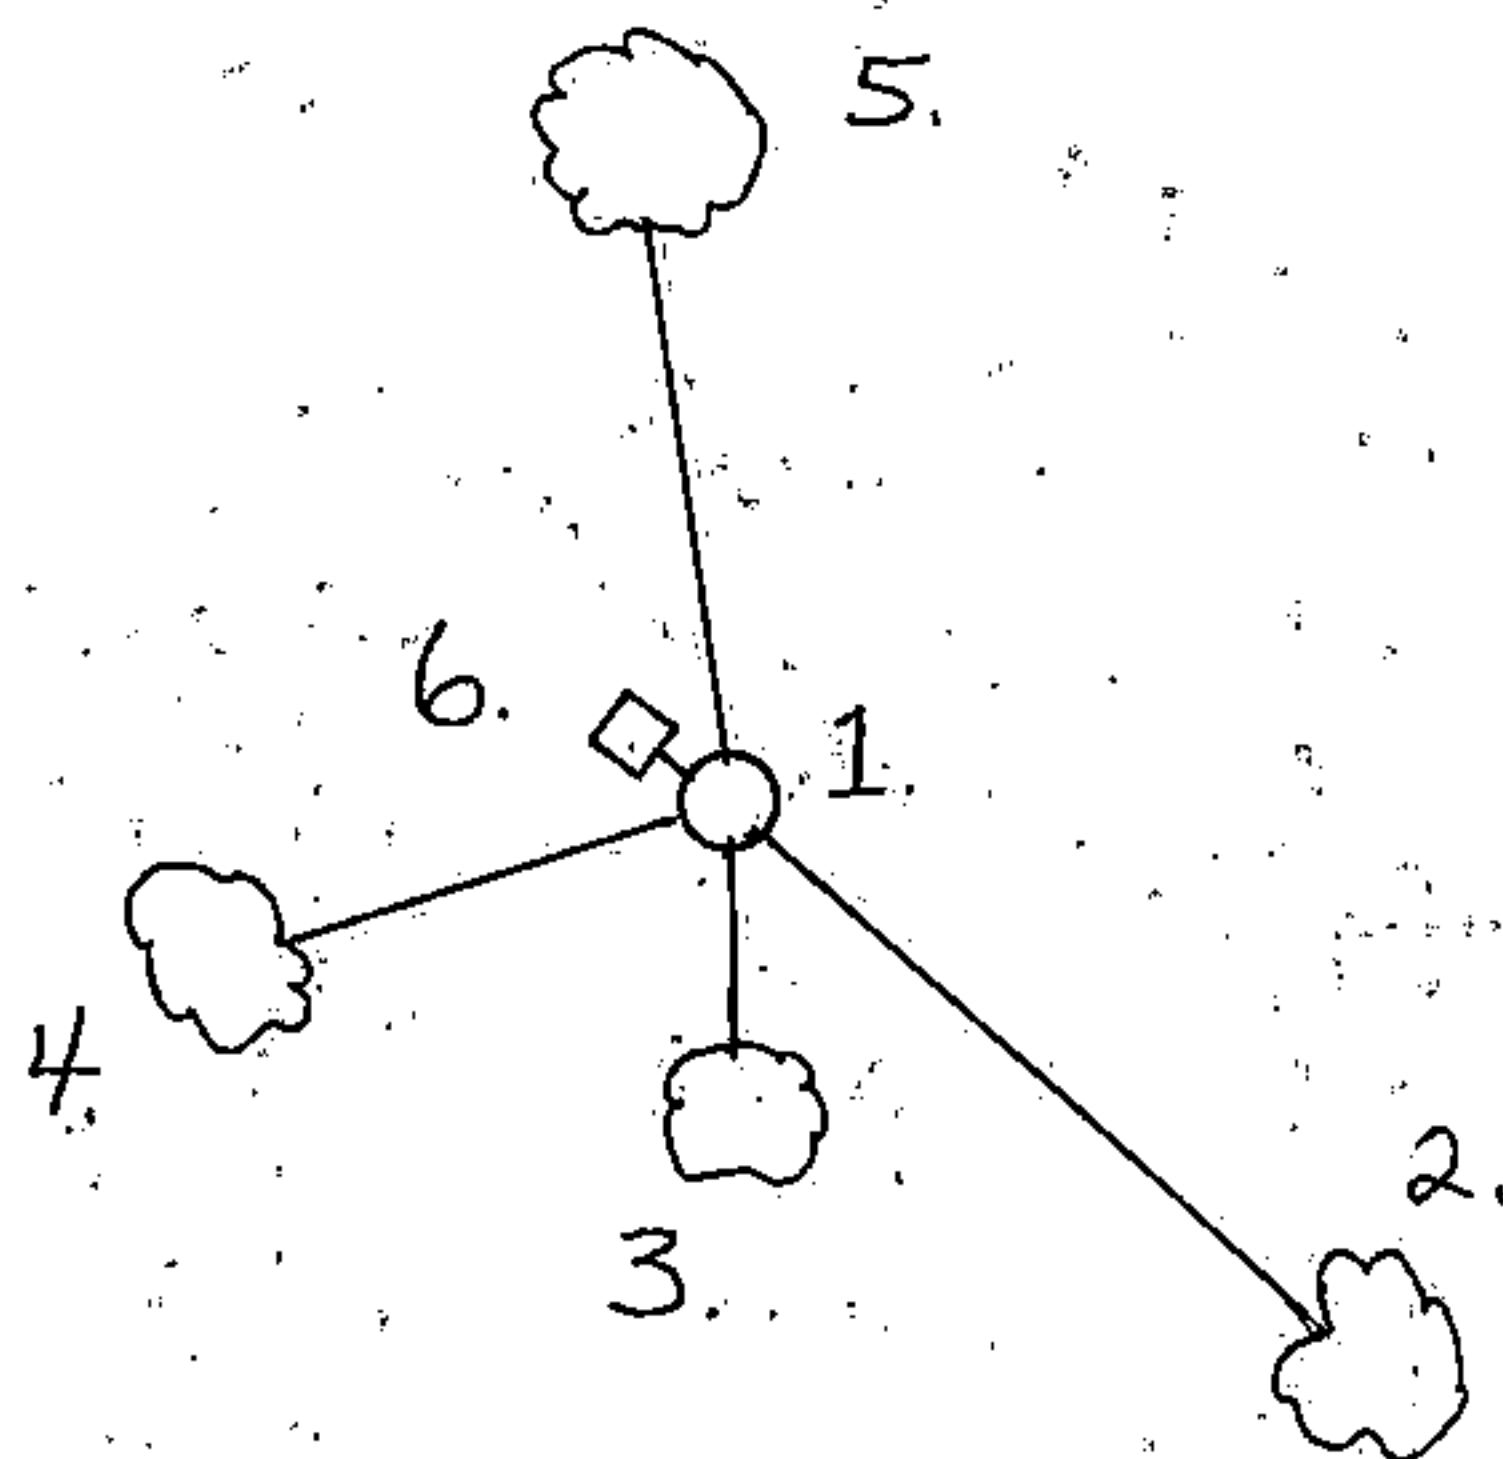

43616220000

R17

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) A found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

3/9/89

Certificate ready for filing:

Dale H. Stacey
District Ranger

Affix Land Surveyor Seal

