

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Index No. E-19


State of Wisconsin }
County of FOREST } ss.

I, John Schulke, do hereby certify that on the 15th day of August, 1989, I found evidence of the North Quarter corner of Section 11 Township 37 North, Range 12 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

Al Tauer

Roman Tauer

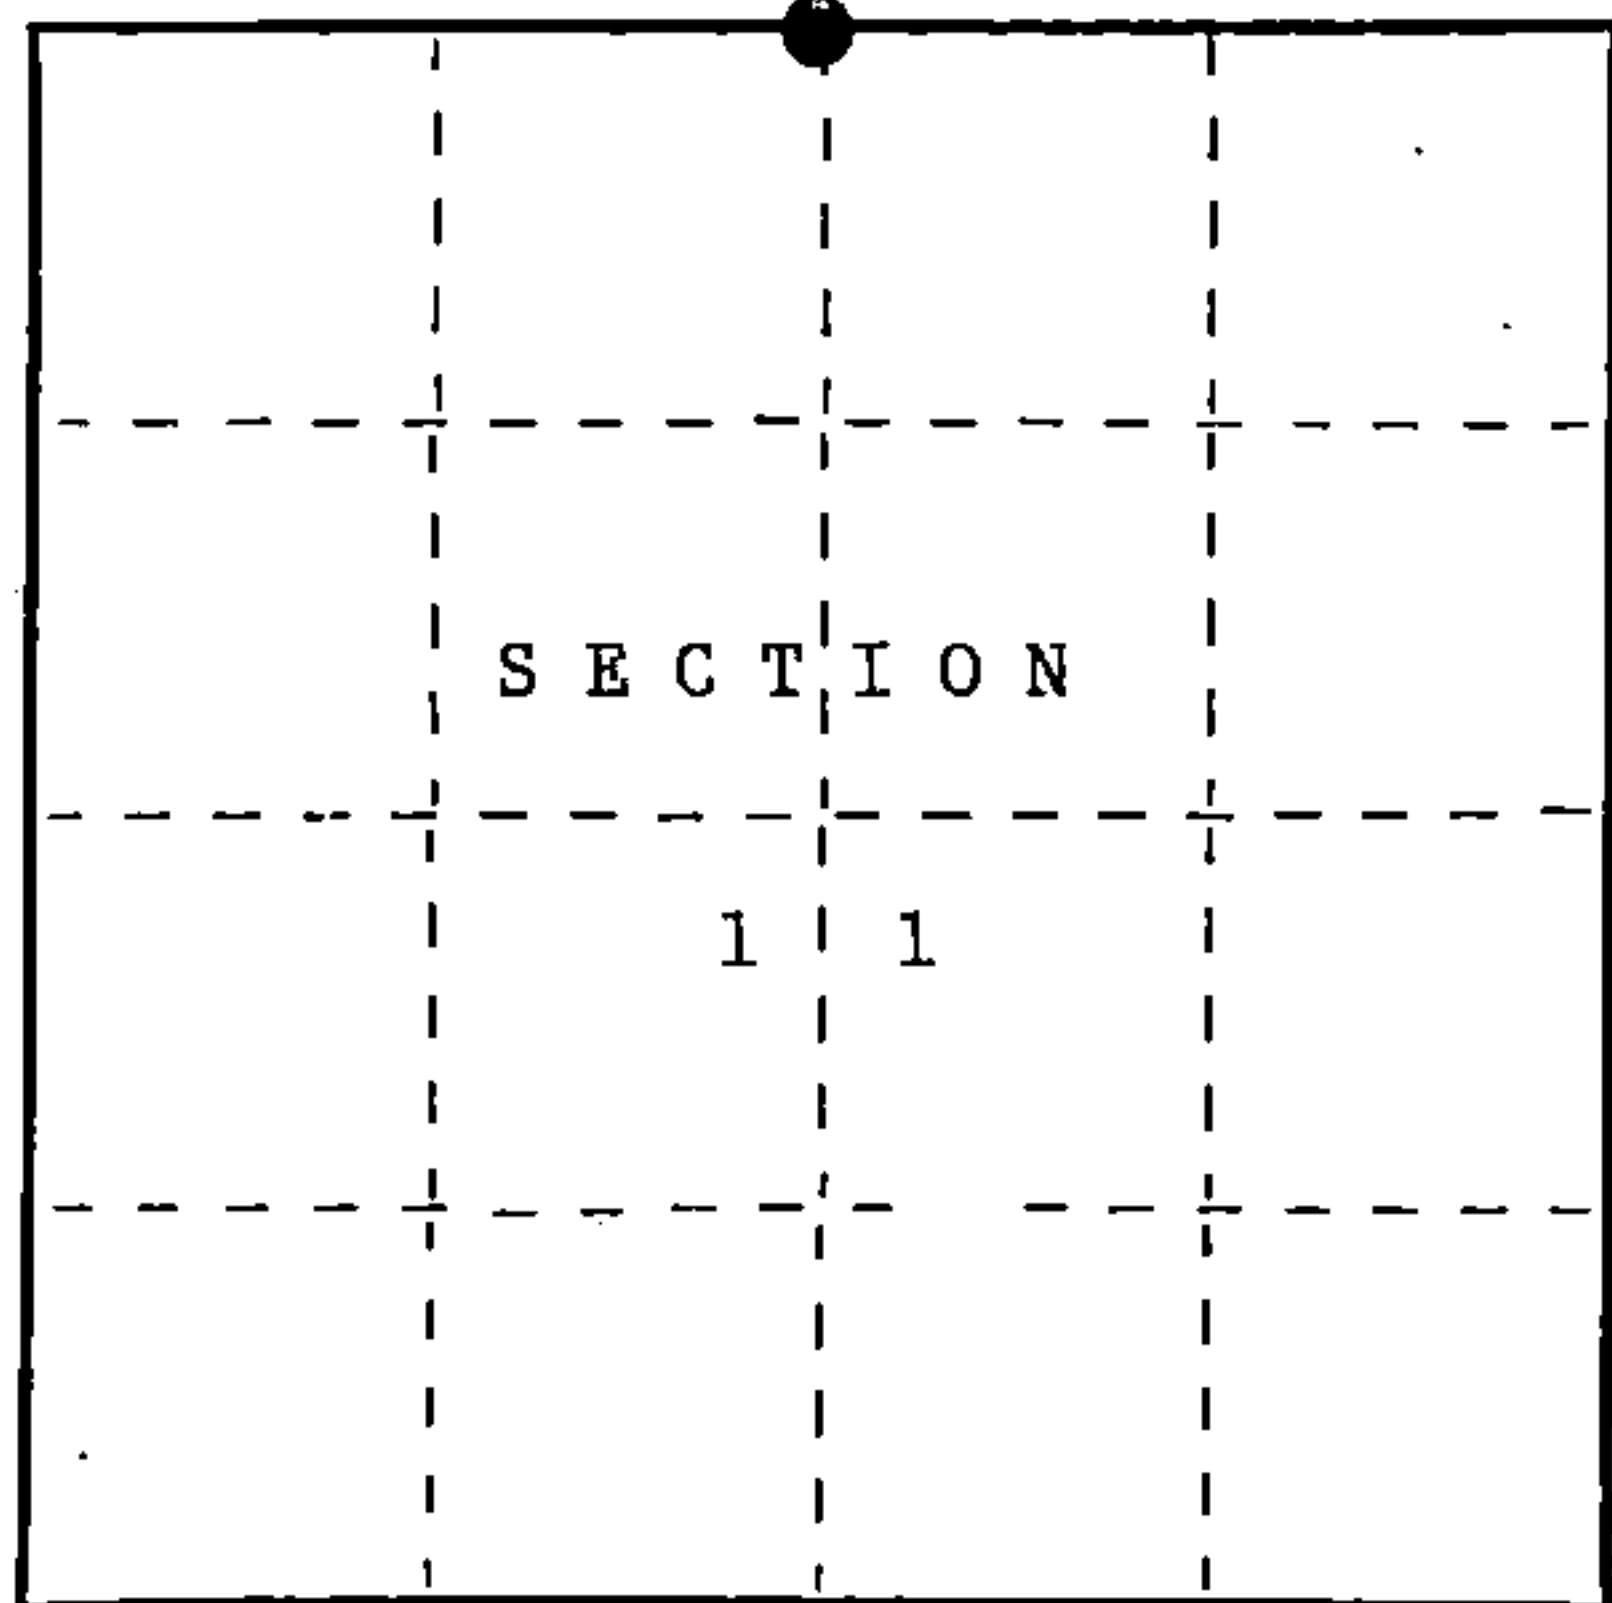

● = Corner monument restored.

History of original corner establishment:

In 1859, Original Government Surveyed by Wm. E. Daugherty. Set a wood post with the following corner references: Birch 6" S32°E 29 lks. Hemlock 25" N32°W 25 lks.

Description of corner evidence found:

In 1989, John Schulke found no evidence of the original corner. Resident witnesses stated original corner stood in North-South fence line about 2 feet South of the fence corner. I accept this as the best available evidence of the corner position.

Description of monument and accessories I established to perpetuate the original location of this corner.

Set a 2 1/2" dia. X 36" aluminum magnetic cap monument stamped to identify the corner. Fence line running North and South. Fence corner bears North a distance of 2.2 ft. from the monument. Set a steel sign post 1.0 ft South of the monument. The following corner references:

Sugar Maple	5"	N87°E	7.07 ft.
Sugar Maple	5"	S09°E	32.22 ft.
Birch	10"	N36°W	22.96 ft.
Balsam	7"	S39°W	35.90 ft.

Dated at Wabeno, Wis., this 25th day of October, 1989.

Signature John C. Schulke Title Register Land Surveyor Registration No. S-1665
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within instrument was filed in this office for record on the 8th day of March, 1990 at 1:00 o'clock P. M.

Paul Achenbrenner
(Register of Deeds)

By Deputy

FORM NO. 985-A

H.C. Miller Company

Stock No. 26273

DOCUMENT NUMBER

139254

43712020020

e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or, used for proportioning in determining the corner location?

No.


QUARTER CORNER

S2
S11

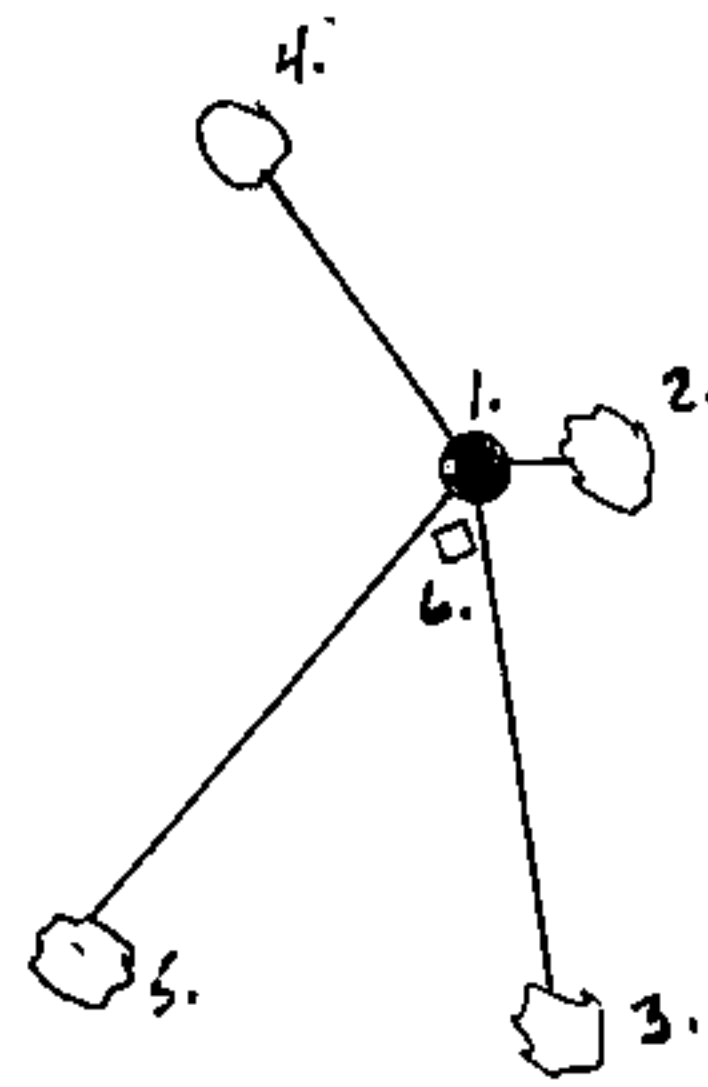

1. 2 1/2" X 36" aluminum monument.
2. Sugar Maple 5" N87°E 7.07 ft.
3. Sugar Maple 5" S09°E 32.22 ft.
4. Birch 10" N36°W 22.96 ft.
5. Balsam 7" S39°W 35.90 ft.
6. Steel-sign post -- South -- 1.0 -- ft.

Affix Land Surveyor Seal

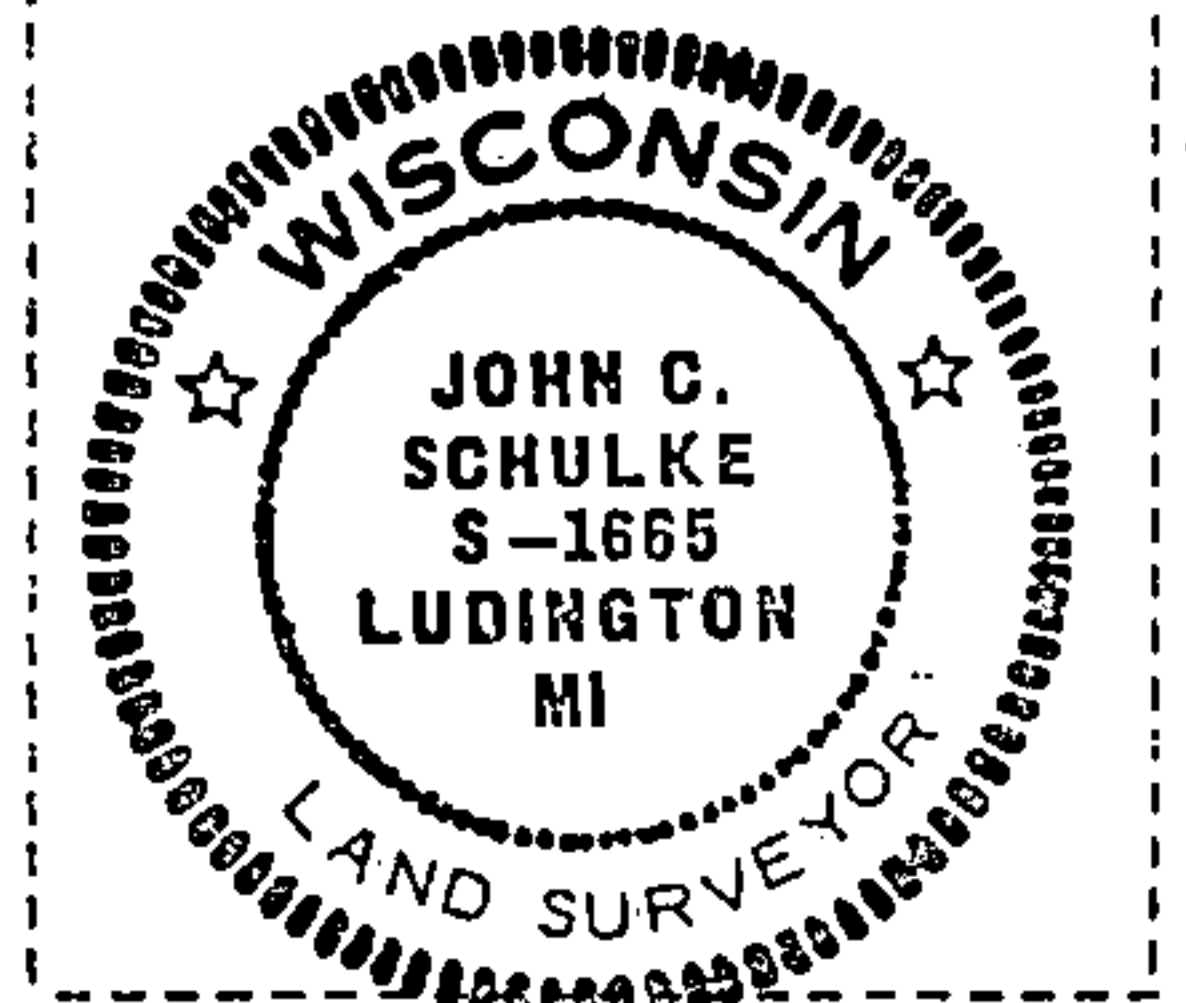

(i) 1. John Schulke (RLS-1665)

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Survey requested by:

Dale B. Stange
District Ranger

1989
Date