

# U.S. PUBLIC LAND SURVEY MONUMENT RECORD


Index No. V-13

State of Wisconsin }  
County of Forest } ss.

I, John C. Schulke, do hereby  
certify that on the Twenty First day  
of July, 1986, I found  
evidence of the Southwest  
corner of Section 27  
Township Thirty Seven, North, Range  
Twelve East, Fourth Principal Meridian,  
as described hereon; and that from this evidence  
I established a new monument and accessories  
as described hereon to perpetuate the original  
location of this corner.

Resident witnesses:

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

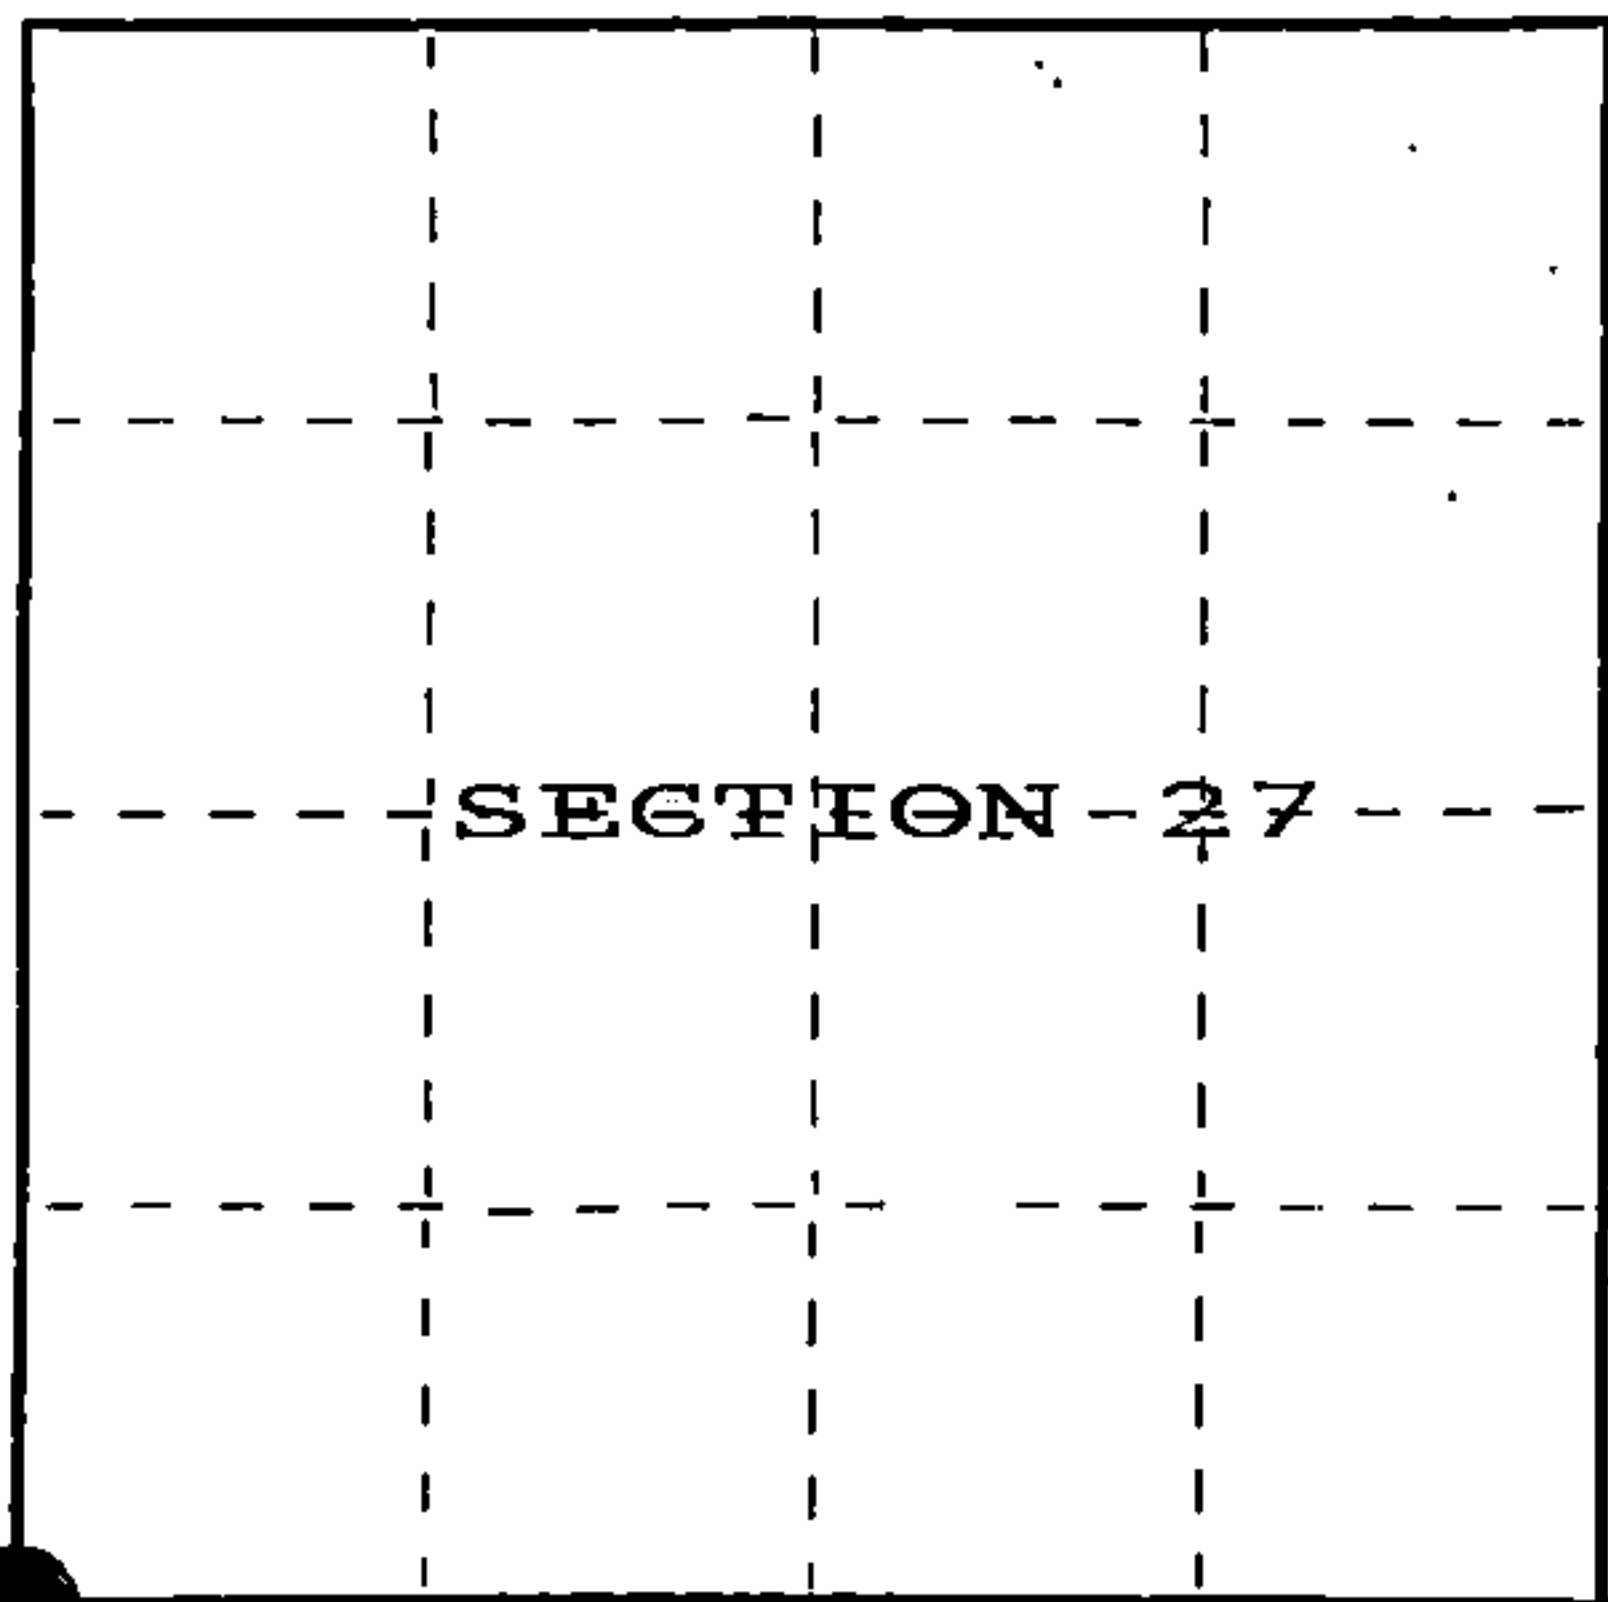

○ = Corner monument restored.

History of original corner establishment:

Original corner established in 1859 by William Daugherty, U.S. Deputy Surveyor.

Set wooden post with the following bearing trees:

Maple	10"	N42°E	11 links
Fir	10"	S88°W	6 links

Geographic Features:

South 14 chains stream 50 links wide runs Southeast.

West 27.34 chains, stream 50 links wide runs South.

East 21 chains enter swamp.

North 11 chains enter swamp.

Description of corner evidence found:

Recovered badly decayed remains of corner post. Post was white pine with top being solid enough to identify the wood. Post hole was about 18" deep and ended in a point. Found stump hole at the described bearing and distance for the GLO maple bearing tree. The recovered corner position was within about ten feet of an estimated corner position based on the stream calls to the South and West. The swamp to the East and North was not well defined.

Description of monument and accessories I established to perpetuate the original location of this corner.

Set a 2 1/2" X 3' aluminum monument, 30 inches in the ground, with aluminum cap stamped; T37N, R12E, S27, S28, S33, S34, 1986, S-1665. Established the following new bearing trees which are blazed, scribed, painted and tagged:

Cedar	12"	S60°E	16.66 feet
White Birch	4"	S26°W	22.96 feet
White Pine	18"	N82°W	21.62 feet
Red Maple	6"	N30°E	21.91 feet
Steel sign post		Southeast	0.5 feet

Dated at Ludington, Michigan, this Nineteenth day of November, 1987.

Signature John C. Schulke Title Land Surveyor Registration No. S-1665  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within  
instrument was filed in this office for record on the 2nd day of February, 1988  
at 9:40 o'clock a. M.

Paul Schenckner  
(Register of Deeds)

By \_\_\_\_\_ Deputy

FORM NO. 985-A

H.C. Miller Company

Stock No. 26273

DOCUMENT NUMBER 134579

4371228000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



No discrepancy, first corner restoration.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

The corner was restored through the recovery of obliterated original corner evidence.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

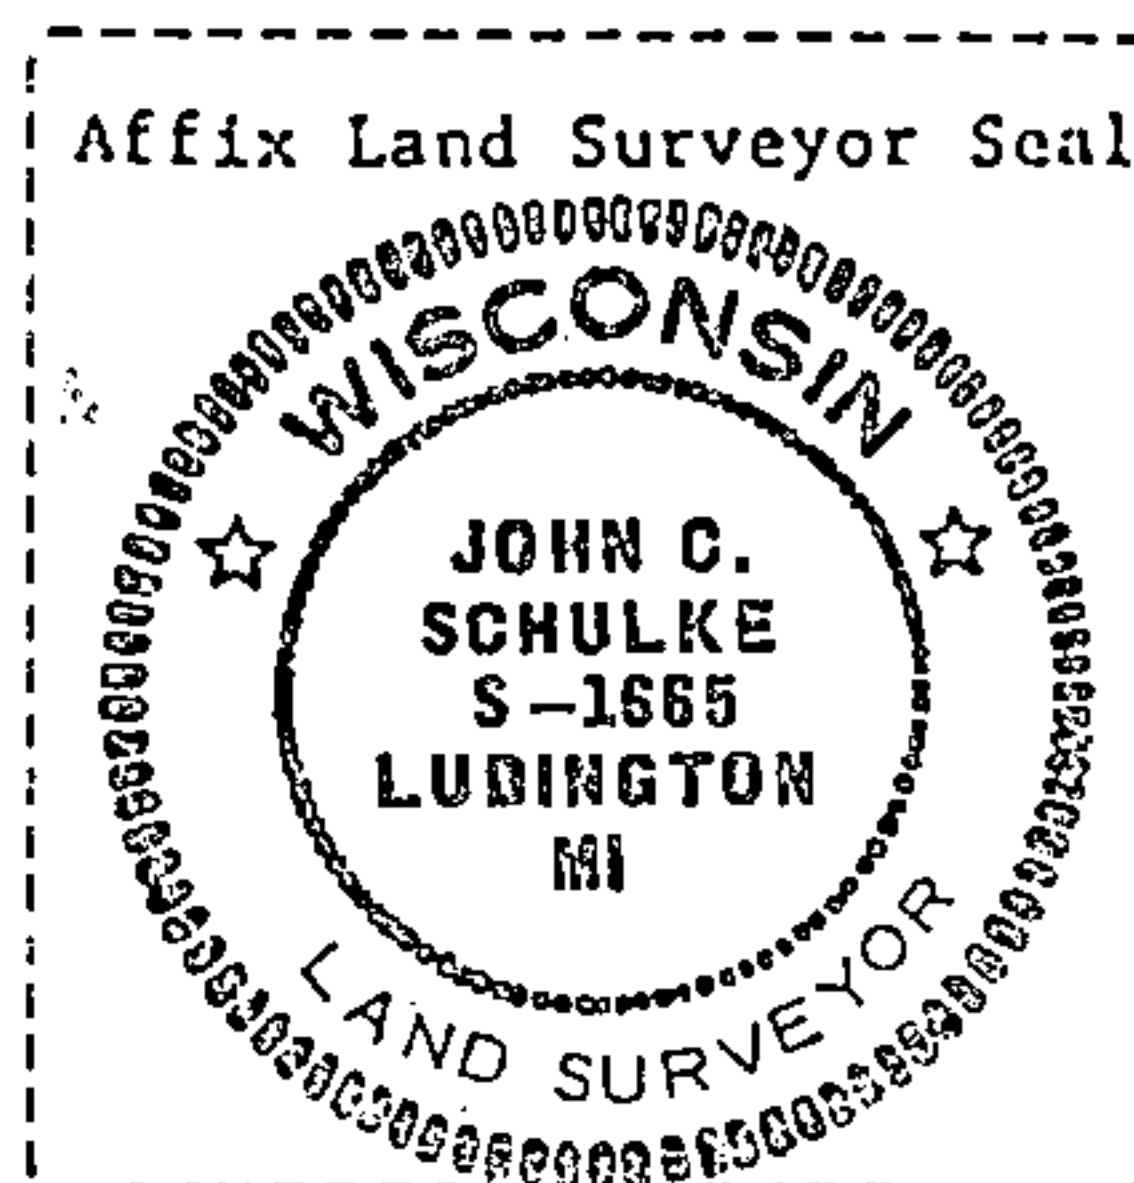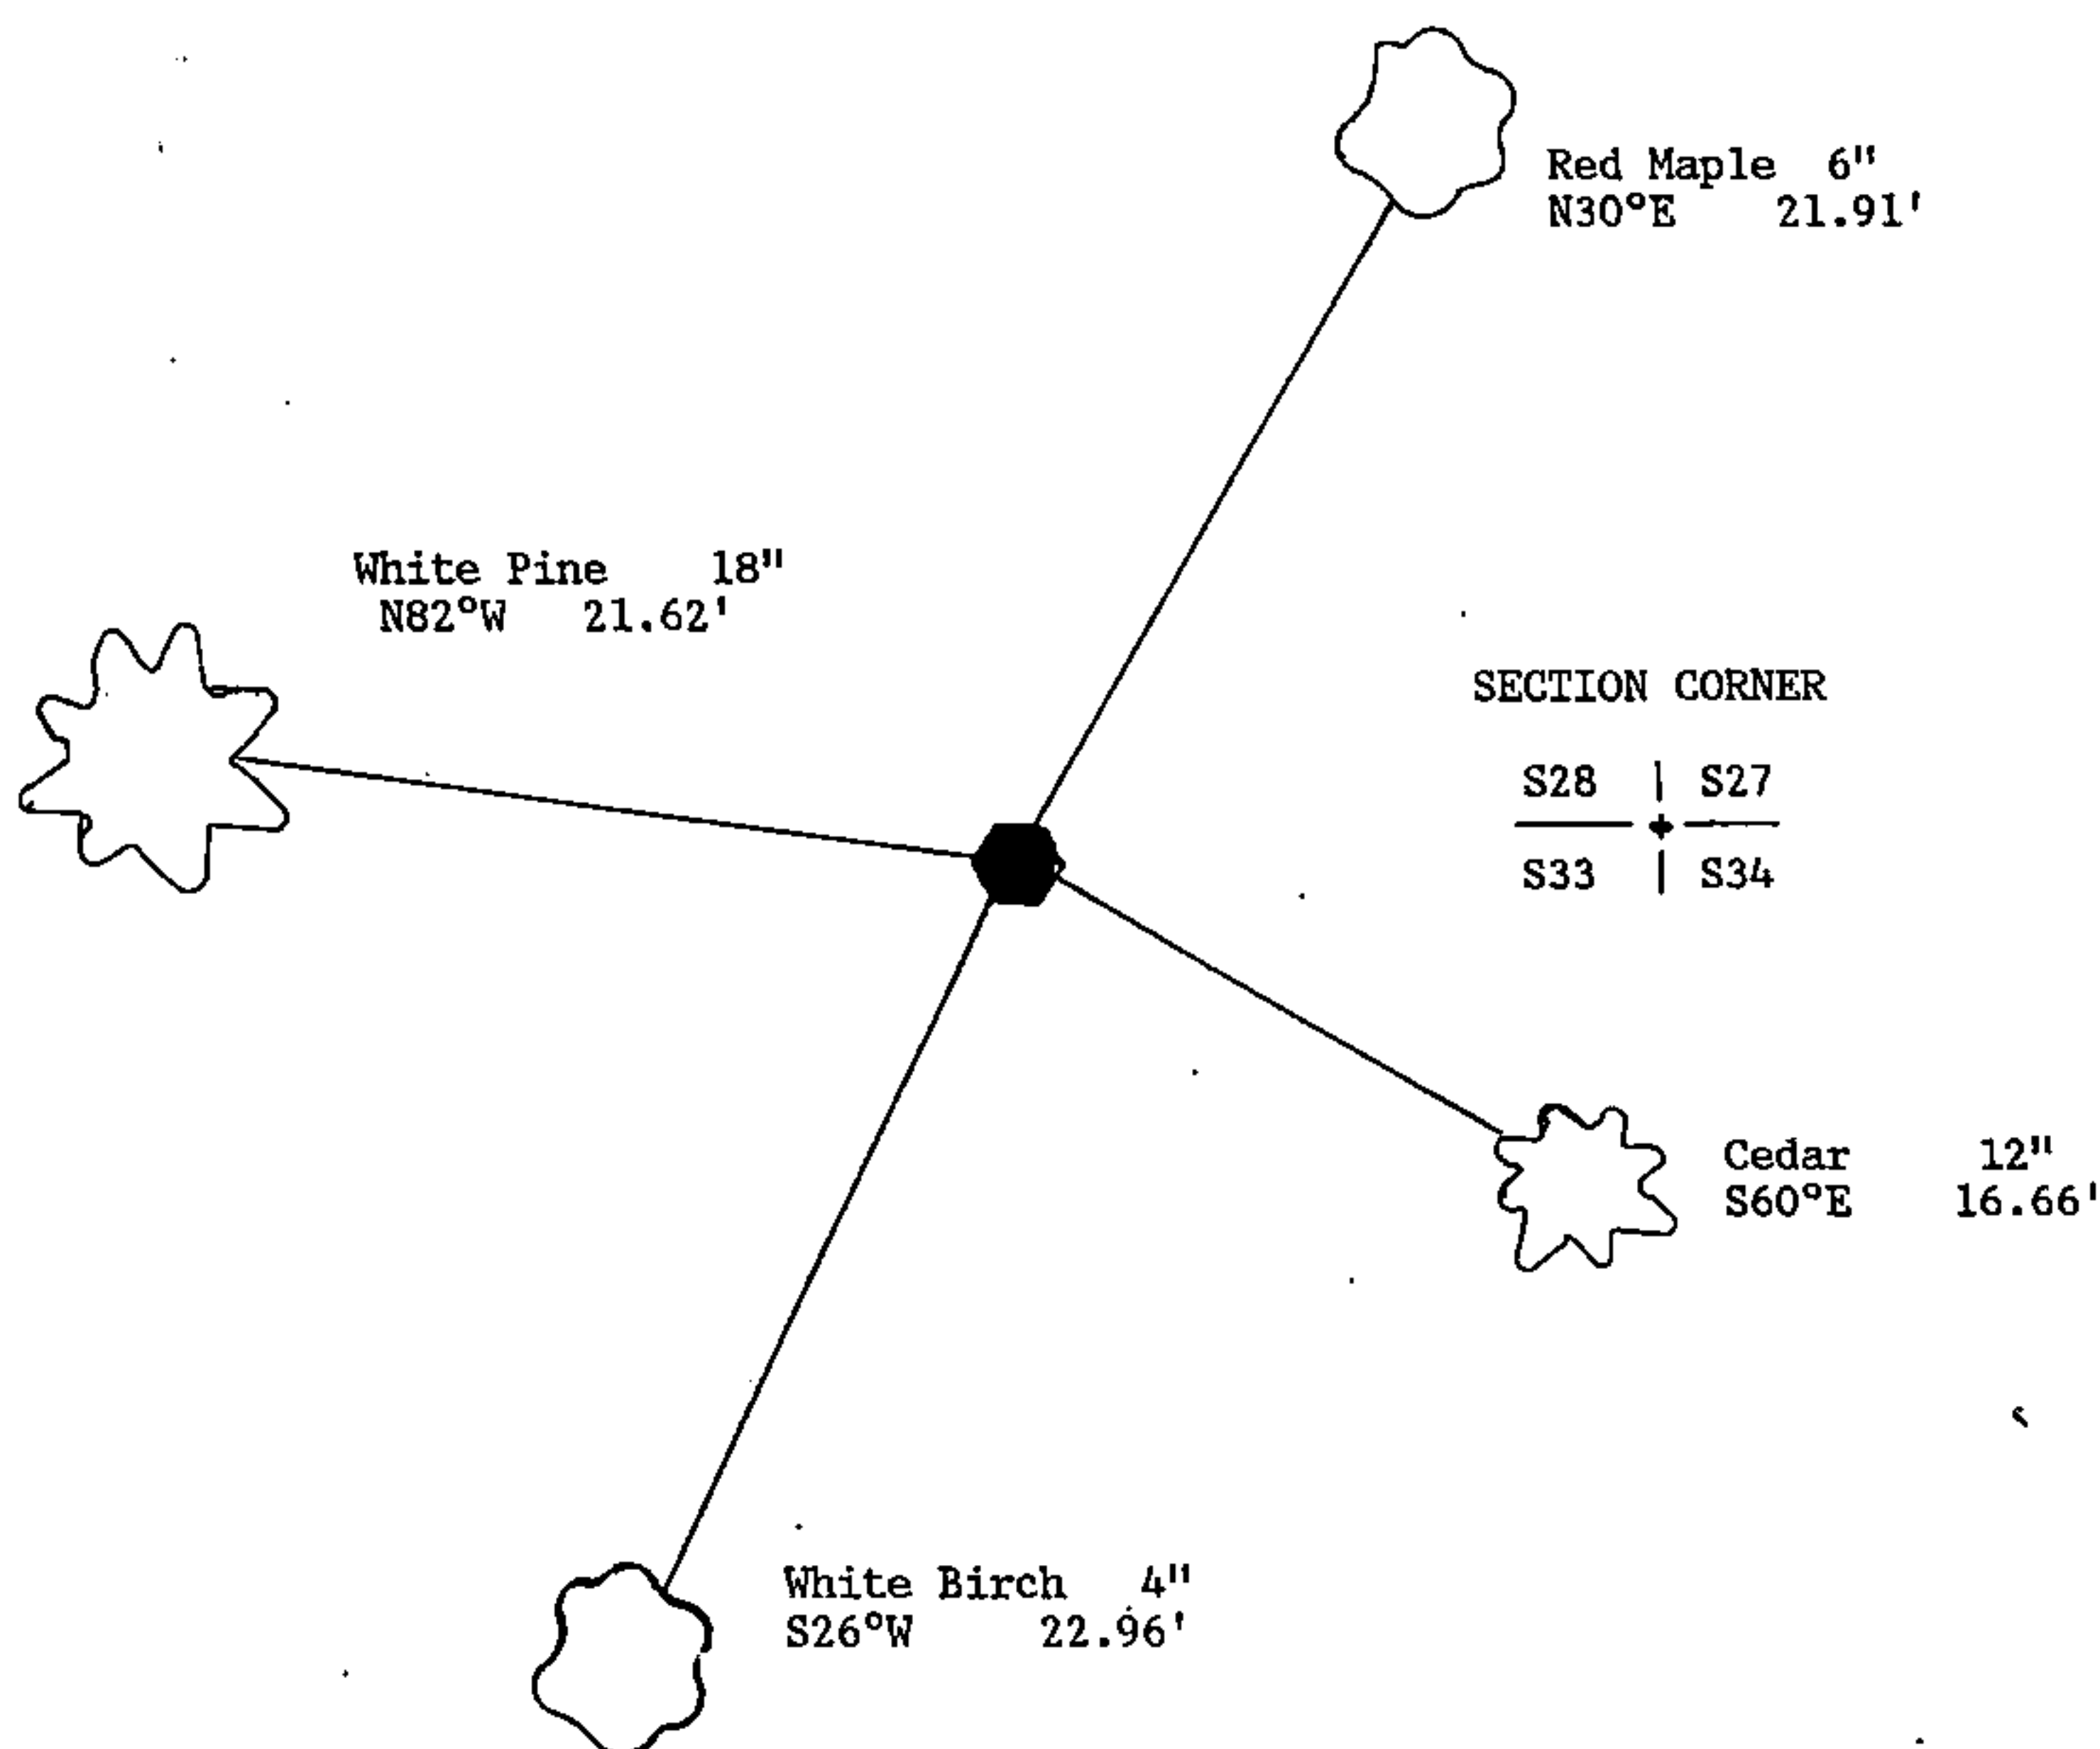

- (i) I, John C. Schulke  
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke  
Signature

11-9-87  
Date

Survey requested by:

Dale S. Staege  
District Ranger

2/1/88  
Date