

DOCUMENT NUMBER

137128

FORM 985 M. G. MILLER CO., MILWAUKEE


State of Wisconsin }
County of Forest } ss.

I, Glen Barker, do hereby
certify that on the 18th day
of November, 19 88, I found
evidence of the 1/4
corner of Section 1 & 12
Township 37, North, Range
13 East, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

N. Spiess

D. Broadbridge

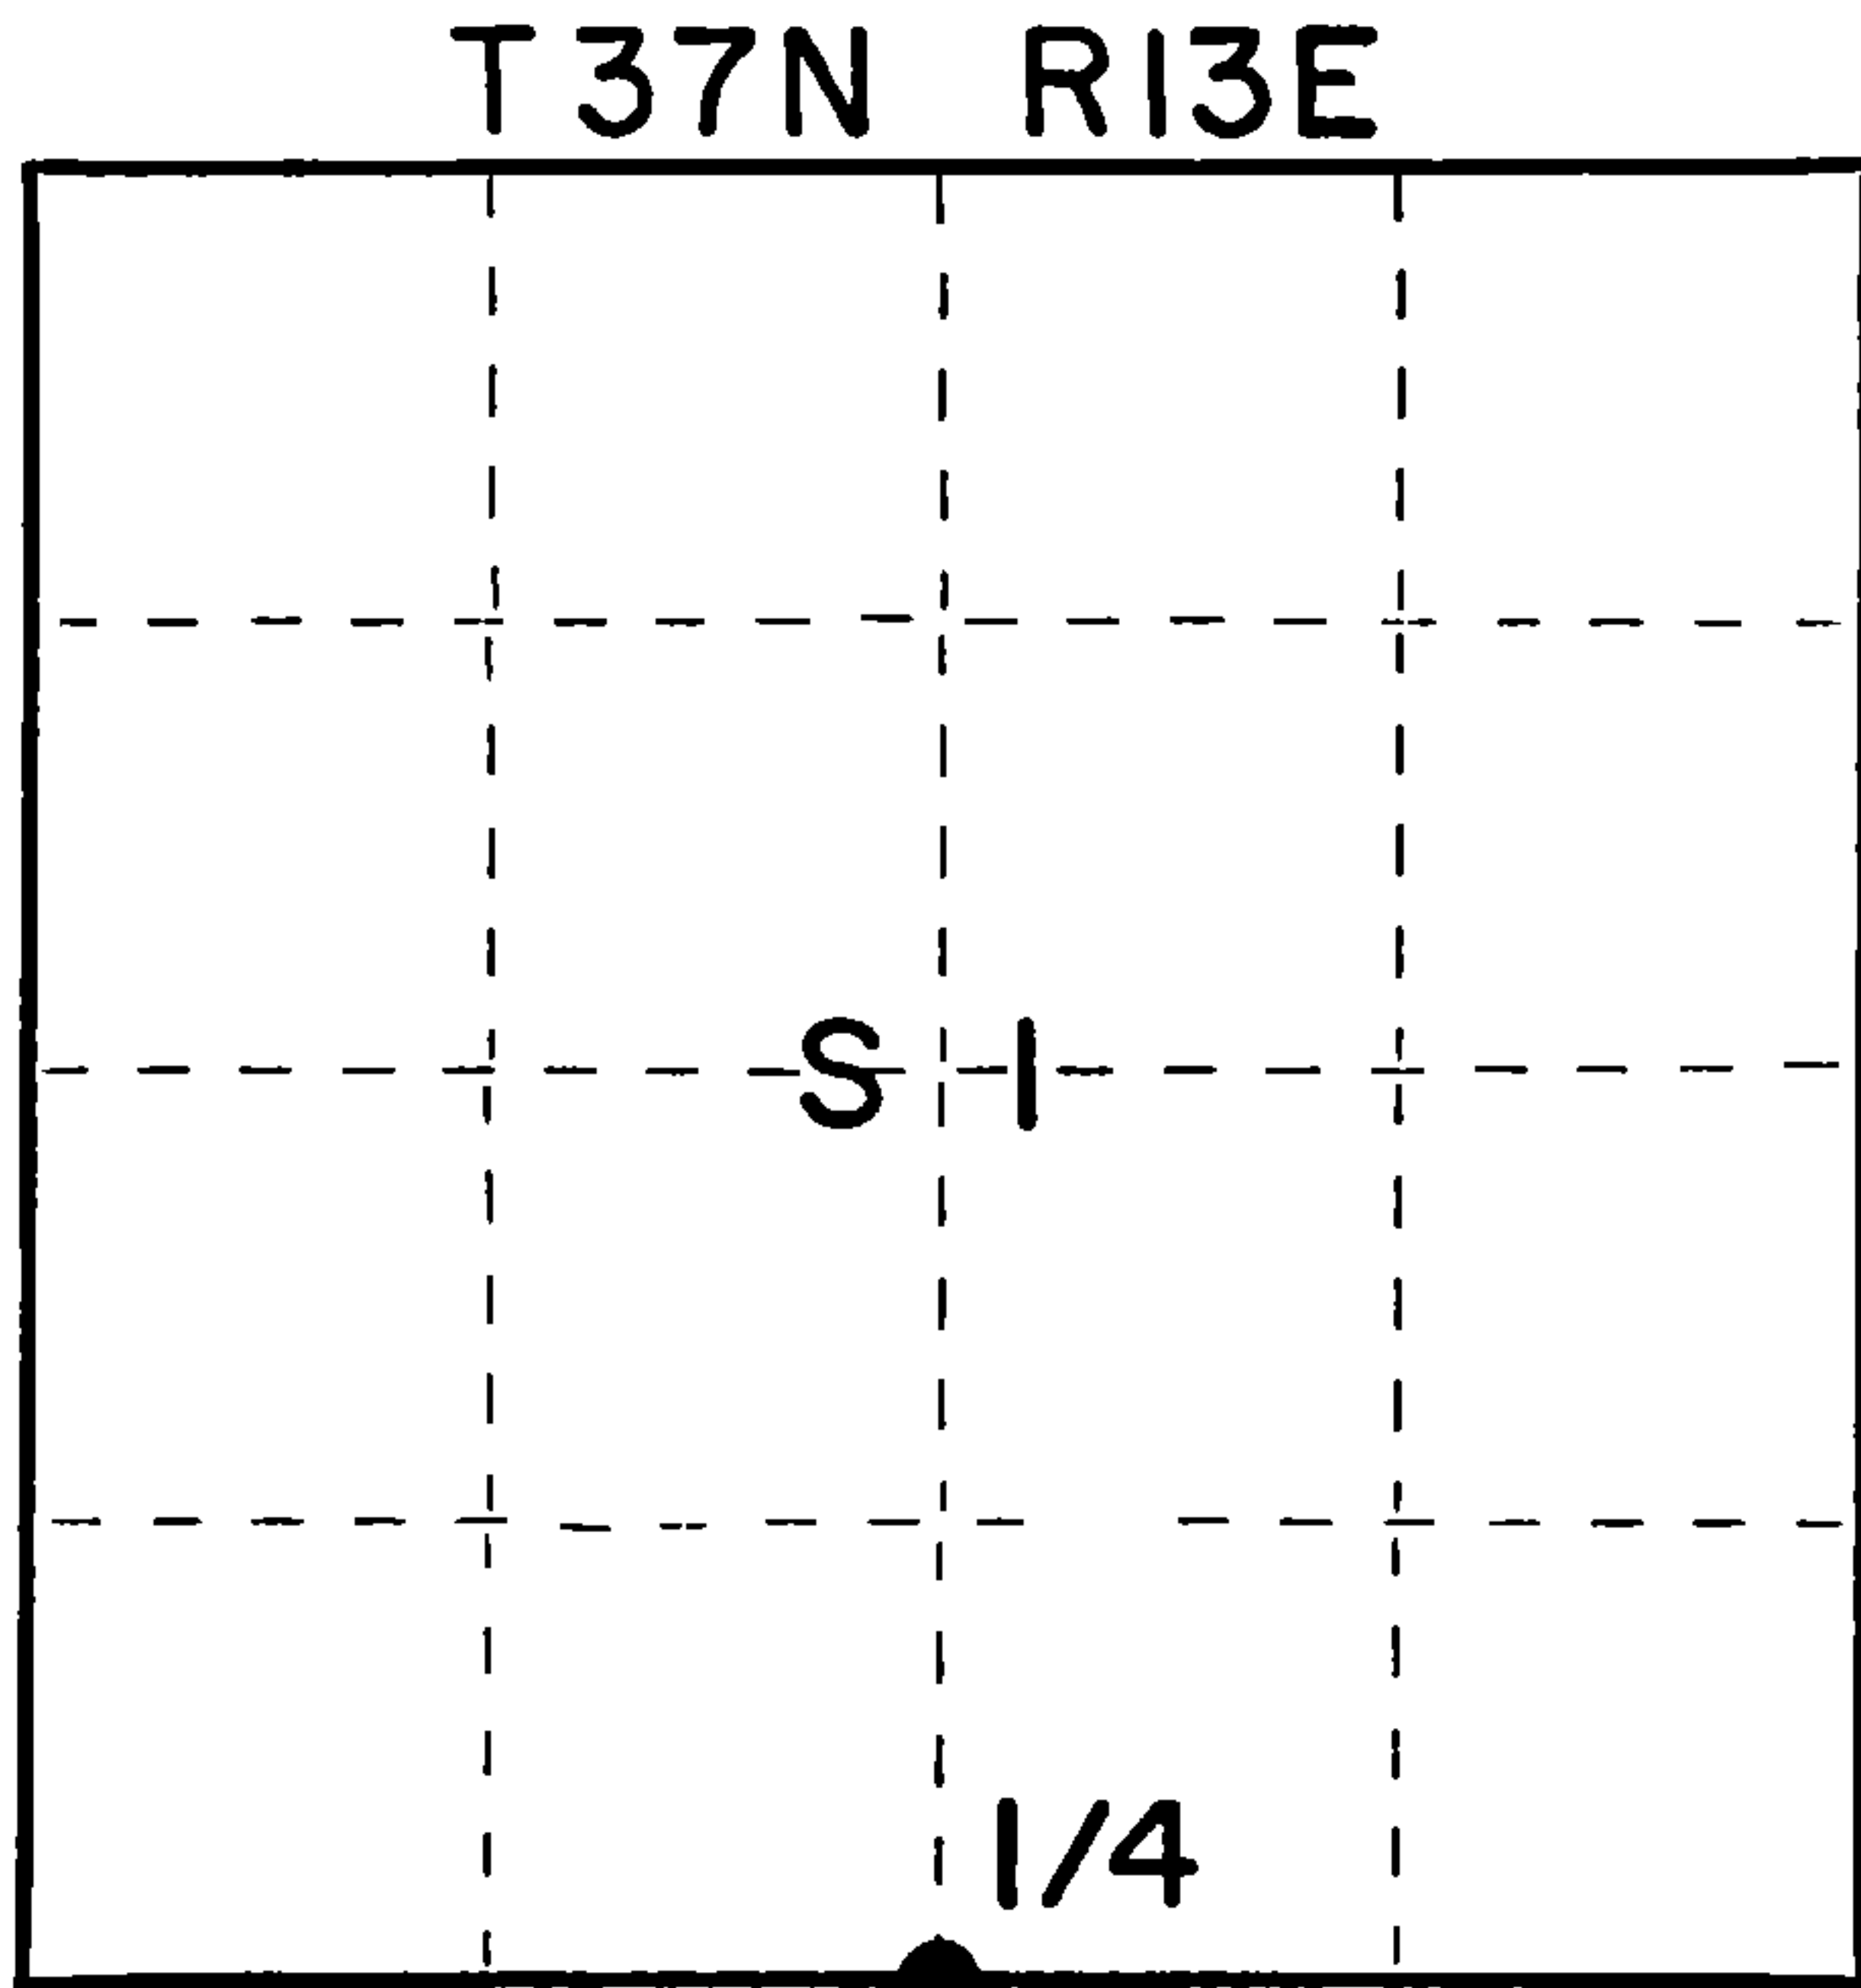

CERTIFIED LAND CORNER RESTORATION
U.S. Public Land Survey Monument Record

Index No. E-23

History of original corner establishment:

Original corner established by James L. Nowlin, government deputy
surveyor in 1865 from which spruce 5" bears N30E 30 links and spruce
4" S34W 10 links.

Description of corner evidence found:

Recovered a 1 1/2" diameter 12" long spruce point buried in swamp moss and
muck which I believe to be original. Also a 3" cedar post point along side
spruce point. Recovered remains of original stump and root system - spruce
4" S34W 10 links. Recovered old location tag on down and rotted spruce under
moss. This and cedar post was witnessed by John W. Macon U.S.F.S Forester in
1934. Old U.S.F.S. notes state corner to be N55E 16.50' of location tag. We
found this to be correct in recovering old evidence.

Description of monument and accessories I established to perpetuate the original location of this corner.
Set a 2 1/4" Forest County aluminum monument with 3 1/4" alloy cap stamped in place
of old spruce point.

Marked NBT:

Black Spruce 5" N49W 51.49'
Tamarack 12" N56E 53.04'
Tamarack 12" S41E 56.78'
Tamarack 7" S40W 45.49'

T37N R13E
S 1
S 12
S 1682
Forest County

Dated at Rhineland, Wis., this 14th day of March, 19 89.

Signature Glen Barker Title Registered Land Surveyor Registration No. 1682
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest I hereby certify that the within
instrument was filed in this office for record on the 31st day of March, 19 89
at 10:25 o'clock A. M.

Paul Achenbrenner
(Register of Deeds)

By _____ Deputy

43713 01 0020

(c) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(i) I, Elen Barker
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Glen Barker
Signature

3/14/89
Date

