

## U. S. PUBLIC LAND SURVEY MONUMENT RECORD


## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 12 and 13, T.37N., R.13E.

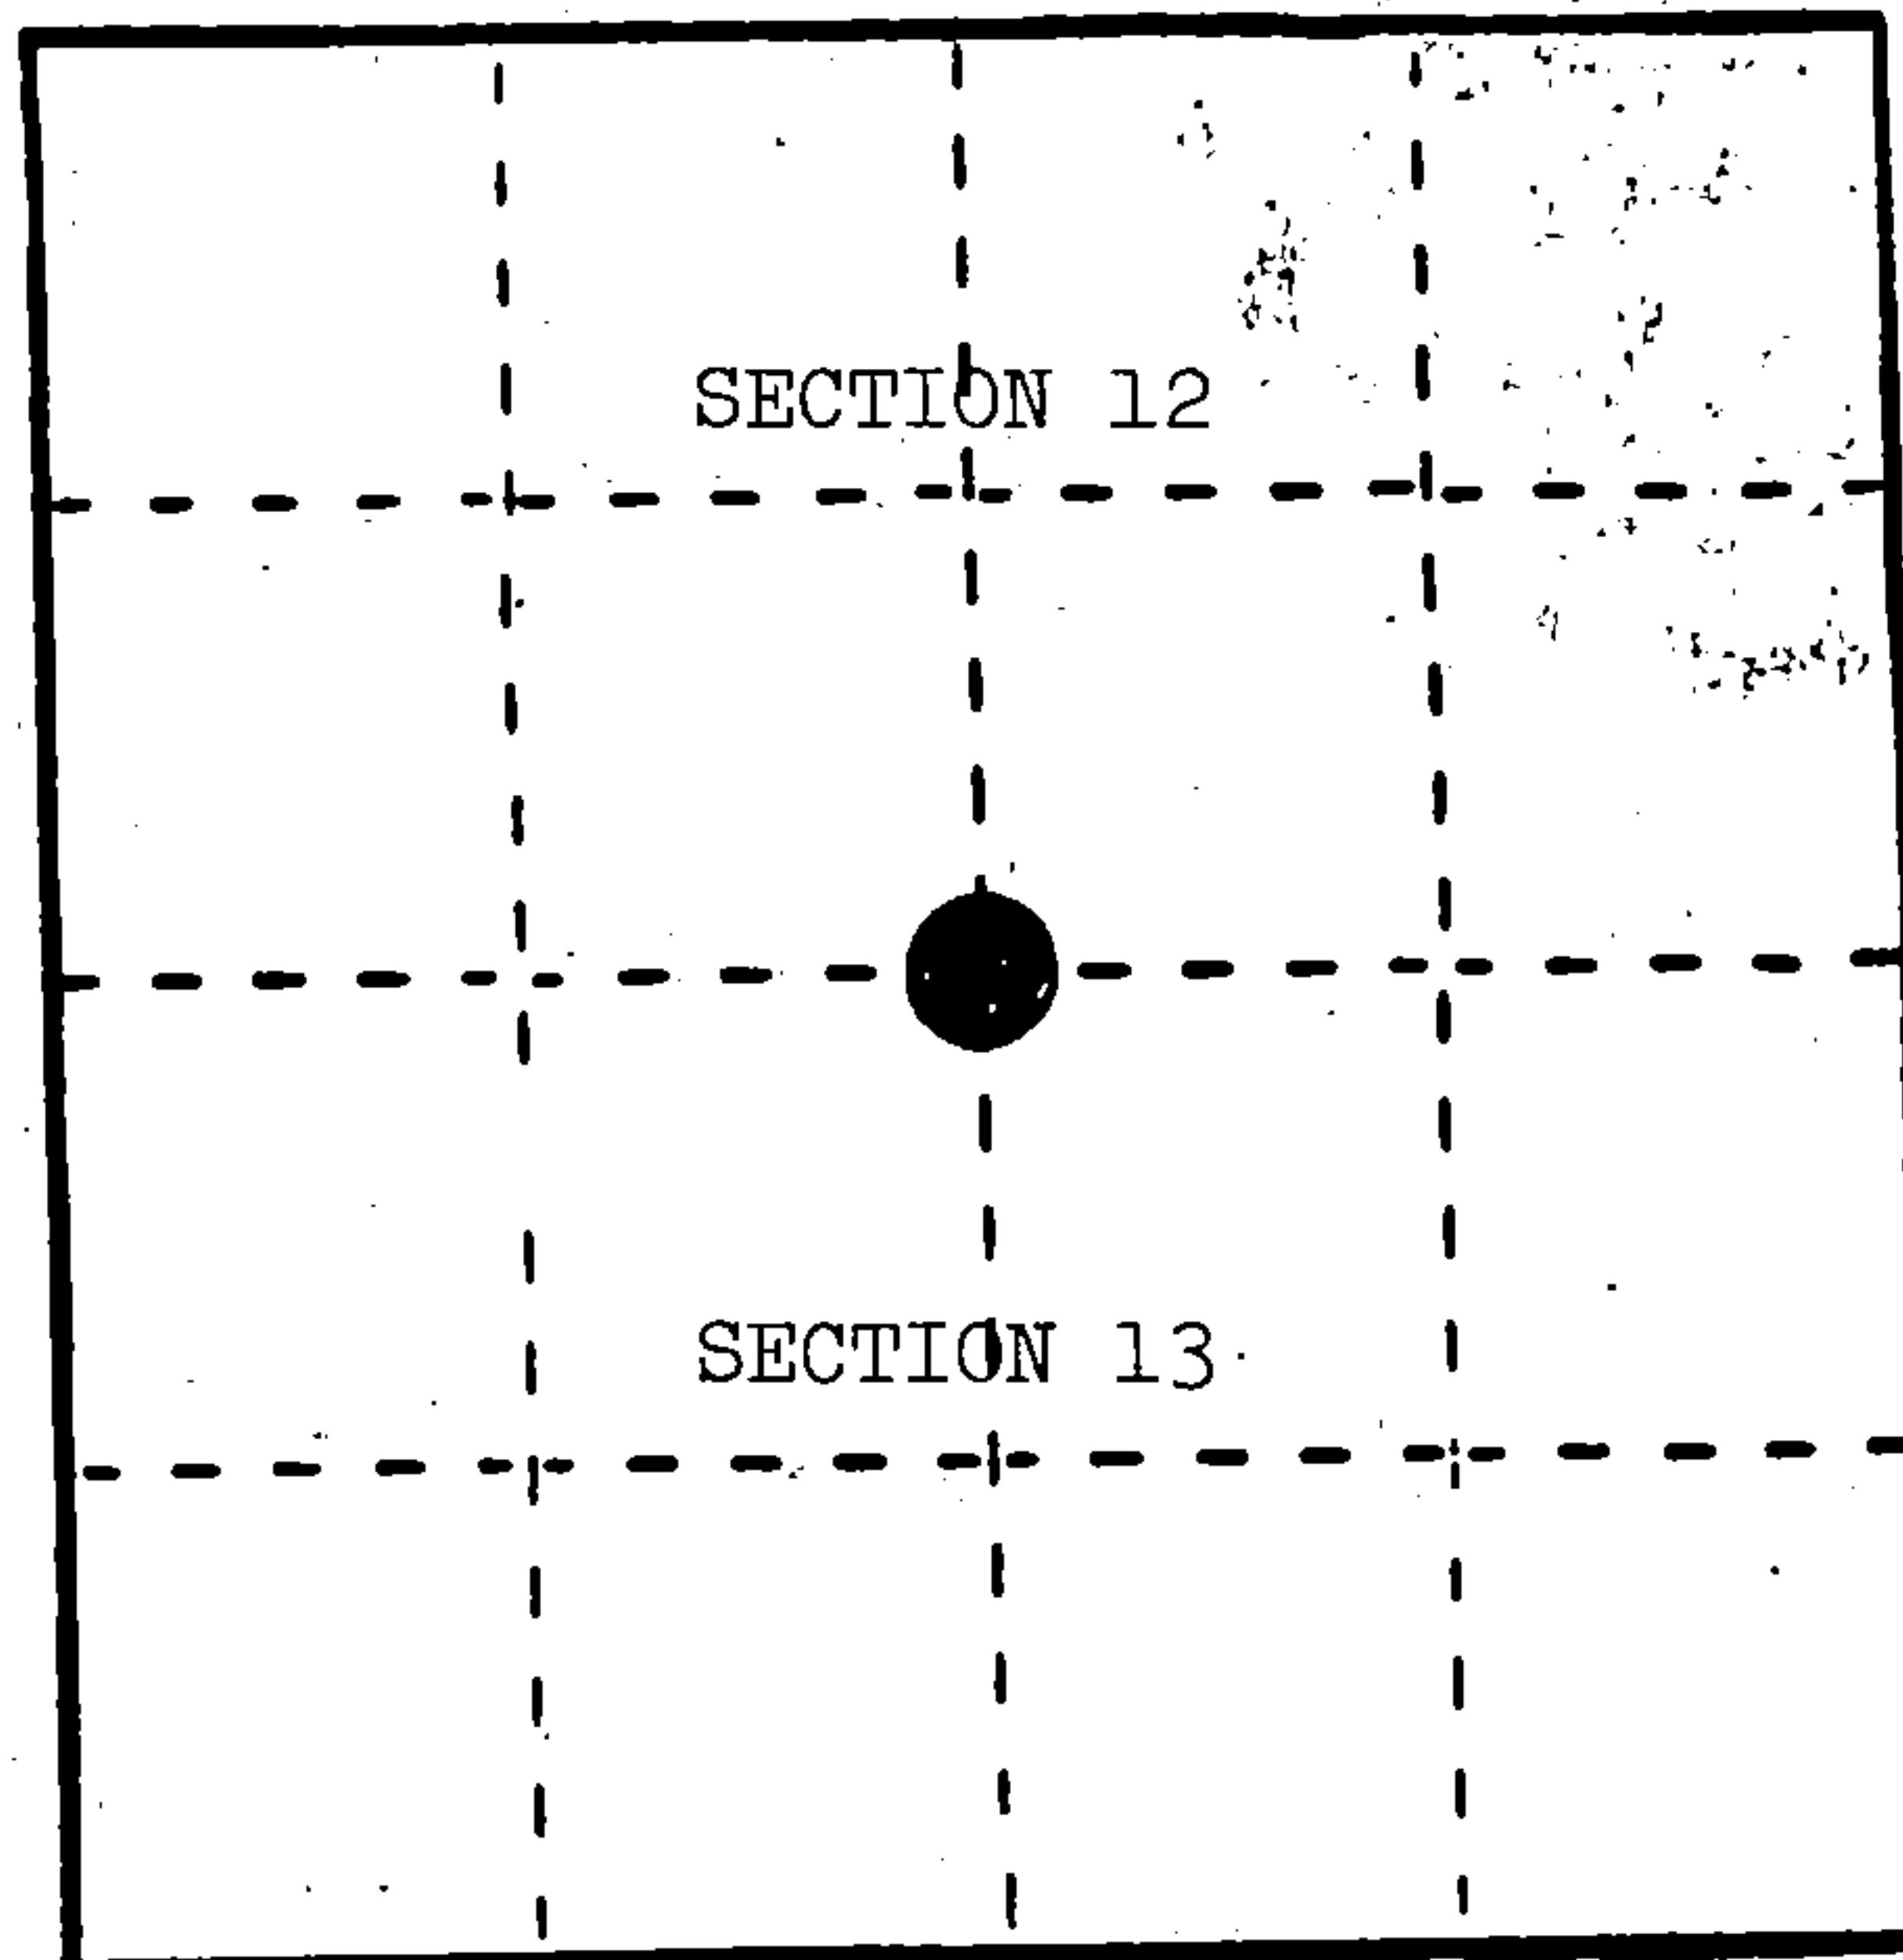

REGISTER'S OFFICE  
Forest County, Wis.

Received for record this 17th day

of March A.D. 1986 at

10:40 o'clock A.M. and recorded

In Vol. CORNER RESTORATIONS

page J-23

Paul Aschenbrenner

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, William Daugherty set wood post with the following BTs: Cedar, 8", N.10°W., 12 links; Cedar, 12", S.30°E., 20 links.

In 1936, Truck Trail Survey No. 388 shows road north and west in place with corner at intersection of Town road.

July 18, 1934, "874" per Poland--found 4" x 4" Cedar post in place at road intersection west and north.


August 18, 1965, J. Resvick found 4" x 4" Cedar post in place. This corner has been in place for 31 years.

June 19, 1985, Harrison found 7' fence post in post hole with 4" x 4" post top lying beside. Centerlines of road fit well. Found stump hole, S.30°E., 13.20 feet. No evidence of BT, N.10°W., 7.92 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. B. Spruce, 7", S.71°E., 32.41 feet
3. B. Cherry, 6", S.5°W., 7.69 feet
4. B. Spruce, 6", S.44°W., 34.24 feet
5. Steel Sign Post, Northeast, 1.10 feet

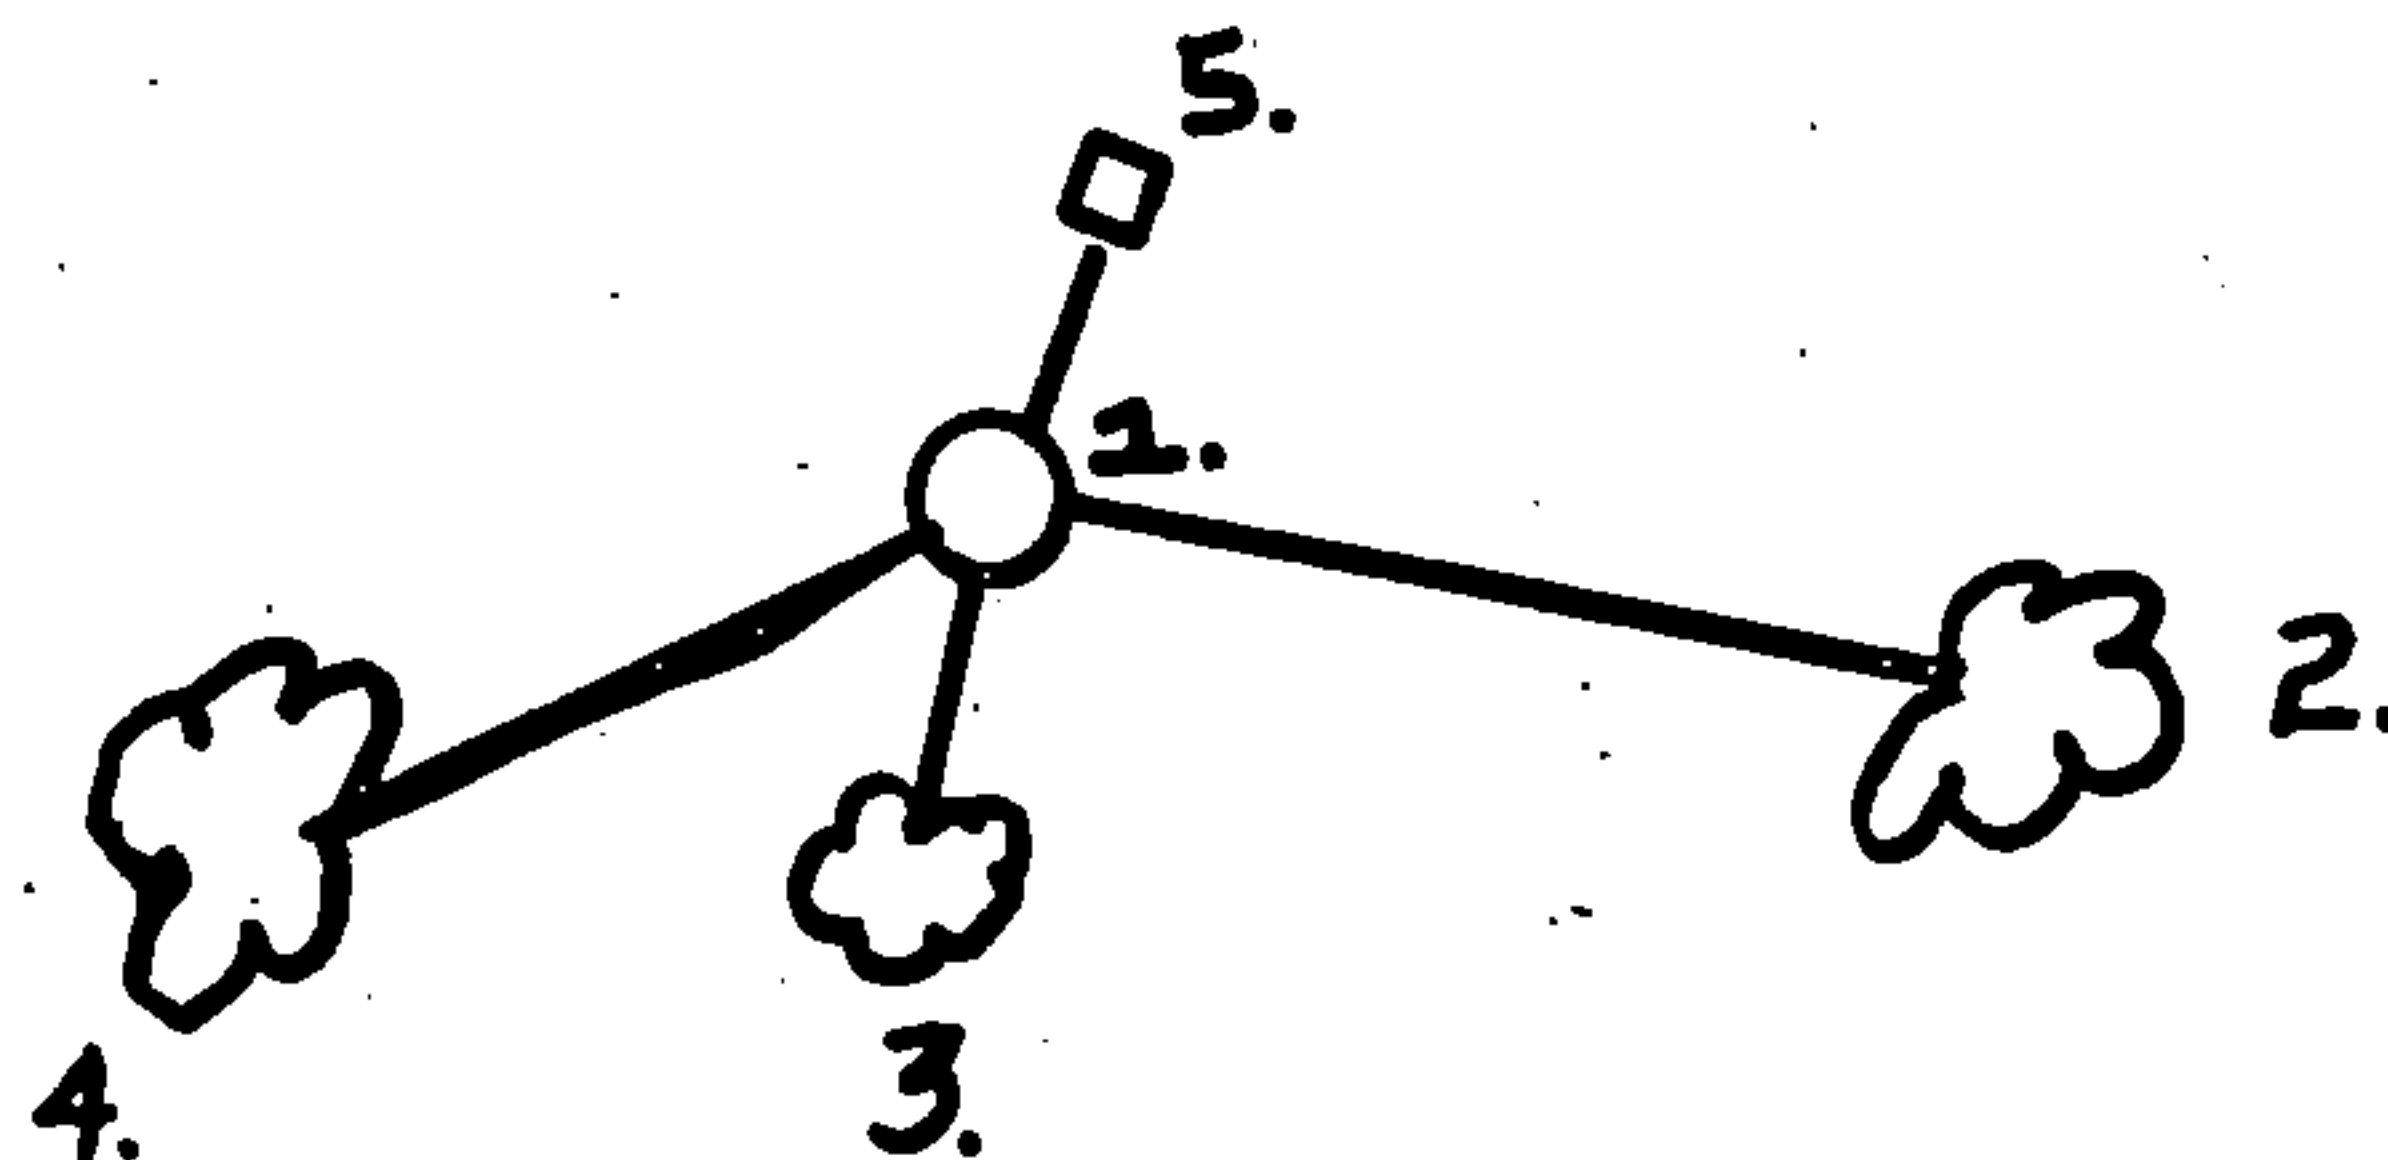

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison  
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 1/3/86  
Signature Date

