


U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Index No. N-7

State of Wisconsin }
County of Forest } ss.
I Gary L. Pisoni, do hereby
certify that on the 9th day
of March, 1993, I found
evidence of the South Quarter
corner of Section 17
Township 37, North, Range
13 East, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

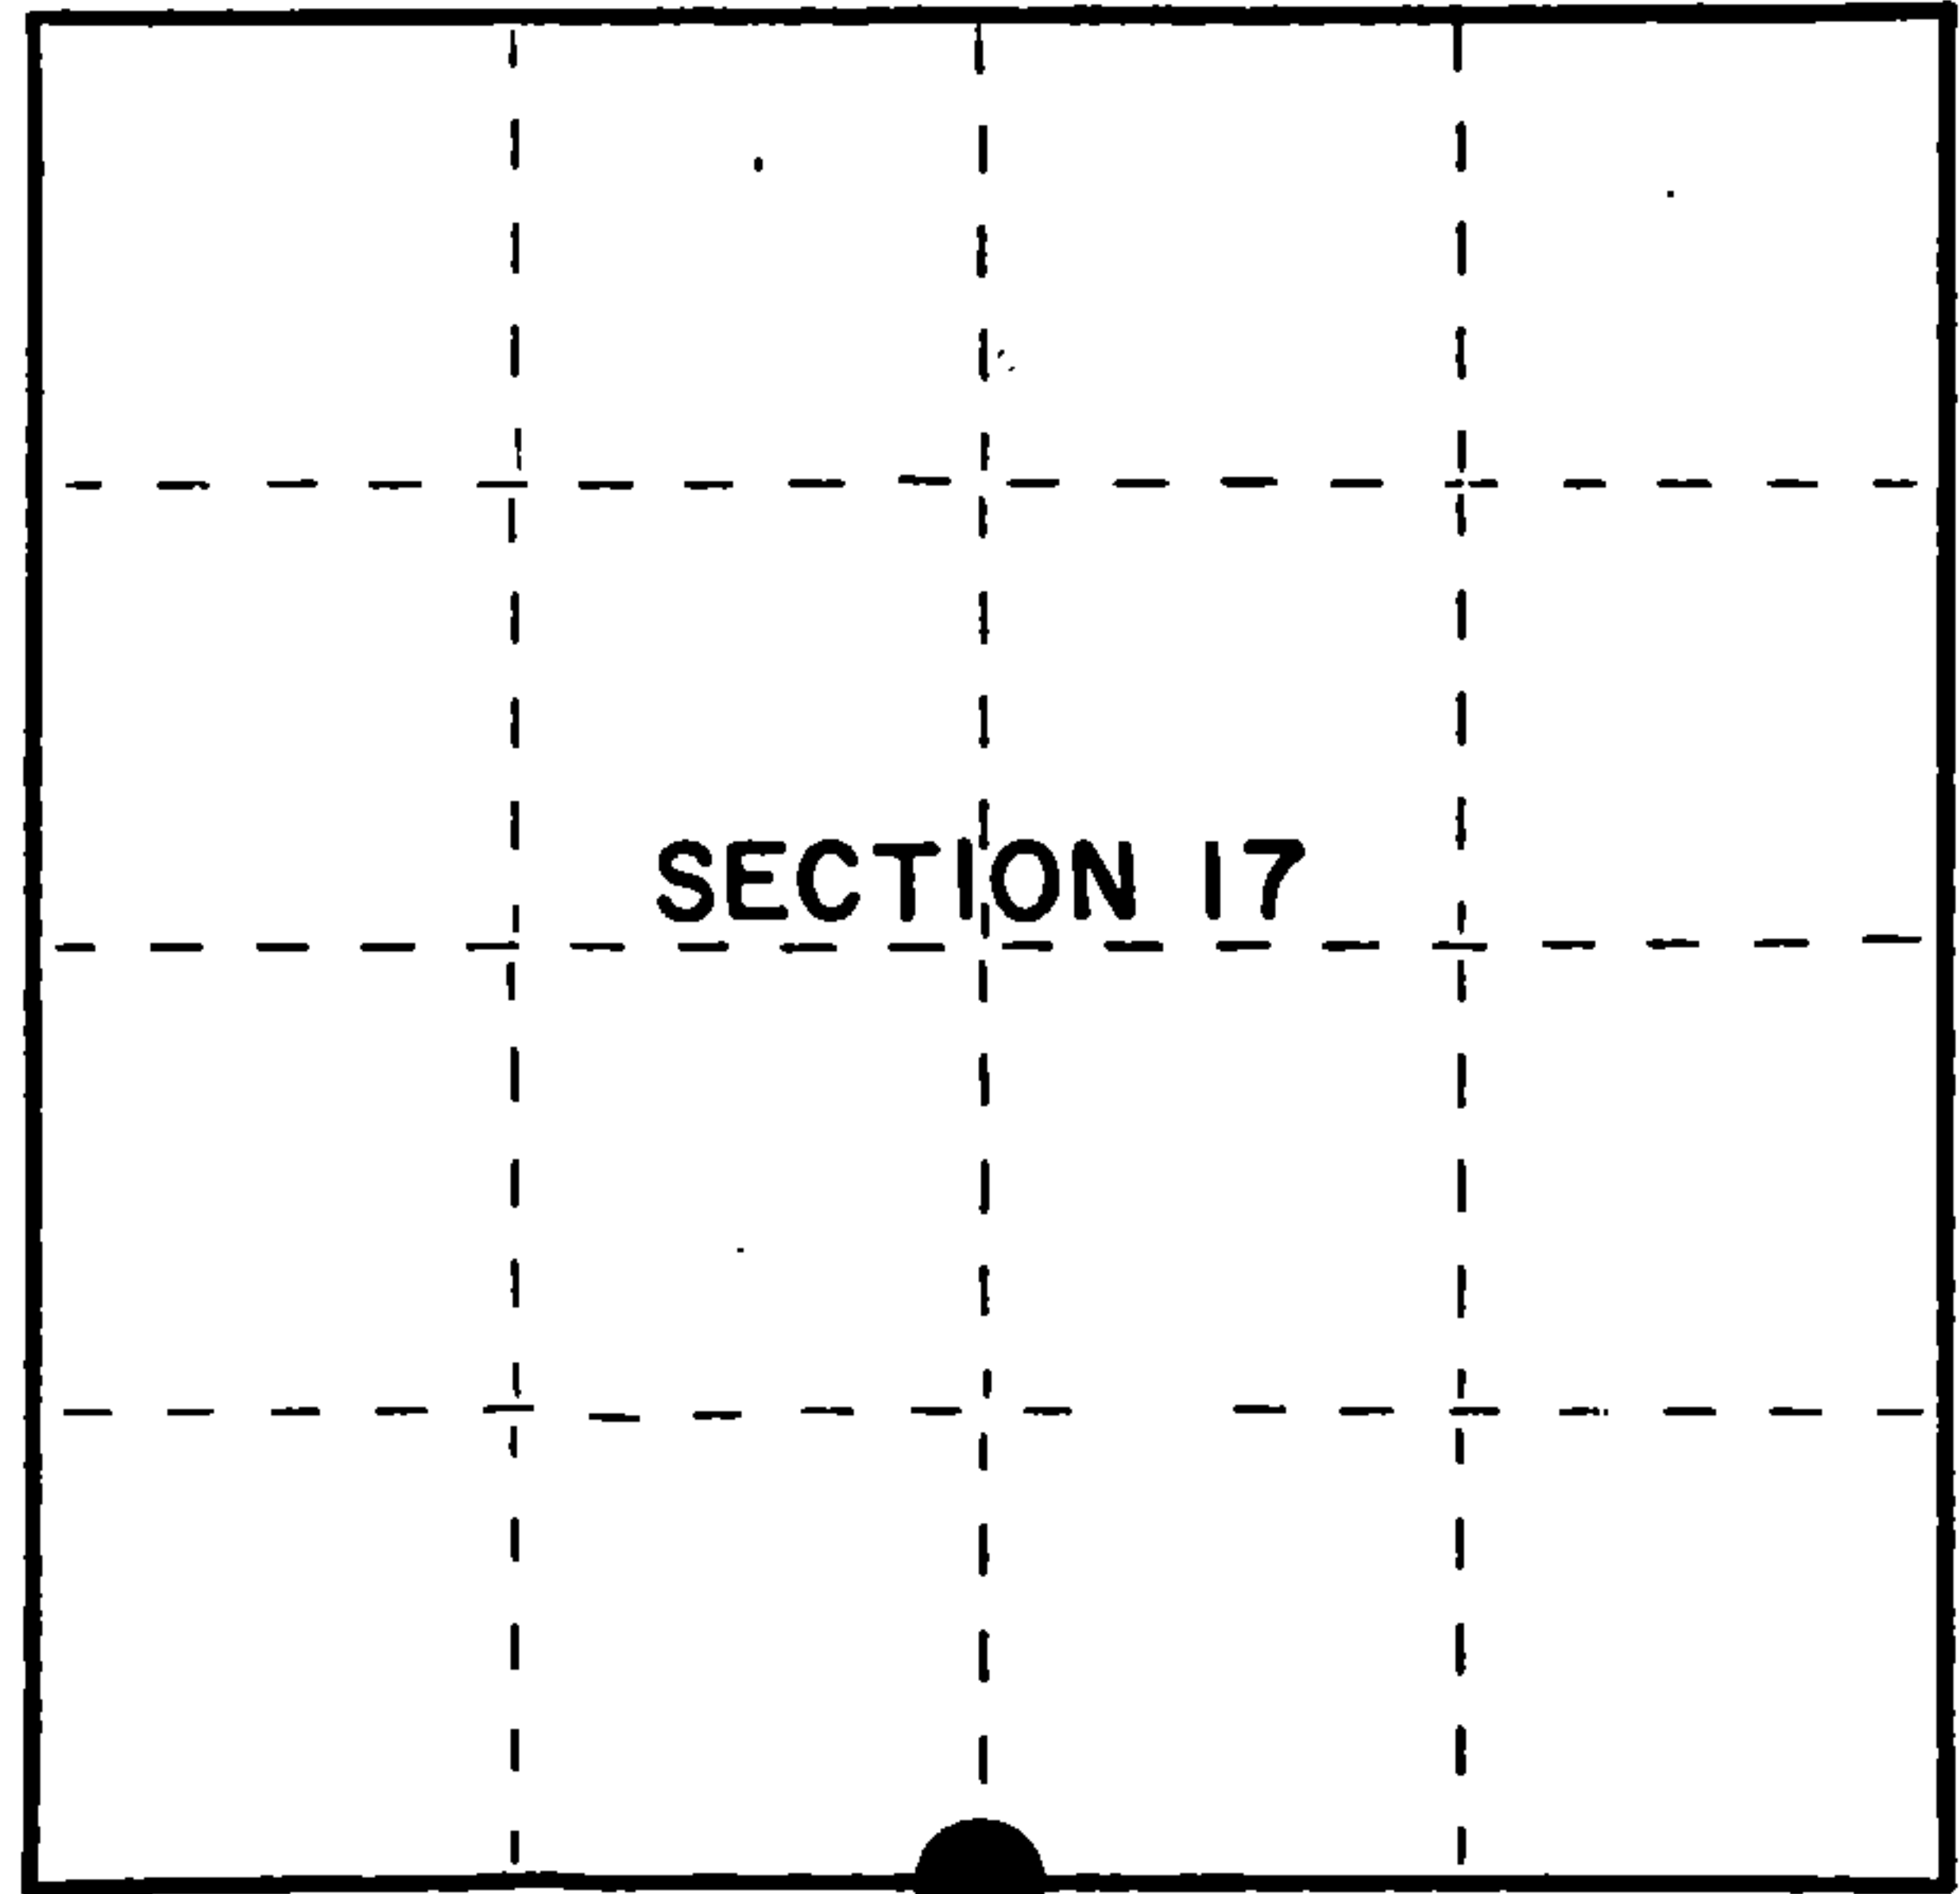

● = Corner monument restored.

History of original corner establishment:
Original Government Survey in 1865 by J.L. Nowlin. West corrected between Sections
17 and 20, at 40.20 chains, set Quarter Section post to Sections 17 and 20, from
which the following bear:

Birch	10"	N 15° W	21 lks.
Birch	12"	S 14° E	20 lks.

Description of corner evidence found:
No evidence of the original corner or bearing trees was recovered. No other corner
evidence was found.
I reestablished the corner position at proportionate distance and on line between the
Southwest and Southeast Section Corners of Section 17.

Description of monument and accessories I established to perpetuate the original location of this corner.
At the corner position, set a 2½ inch diameter aluminum pipe monument, 3 feet long,
3 inches above the ground surface, with an aluminum cap stamped; T37N, R13E, 1/4,
S17, S20, 1993, S-1634. From which the following new blazed and scribed bearing
trees bear; (Measurements taken to a nail in side of tree)

Sugar Maple	8"	N43° E	15.32 feet
Sugar Maple	16"	N77° E	19.78 feet
Basswood	12"	S30° W	26.17 feet
Sugar Maple	16"	N37° W	16.02 feet
Steel Sign Post		North	0.90 feet

Dated at Iron River, MI, Wis., this 22nd day of April, 1993
Signature Gary L. Pisoni Title Land Surveyor Registration No. S-1634
(County Surveyor, Registered Land Surveyor, or other duly authorized official)
Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 12th day of August, 1993
at 1:25 o'clock P M.

By [Signature] (Register of Deeds)
Deputy

FORM NO. 985-A
H.C. Miller Company
Stock No. 26273
DOCUMENT NUMBER
148156

43713170020

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

see drawing below.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Re-established through lost corner proportionate methods.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

G.L.O. 80.40 chns.
S18|S17 N89°48'51"E 5520.22' S17|S16
S19|S20 2760.11' 1/4 2760.11' S20|S21

16" Sugar Maple(NBT)
N37°W, 16.02 feet


Steel Sign Post
North, 0.90 feet

8" Sugar Maple(NBT)
N43°E, 15.32 feet

16" Sugar Maple(NBT)
N77°E, 19.78 feet

Quarter Corner S17
S20

12" Basswood (NBT)
S30°W, 26.17 feet

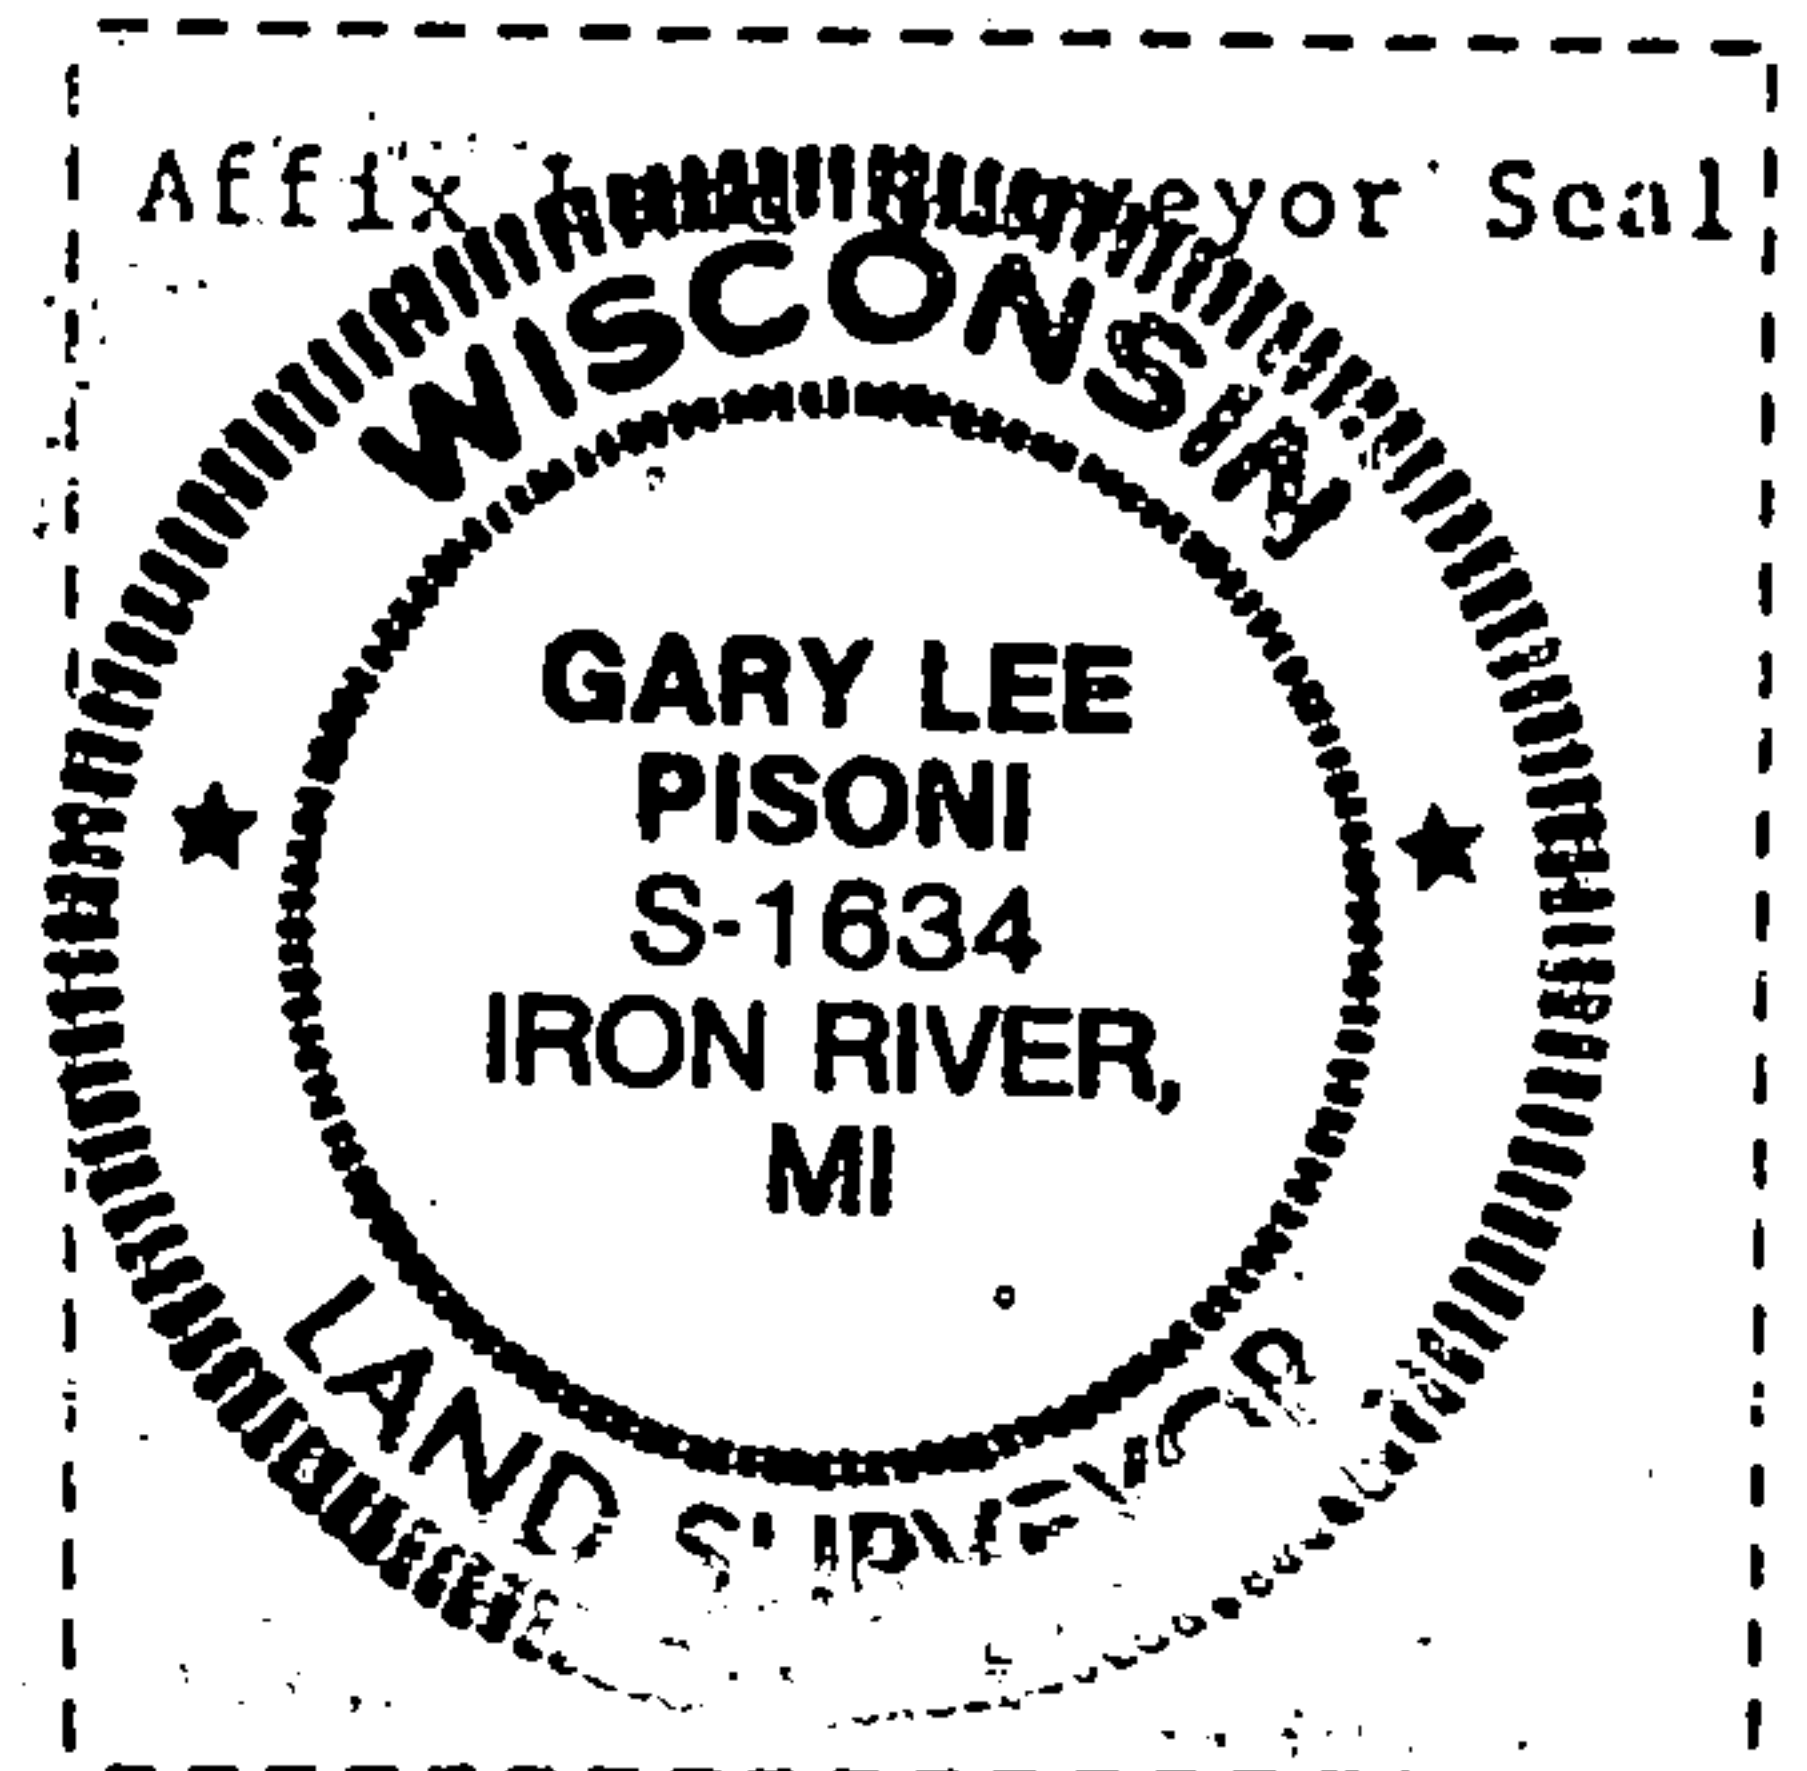

(i) I, Gary L. Pisoni
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Survey requested by:

Sue Vap
District Ranger

Date