


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (d) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 7 and 12,
 Township 37 North, Range 15 and 16 East,
 Forest County, State of Wisconsin.

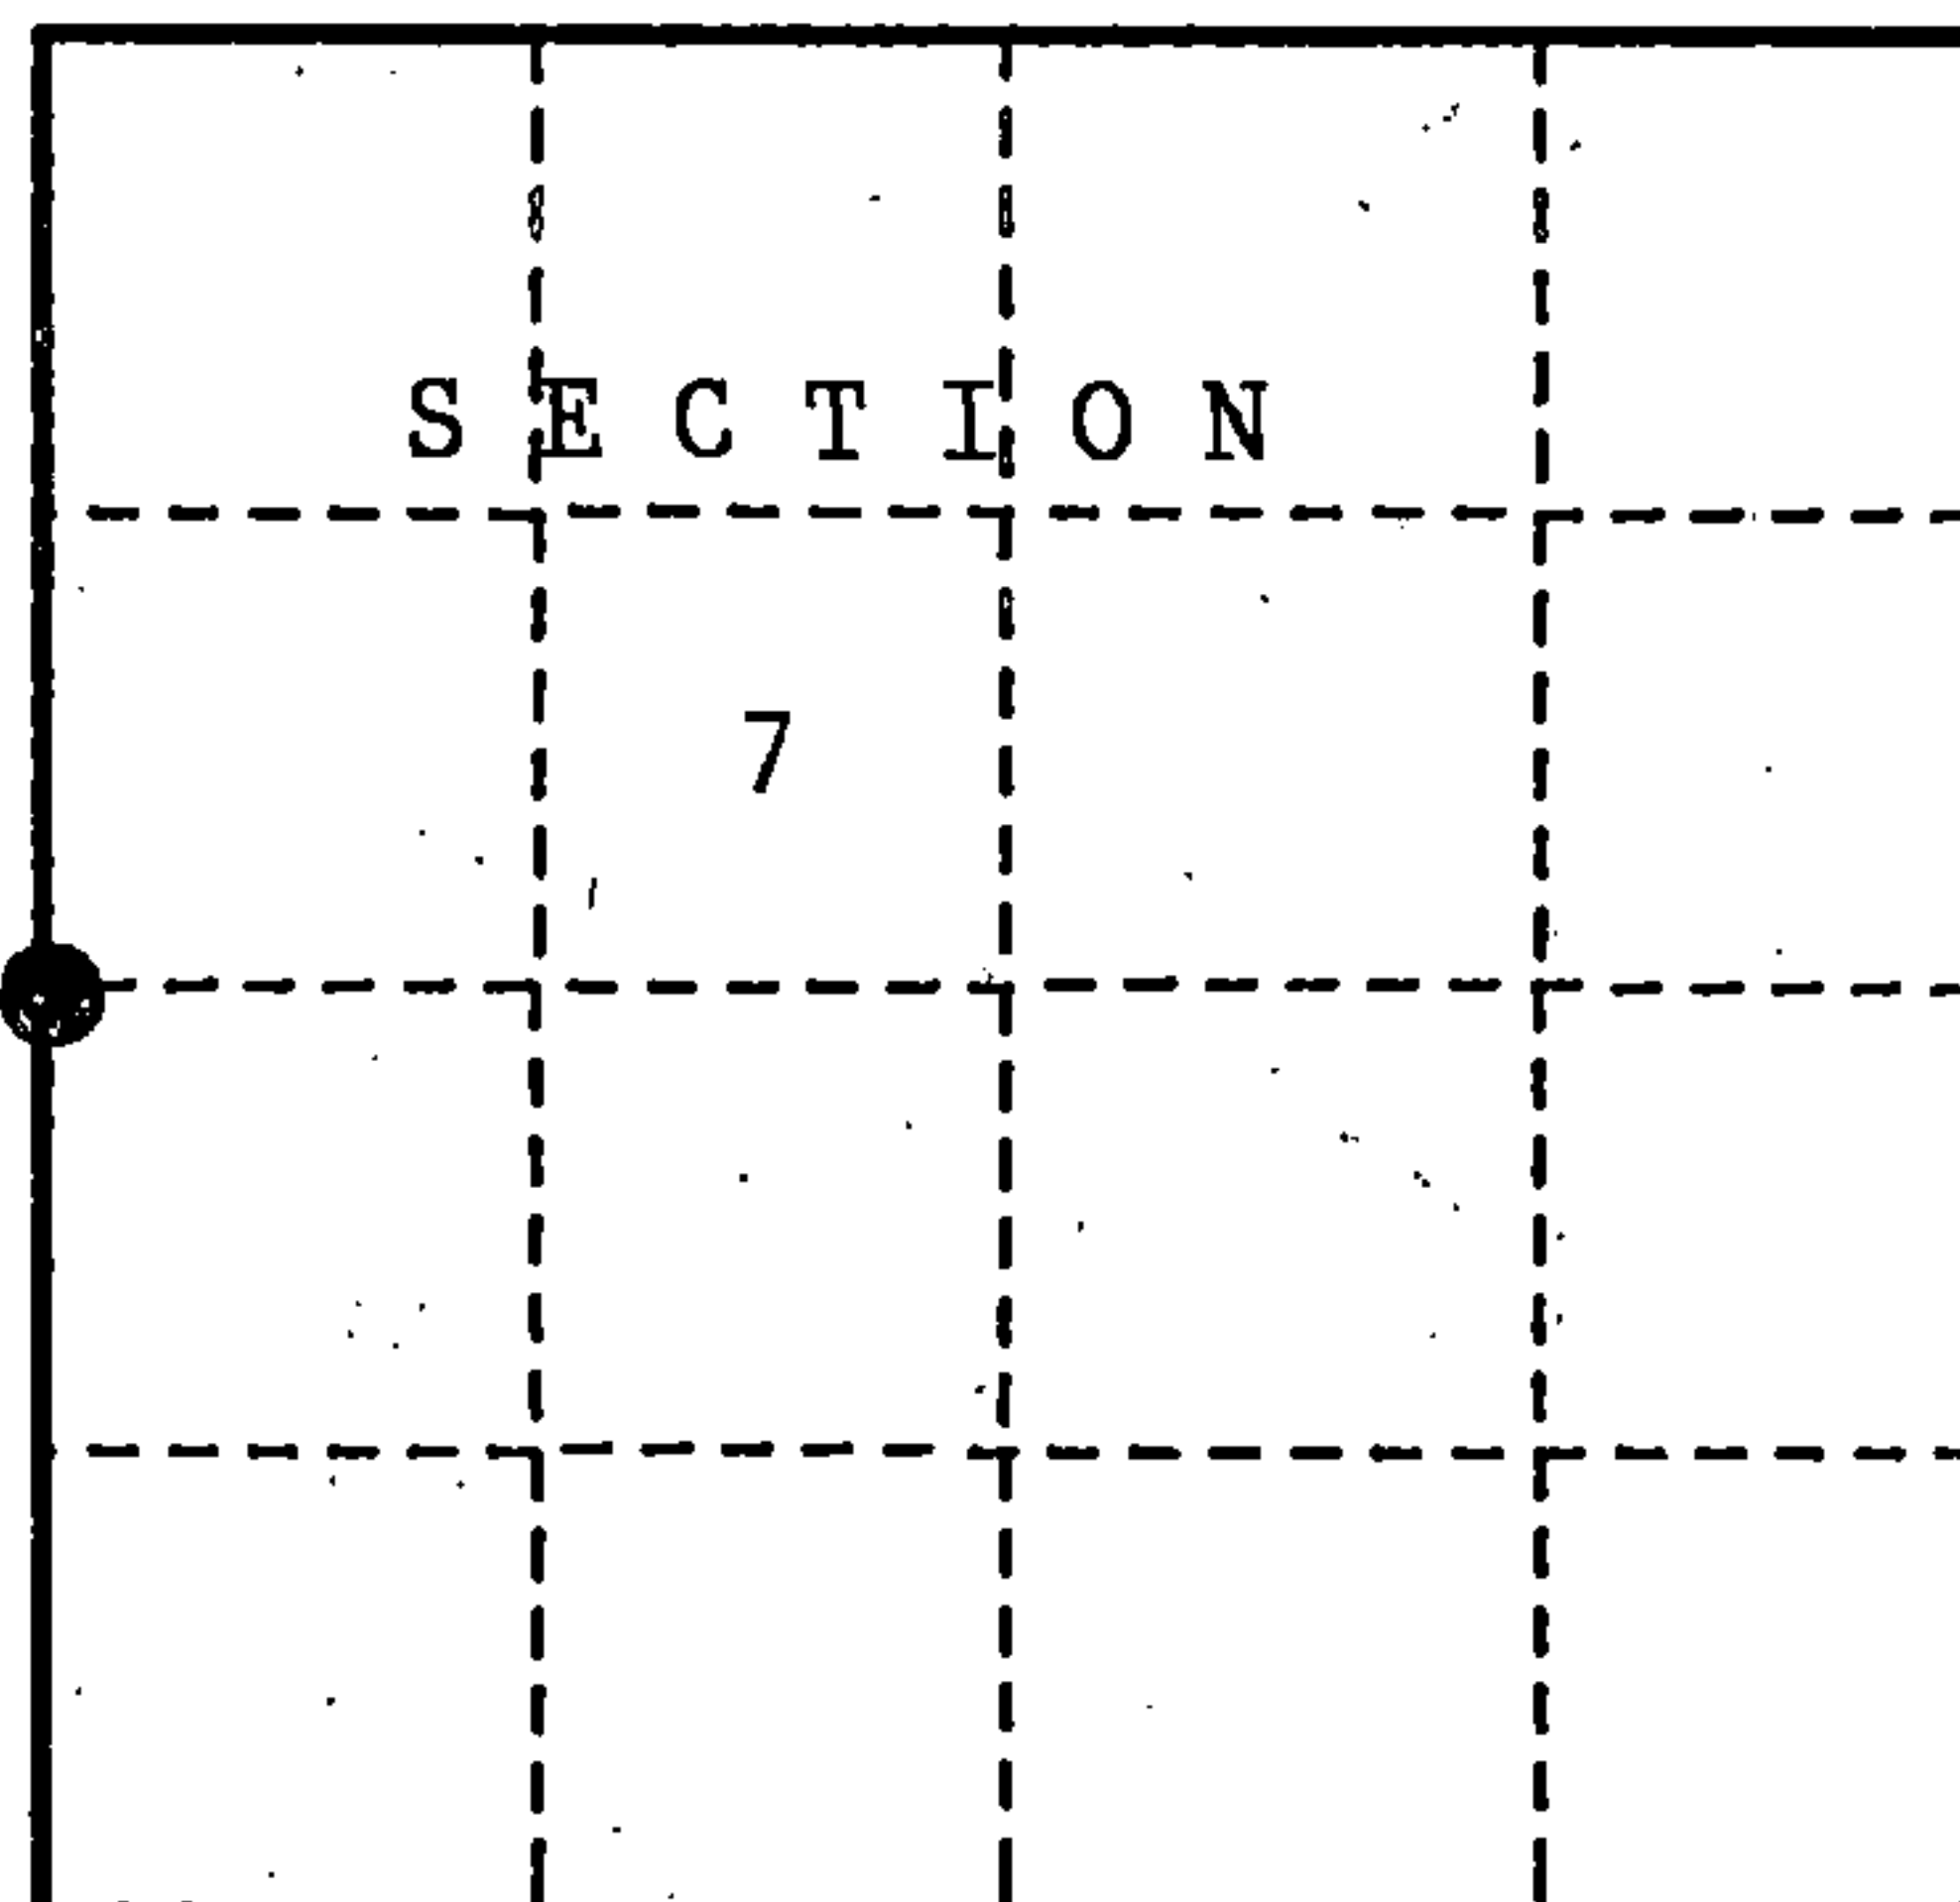

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post at the corner with the following corner references:

Lynn 12" bears N29°W, 20 lks.
 Sugar 15" bears S48°E, 35 lks.

In 1972, Jean Resvick recovered a wooden post with scribing, lying on the ground. Also recovered the following 1857 bearing trees: Basswood clump bears N29°W, 20 lks.

Sugar stump bears S48°E, 35 lks.

Set a 2" dia. galvanized wrought iron pipe, filled with concrete, with a brass cap marked to identify the corner. The following corner references:

Sugar 6" bears N15°E, 19.55 ft.

Hemlock 15" bears S67°W, 35.80 ft.

In 1990, John Schulke recovered monument in place and the following corner references:

Sugar Maple 10" bears N08°E, 35.83 ft. Hemlock 16" bears S77°W, 19.20 ft.


Dead Hemlock 16" bears S74°E, 8.97 ft. Steel Post bears East, 1.3 ft.

The following new bearing tree: Sugar Maple 6" bears S64°E, 22.58 ft.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" dia. galvanized wrought iron pipe with a brass cap stamped to identify the corner.
2. Sugar Maple 10" N08°E 35.83 ft.
3. Hemlock 16" S77°W 19.20 ft.
4. Sugar Maple 6" S64°E 22.58 ft.
5. Steel sign post East 1.3 ft.

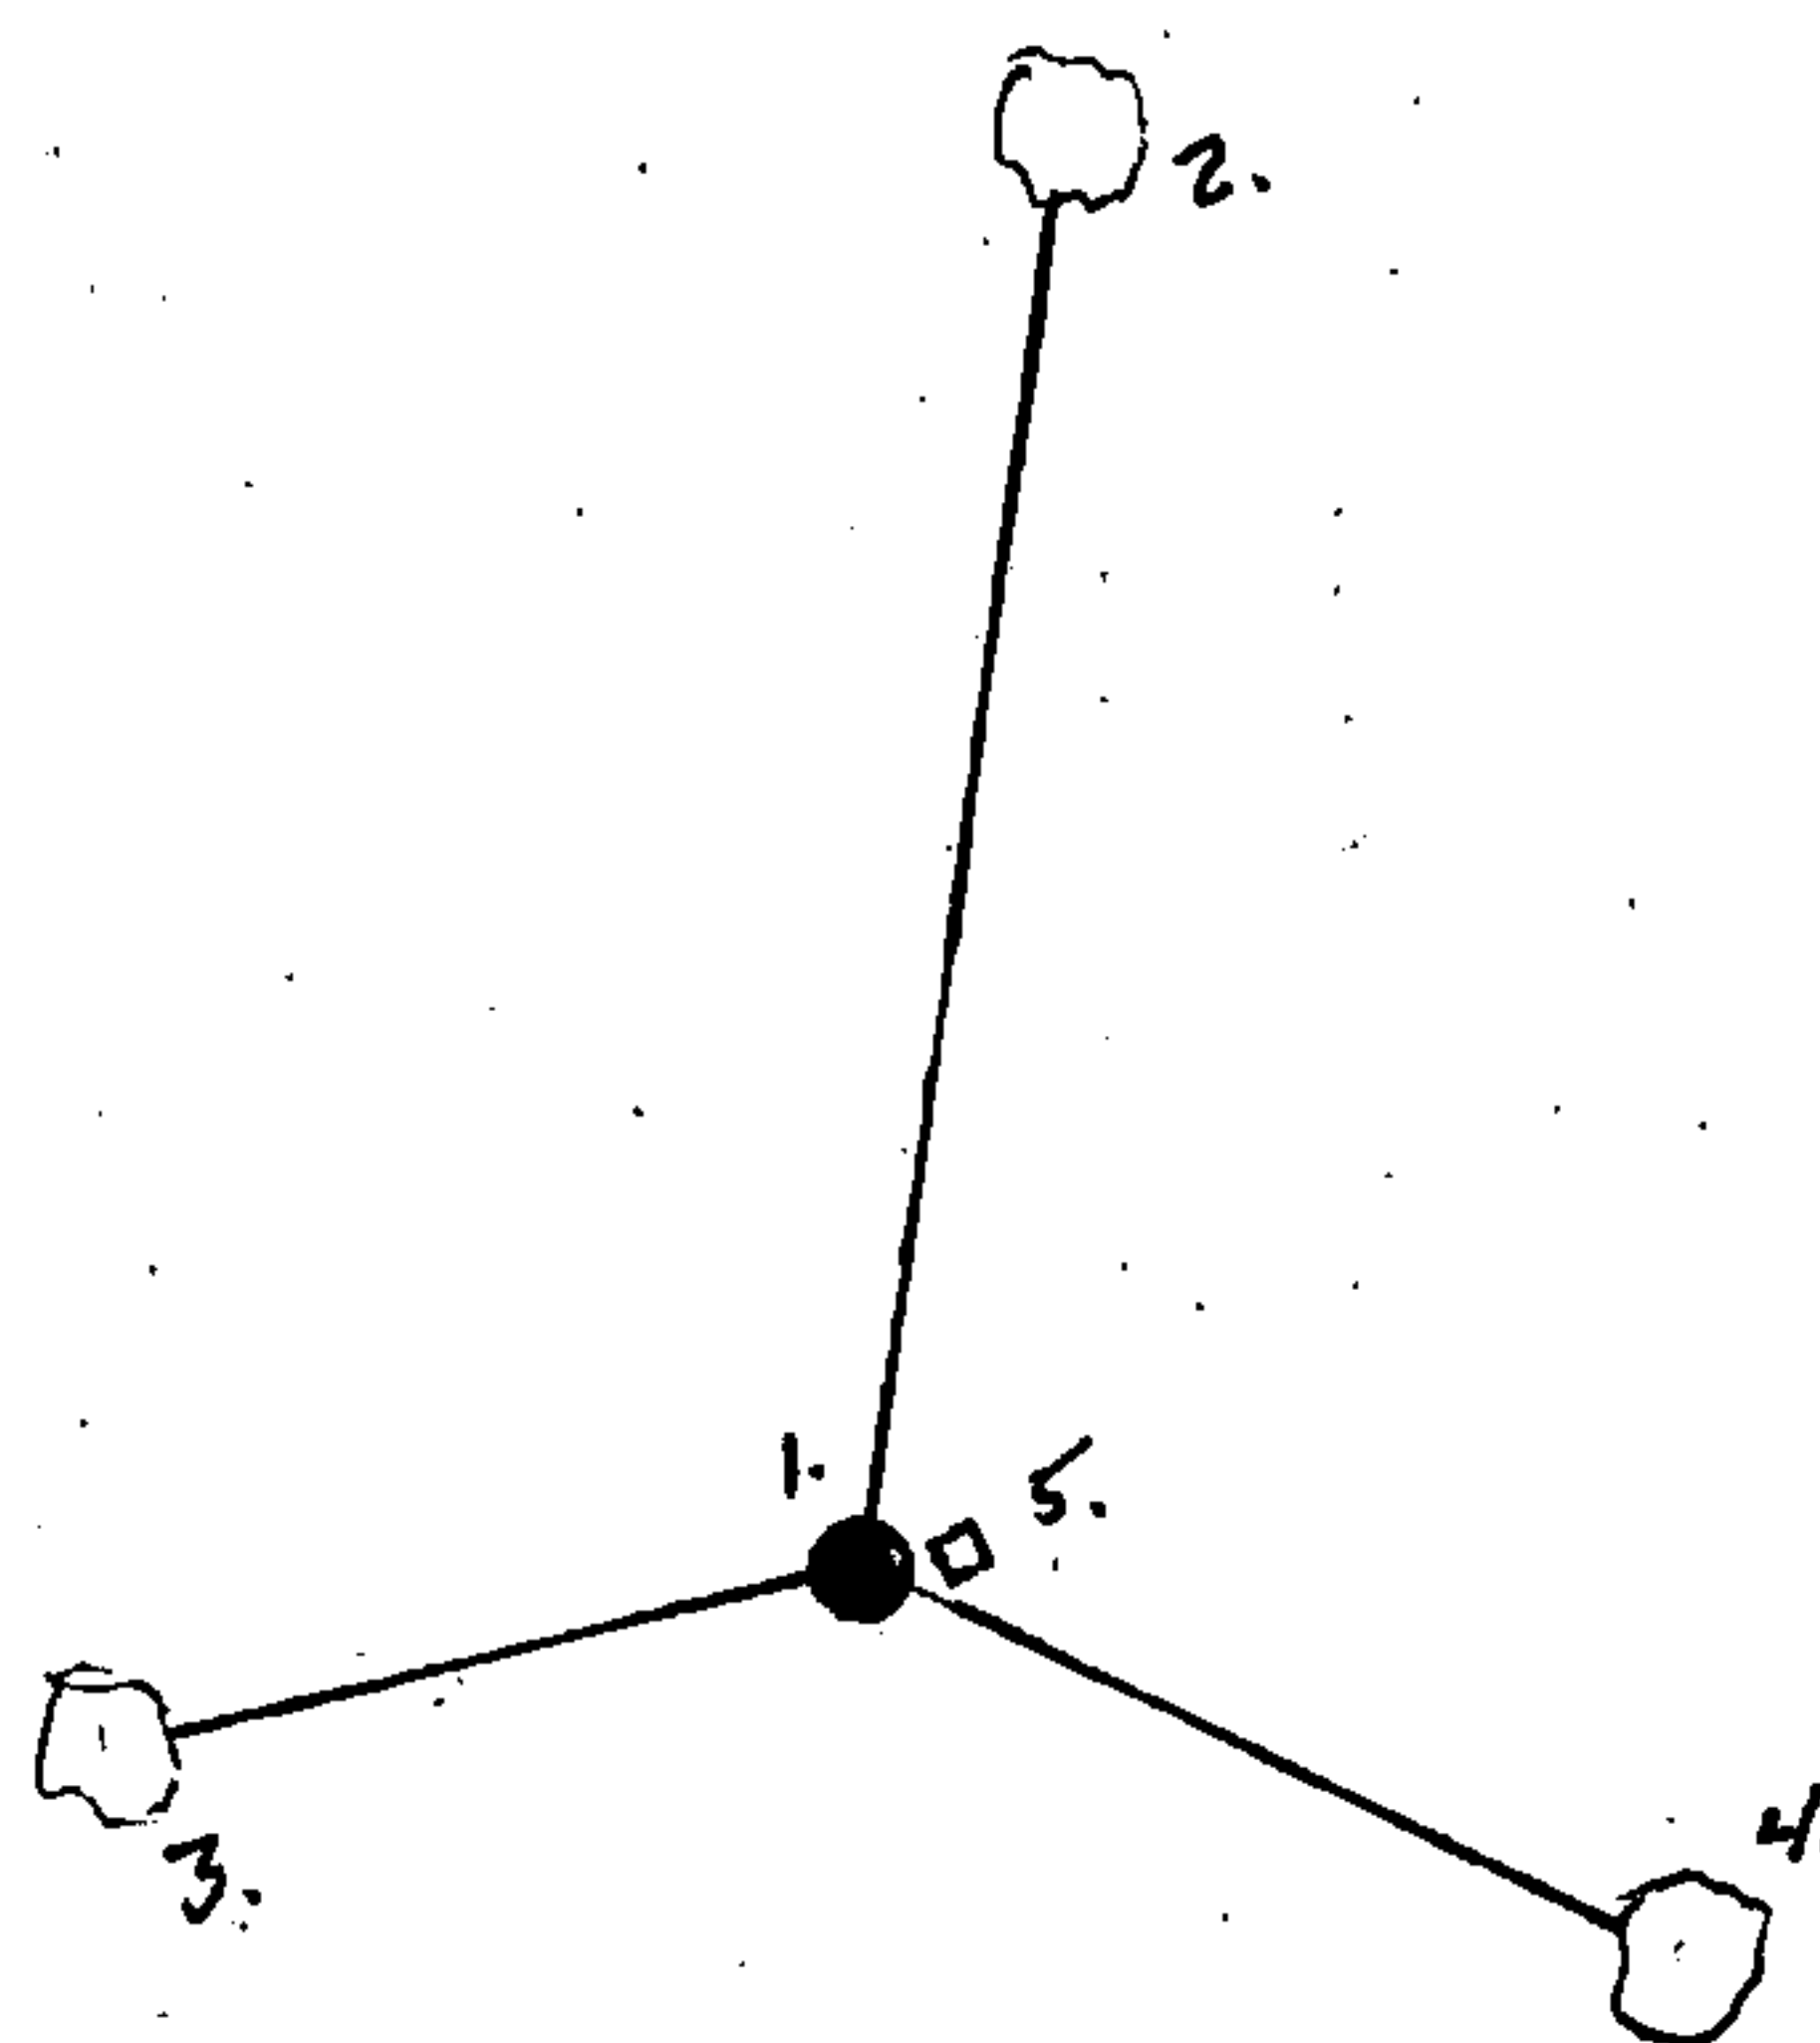

T37N, R15E

T37N, R16E

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 19th day
 of December A.D., 1990 at
8:45 o'clock A.M. and recorded
 in Vol. Corner Restorations
 page 6-1

Paul Asclebrenner
 Register of Deeds

43715122068

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) found perpetuated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO.

(1) I, John Schulke a Register Land Surveyor

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

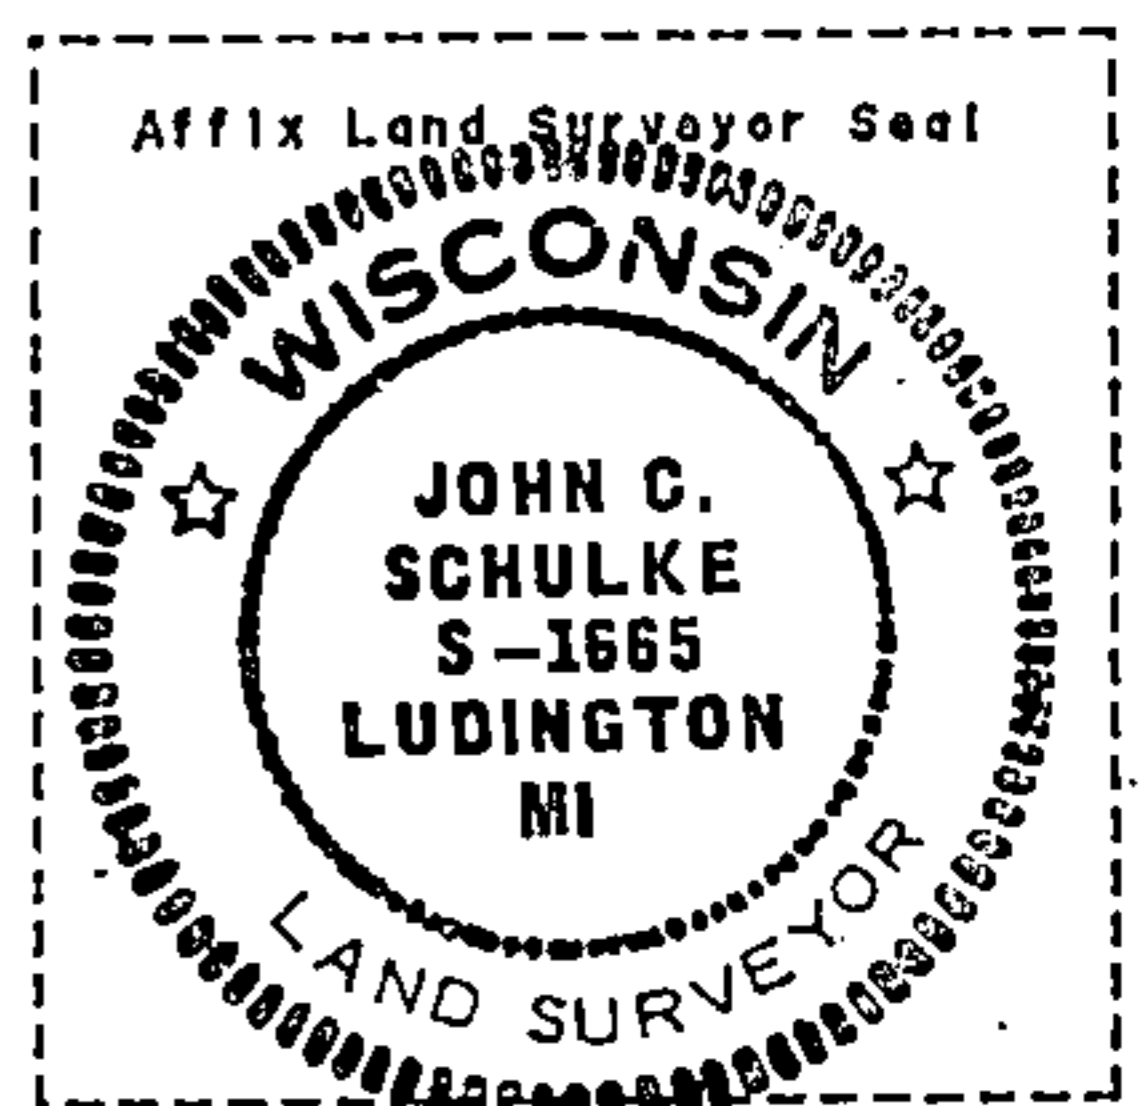

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner common to Sections 12 and 7
 T37N, R15-16E, Forest County, Wisconsin

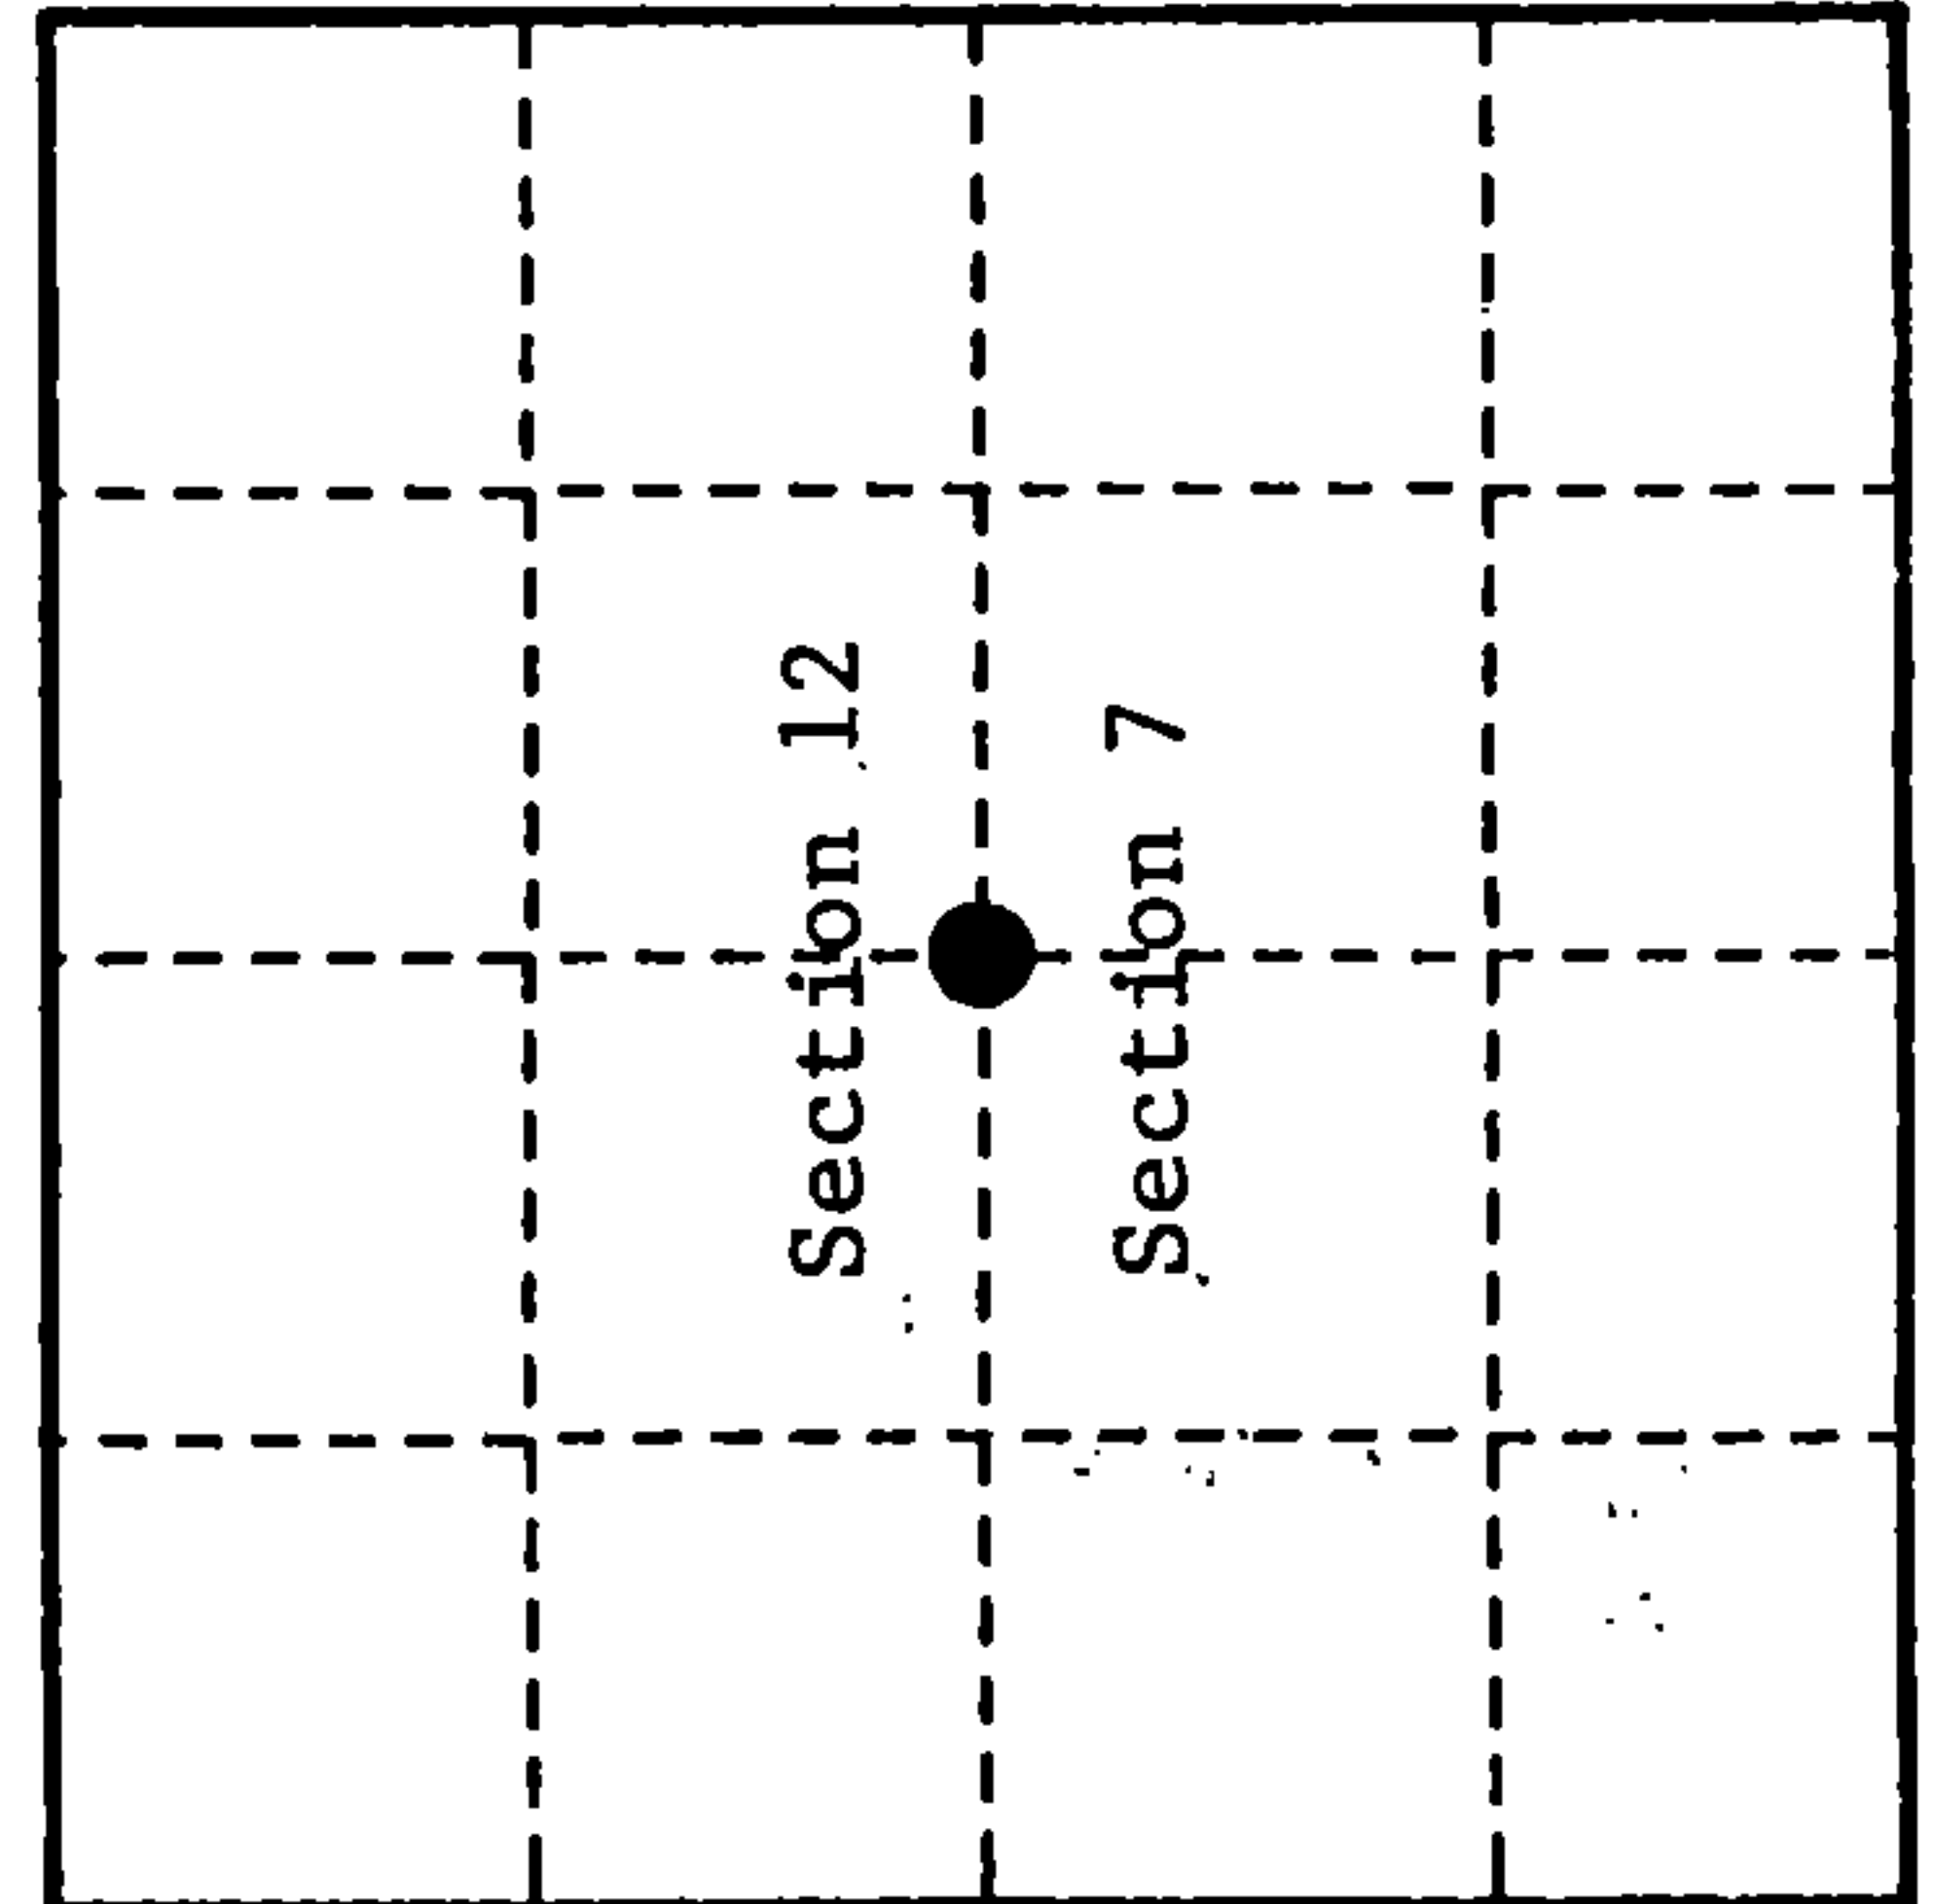

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Government Survey in 1857 by Artemas Curtis.

In 1972, Jean Resvick, a Land Surveyor with the U.S. Forest Service, found a scribed 6" x 6" x 2' wood post lying on ground. From old post hole, found original bearing tree evidence. In place of post, set a 2" diameter galvanized iron pipe, 5 feet long, with a brass cap stamped: T37N, R15E, R16E, 1/4, S12, S7, 1972, S-802 from which the following bear:

Sugar	6"	N 15°E	19.55 feet
Hemlock	15"	S 67°W	35.80 feet
Steel sign post		N 75°E	1.2 feet


On 9/21/99, Gary L. Pisoni RLS, found above monument and assessories as described below.

See previous Land Corner Certificate dated November 21, 1972.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Sugar, 9", N 15°E, 19.55 feet
2. Hemlock, 17", S 67°W, 35.80 feet
3. Steel sign post, N 75°E, 1.2 feet
4. Sugar Maple, 7", S 58°E, 22.59 feet (NBT)

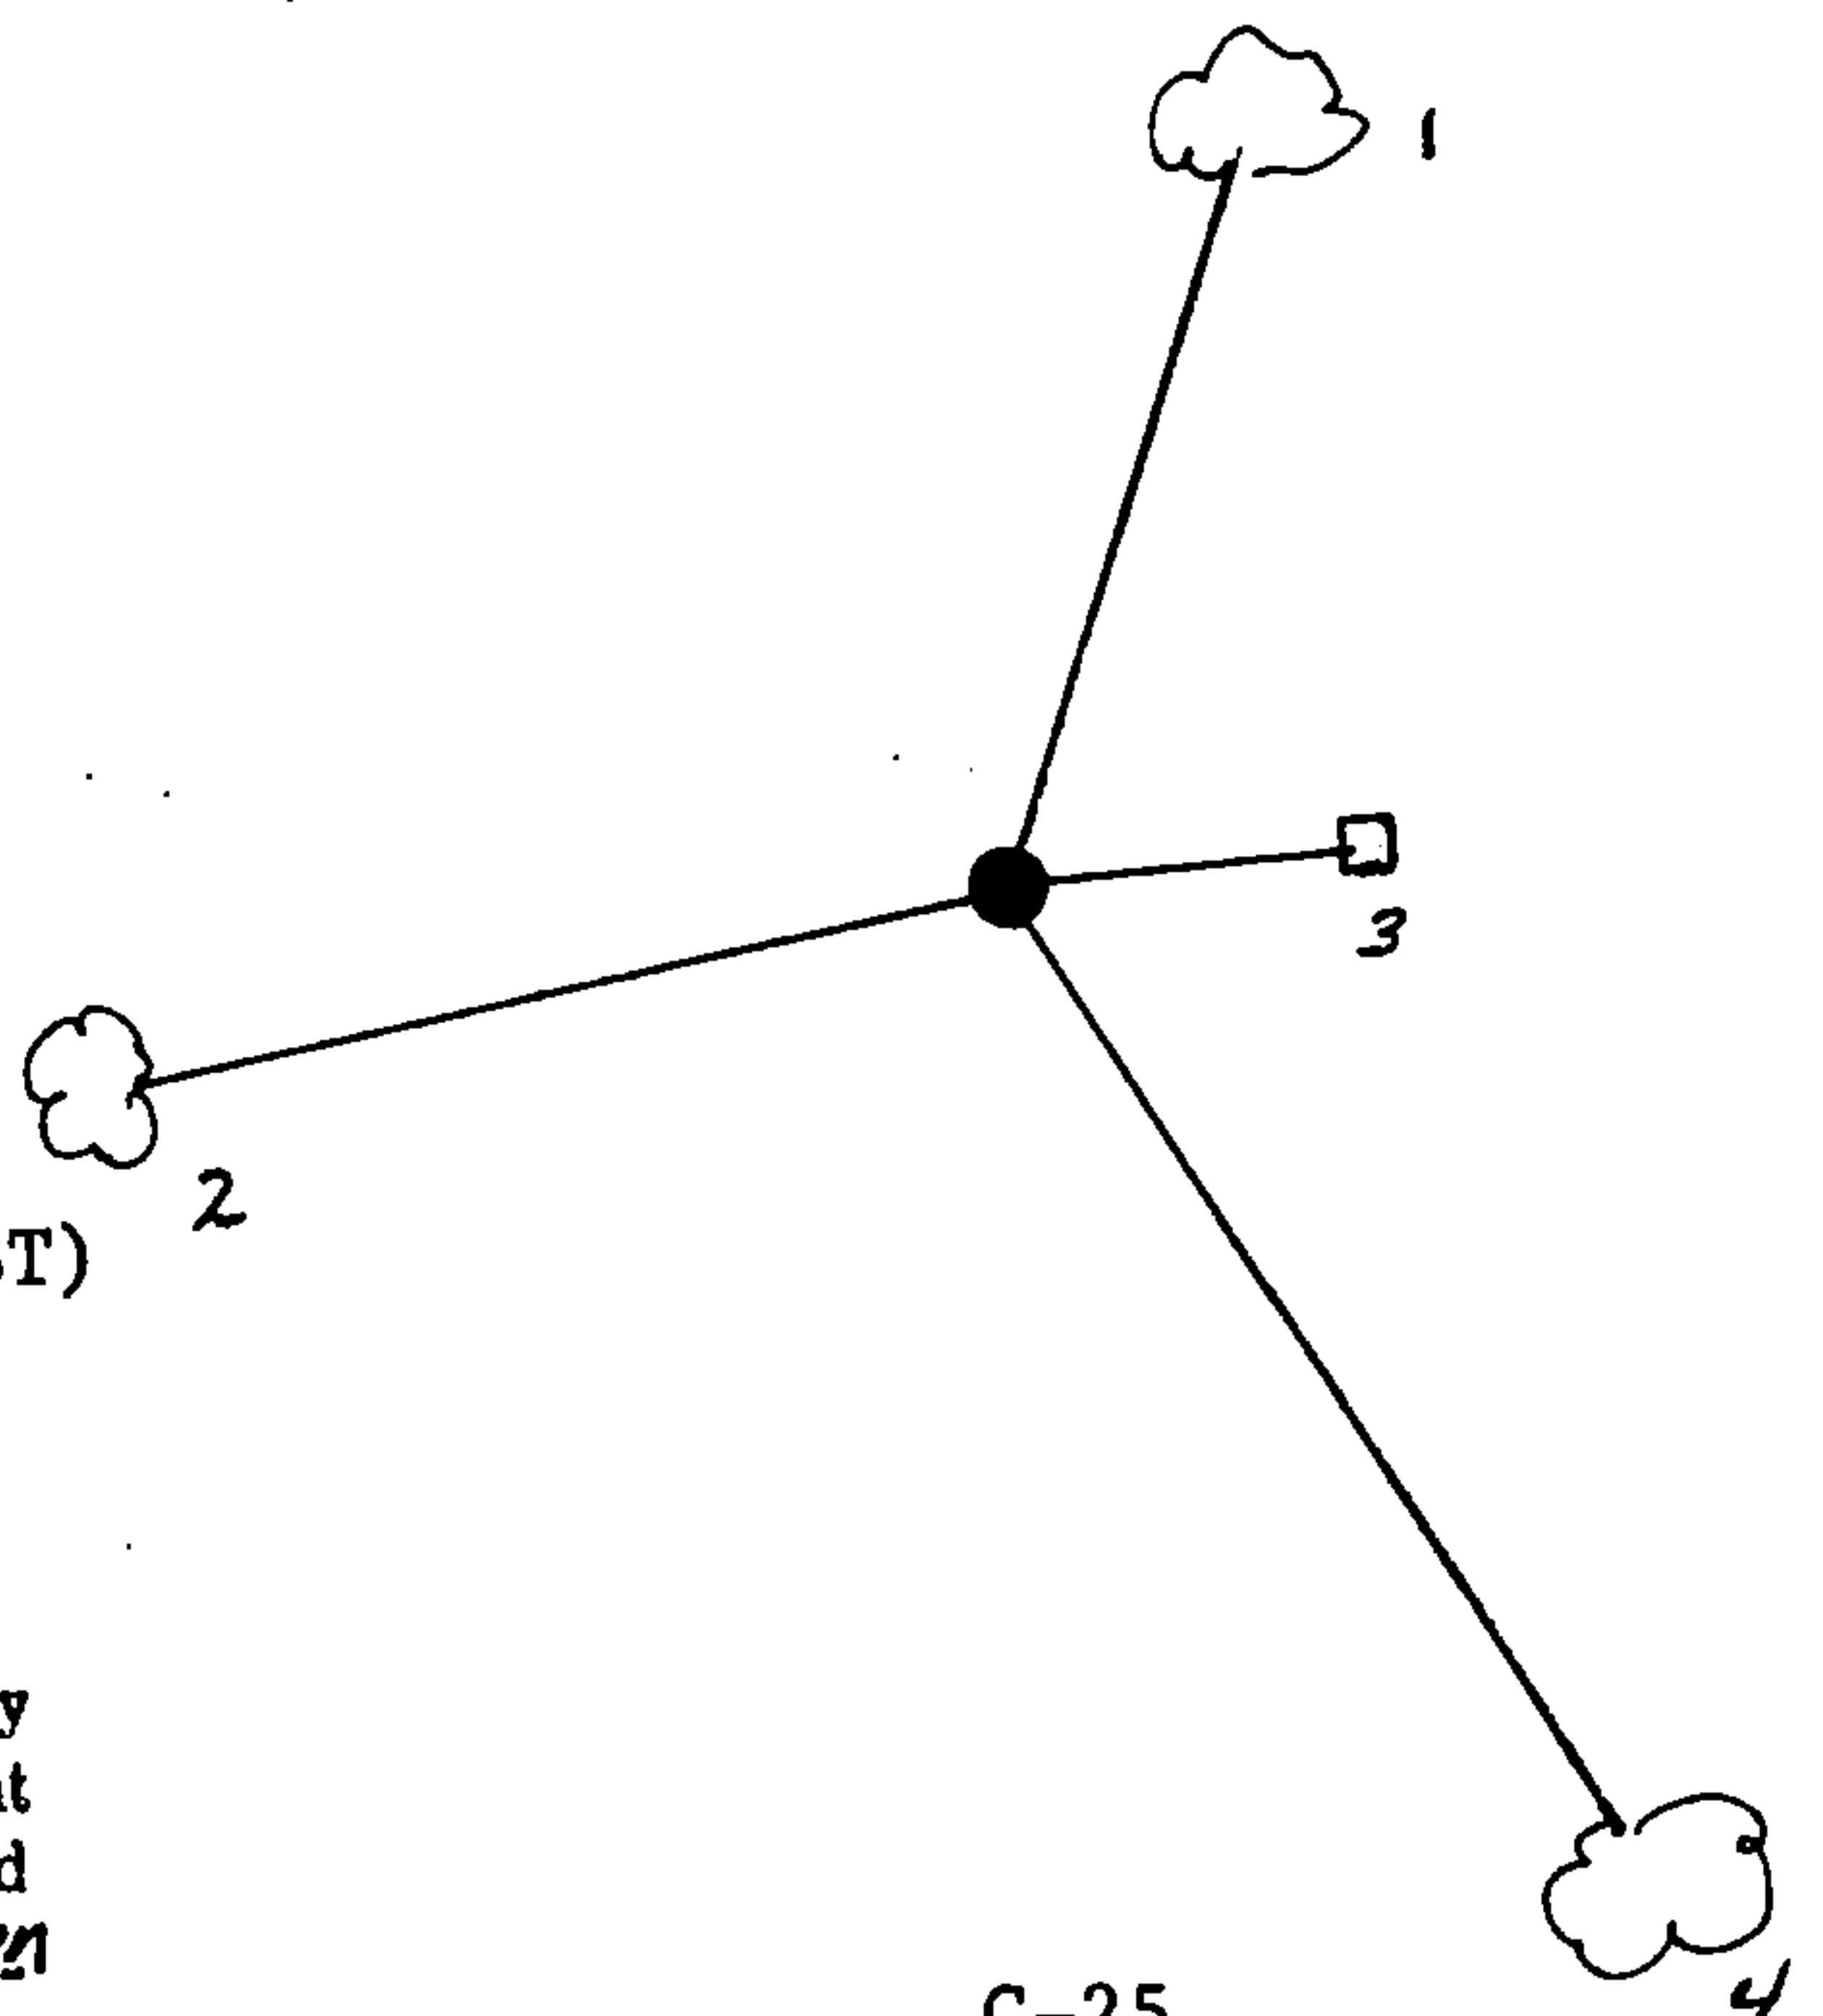

REGISTER'S OFFICE
 Forest County, Wis.
 Received for record this 27th day
 of October A.D. 1999 at
10:05 o'clock A.M. and recorded
 in Vol. Corner Restoration
 page G-25

Kay Swanson Deputy
 Register of Deeds

G-25

4 371512 2000

G-25

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from accepted evidence.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

- (1) I, Gary L. Pisoni
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

10-1-99

Date

CERTIFICATE READY FOR FILING:

District Ranger

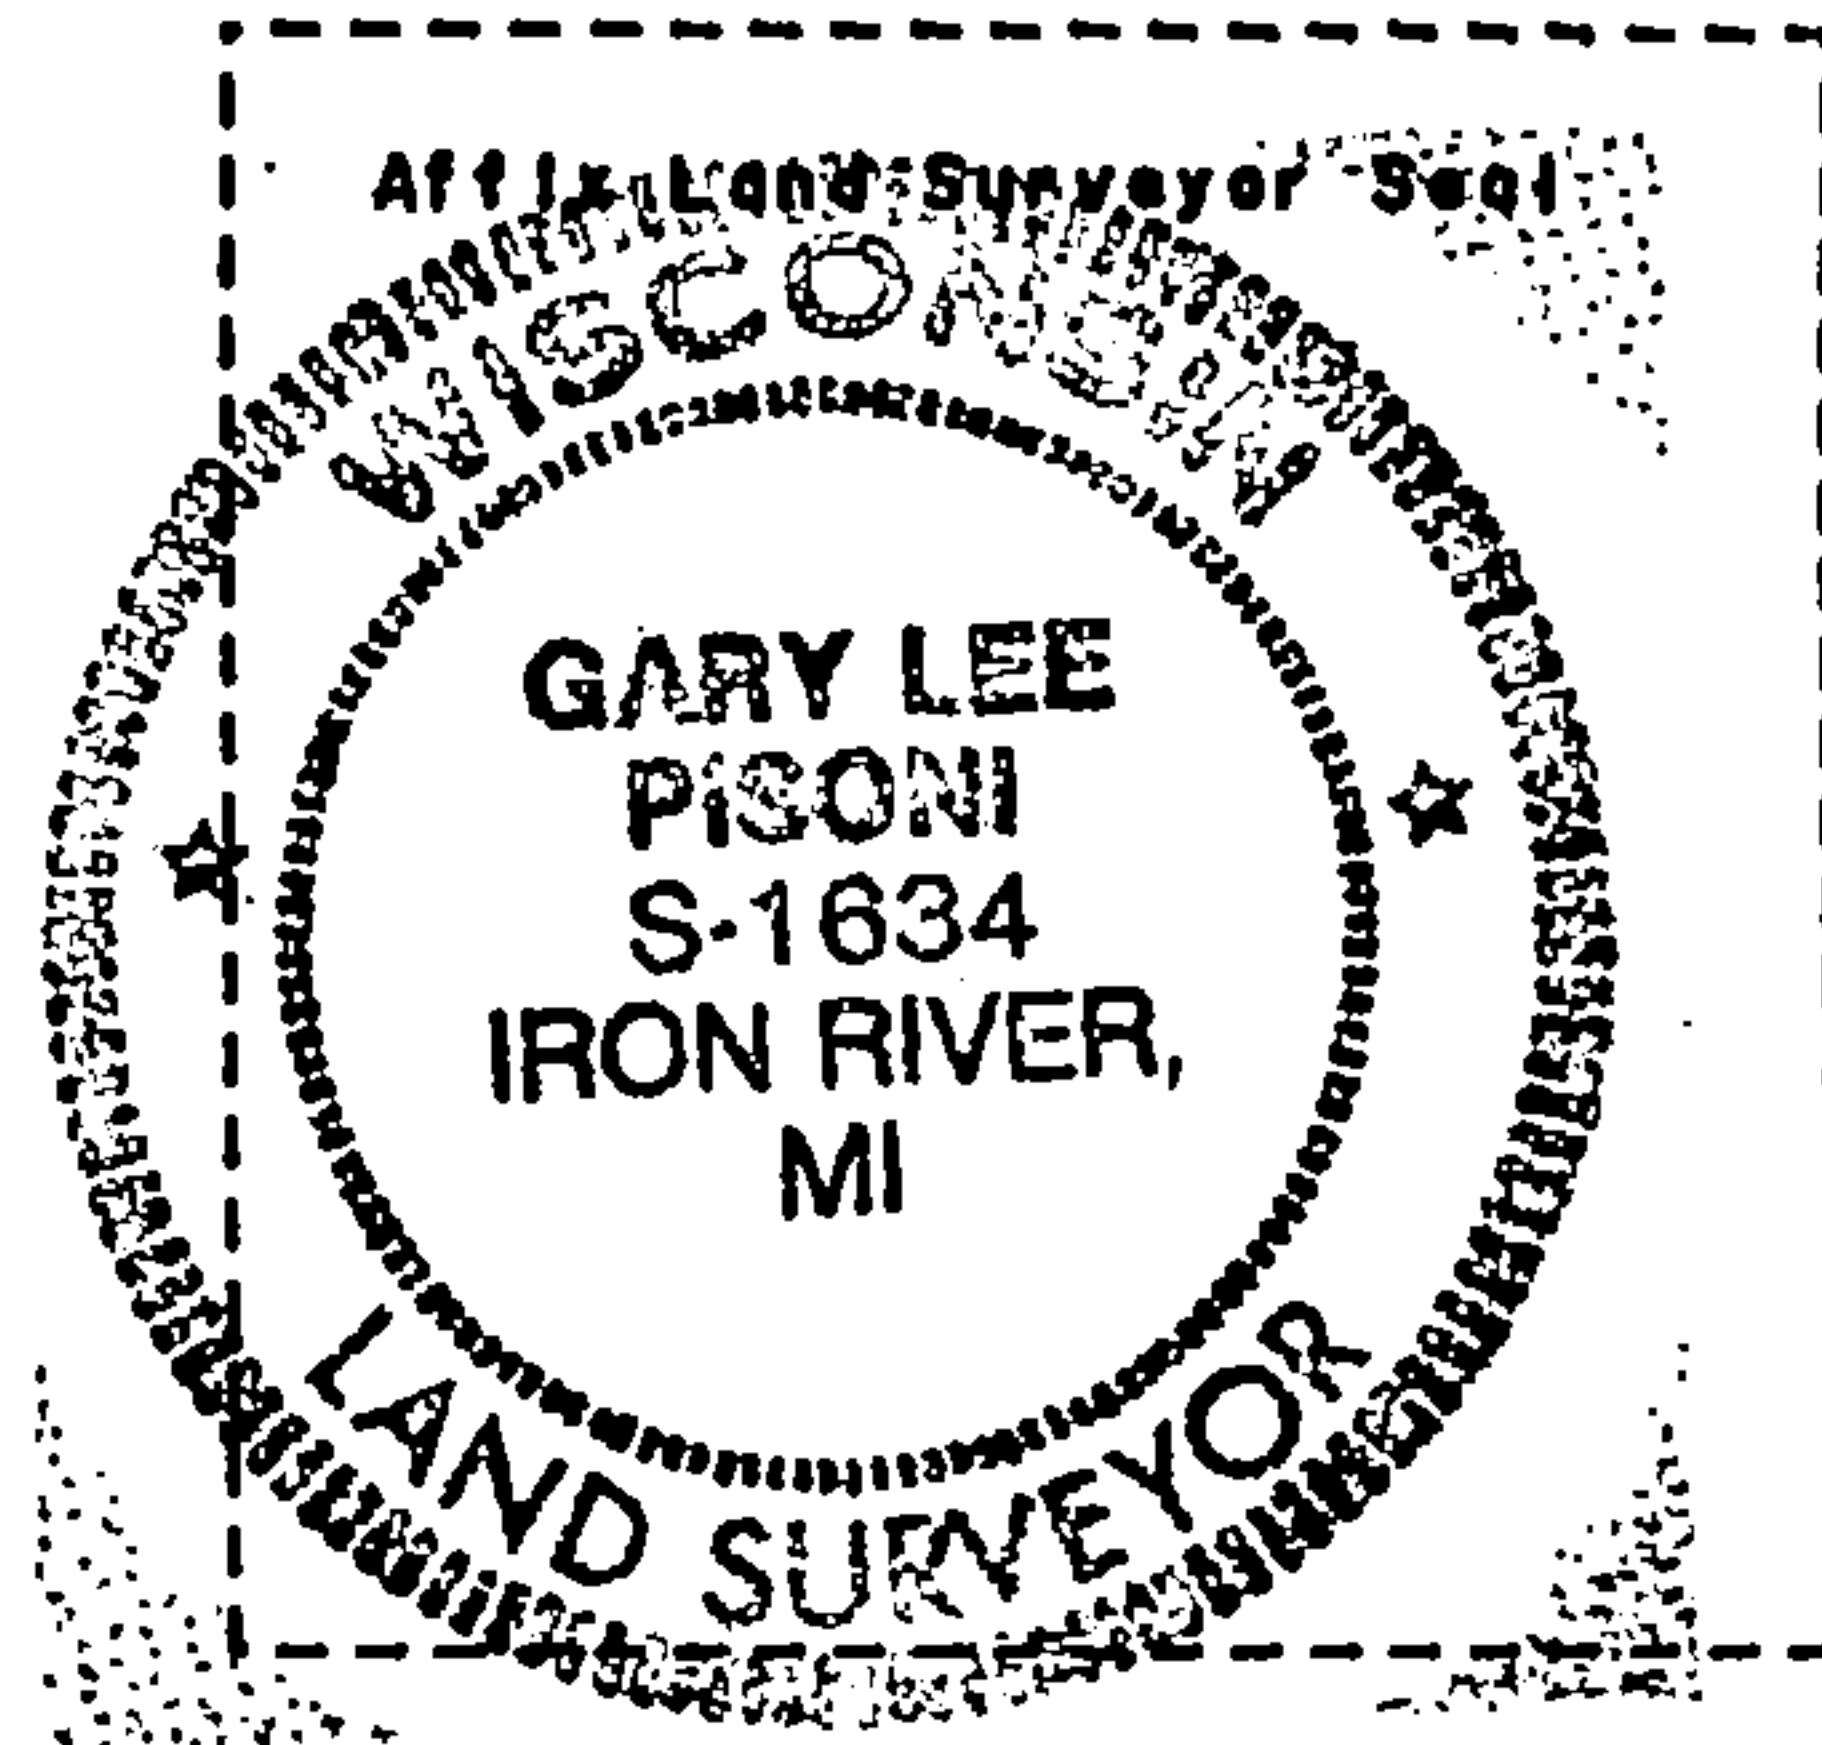

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

SS.

I Jean F. Resvick, do hereby certify that on the 25th day of July, 19 72,
I found evidence of the East Quarter corner of Section 12
Township 37 North, Range 15 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.

North between sections 7 and 12. 40.0 chains set quarter section post between sections
7 and 12.

Lynn 12", N29W, 20 lks.


Sugar 15", S48E, 35 lks.

Description of corner evidence found:

Scribed 6"x6"x2' post. Post is rotten and lying on the ground. From old post hole
a bass wood clump growing from a 24 inch basswood stump, bears N29W, 20 lks.
a large rotten sugar stump bears, S48E, 35 lks.


Description of monument and accessories I established to perpetuate the original location of this corner:

At the old post hole found, I set a 2 inch inside diam. galvanized wrought iron pipe,
5 feet long, filled with concrete, with a brass cap marked:

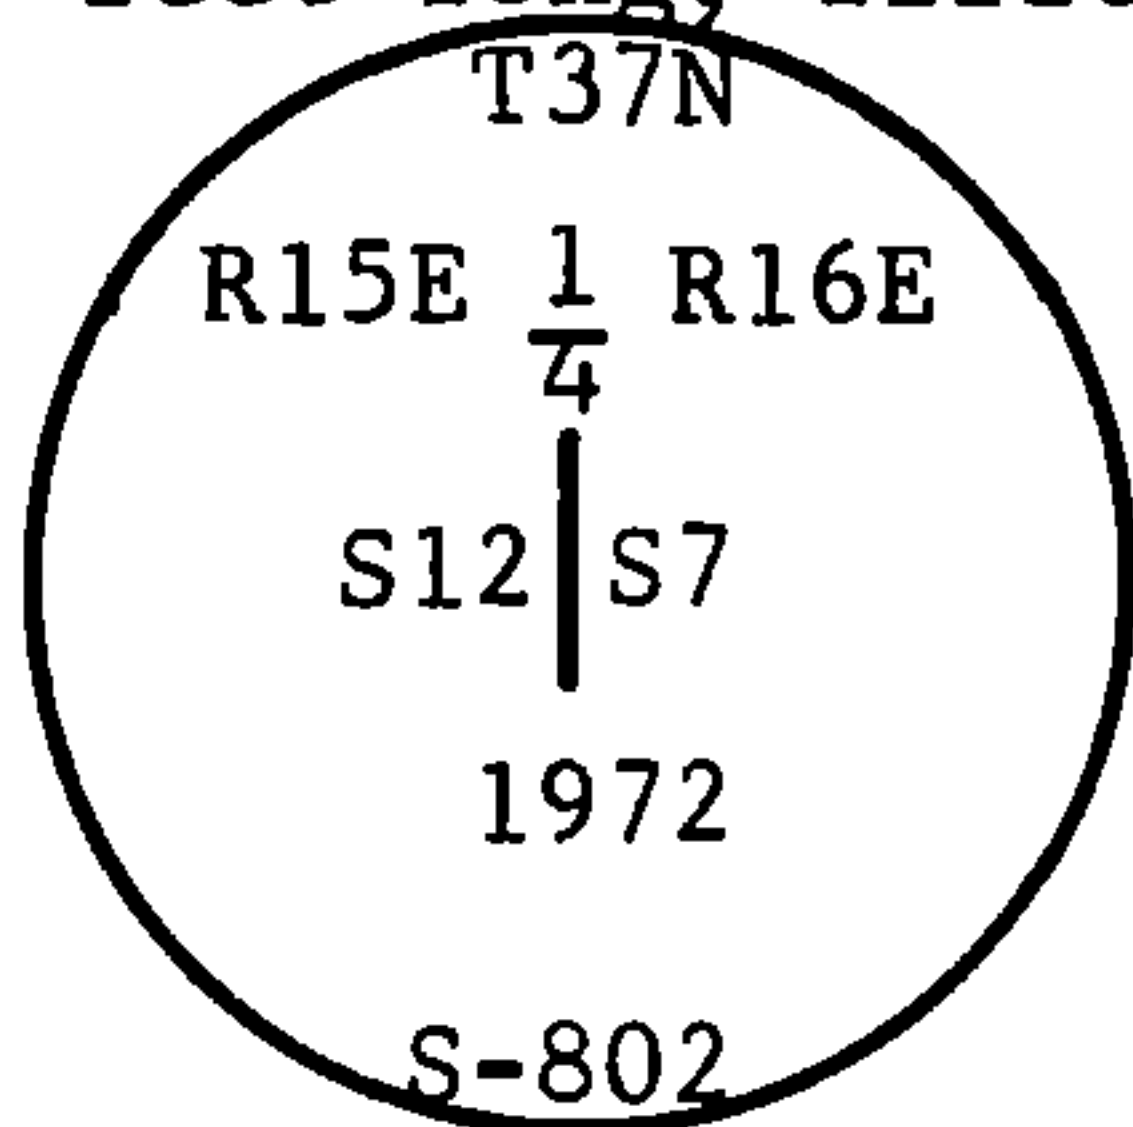

From which the following accessories bear:

Sugar, 6", N15°E, 19.55 feet
Hemlock, 15", S67°W, 35.80 feet

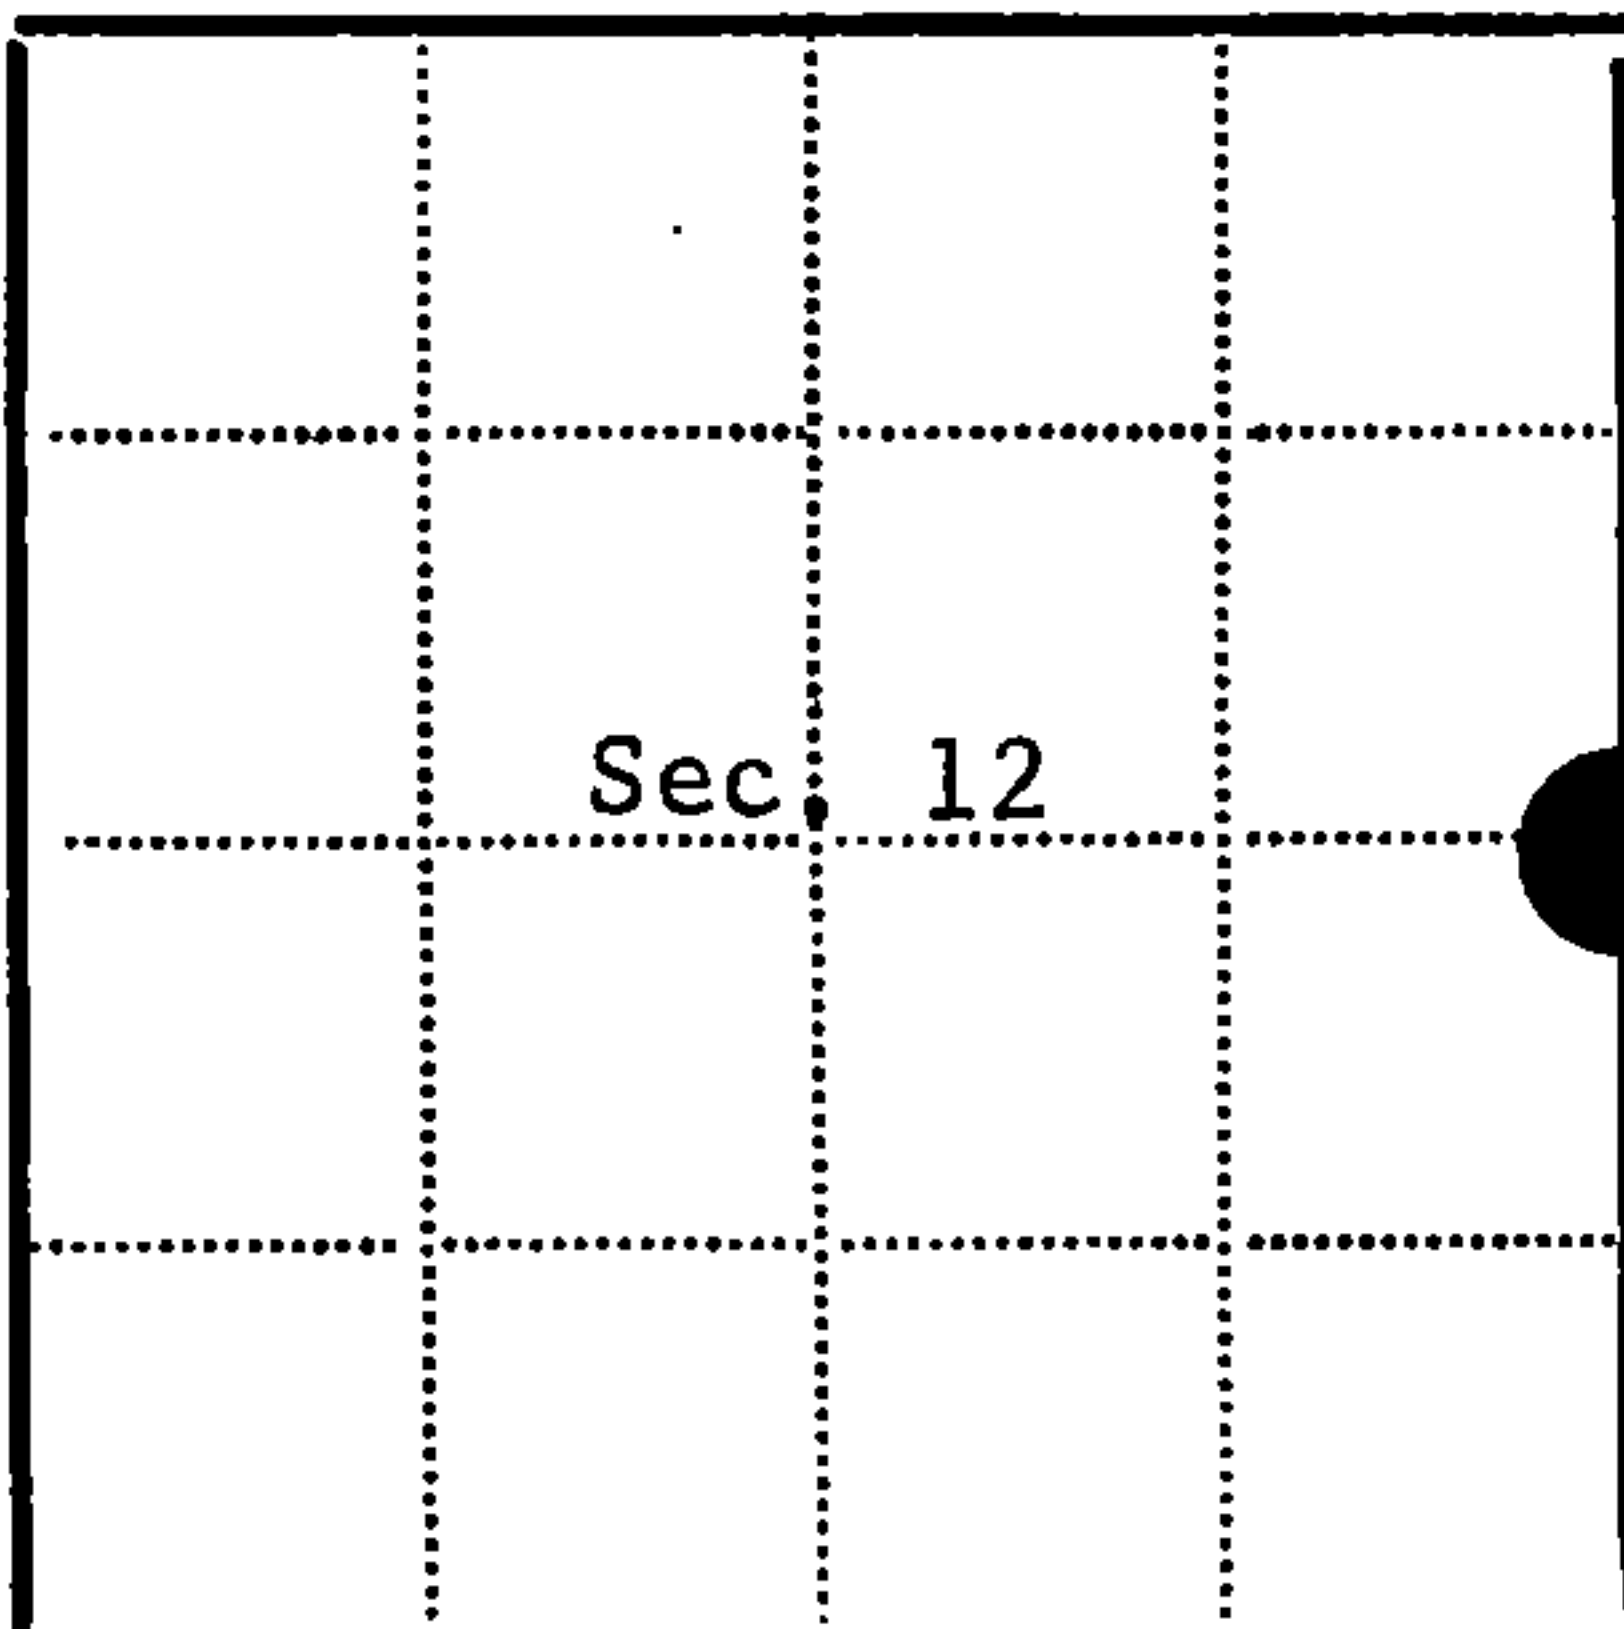

● = Corner monument restored

□ =

Resident witnesses

Dated at Rhineland Wisconsin, this 24th day of November,
19 72.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

DOCUMENT NUMBER

102912

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
on the 15th day of February, 19 73, and was filed in Book
No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 37 North, Range 15 East, Section 12, Index No. G-25, Page No. _____

46715122000

25