State of Wisconsin	
County of Forest	SS.
certify that on the 2nd of August , 19.83 evidence of the Southwest Section corner of Section 12 Township 38 , Nort 14 East , Fourth Principal I as described hereon; and that from this I established a new monument and as as described hereon to perpetuate the location of this corner.	day I found h, Range Meridian, evidence ccessories
Resident witnesses:	
David Brownell	
~**	
i i i	
CECTION 12	
SECTION -12+-	
	· - -

History of original corner establishment: Original Government Survey in 1865 by H.& J.L. Nowlin. North between Sections 13 and 14, 80.00 chains, set Section Corner post to Sections 11, 12, 13, and 14, from which the following bear: 14" 12 1ks. Cedar N12°W 10" N39°E 13 1ks. Fir Description of corner evidence found: Old Hwy 139 bears North and South, Forest Road #2593 bears West, and Forest Road #2397 bears East. I accept the intersection of these roads as the best available evidence for restoring the corner position. No original corner evidence was recovered. Description of monument and accessories I established to perpetuate the original location of this corner. At the restored corner position, set a $2\frac{1}{2}$ " diameter aluminum pipe monument, 3 feet long, 3½ feet in the ground, with an aluminum cap stamped: T38N R14E, S11, S12, S13, S14, 1983, S-1107. From which the following new blazed and scribed bearing trees bear: N51°E 60.47 feet B. Ash S 7°E 124.41 feet Spruce S54°W 32.69 feet Power Pole #78-2468

Dated at <u>Hiles</u>	Wis., this	28th	day of	March		1985
Signature William B. Ochson (County Surveyor, Registered	-		•			•
Office of Register of Deeds, County of nstrument was filed in this office for recor	Fores	st 24th	day	of April	ereby certify that	the within 19.85
t 1:00 o'clock P. M.						
Faul Ascheni (Register of Deeds)	renn	er/				
3y		Dep	uty			


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from accepted evidence.

(9&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

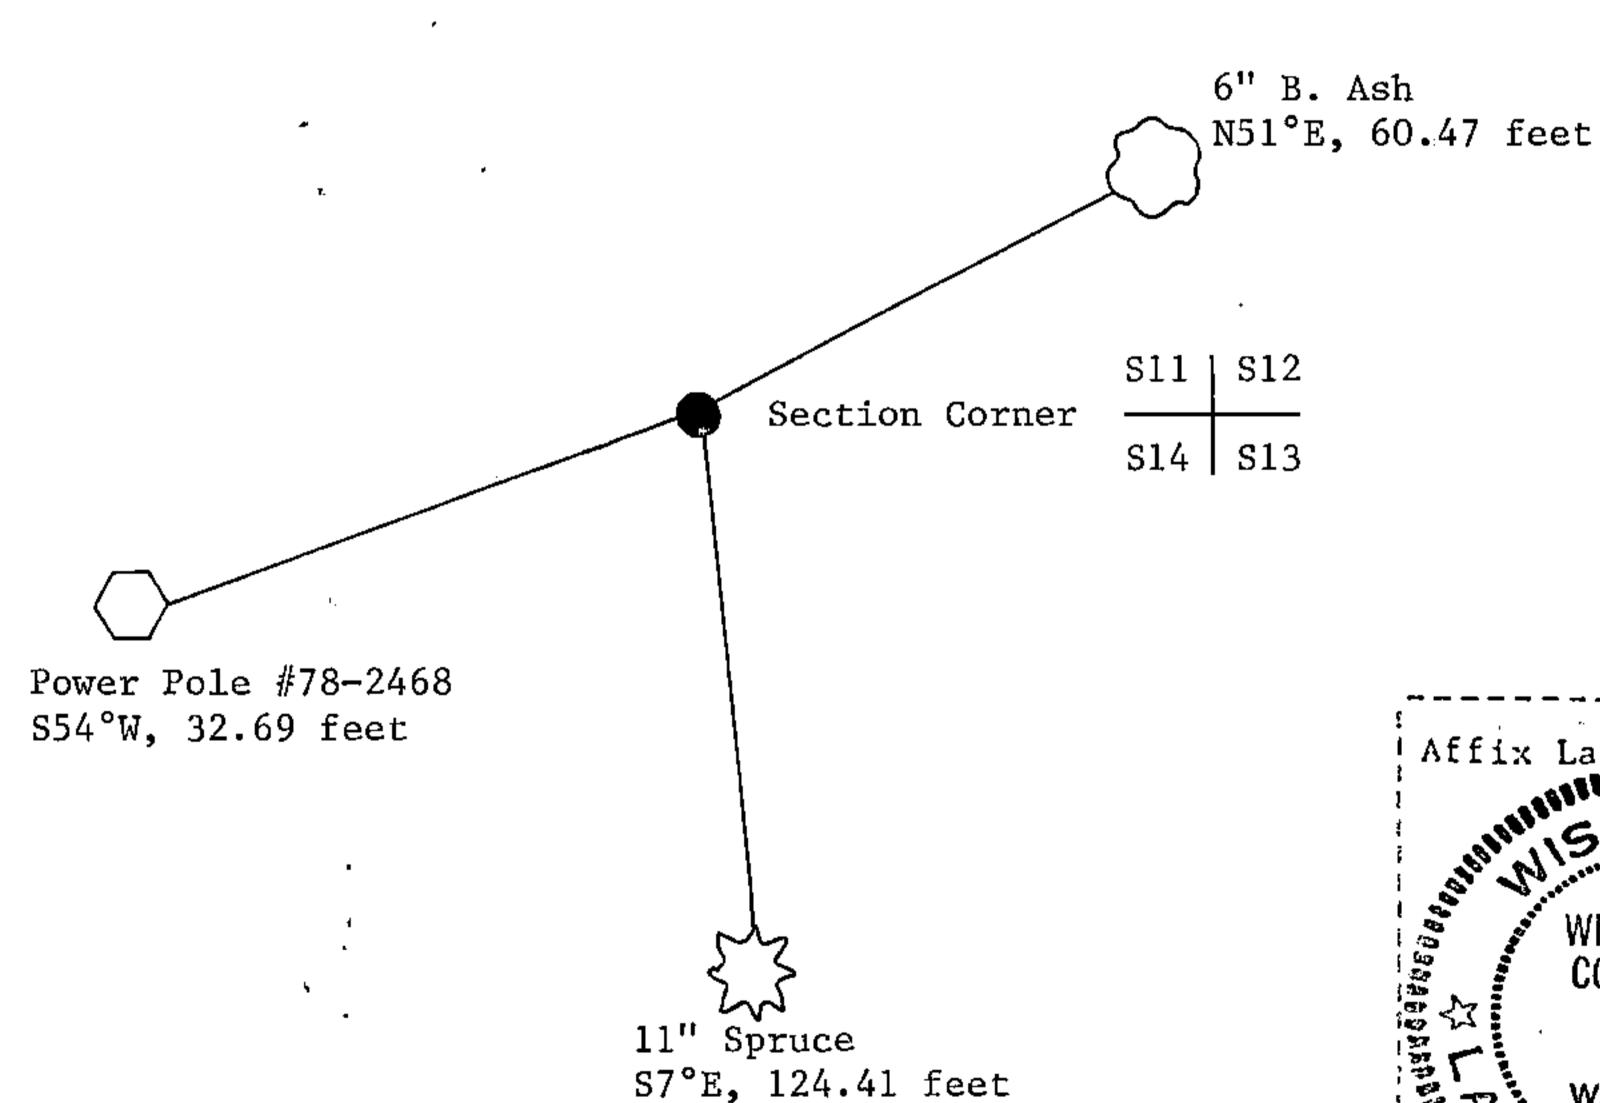

(i) I. William B. Cochrane

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is

William B. Cochrane March 28 1985

Affix Land Surveyor Send

WILLIAM B.

COCHRANE

S-1107

HILES,

WISCONSIN