FORM NO. 985-A

US	PUBLIC.	LAND	SURVEY	MONUMENT	RECORE
U. U.	1 OPFIC	LAND	2017 4 [1	INCIACIAITIA	NECONE

		Λ_	1
Index	No	A-	1

			0.0.					
State	of Wisc	onsin						
County of	Forest		} ss.					
certify that of April evidence of t corner of	he North Section 37, Forereon; and a new month	6th, 19 west Sect 6, I burth Princip that from onument an	North, Range pal Meridian, this evidence d accessories the original					
Resident wit	nesses:							
David Brow	me11							

		·						

• •		I						
		I I	1 -					
		I	1					
		1						
	\		<u> </u>					
	SE G FI	ON- 6						
i		1						
		!	<u> </u>					
		l I						
!								

ent restored.

History of original corner establishment:

Original Government Survey in 1857 by Artemas Curtis. In 1972, Jean Resvick, a Land Surveyor with the U.S. Forest Service, foune a 6"x6" scribed cedar post in concurrence with original B.T. evidence. In place of post set a 2" diameter galavanized iron pipe, with a brass cap stamped: T38N, R15E, R16E, T37N, S1, S6, S31, S36, 1972, S-802. From which the following bear:

Cedar	5"	N55°E	22.79 feet					
Cedar	14"	S65°E	17.77 feet					
Cedar	12"	S73°E	7.56 feet					
Cedar Description of corner	9" evidence found:	N14°W	18.83 feet	Stee1	sign post,	SW,	1.00	fee

Monument as described and in place, from which the following bear: Steel sign post SW 1.00 feet

All of the above bearing trees were cut down for the Photo Project.

Description of monument and accessories I established to perpetuate the original location of this corner.

 Blazed and scribed the following new bearing trees:

 Cedar
 8"
 N 7°E
 40.65 feet

 Cedar
 12"
 S 4°E
 55.26 feet

 Cedar
 11"
 S57°W
 46.25 feet

 Spruce
 6"
 N72°W
 56.77 feet

Dated at Hiles	, Wis., this. 8th	day of	March	
Dated at Hiles William B. Coch Signature William B. Cochrane	lane I and Summer		_	C 1107
(County Surveyor, Registe	cred Land Surveyor, or other	duly authorized off	Reg ficial)	gistration No. 5-110/
Office of Register of Deeds, County of instrument was filed in this office for re	Forest		, I hereby	certify that the within
instrument was filed in this office for reat 1:00 o'clock P. M.	cord on the 24th	day of	f April	1985
	^			
Paul Aschent		·		
(Register of Dee	ds)			


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(r) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored through acceptance of a foune perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

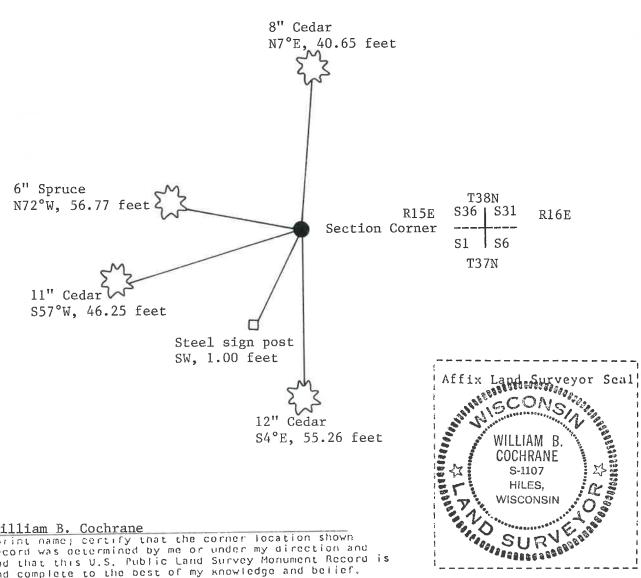

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

March 8, 1985 William B. Cochrane