


Stock No. 26273

156581

State of Wisconsin }
County of Forest } ss.
William B. Cochran, do hereby
certify that on the 29th day
of July, 1994, I found
evidence of the East Quarter
corner of Section 28
Township 39 North, Range
13 east, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

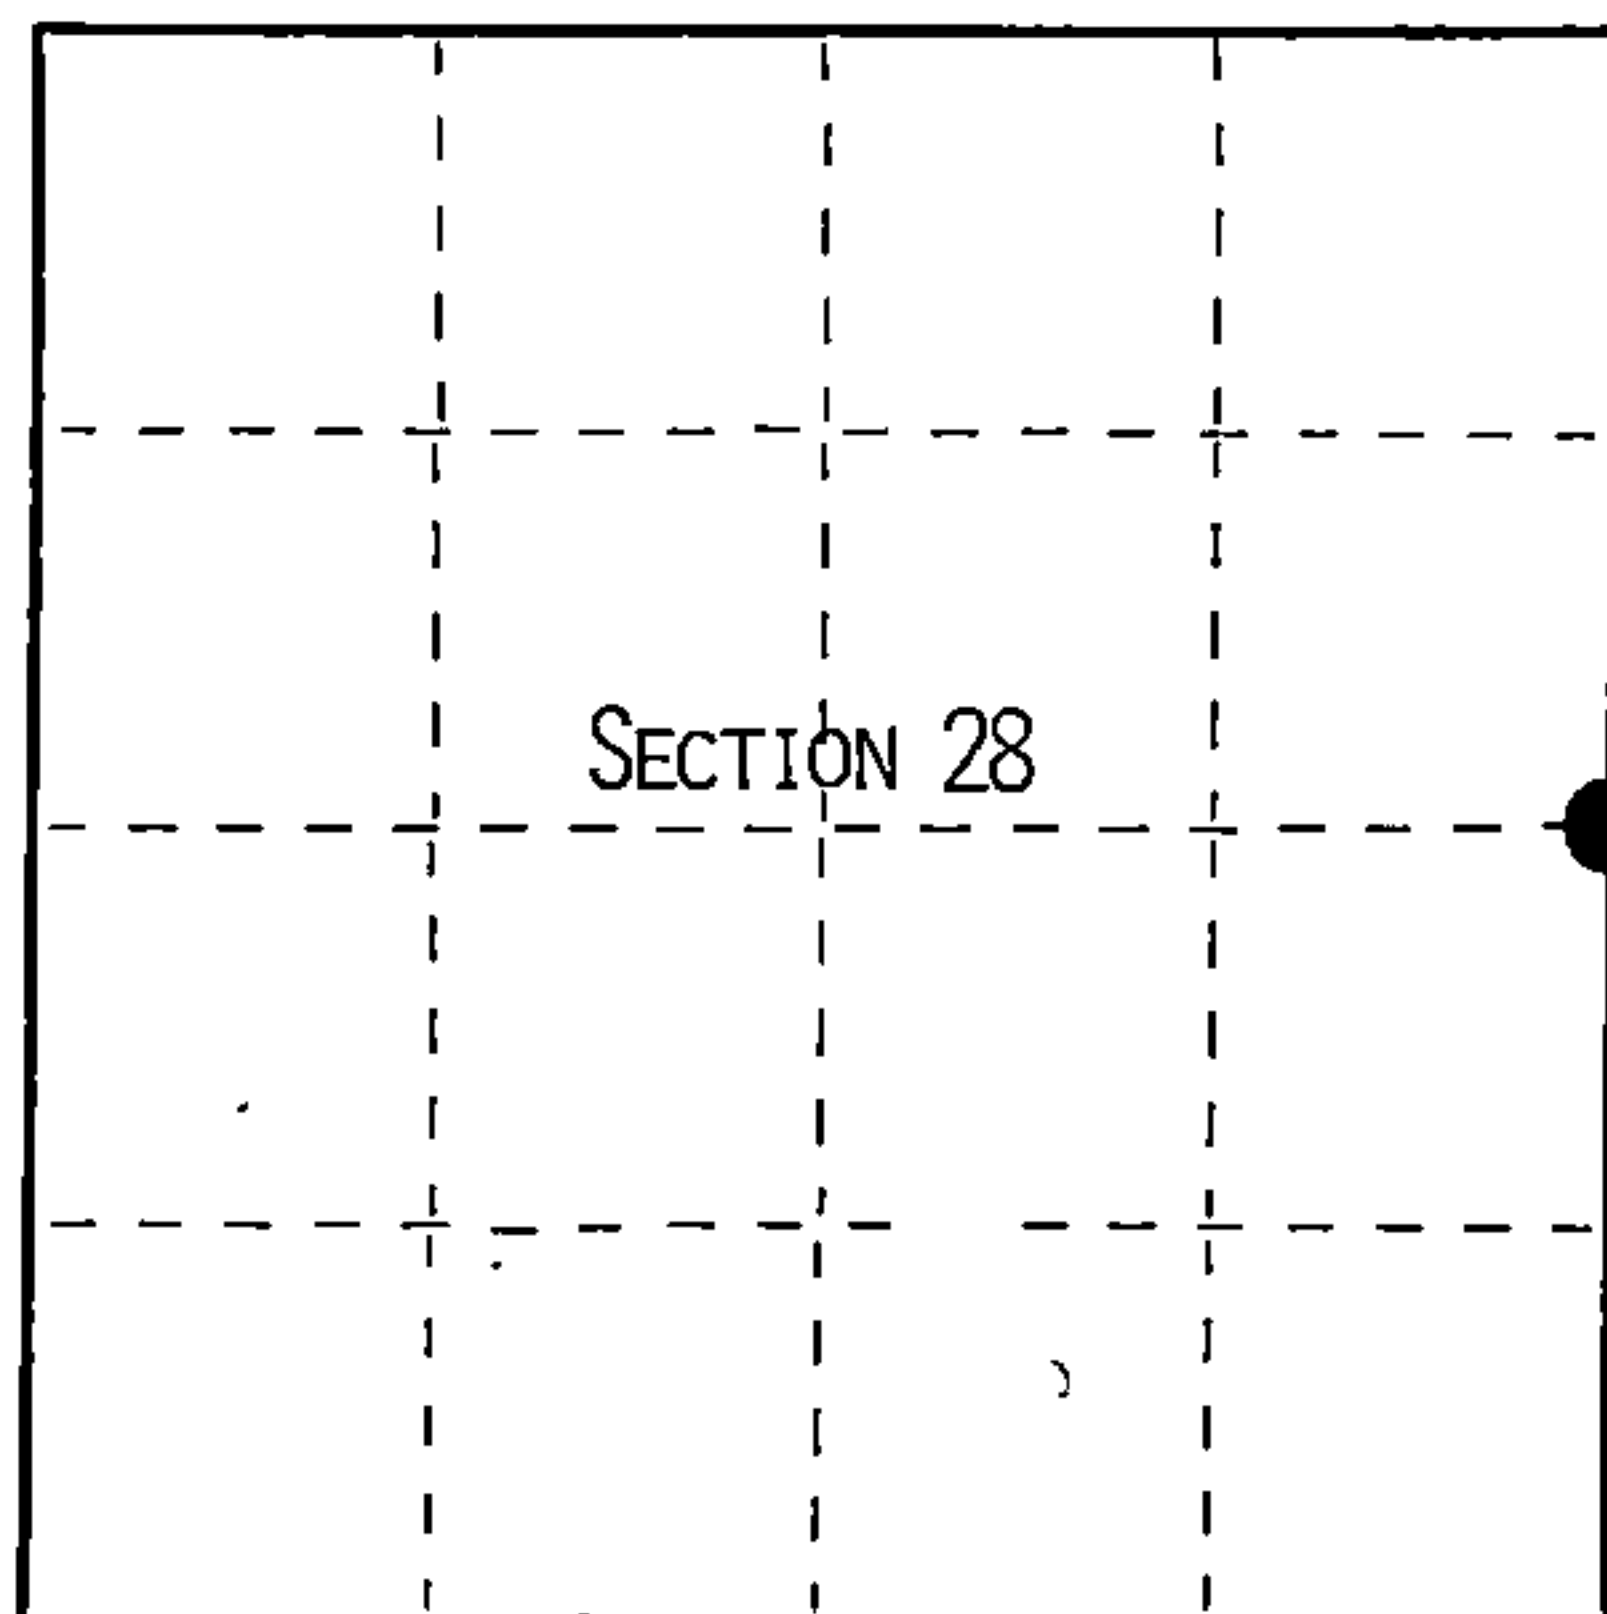

● = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. T-13

History of original corner establishment:

Original Government survey in 1865 by William E. Daugherty
North between sections 27 and 28, at 40 chains set post form which:

Tamarack	6"	S59°E	13 lks
Fir	7"	N18°W	24 lks

Description of corner evidence found:

Found 4"X4" squared wood post recently set by State of Wisconsin to preserve the
Corner position.

From post S59°E 13 lks (8.50') remains of Tamarack stump.

Description of monument and accessories I established to perpetuate the original location of this corner.

In place of wood post accepted as the original corner position, set a 2½"X60" aluminum
pipe monument 2½ feet in the ground with an aluminum cap stamped: T39N, R13E, 1/4,
S27, S28, 1994, S-1107. From which the following bear:

Cedar	9"	S73°E	35.60 feet
Cedar	11"	North	30.02 feet
Steel sign post		Southwest	1.00 feet

Dated at Hiles, Wis., this 20th day of December, 1994.

Signature William B. Cochran Title Land Surveyor Registration No. S-1107
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 23rd day of August, 1996
at 2:30 o'clock P M.

(Register of Deeds)

By John Tomkowiak Deputy

43913282000


- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated corner.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

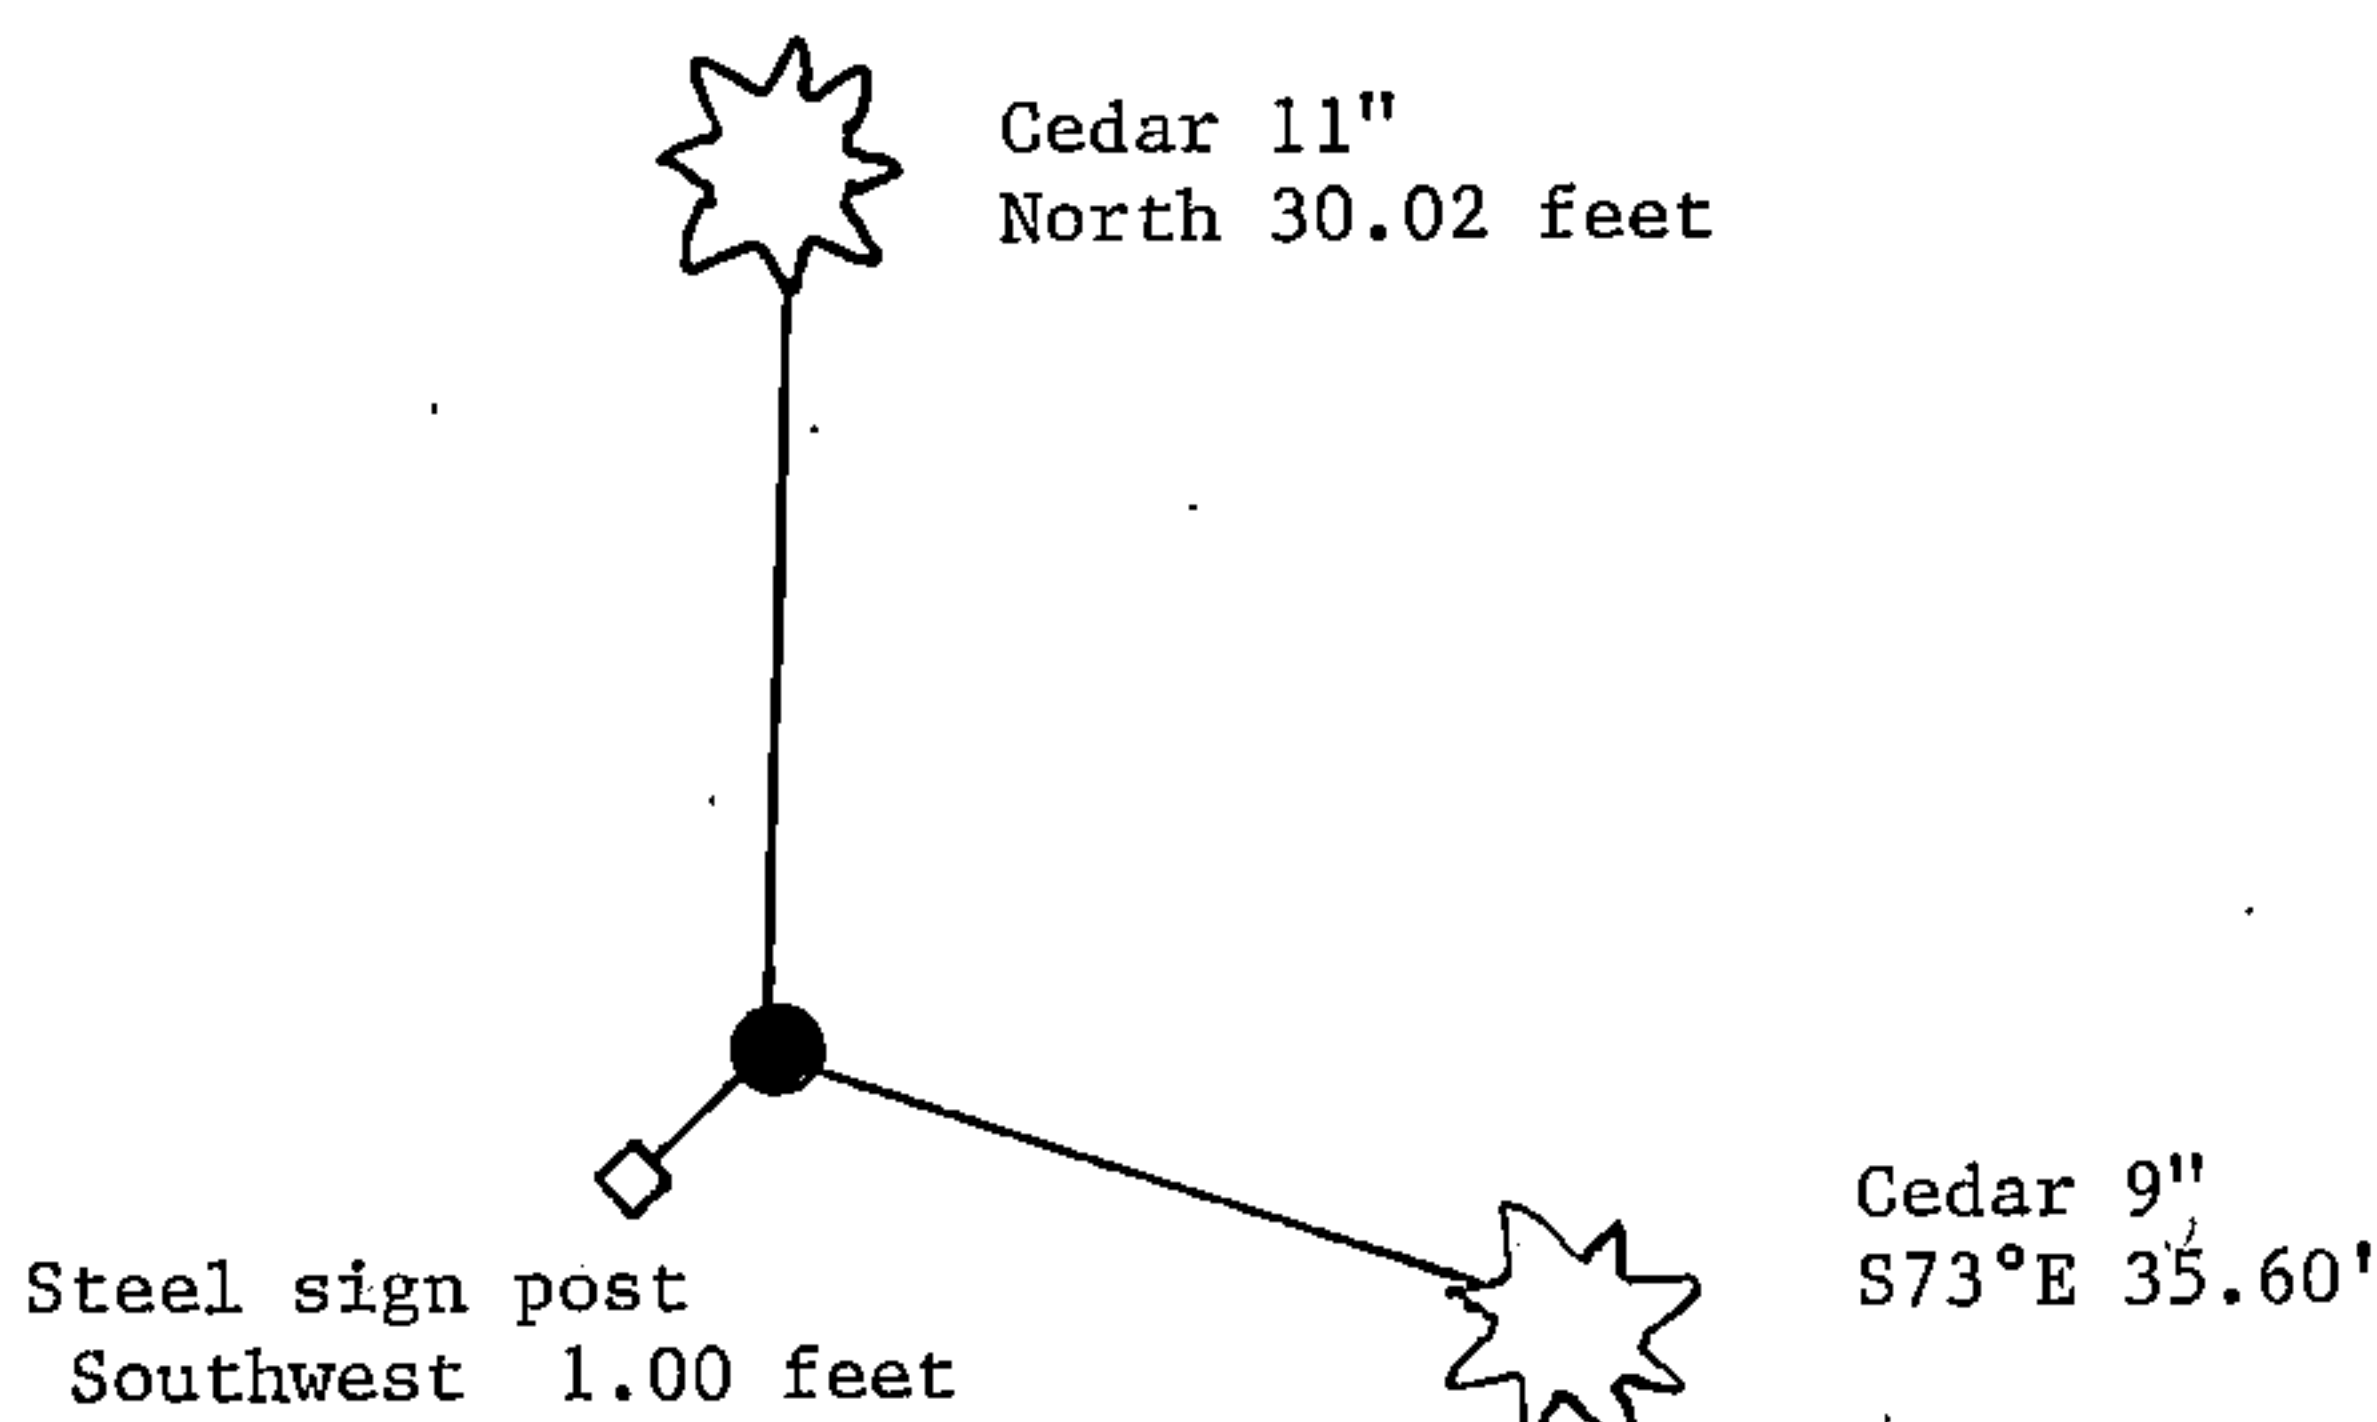

- (i) 1. William B. Cochrane
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

William B. Cochrane

12/20/94

Affix Land Surveyor Seal

