




Stock No. 26273

156584

State of Wisconsin }
County of FOREST } ss.

I William B. Cochran, do hereby
certify that on the 25 th day
of October, 1988, I found
evidence of the Northwest Section
corner of Section 33
Township 39, North, Range
13 East, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

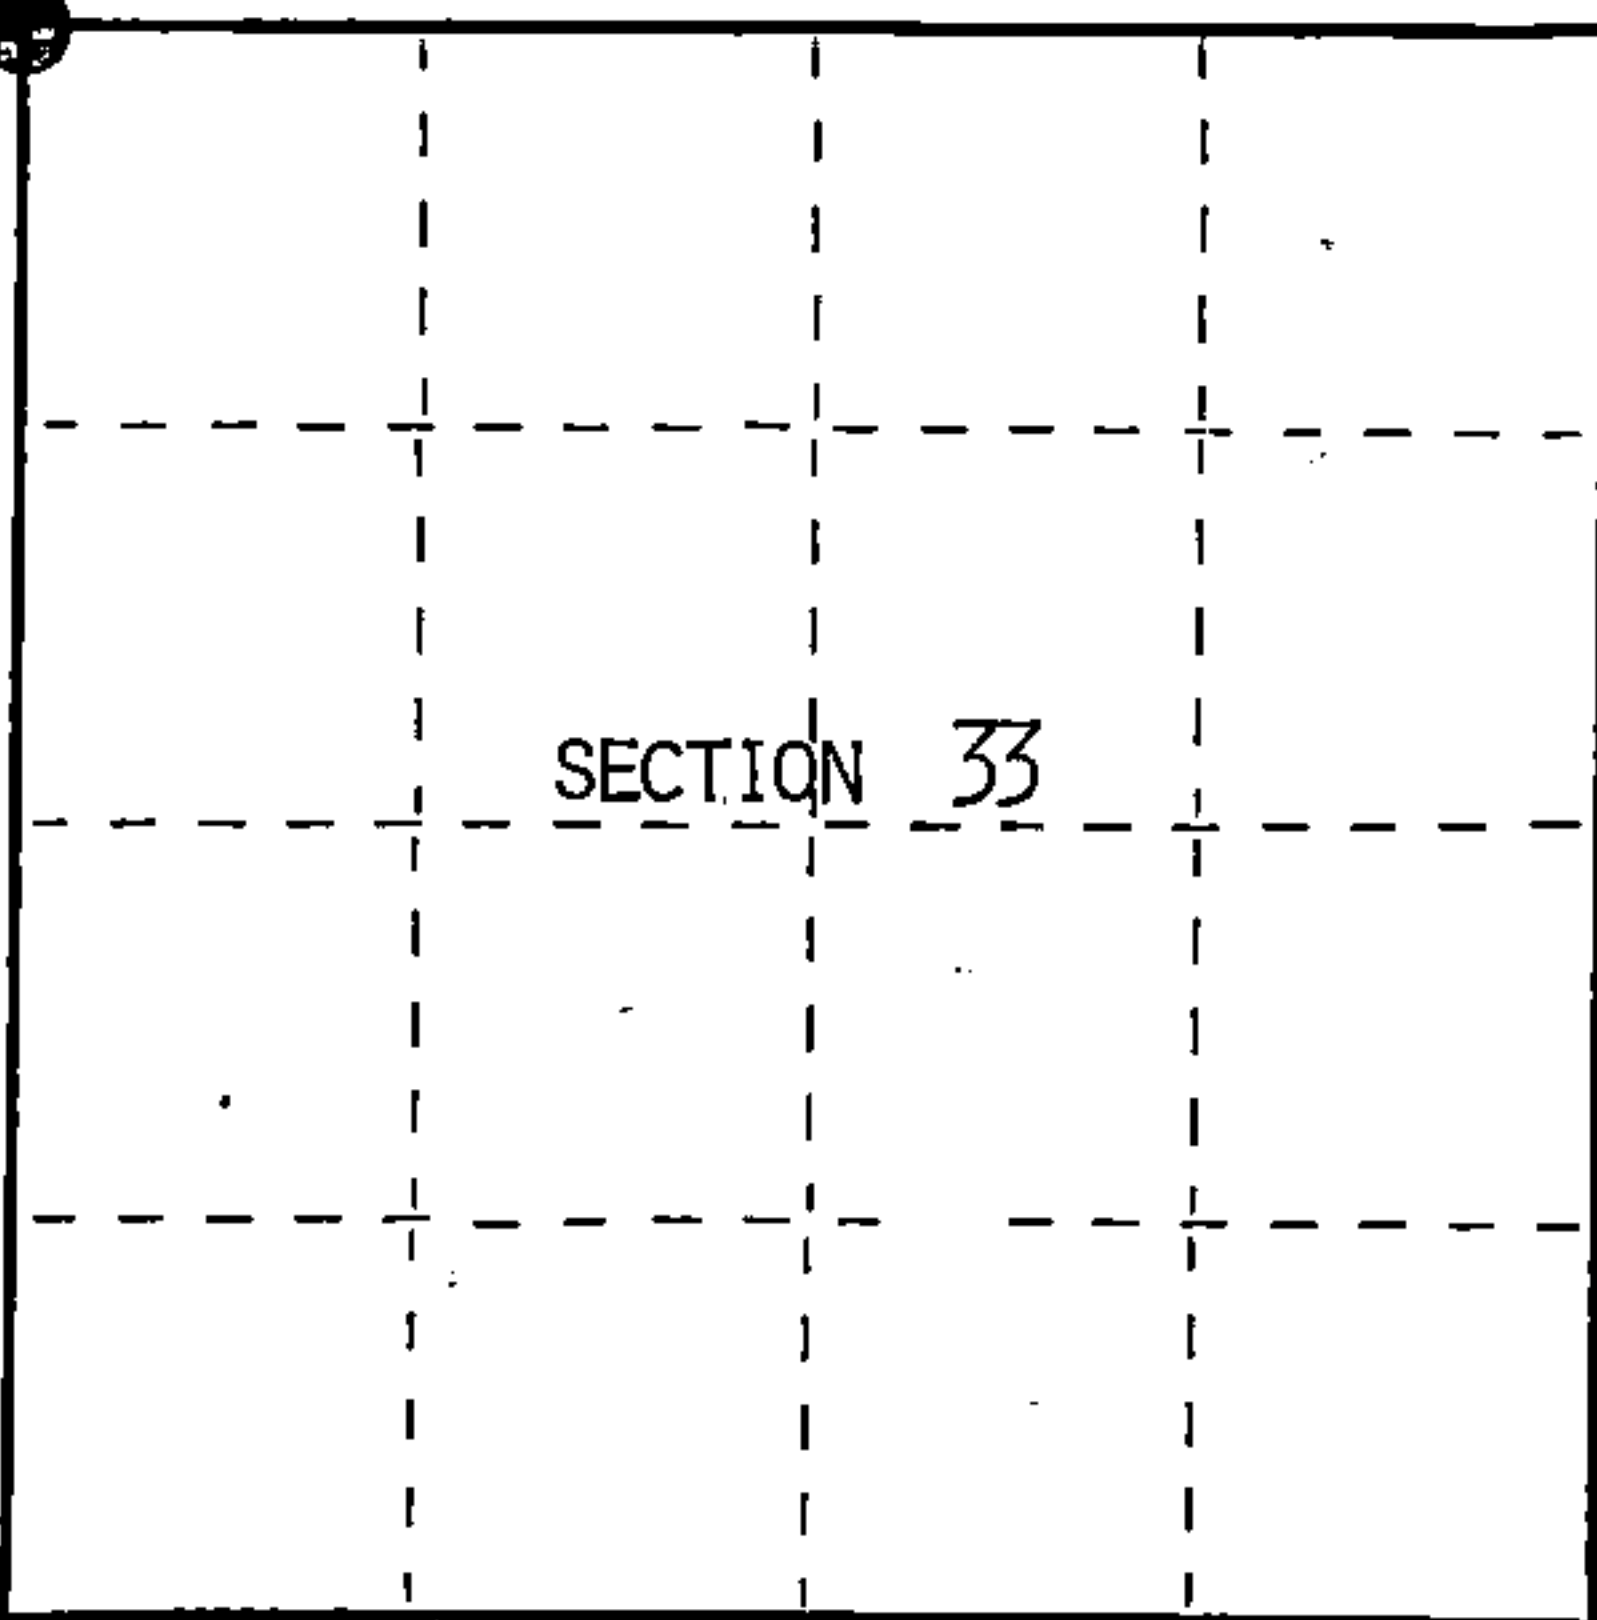

● = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. V-9

History of original corner establishment:

Original Government Survey by William E. Daugherty in 1865.

At 80 chains north between sections 32 and 33 set post from which:

Sugar	15"	N06°E	18 lks
Birch	10'	S36°W	14 lks

Description of corner evidence found:

At the corner position found a 4"x4" scribed wood post as found by forest service personell in 1970. No original corner evidence was found.

Description of monument and accessories I established to perpetuate the original location of this corner.

In place of the 4"x4" scribed wood post accepted as best available evidence of the corner postion, set a 2½"x36" aluminum pipe monument 2½ feet in the groune with an aluminum cap stamped: T39N, R13E, S28, S29, S32, S33, 1988, S-1107. From which:

Maple	5"	N66°E	31.08 feet
Maple	3"	N73°W	28.17 feet
Aspen	4"	N03°W	34.90 feet
Steel sign post		North	1.00 feet

Dated at Hiles, Wis., this 21st day of December, 1994

Signature William B. Cochran Title Land Surveyor Registration No. S-1107
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within
instrument was filed in this office for record on the 23rd day of August, 1996
at 2:30 o'clock P. M.

(Register of Deeds)

By [Signature] Deputy

439132910000


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Acceptance of found corner evidence

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

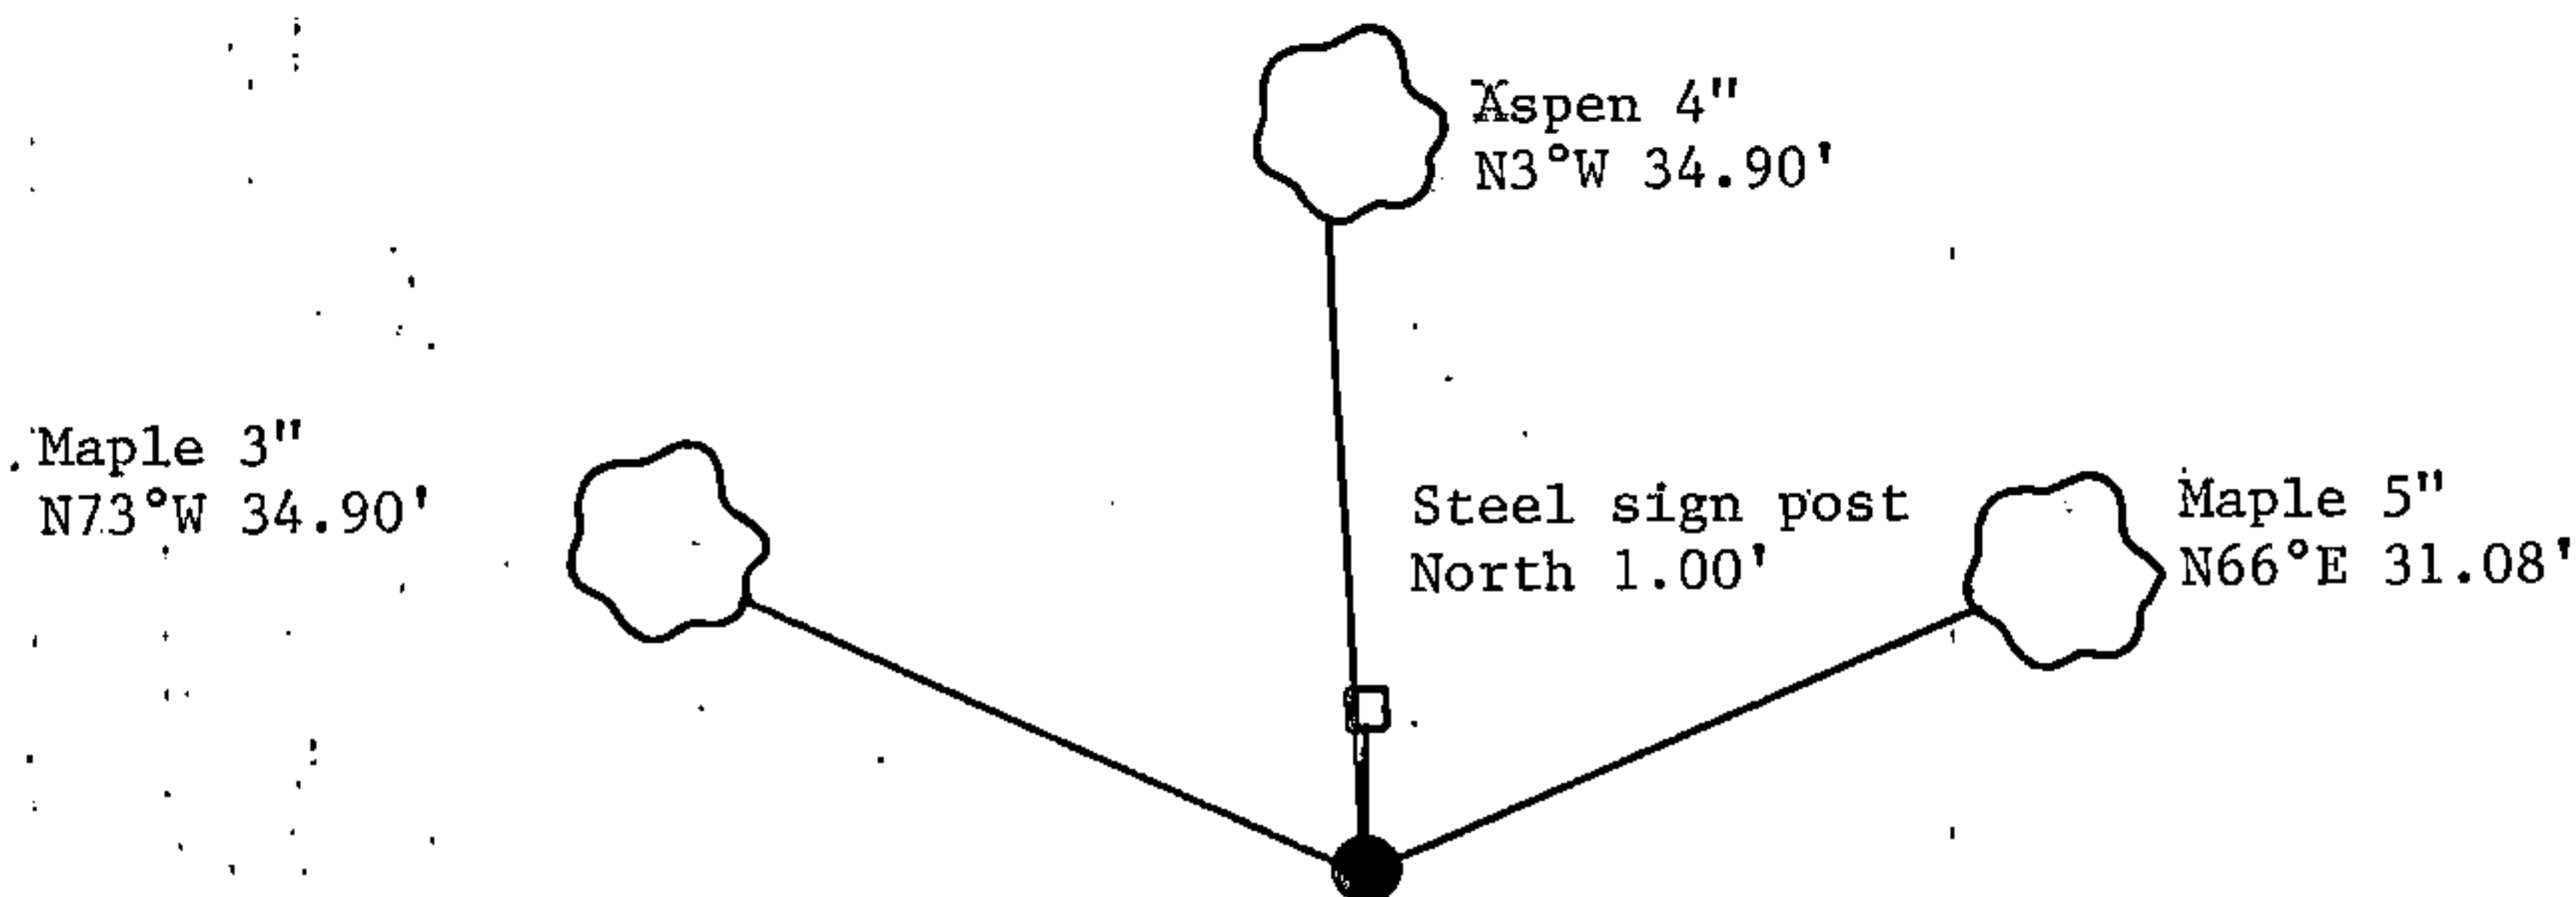

William B. Cochrane

(i) I, William B. Cochrane (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Survey requested by:

District Ranger

Date

Affix Land Surveyor Seal

