Index No. E-13

H.C.Miller Company [77]	
H.C. Millor	-
	Ċ

O = Corner monument restored.

u s	PUBLIC	IAND	SURVEY	MONUMENT	RECOR
U.J.		LAND	SOLAFI	IAIOIAOIAICIA I	ハー

State of Wisconsin ss.	History of original corner	establishn	ent:			
County of Forest William B. Cochrane do hereby Certify that on the 8th day of August 19 85, I found	Original Government Survey in 1865 by William E. Daugherty and Alex McDill. North between Sections 9 and 10, at 80.00 chains, set Section Corner Post to Sections 3, 4, 9, and 10, from which the following bear;					
evidence of the Northeast Section	Birch	8"	s60°W	22 1ks.		
Section 9 Fownship 39 North, Range 14 East Fourth Principal Meridian,	Tamarack	15"	N69°E	26 1ks.		
as described hereon; and that from this evidence established a new monument and accessories	Description of corner evid	lence found	i:			•
as described hereon to perpetuate the original ocation of this corner.	Found large Tamarac Found 14" Y. Birch	-	_	th.		
Resident witnesses:	I accept these bear	cing tre	e evidence as	original. : "		
Tony. Tillman	The corner position is restored at a point which is N60°W, 22 1ks. from the Birch, and S69°W, 26 1ks. from the Tamarack stump.					
State Plane Co-ordinates N- 263,358.8040 E-2,321,471.3160	3 feet long, 2½ fee	ing tree et in the	evidence, set e ground, with	to perpetuate the original a 2½ inch diameter an aluminum cap state following new blace	aluminum pipe monumamped; T39N, R14E,	S3, 🦎
	Maple Spruce	12 '' 18 ''	N44°E N18°W	60.63 feet 69.93 feet		7
	Steel Sign Pos	3 T	South	0.50 feet	•	
SECTION 9	Dated at Hiles		, Wis., this	11th day of	February	1987
		Surveyor, Reg	gistered Land Surveyo	r, or other duly authorized offic	,	oS-1107
	Office of Register of Deed instrument was filed in th	s, County	of Fores	t 11th	, I hereby certify that March	t the within
	at o'clock	(Register of I	nbrenner			, 19.0.7
	· ·	free pares of t	- LLUS/			

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


See drawing below

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Restored from original evidence.

(g&h) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

> 18" Spruce (New bearing tree) N18°W, 69.93 feet

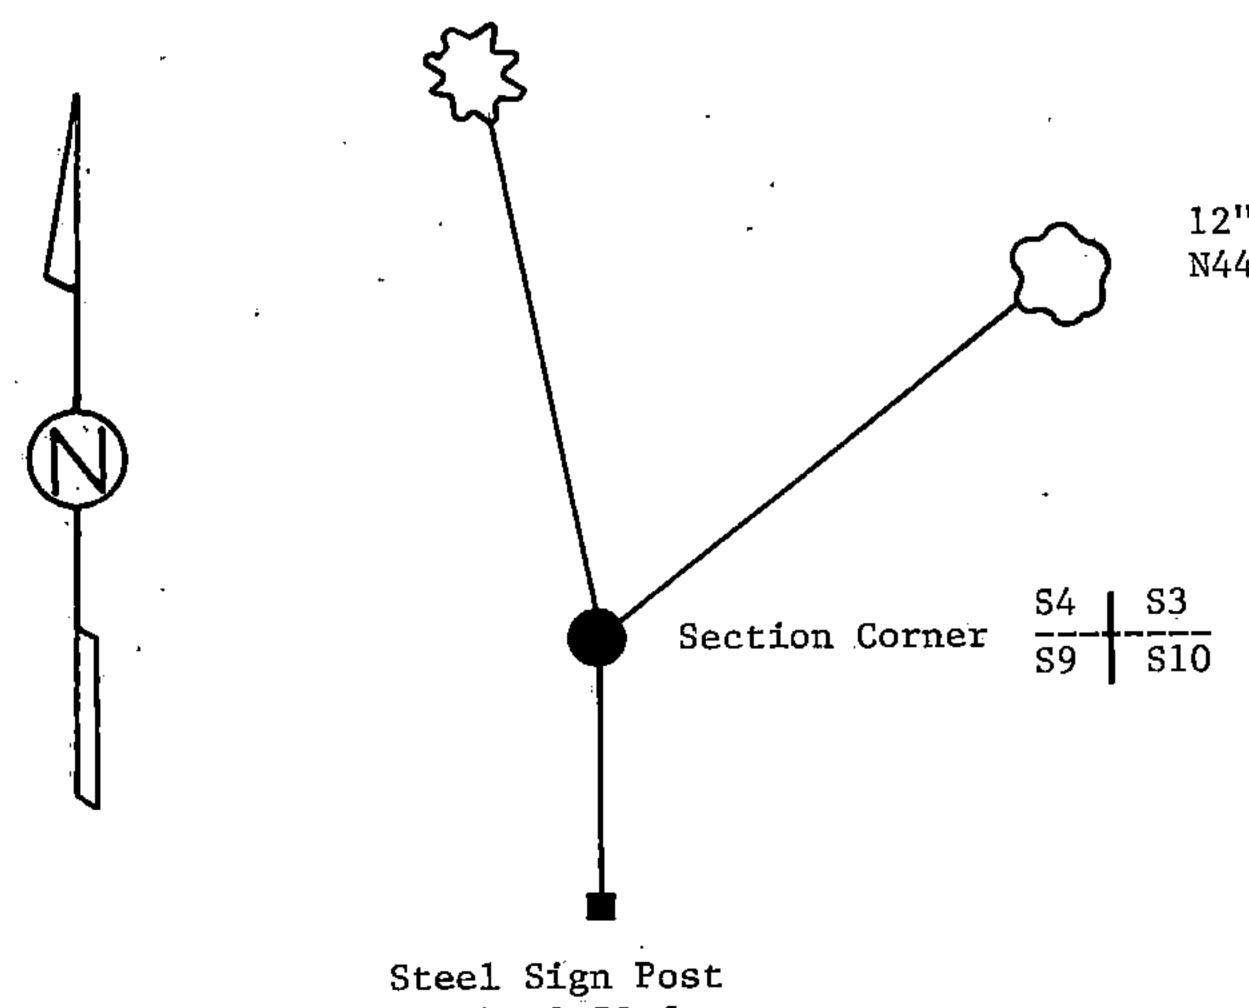

12" Maple (New bearing tree) N44°E, 60.63 feet

South, 0.50 feet

Affix Land Surveyor Scal "ISCONS WILLIAM B. COCHRANE S-1107 HILES, WISCONSIN

William B. Cochrane (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and beijef.

Sagnature

Survey requested by;

(i):

District Ranger