Index	No	N-7
HIGGA	110	

State of Wisconsin } ss.	History of original corner establishment:					
County of Forest I William B. Cochrane , do hereby certify that on the 29th day	Original Government Survey in 1865 by William E. Daugherty and Alex McDill. West corrected between Sections 17 and 20, at 40.12 chains, set Quarter Section Post to Sections 17 and 20, from which the following bear;					
of October 19.86., I found evidence of the North Quarter corner of Section 20. Township 39., North, Range	Sugar Sugar	12'' 18''	N27°E S29°W	18 1ks. 31 1ks.		•
14. East	Description of corn					1
as described hereon to perpetuate the original location of this corner.		•		t proportionate dis	tance between the	Northeast
Resident witnesses:				n 20, and in the Ce		1 1
Tony Tillman	•					\$\frac{\rho}{7}
State Plane Co-ordinates N- 252,455.1628 E-2,313,886.4710	Corner position At a point N2° $2^{1/2}$ feet in the $1/4$, S17, S20,	on is not mone W, 41.96', see ground, with	umented. t a 2½ inch d h an aluminum 6, S-1107. Fr	ed to perpetuate the original immeter aluminum pincap stamped; T39N, om which a Steel Sinew blazed and scr	pe monument, 3 fee R14E, Reference M gn Post bears Nort	et long, Monument, th, 0.50 feet.
	Maple Maple Steel Sig	8" 7" gn Post	S48°E S30°W N 2°W	59.97 feet 58.15 feet 42.46 feet		
SECTION 20		Hiles	• •	25th day of		
	(C	County Surveyor, Reg	gistered Land Survey	Land Surveyor	fficial)	n No. S-1107
	Office of Register of instrument was file at 12:50 o'clock.	f Deeds, County d in this office for	of Fore	est 18th day o		that the within 1988
O = Corner monument restored.	Ву	***************************************	~	Deputy		-

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.


(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Re-established through lost corner proportionate methods and Center-Line of Road

This corner position was re-established using State Plane Co-ordinates computed from Aerial Photography and a Global Positioning Satellite Survey. The computed corner position was located in the field using a North Seeking Gyro, an Electronic Distance Meter, and/or a steel tape.

(g&h) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

S18 _ S17	G.L.O. 40.12 chs.	• .	G.L.O. 40.12 chs.	S17 S16
S19 S20	2626.69' N87°-10'-44''E	1/4	2626.70' N85°-56'-30"E	S20 S21

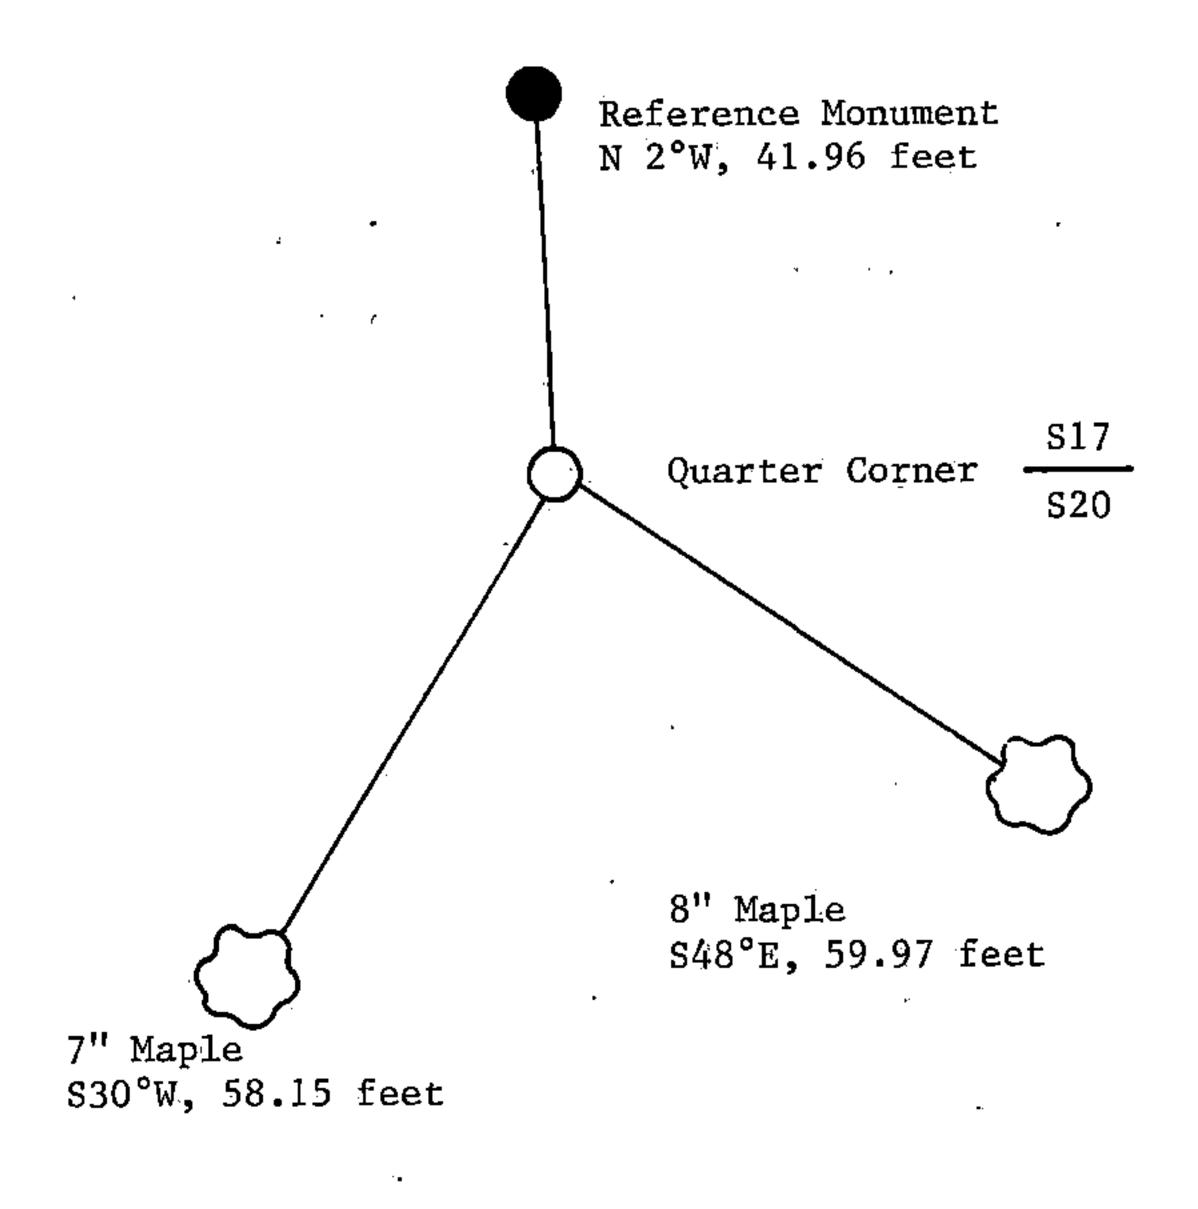

WILLIAM B.
COCHRANE
S-1107
HILES,
WISCONSIN

(i) i. William B. Cochrane

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature B. Cochrane

yate /

Survey requested by;

Date

District Ranger