HCMillerCompany (TY)

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

		TΩ
Index	No.	アーカ

State	of Wisco Forest	nsin	\	
County of	Forest		. .	
I William B. Cochrane do hereby certify that on the loth day of September 19.85. I found evidence of the East Quarter corner of Section 17. Township 39 North, Range 14 East Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.				
Resident wi	tnesses:			
David Brow	wnell	·		
Tony Till	nan			
State Plan N- 255,25 E-2,316,42		nates	•	
	l 1	1		
	l i	; [
	! :-	 		
	i ! I !	l 1		
	SECT	ON 17 ¦	. 1	
I	· :-		. – – –	
 -	i — — — i- I	-		
		-		
		 		
		- - - - - - - - - - - -		

$\circ =$	Corner	monument	restored.
•	~~,,,,,,,		

History of original corner establishment:

Original Government Survey in 1865 by William E. Daugherty and Alex McDill. North between Sections 16 and 17, at 40.00 chains, set Quarter Section Post to Sections 16 and 17, from which the following bear;

Elm 14" S70°E 16 1ks. Spruce 7" N17°W 20 1ks.

Description of corner evidence found:

No corner evidence was recovered.

The corner position is re-established at proportionate distance and on line between the Northeast and Southeast Section Corners of Section 17.

Description of monument and accessories I established to perpetuate the original location of this corner.

At the corner position, set a $2\frac{1}{2}$ inch diameter aluminum pipe monument, 3 feet long, $2\frac{1}{2}$ feet in the ground, with an aluminum cap stamped; T39N, R14E, 1/4, S16, S17, 1986, S-1107. From which the following new blazed and scribed bearing trees bear;

Cherry 8" N30°E 10.79 feet
Basswood 13" N52°W 27.08 feet
Steel Sign Post North 1.00 feet

Dated at	Hiles		Wis., this	11th	day of	February	19 87
Signature	County St	G. Cochia irveyor, Registered	Land Survey	Land Sur	veyor y authorized o	Regi	stration No. S-1107
Office of Reg	ister of Deeds	s, County ofs	Fore	st 11th	day o	, I hereby	certify that the within
at 3:30	clock. P.	M.		,		~~	••••••
	Janel	Aschan	reme	<u>"</u>			
***************************************	()	Register of Deeds)					


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(r) was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

This corner position was re-established using State Plane Co-ordinates computed from Aerial Photography and a Global Positioning Satellite Survey. The computed corner position was located in the field using a North Seeking Gyro, an Electronic Distance Meter, and/or a steel tape.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

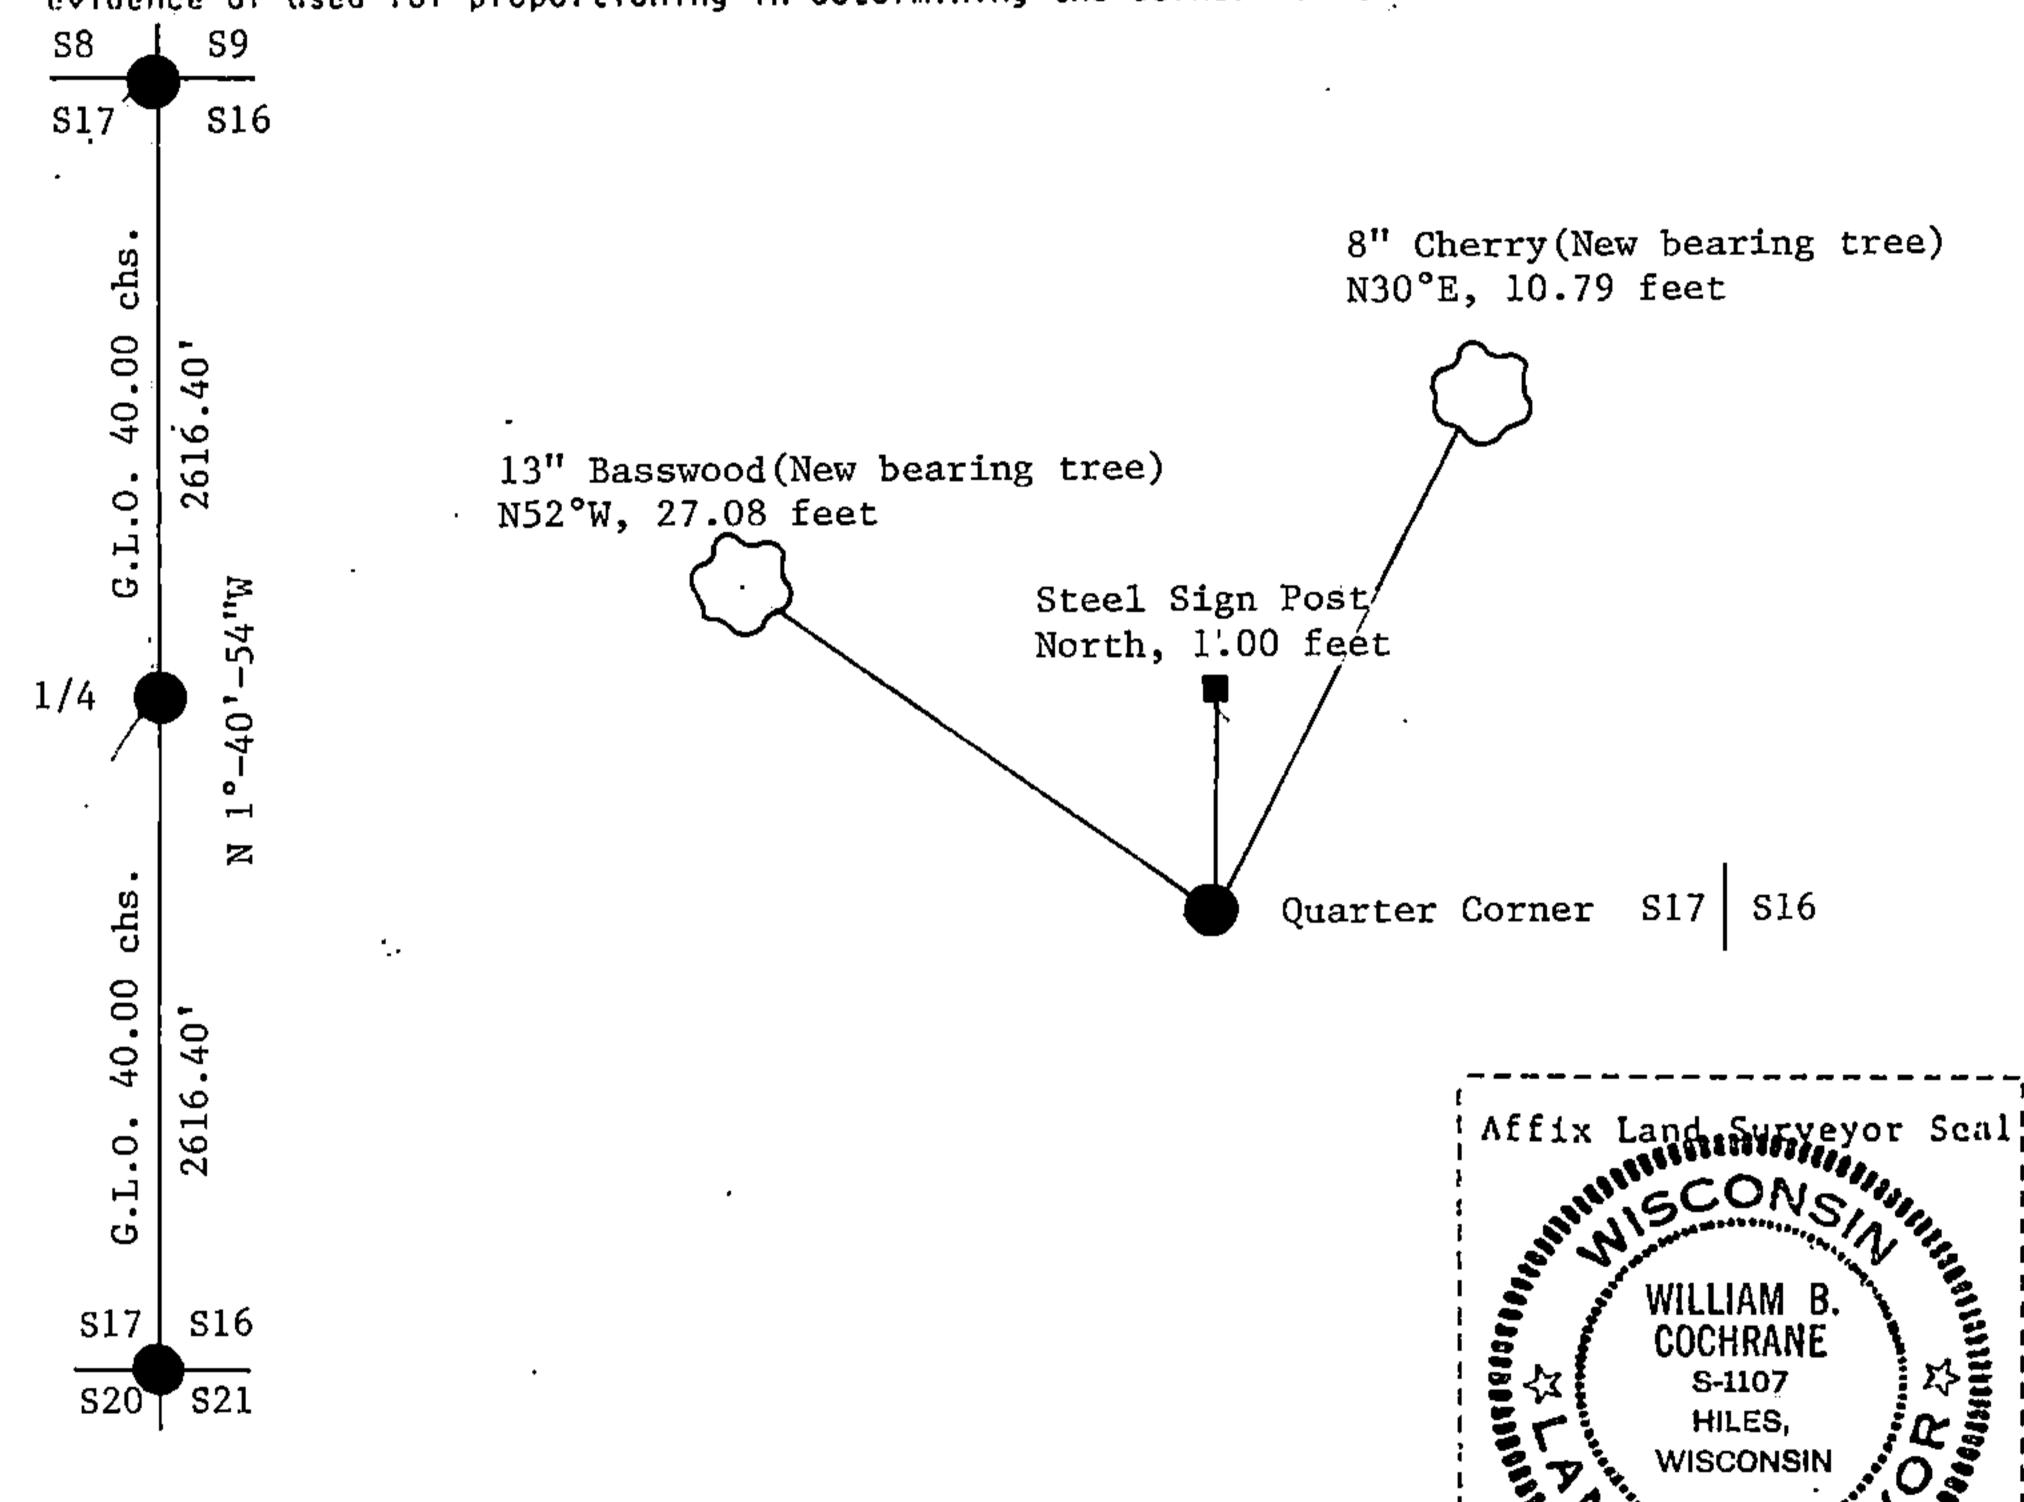

William B. Cochrane

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

(i)

William B. Cochrane February 11, 1987

Survey requested by; Marie Back 398

District Ranger

Date