Ö	İ
Ž	
-	
1,	
23,	
	֡
5	
$\Box$	
J	
<u> </u>	•

	•
_	
CIACIO MITARETAN APPROPRIA	
	•
	•

## FORM NO. 985-A "C.Miller Company [77] Stock No. 26; DOCUMENT NUP 4.4

HS	PURLIC	IAND	SURVEY	MONUMENT	RECOR
U.J.	T U DLIC	LAND	SOLATI		NECON

Index	No P-21
HIUEX	110. <u> </u>

State of Wisconsin } ss.	History of original corner esta	ablishment:	•	-	<del>.</del> .
County of Forest	_		65 hou 138118 12 12-		
	Original Government Subetween Sections 23 and	•		•	
I William B. Cochrane do hereby	from which the follow:	-	0.00 chains, set qu	arter section rost,	
certify that on the 12th day	Hemlock	12"	N14°W	24 1ks.	•
ofSeptember	Birch	10"	S41°E	8 1ks.	
evidence of theWest Quarter Corner of Section 24		_ •			
Township40 North, Range					
13 East Fourth Principal Meridian,	_				
as described hereon; and that from this evidence	Description of corner evidence	e found:			
I established a new monument and accessories	•		und. No other corne	r evidence was recovered	i.
as described hereon to perpetuate the original					
location of this corner.	I re-established the	corner posi	tion in the Center-	Line of State Hwy 55 and	ī
		•		tion Corner of Section	
Resident witnesses:	and the Southwest Sec	ction Corne	r of Section 24.		
•			•		
				•	-
					~
······································					
	Description of monument and	l accessories I	established to perpetuate	the original location of this co	orner.
	<u>-</u>			inum pipe monument, 3 fe	
	<del></del>	_		amped; T40N R13E, 1/4, S	
	0.	•	<del>-</del>	zed and scribed bearing	-
	bear;				
	Aspen	8"	N23°E	57:22 feet	,
	Balsam	6"	S59°E	41.25 feet	
	C/L Hwy 55		West	16.00 feet	
<del></del>	. Set- Steel Sign Post		East	33.00 feet	
1 OF CT T day On	• .		40.1	544 T	0.0
SECTION 24	Dated at <u>Hiles</u>	, V	Vis., this 19th	day of <u>February</u>	1992
	1.1.11: A	Posler	Tond Com		C 1107
	Signature (County Surve	vor. Registered 1	Title Land Sur Land Surveyor, or other duly	<u>NEXOT</u> Registra	tion No. S-1107
	Office of Register of Deeds, C	- · · •		T bassiss and	ifer that the mishi-
	instrument was filed in this or			day of August	ify that the within
	at 10:15 o'clock		OH HIC		·· ···································
			•		
	Jan 1	Kengr	enner	•	•
	(Reg	ister of Deeds)			
	D		<b>D</b>		
O = Corner monument restored.	DУ		Deputy		


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(r) was the corner restored through acceptance or (1) an obliterated evidence location, or, (2) a found perpetuated location?

(9&h) was the corner reestablished through lost corner proportionate methods? If so, method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Re-established through lost corner proportionate methods.

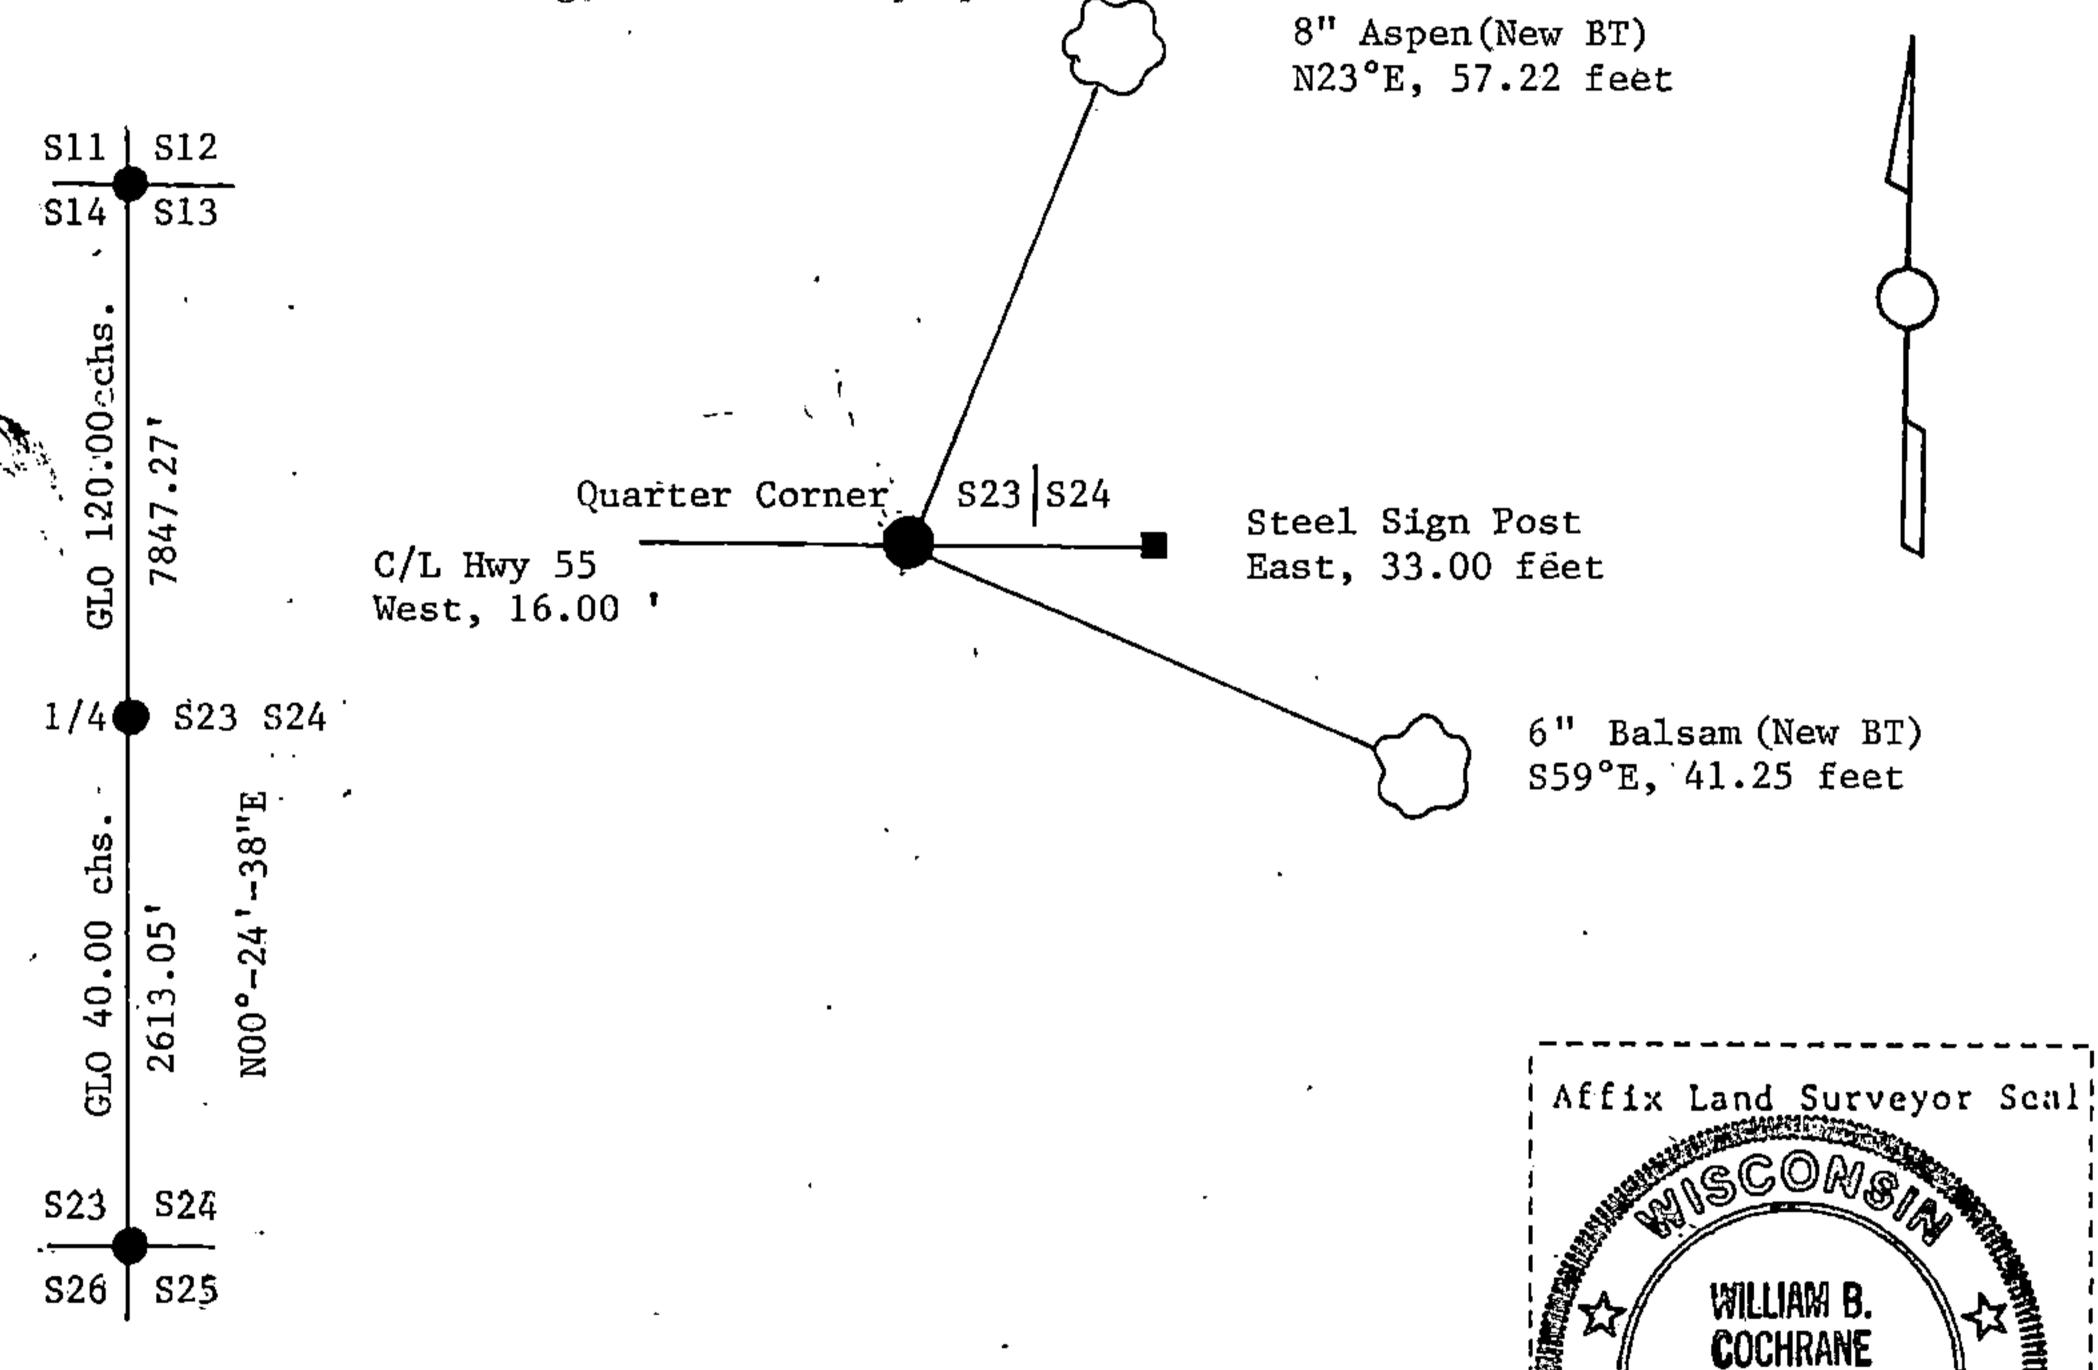

**\$-1107** 

HILES,

WISCONSIN

William B. Cochrane (i)

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Survey requested by; District Ranger Date