1011

History of original corner establishment:

from which the following bear;

Spruce

Sugar

State	of Wisconsin]
County of	Forest	} ss.
certify that of July evidence of the corner of Township	Pisoni n the 24th South Quar Section 27 41 Fourth Printereon; and that from a new monument hereon to perpetualis corner.	991 I found ter North, Range cipal Meridian, n this evidence and accessories
_		
Resident with	iesses:	
		,
	·.	
-	-	
	i	
;	1	1
		· -
	1	i l
	1 	1 1
	SECTION 27	-
1	1	
- +	· - ¹ ·	-
1	[\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
1	<u> </u>	1
Corner	monument restored	· — — — — — — — — — — — — — — — — — — —

	•		•					
Descripti	ion of corner ev	idence found:						
No origi	nal corner e	evidence was 1	recovered.					
		er position a west Section (on line b	between the	D
	•		•	٠.		•	•	Ø
	-		_	•		~ ·		
At the constant of the second	orner posit above the 1634. From v	nt and accessories ion, set a $2\frac{1}{2}$ ground, with a which the folton a nail in	inch diamet an aluminum lowing new b	er alumi cap stam lazed an	num pipe ped; T41	monument N R14E, 1	, 3 feet lor /4, S27, S3 ^l	ng,
•	W. Spruce	1411	N37 ₀ W		25.77			
	S. Maple	13'' 11''	N74°E S60°E		20.33 22.51			
	S. Maple S. Maple	1011	S54 W		19.65		-	
	Steel Sign		North		<u>-</u>	feet		
~					· ·		•	
	-	River, MI	•		•			* *
Signature	e Aary o	L. Promi y Surveyor, Registere	Title	Land Sur	veyor authorized o	official)	Registration N	ioS-1634
Office of instrume	Register of Dent was filed in	y Surveyor, Registerededs, County of this office for reco	Sizest ord on the	104	day	of I he	reby certify th	at the withi
at. <i>zz</i>	Jan	Asche	Krenner					
************		(Register of Deeds	;)					
Ву				Deputy				
-			,	•				

Original Government Survey in 1865 by William E. Daugherty. West corrected between Sections 27 and 34, at 40.16 chs., set Quarter Section Post to Sections 27 and 34,

S40^OW N31^OE

22 lks.

20 lks.


(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the tocation of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and [1] the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing below.

(f) was the corner restored through acceptance of (i) an obliterated evidence location, or, (2) a found perpetuated location?

Restored through lost corner proportionate methods.

(gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location? Reestablished through lost corner proportionate methods.

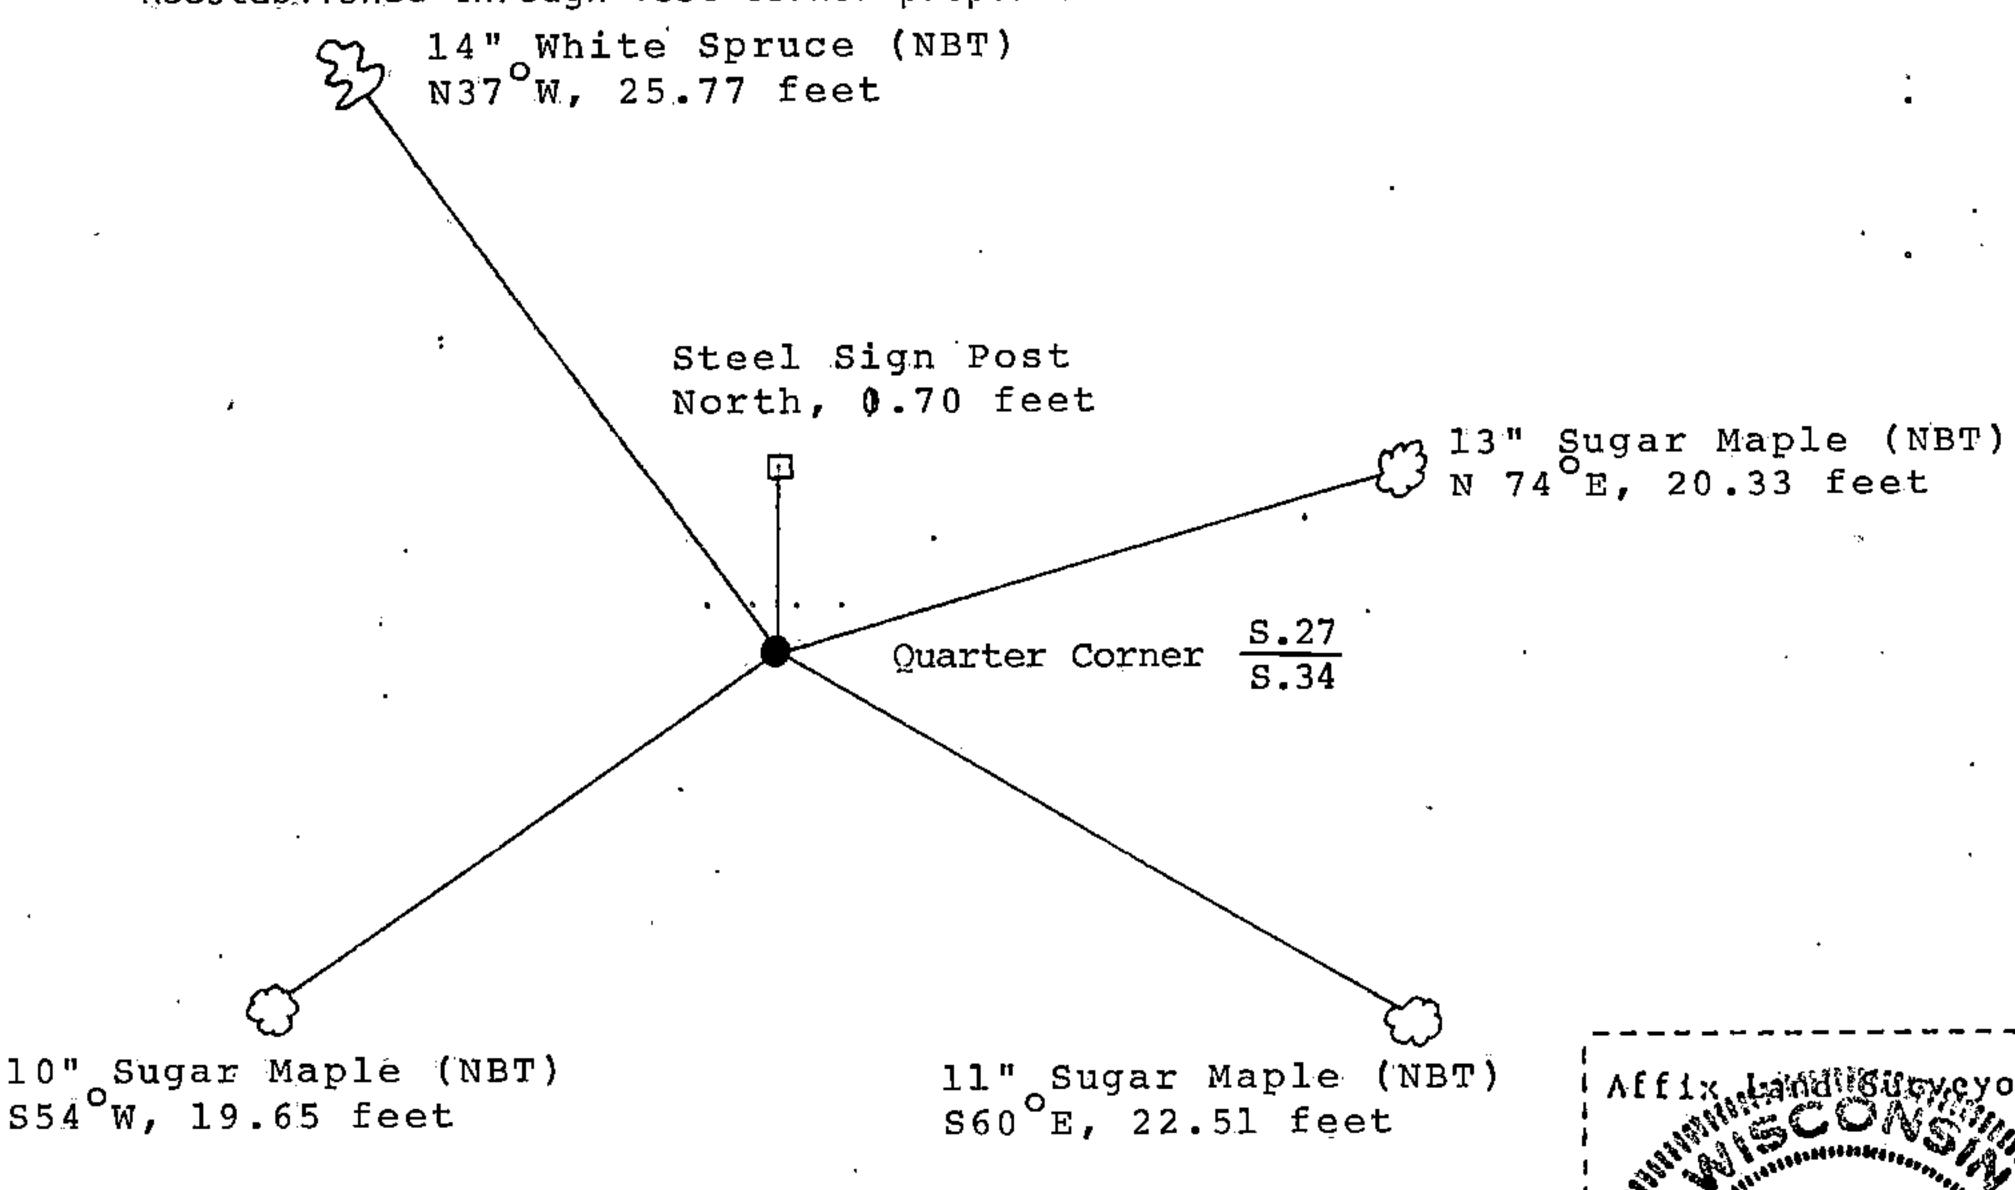

s.28	S.27	G.L.O. 40.16 chs.	1/4	G.L.O. 40.16 chs. 2628-82	S.27	S.26
S.33	s.34	N88° 49'41"E		5257.65'	s.34	S.35

Gary L. Pisoni (i) Type or print name; certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature L. Permi

Survey requested by; District Ranger

PISONI

S-1634

IRON RIVER,

MI