

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick do hereby certify that on the 18th day of July, 1969, I found evidence of the Northwest Section corner of Section 1 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.

Set wood post.

Hemlock 14, bears N73W, 10 lks.

Y. Birch 20, bears N61E, 22 lks.

Sugar 12, bears S60E, 25 lks.

Ironwood 8, bears S54W, 33 lks.

Description of corner evidence found:

Squared post lying on ground by mound of rock.

Point of post found in mound of rock along with older point.

Hemlock stump bears N73W, 10 lks. from post point.

Birch stump hole bears N61E, 22 lks. from post point.

Description of monument and accessories I established to perpetuate the original location of this corner:

Replaced old post point with 2 inch in side diam., galvanized, wrought iron pipe, 5 feet long, flanged at bottom, filled with concrete with brass cap marked.

from which the following blazed and scribed new bearing trees bear.

Maple 6, N41E, 27.59 ft. or 41.803 lks.


Basswood 7, S83E, 43.46 ft. or 65.848 lks.

Maple 4, S34W, 5.10 ft. or 7.727 lks.

Elm 5, N13 W, 4.85 ft. or 7.348 lks.

T36N R16E
S35 S36
S 2 S 1
T35N
1969
S-802

43616350000

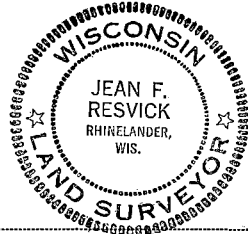

Resident witnesses.....

Dated at Rhineland Wisconsin, this 30th day of July 1969.

Signature Jean F. Resvick Title Cadastral surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)


Surveyors Registration No. S-802 DOCUMENT No. 98043

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. _____ Page No. A-21 of County Records.

Signature Eugene Stetson Title Register of Deeds

Township 35 North, Range 16 East, Section 1, Index No. A-21, Page No. _____

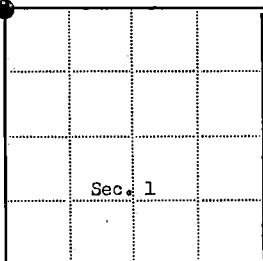

⊗ = Corner monument restored



DOCUMENT NUMBER
139173


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Section Corner common to Sections 1-6-31-36,
T.35-36N., R.16-17E., Forest-Marquette
Counties, Wisconsin.

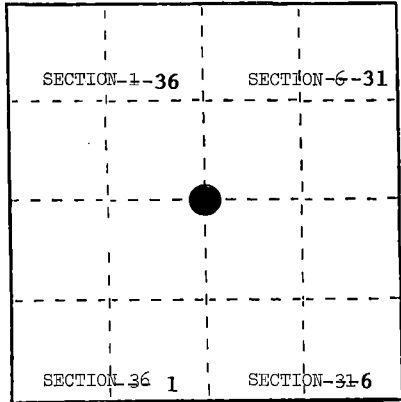


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post with the following BTs: Sugar, 18", S.12°W., 15 links; Sugar, 15", N.54°W., 26 links; Sugar, 15", N.40°E., 35 links; Yellow Birch, 18" S.70°E., 32 links. In 1934-35, J. J. Jenkins, Menominee County Surveyor, while surveying for Marinette County, set a 4" iron post for the corner. In 1936-37, F. Gould and B. Hammes, Deputy County Surveyors, said they found old post at corner and stumps checked for BTs. In 1969, J. Resvick (RLS) found a 4" iron post with a brass cap stamped for corner. He added the following BTs: Maple, 10", N.22°E., 35.45 feet; Maple, 13", S.46°E., 32.07 feet; Maple, 6", S.68°W., 11.34 feet; Elm, 7", N.13°W., 31.43 feet. In 1984, M. Stefan (RLS) found monument and accessories as per Resvick. Repainted BTs and added a steel sign post which bears north, 1.2 feet from corner. In 1988, A. Harrison found monument and accessories as per Stefan, found the Elm BT to be dead and replaced it with a Basswood, 8", N.41°W., 26.23 feet from monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County Monument stamped to identify the corner.
2. Maple, 10", N.22°E., 35.45 feet
3. Maple, 13", S.46°E., 32.07 feet
4. Maple, 6", S.68°W., 11.34 feet
5. Dead Elm, 7", N.13°W., 31.43 feet
6. Basswood, 8", N.41°W., 26.23 feet
7. Steel Sign Post, North, 1.20 feet

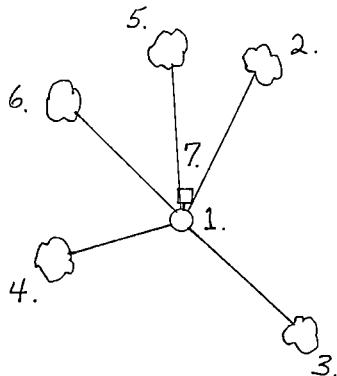

Book 1, Page 21

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 26 day
of February, 1990 at
10:10 o'clock A.M. and recorded
in Vol. 139173, Page 21
CORNER RESTORATIONS

Paul A. Schaeffer
Register of Deeds

A-25

43616360000

A-25
35-16

A
25

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


- (1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

Certificate ready for filing:

Dale B. Stage
District Ranger

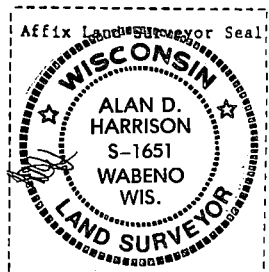

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick do hereby certify that on the 21st day of July, 1969, I found evidence of the Northeast Section corner of Section 1 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new ~~monument and~~ accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1859 by Artemas Curtis.

Set wood post.

Sugar 18, bears S12W, 15 lks.

Sugar 15, bears N54W, 26 lks.

Sugar 15, bears N40E, 35 lks.


Y. Birch 18, bears S70E, 32 lks.

Survey for Marinette County by J.J. Jenkins, Menominee County Surveyor, in Dec. 1934 and Jan. 1935 and recorded in Marinette County.

Set 4" iron post for the corner to sections 1, 6, 31, and 36.

Description of corner evidence found:

Found 4 inch diameter iron post with brass cap stamped.

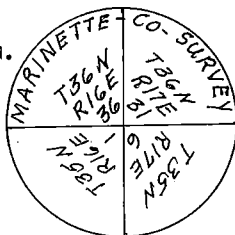

Description of ~~monument and~~ accessories I established to perpetuate the ~~original~~ location of this corner:

Blazed and scribed the following new bearing trees.


Maple 10, bears N22E, 35.45 ft. or 53.712 lks.

Maple 13, bears S46E, 32.07 ft. or 48.590 lks.

Maple 6, bears S68W, 11.34 ft. or 17.182 lks.

Elm 7, bears N13W, 31.43 ft. or 47.484 lks.

43616360000

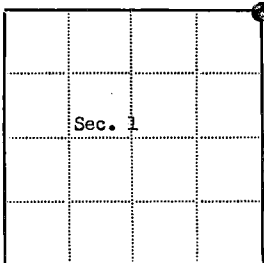

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 30 day of July 1969

Signature Jean F. Resvick Title Cadastral surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT No. 98046

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. _____ Page No. A-25 of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 35 North, Range 16 East, Section 1, Index No. A-25, Page No. _____



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 18th day of September, 19 74,
I found evidence of the East Quarter corner of Section 3
Township 35 North, Range 16 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride August 1858.

South corrected between Sections 2 and 3. 36.50 chains set post for corner of Sections 2 and 3.

Sugar, 6", N79W, 33 lks

Elm, 12", N66E, 21 lks

16.50 chains north enter swamp E&W

21.50 chains north stream 100 lks runs east

Description of corner evidence found:

Iron pipe

Sugar 24", N79°W 33 lks from pipe

16.50 chains north to swamp

21.50 chains north to north side of stream runs east

Description of monument and accessories I established to perpetuate the location of this corner:


At the corner position set a 2 inch inside diameter galvanized pipe 3 feet long filled with concrete with a brass cap stamped: T35N, R16E, $\frac{1}{4}$, S3, S2, 1975, S-802.

From which the following bear


Sugar 10" N14°E, 9.55 feet

Sugar 7" N36°W, 22.48 feet

Set a steel sign post southeast 0.50 feet

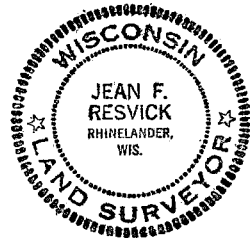

43516032000

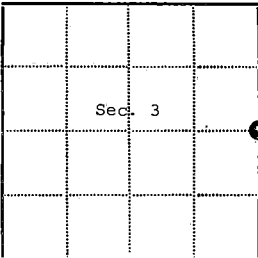

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 22 day of March,
19 75

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802Office of Register of Deeds County of ForestI hereby certify that the within instrument was filed in this office for record on the 31st day of March, 19 75, and was filed in Book

No. Corner Page No. C-17 of County Records. **106868**
Restorations Document Number

Signature Eugene Steiny Title Register of Deeds

Township 35 North, Range 16 East, Section 3, Index No. C-17, Page No. 17

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 1-2, T.35N., R.16E., Forest County, Wisconsin.

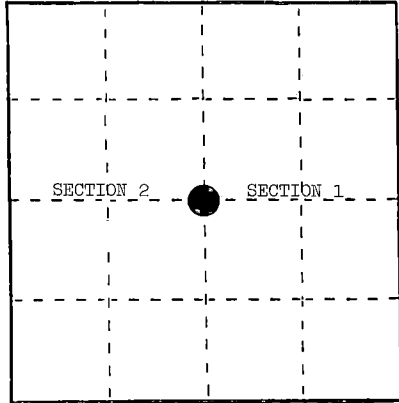

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set a wood post with the following BTs: Sugar, 12", N.22°W., 10 links; Hemlock, 18", S.76°E., 35 links.

In 1926, Goodman Lumber Company found an old 2" Ironwood post with the following BTs: Maple, 15", N.22°W., 10 links; hollow Hemlock stump (partially burnt), S.80°E., 35 links. They replaced the Ironwood post with a 4" Cedar post. Then in 1927, they set a 1 3/4" Lead pipe 8" high.


In 1969, J. Resvick (RLS) found a 4" x 4" Cedar post rotted off, with a 1 1/4" pipe 1 foot long next to post point; Maple stump, N.22°W., 10 links from point; Hemlock stump hole with root remains, S.76°E., 35 links from post point. He replaced post point with a 2" x 60" iron pipe filled with concrete with a brass cap stamped for corner with the following BTs: Elm, 7", N.76°E., 13.64 feet; Cherry, 10", S.22°W., 24.60 feet.

In 1988, A. Harrison found monument as per Resvick and added accessories.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 60" iron pipe filled with concrete and stamped for the corner.
- Elm, 7", N.76°E., 13.64 feet
- Cherry, 10", S.22°W., 24.60 feet
- Cherry, 7", N.64°W., 55.50 feet
- Steel Sign Post, North, 0.93 feet

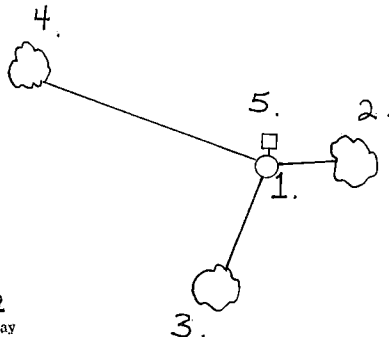

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 29th day of March A.D., 1990 at 10:00 o'clock A.M. and recorded in Vol. CORNER RESTORATIONS

page 21
Paul Hachenauer
Register of Deeds

Book 1, Page 25

C-21

43516020000

C 21

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

3/12/90

Date

Certificate ready for filing.


District Ranger

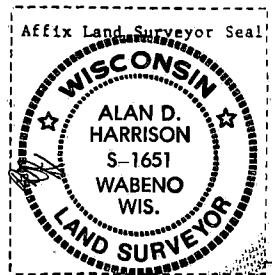

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. C-9

1/4 Corner to Section 4 T35N, R16E
(Section/Quarter)

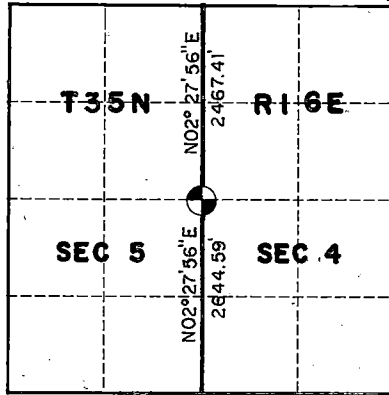

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff

Signature

1993

Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride set a wood post at this corner location at 40 chains and marked the following bearing trees:


Hemlock	14"	East	25
Birch	6"	N78W	21

Corner search area was set at single proportionate position and Hemlock stumps of 30" or better were found but no post evidence or blazes in the area. A CCC tag was found on a tree facing an iron rail at the centerwest and center quarter corners of this section. The centerwest corner occupation was roughly 70 ft. north and the center quarter corner occupation was roughly 30 ft north. This occupation evidence was pushed westward to the west line falling between 100 ft and 140 ft. north of the single proportionate search area. Nothing was found. I did not have any survey record of the two CCC tags mentioned and thus determined the corner position lost, setting it at single proportionate position. The measured distance along the east west section lines fit too close to record to accept the errors the CCC tags witnessed. In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

Set a 2"x 60" aluminum post with stamped cap at corner. Ties are to aluminum nails driven into the tree centers which trees were scribed and blazed. Bearings are magnetic.

1-2 =	S63°E	29.90'
1-3 =	S02°E	18.98'
1-4 =	S87°W	5.25'
1-5 =	N46°E	45.08'
1-6 =	N10	0.50'

⊕ = Set 2"x60" Aluminum monument

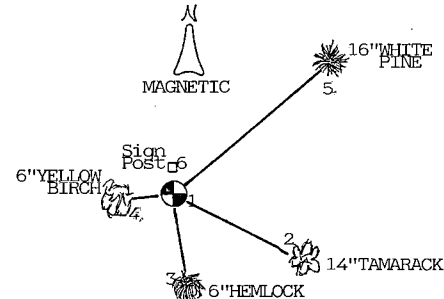

Plat Ready For Filing:

Ralph Hall
District Ranger

4351605 2000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature


Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date


Signature

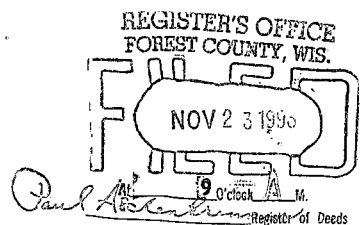

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. C-13

QUARTER Corner to Section 4 T35N, R16E
(Section/Quarter)

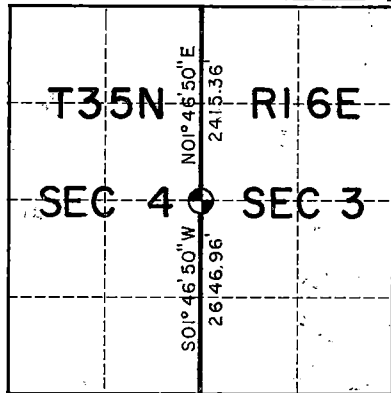

○ = Corner monument restored.



Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993

Date

Anthony

Ralph McCall
District Ranger

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, set this corner position at 40 chains from the south and marked the following bearing trees:

Sugar	14"	S81W	13
Hemlock	18"	N20E	6

A stream call was noted on the south corrected line at 23.50 chains with the corner set at 36.50 chains.

CCC tags were located facing iron rails at the Centerwest and center quarter corners of section 4 falling approximately 70 ft and 30 ft north of the corners computed for single proportionate measure of the quarter corners. I pushed these points of occupation both westward and eastward in search areas for the quarter corners which would place the east quarter corner south roughly 100 to 140 ft. This corner position fell in a heavily logged area in Popple slashing and no evidence was found. The stream call to the north fit within a chain, however. I set this corner by lost methods of single proportionate measure.


In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

Set a 2"x 36" aluminum monument

at corner position with stamped cap. Ties are to aluminum nails driven into the tree centers which trees were blazed and scribed. Bearings are magnetic.

1-2 =	N86°E	95.22'
1-3 =	S53°E	60.30'
1-4 =	S55°W	82.68'
1-5 =	N27°E	44.90'
1-6 =	West	0.70'
1-7 =	North	0.60'

⊙ = Set 2"x36" aluminum monument

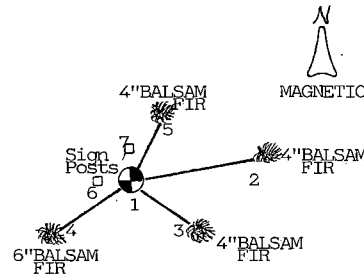

Plat Ready For Filing:

4351604 2000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature


Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

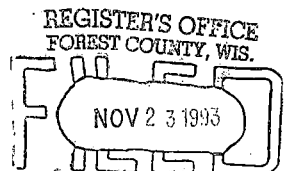

Paul A. [Signature]
9 O'clock A.M.
Register of Deeds

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 17th day of July, 19 69,
I found evidence of the West quarter corner of Section 1
Township 35 North, Range 16 East, Fourth Principal Meridian, as described
hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride
Set wood post
Sugar 12, bears N22W, 10 lks.
Hemlock 18, bears S76E, 35 lks.
4:00 chains south enter swamp.


Description of corner evidence found:

4 chains north of edge of swamp found 4 x 4 cedar post, rotted off with a 1 $\frac{1}{4}$ inch diam.
pipe, 1 ft. long along side of post point.
Maple stump bears N22W, 10 links from post point.
Hemlock stump hole, hemlock roots found, bears S76E, 35 links from post point.



Description of monument and accessories I established to perpetuate the original location of this corner:
Replaced post point with a 2 inch diameter, galvanized wrought iron pipe, 5 feet long,
filled with concrete, flanged on bottom, with brass cap stamped.

From which the following blazed and scribed new bearing trees
bear.

Elm 7, bears N76E, 13.64 ft. or 20.667 lks.
Cherry 10, bears S22W, 24.60 ft. or 37.272 lks.
pipe found set along side monument.

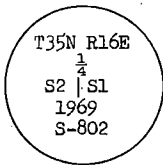

4351602 2444

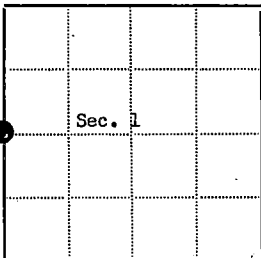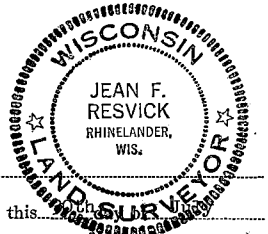

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at RhinelandWisconsin, this 17th day of July, 19 69.Signature Jean F. ResvickTitle Cadastral surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802DOCUMENT NUMBER 98049Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
on the 22nd day of May, 19 70, and was filed in Book
No. _____ Page No. C-21 of County Records.

Signature Eugene StutzTitle Register of Deeds

Township 35 North, Range 16 East, Section 1, Index No. C-21, Page No. _____

C 21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

⊙ = Corner monument restored.

Quarter Corner to Sections 1-6, T.35N., R.16-17E., Forest-Marinette Counties, Wisconsin.

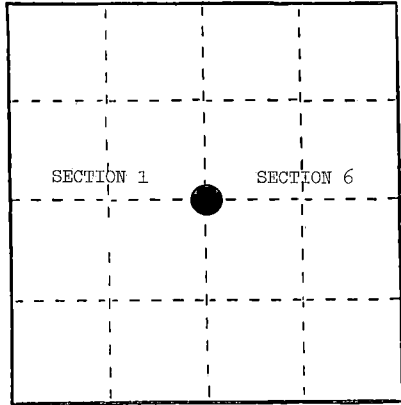

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post with the following BTs: Sugar, 18", N.79°W., 48 links; Elm, 12", S.42°E., 36 links.

In 1927, Goodman Lumber Company found an Elm post believed set by Wells Company surveyors. They set a 3" Maple post and a 2" flue pipe 20" high.

In 1934-35, J. J. Jenkins, Menominee County Surveyor, while surveying the east boundary of T.35N., R.16E., set a 4" iron pipe with brass cap stamped to identify the corner.


In 1969, J. Resvick (RLS) found Jenkins' County monument. He mounded rock around monument and added the following BTs: Maple, 7", S.56°E., 21.12 feet; Maple, 10", S.32°W., 10.83 feet; Maple, 15", N.49°W., 35.32 feet.

In 1987, A. Harrison (RLS) found monument and accessories as per Resvick. He repainted the BTs and added a steel sign post which bears south, 1.33 feet from corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County monument stamped to identify the corner.
2. Maple, 7", S.56°E., 21.12 feet
3. Maple, 10", S.32°W., 10.83 feet
4. Maple, 15", N.49°W., 35.32 feet
5. Steel Sign Post, South, 1.33 feet

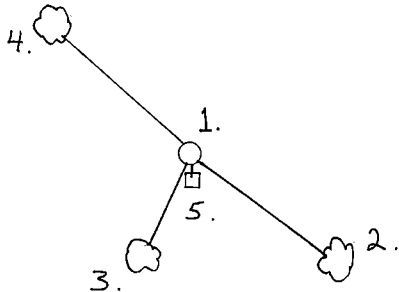

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 26th day
February, 1990, at

10:10 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

Page C-25

Paul H. Harkness
Register of Deeds

43516012644

C 25

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

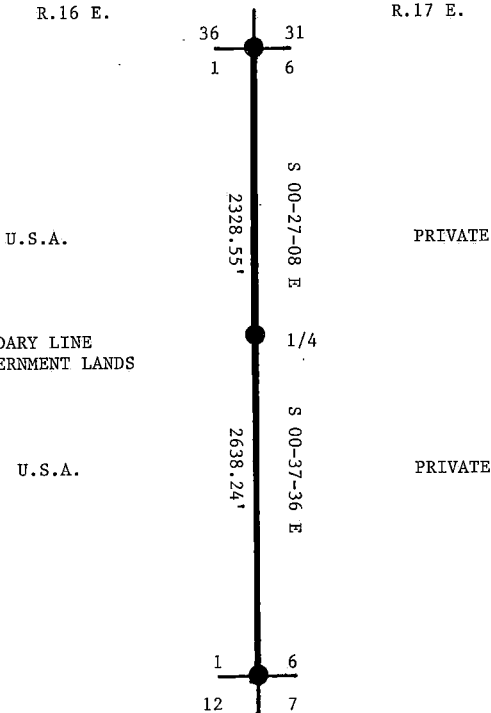

— = MARKED BOUNDARY LINE
OF U.S. GOVERNMENT LANDS

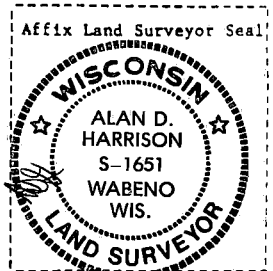

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Alan D. Harrison 2/20/90
Signature Date

Certificate ready for filing: Dale S. Hager
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 22nd day of July, 1969,
 I found evidence of the East quarter corner of Section 1
 Township 35 North, Range 16 East, Fourth Principal Meridian, as described
 hereon; and that from this evidence I established a new ~~monument~~ and accessories as described hereon to per-
 petuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.

Set wood post.

Sugar 18, bears N79W, 48 lks.


Elm 12, bears S42E, 36 lks.

Survey for Marinette County by J.J. Jenkins, Menominee County Surveyor, in Dec. 1934 and Jan.
 1935 and recorded in Marinette County.

Set 4 inch iron post for the quarter corner between sections 1 and 6.

Description of corner evidence found:

Found 4 inch diameter iron post with brass cap marked:

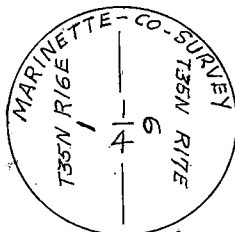
Description of ~~monument~~ accessories I established to perpetuate the ~~original~~ location of this corner:

Blazed and scribed the following new bearing trees.


Maple 7, bears S56E, 21.12 ft. or 32.000 lks.

Maple 10, bears S32W, 10.83 ft. or 16.409 lks.

Maple 15, bears N49W, 35.32 ft. or 53.515 lks.

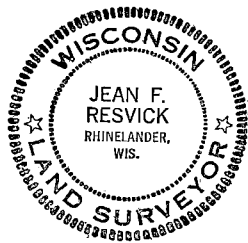

43516012000

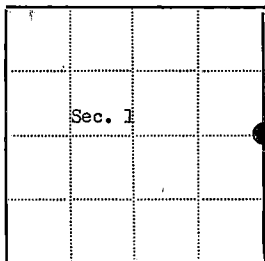

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland Wisconsin, this 30th day of July
 1969.

Signature Jean F. Resvick Title Cadastral surveyor
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NO. 98044Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
 on the 22nd day of May, 1970, and was filed in Book
 No. _____ Page No. C-25 of County Records.

Signature Eugene Stutz Title Register of Deeds

Township 35 North, Range 16 East, Section 1, Index No. C-25, Page No. _____

C 25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 6-7, T.35N., R.16E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day


of August A.D. 1987 at

8:35 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page E-3

Paul A. Schenck
Register of Deeds

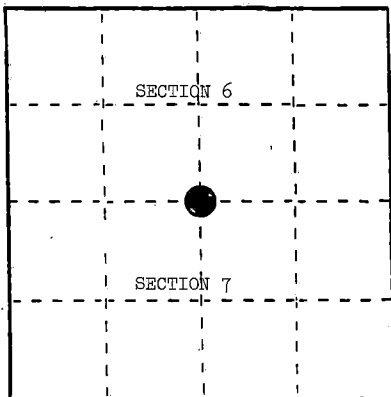

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following BTs: Hemlock, 8", N.28°W., 7 links; Hemlock, 15", S.27°E., 9 links.


In 1936, John Hammes found a Cedar stake and placed a metal location poster on the west side of the found stake.

In 1987, Alan Harrison (R.L.S.) found a 2" iron pipe in a mound of stone. Pipe is driven next to post point remains. Did not find location poster as set by Hammes. Blazed lines run east and west from pipe. Distance east to edge of swamp fits within 15 feet of original survey call. Accepted location of pipe as best corner evidence and replaced said pipe with a 2½" x 36" aluminum monument stamped for corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument stamped to identify the corner, in a mound of stone.
2. Sugar, 7", N.56°E., 32.29 feet.
3. Sugar, 4", S.33°W., 14.06 feet.
4. Red Maple, 6", N.50°W., 39.52 feet.
5. Steel Sign Post, Southeast, 1.29 feet.

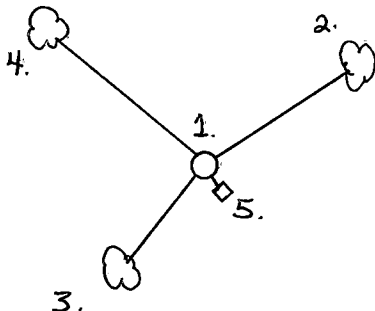

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
- (2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

8/5/87
Date

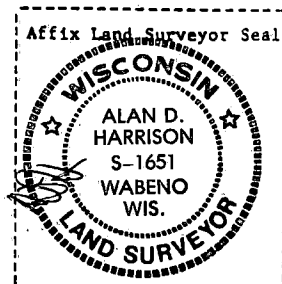

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section Corner to Sections 5-6-7-8, T.35N., R.16E.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 10th day
of August A.D. 1987 at
8:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

PAID E. J. Hochenauer
Register of Deeds

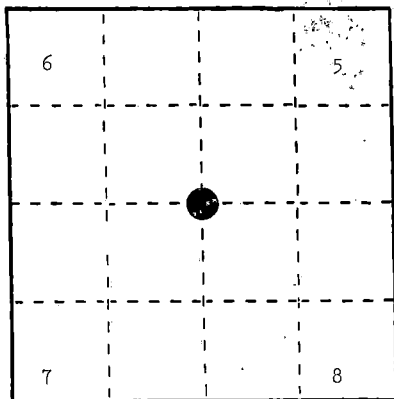

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following BTs: Elm, 15", N.45°W., 58 links; Ironwood, 8", N.2°E., 4 links; Sugar, 8", S.48°E., 46 links; Sugar, 10", S.38°W., 37 links.


In 1936, John Hammes found an Elm stake in good condition 3 chains north of a railroad grade. He set a location poster on a Maple, 8", which bears north, 20 links from corner.

In 1987, Alan Harrison (R.L.S.) found a 2" iron pipe in a mound of stone, driven next to a Cedar post point. Railroad grade is ±200 feet south. No original evidence found nor the metal location poster. Accepted iron pipe as best evidence location and replaced pipe with a 2½" x 36" aluminum monument with tablet stamped for corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments:

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument stamped to identify the corner, in a mound of stone.
2. Sugar, 5", N.6°E., 12.65 feet.
3. Sugar, 12", S.58°W., 24.93 feet.
4. Sugar, 7", N.51°W., 43.08 feet.
5. Steel Sign Post, Northeast, 1.00 feet.

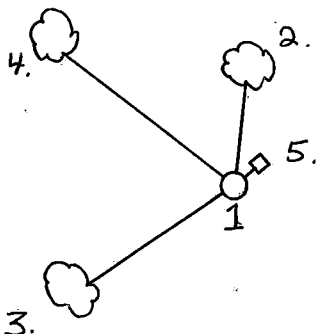

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature


8/5/87
Date




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. E-7

Quarter _____ Corner to Section 5 8 T 35 N, R 16 E
(Section/Quarter) _____

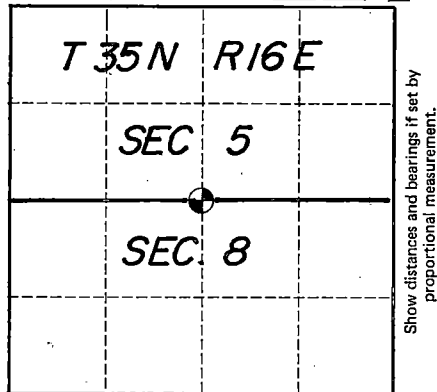

○ = Corner monument restored.

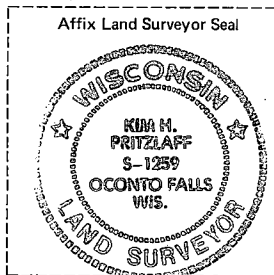

Set a 2"x36" Aluminum Post with cap stamped for corner in place of existing wood post. Bearings and distances shown are to nails driven into the tree centers with measurements to the nearest foot. Bearings are magnetic.

I, Kim H Pritzlaff, RLS
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1992

Date


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858, James McBride, contract surveyor, set this corner at 40 chains and marked the following bearing trees:

Fir 8" N03W 3 links
Hemlock 11" S10W 30 links

During a traverse of Section 8, a squared cedar post was found in a rock cairn approximately 2640 ft east of the section corner. A CCC tag was also found nailed to a nearby tree. I pulled S10W for 22 feet and found rotted Hemlock stump evidence. I accepted the post as the corner perpetuation and monumented same.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

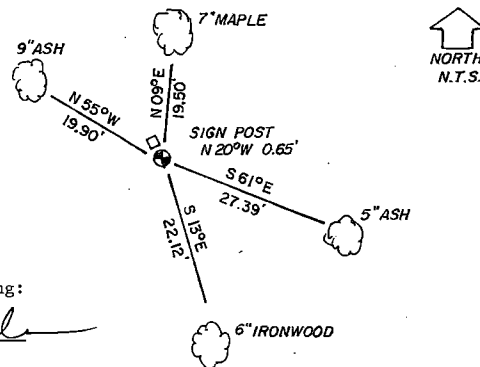

Plat Ready For Filing:

Ralph L. Abel
Acting District Ranger

43516050020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.


NOV 23 1993

Paul A. Anderson
9:07 AM
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. E-11

1/4 Corner to Section 9 4 T35N, R16E
(Section/Quarter)

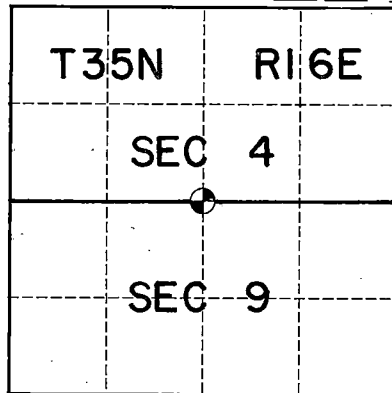

Show distances and bearings if set by
proportional measurement.

○ = Corner monument restored.



I, Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1997

Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, set this corner at 39.94 chains and marked the following bearing trees:

Sugar	10"	N64E	9
Hemlock	16"	S45E	27

Set a search area at the single proportionate position for this corner and recovered an iron rail in a rock cairn east the proportionate location 40 ft *. I pulled S45E for 17.82 ft and recovered rotted Hemlock stump remains. Possible hardwood stump hole was noted N64E for 6 feet. I accepted the iron rail as the corner perpetuation and monumented same.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

Set a 2"x 36" aluminum post with stamped cap in place of the iron rails.


Ties are to aluminum nails

driven into the tree
centers which trees were
scribed and blazed.

Bearings are magnetic.

1-2 = N45°E	5.64'
1-3 = S13°E	21.04'
1-4 = S86°W	42.85'
1-5 = N13°W	30.19'
1-6 = West	4.60'

● = Set 2"x36" Aluminum
Monument

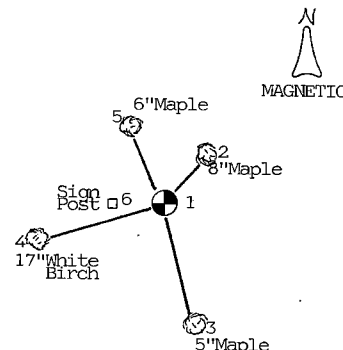

Certificate Ready For Filing:

Ralph McCall
Acting District ranger

149051

43516040020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature


Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

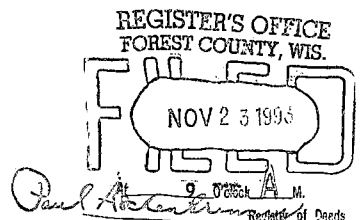


U. S. PUBLIC LAND SURVEY MONUMENT RECORD**INSTRUCTIONS:**

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 3, 4, 9, and 10,
T.35N., R.16E.

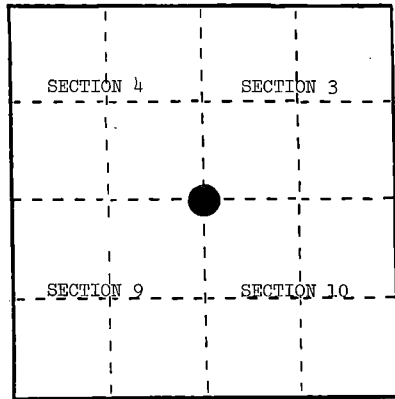

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Birch, 20", N.37°W., 15 links; Sugar, 10", N.16°E., 55 links; Sugar, 10", S.53°E., 17 links; Birch, 8", S.47°W., 13 links.


In 1928, Goodman Lumber Company found rotted post and a post by water-power surveyors in 1927 and BTs by Connor surveyor from 1928. Set a flue pipe, 2" x 32".

October 31, 1984, Alan Harrison found 2" iron pipe by Goodman Lumber Company, no evidence of post. From pipe, at N.37°W., 9.90' large tree turnout; at N.16°E., 36.30', stump hole; at S.53°E., 11.22', stump hole; at S.47°W., 8.58', found nothing.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify the corner.
2. Sugar, 9", N.16°E., 65.09'
3. Sugar, 5", S.78°E., 38.51'
4. Sugar, 10", S.61°W., 28.82'
5. Sugar, 10", N.28°W., 76.99'
6. Steel Sign Post, South, 2.00'

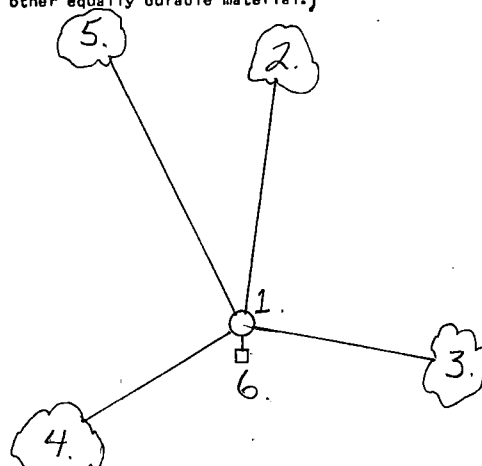

REGISTER'S OFFICE
Forest County, Wis.

Received for record this... 23rd day

of... January... A.D., 1985 at

9:00 o'clock... A.M. and

recorded in Vol. CORNER RESTORATION

on page 13

Paul A. Schumacher
REGISTER

4351604 0000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(1) I, Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/14/84
Date

Affix Land Surveyor Seal

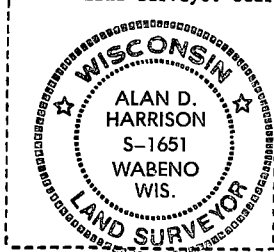


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner to Sections 3 and 10, T.35N., R.16E.

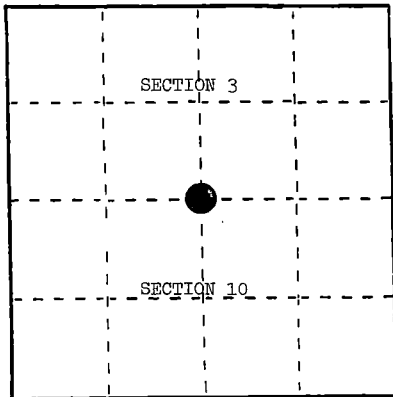

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day

of February A.D., 1988 at

10:00 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page 5-15

Paul A. Schenck
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Elm, 12", N.11°W., 22 links; Elm, 14", S.27°W., 10 links.

In 1928, Goodman Co. found a 4" Maple post by Wells Co. and set a 4" Elm post and flue pipe 2" x 30".


In 1936, J. Hammes found iron pipe and put a location poster on a 9" Maple from which the corner bears N.16°W., 20 links.

In 1987, Alan Harrison found location poster grown into a 20" Sugar as per Hammes. Pulled N.16°W., 13.2 feet from Sugar and found Goodman's flue pipe lying down. Found pipe hole and wood post hole and turnouts in location of original BTs. Monumented post hole as best remaining evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument with tablet stamped to identify the corner.
- Sugar, 18", N.45°E., 35.94 feet
- Sugar, 22", S.18°E., 15.20 feet
- Sugar, 7", N.54°W., 13.64 feet
- Steel Sign Post, 6', East, 0.73 feet

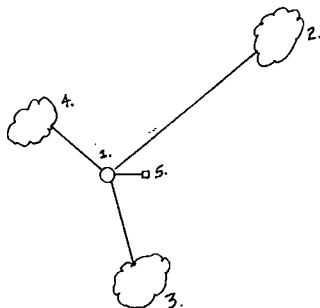

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

2/11/88
Date

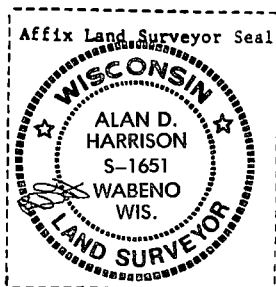

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 11th day of Sept., 19 72, I found evidence of the Northeast Section corner of Section 10 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride
80.00 chains North between section 10 and 11, set post.
Linn 16, bears N83W, 35 lks.
Sugar 16, bears N50E, 31 links
Sugar 8, bears S64E, 37 links
Ironwood 10, bears S36W, 37 links


Description of corner evidence found:

2 inch steel pipe, 20 inches above ground
Old post point along side of pipe
Basswood snag, 28 inch diam. with rotted out blaze and open face, bears N81W, 35 links
Stump hole bears N50E, 31 links
Stump hole bears S64E, 37 links

Description of monument and accessories I established to perpetuate the original location of this corner:


Replaced 2 inch pipe found with 2 inch inside diam. galvanized iron pipe, 5 ft. long, filled with concrete, flanged on bottom with brass cap stamped.

From which the following blazed and scribed new bearing trees bear:

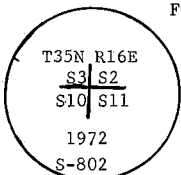

Maple 5, N24W, 13.50 ft.
Yellow Birch 8, S14E, 17.88 ft.
Basswood 9, S60W, 9.27 ft.
Maple 7, N18W, 37.62 ft.

43516030000

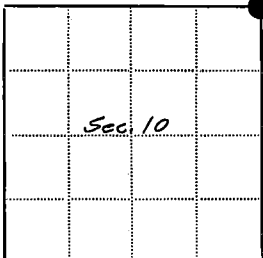

⊗ = Corner monument restored

□ =

Resident witnesses

Dated at Rhineland Wisconsin, this 6th day of April, 19 73.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 103127

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 10th day of April, 19 73, and was filed in Book No. E-17 Page No. E-17 of County Records.

Signature Eugene Stangor Title Register of Deeds

Township 35 North, Range 16 East, Section 10, Index No. E-17, Page No. 17


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter Corner to Sections 2 and 11, T.35N., R.16E.

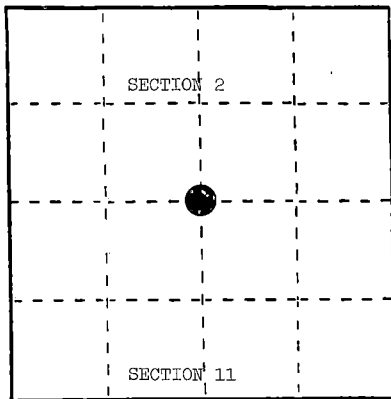

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day

of February A.D. 1988 at

10:00 o'clock A.M. and recorded

in Vol. 5-19

page 5-19

Register of Deeds

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Linn, 16", N.59°E., 14 links; Sugar, 14", S.27°W., 24 links.

In 1928, Goodman Co. found old 4" Maple post partly rotted (set by Wells Co.). Set 4" Hemlock post and 2'-8" flue pipe 1' high. Found 16" Linden at N.59°E., 14 links, to be a stub.

In 1936, J. Hammes found iron pipe and placed a location tag on 4" Hemlock post alongside iron pipe.


In 1974, Resvick and Tallier found a 1" iron pipe with top of old post with Forest Service location tag stuck in top of pipe. Also found a 2" iron pipe alongside 1" iron pipe and post remains found in hole after removing pipe. Found no evidence of BTs.

In 1987, Alan Harrison found the corner as per Resvick and Tallier and noted that original Basswood BT is now a stump hole. Monumented post hole as best remaining evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" x 36" aluminum monument with tablet stamped to identify the corner.
2. Sugar, 10", N.09°W., 29.30 feet
3. Basswood, 12", S.75°E., 19.54 feet
4. Sugar, 14", N.48°W., 58.42 feet
5. Steel Sign Post, 6', Southeast, 0.73 feet

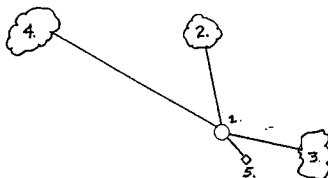

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

2/11/88

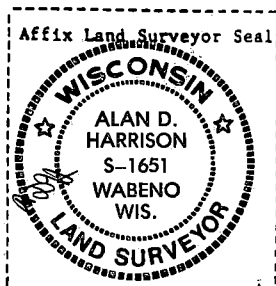


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Section Corner to Sections 1-2-11-12, T.35N., R.16E., Forest County, Wisconsin.

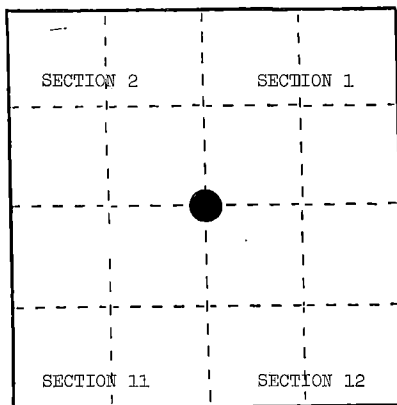


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following BTs: Sugar, 10", N.35°W., 32 links; Sugar, 12", N.76°E., 18 links; Sugar, 14", S.68°E., 60 links; Hemlock, 16", S.09°W., 55 links. In 1927, Goodman Lumber Company found a 3" Cedar post with the following BTs: Maple, 16", N.82°E., 18 links, with BT marks; Maple stub (dead), 16", S.67°E., 60 links. They set a flue pipe 14" high for corner. In 1936, John Hammes found a 1½" iron pipe 16" above ground. He placed a metal location tag on a Maple BT, 30" diameter, on the west side of tree from which the corner bears S.76°W., 20 links. In 1969, J. Resvick found 1½" iron pipe with post point alongside and a 30" snag which bears N.76°E., 18 links from pipe. Snag has overgrowth scribing. He replaced post point with a 2" x 60" iron pipe filled with concrete with brass cap stamped for corner. (He made BTs to corner--see sketch.) In 1988, A. Harrison found monument and accessories per Resvick and added a steel sign post (see sketch).

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" monument with brass tablet stamped to identify the corner.
2. Maple, 18", N.23°E., 31.75 feet
3. Yellow Birch, 12", S.34°E., 26.66 feet
4. Maple, 10", S.70°W., 21.85 feet
5. Basswood, 9", N.43°W., 21.19 feet
6. Steel Sign Post, North, 1.59 feet

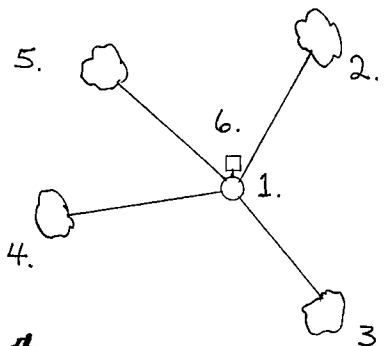

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 29th day
of March A.D., 1990 at

10:00 o'clock A.M. and recorded
in Vol. 41 CORNER RESTORATIONS

page 5-41

Paul A. Schuchman
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/12/90
Signature Date

Certificate ready for filing: Dale R. Haeger
District Ranger

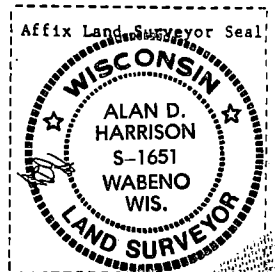

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 16th day of July, 1969, I found evidence of the Southwest Section corner of Section 1 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride.
Set wood post for Sections 1, 2, 11 and 12.
Sugar 10, bears N35W, 32 lks.
Sugar 12, bears N76E, 18 lks.
Sugar 14, bears S68E, 60 lks.
Hemlock 16, bears S 9 W, 55 lks.

Description of corner evidence found:


Maple, 30 inch snag with over growth scribing from which a 1½ inch diam. pipe and post point bear S76W, 18 lks.

Description of monument and accessories I established to perpetuate the original location of this corner:


Replaced post point with a 2 inch inside diameter, galvanized wrought iron pipe, 5 feet long, filled with concrete, flanged at bottom with brass cap stamped.

T35N R16E
S2 S1
S11 S12
1969
S-802

From which the following blazed and scribed new bearing trees bear.
Maple 18, bears N23E, 48.1 lks.
Y. Birch 12, bears S34E, 40.4 lks.
Maple 10, bears S70W, 33.1 lks.
Basswood 9, bears N43W, 32.1 lks.

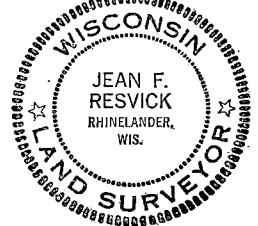

43516020000

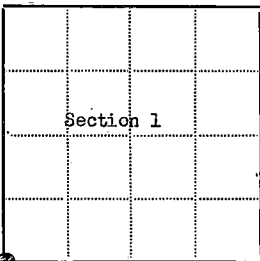

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland Wisconsin, this 30th day of July 1969

Signature Jean F. Resvick Title Cadastral surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 98042

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in Book No. _____ Page No. E-21 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 16 East, Section 1, Index No. E-21, Page No. _____

E
21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

● = Corner monument restored.

Quarter Corner common to Sections 1-12, T.35N., S.16E., Forest County, Wisconsin.

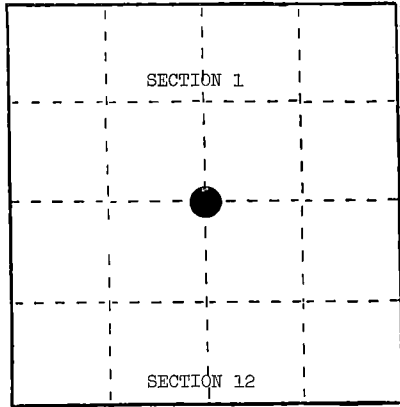

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post and made the following BTs: Cedar, 8", N.28°E., 13 links; Black Ash, 10", S.43°E., 5 links.

In 1927, Goodman Company found 2½" Cedar post set by Wells Company in swamp. They set a flue pipe 34", 10" high. Found references as follows (no bearing marks): Cedar stump, 16", S.52°E., 11 links; Birch stump, 12", S.65°E., 4 links; Tamarack stump, 13", S.16°W., 14 links. In 1936, J. Hammes found 1½" iron pipe and put location poster on a Cedar, 8", S.78°W., distance not listed.

In 1969, J. Resvick found iron pipe alongside 3" x 3" squared wood post. Location poster on 8" Cedar with Hammes' initials.

In 1975, J. Resvick returned to corner and found an unstamped brass capped monument set in place of pipe and post by unknown person.


In 1987, A. Harrison found corner as per Resvick and the remains of the stumps found by Goodman Company. Stamped monument cap and made new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Brass capped monument stamped to identify corner location.
2. Black Ash, 8", S.11°E., 16.30 feet
3. Cedar, 7", S.23°W., 17.50 feet
4. Cedar, 14", N.24°W., 48.63 feet
5. Steel Sign Post, Northeast, 0.90 feet

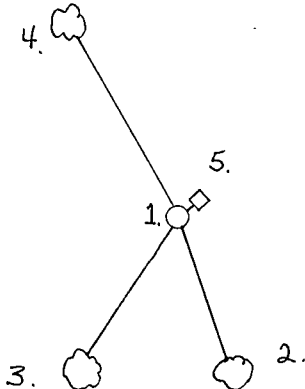

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 26 day
of February, 1990, at
10:10 o'clock A.M. and recorded

in Vol. **CORNER RESTORATIONS**
page **E-23**

Paul A. Schrammer
Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 2/20/90
Signature Date

Certificate ready for filing: Dale S. Steen
District Ranger

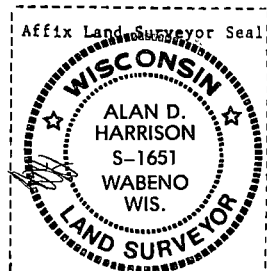

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.


○ = Corner monument restored.

Quarter Corner to Sections 1 and 12, T.35N., R.16E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day
of February A.D., 1988 at
10:00 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 5-93

but
Register of Deeds

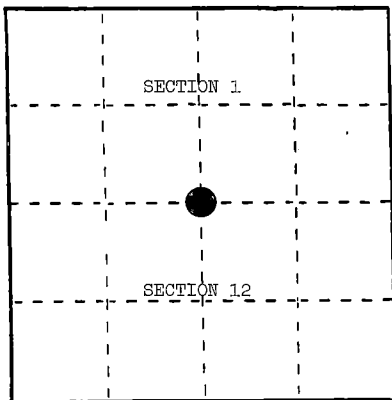

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set post with the following BTs: Cedar, 8", N.28°E., 13 links; Black Ash, 10", S.43°E., 5 links.

In 1927, Goodman Co. found a 2½" Cedar post set by Wells Co. Set 34" flue pipe 10" high. Had no trees with bearing marks but had the following: Cedar Stump, 16", S.52°E., 11 links; Birch Stump, 12", S.65°E., 4 links; Tamarack Stump, 13", S.16°W., 14 links.

In 1936, John Hammes found a 1½" iron pipe and placed a metal location poster on the east side of an 8" Cedar.

In 1969, Jean Resvick found 1½" iron pipe alongside a 3" x 3" squared Cedar post and a Forest Service location poster on an 8" Cedar 28 chains west of corner.


In 1975, Jean Resvick and Tom Tallier found an unstamped monument set in place with iron pipe and post alongside.

In 1987, Alan Harrison and Tom Tallier found monument as per Resvick and Tallier in 1975. They stamped the cap and made accessories to it.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Aluminum monument with cap stamped to identify the corner.
2. Ash, 8", S.11°E., 16.30 feet
3. Cedar, 7", S.23°W., 17.50 feet
4. Cedar, 14", N.24°W., 48.63 feet
5. Steel Sign Post, 6', Northeast, 0.90 feet

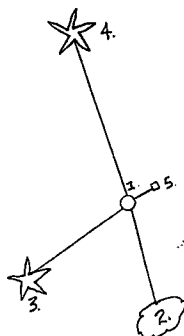

43516810020

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Alan D. Harrison


- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

2/11/88

Affix Land Surveyor Seal

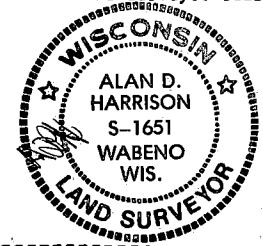

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter Corner Common to Sections
1 and 12, T.35N., R.16E., Forest
County, Wisconsin

State Plane Coordinates

N - 138,443.95

E - 2,369,241.49

Geographic Coordinates

N - 45-32-07.85


W - 88-26-10.01

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 4th day
of March A.D., 1999 at
1:15 o'clock P.M. and recorded
in Vol. 100 CORNER RESTORATION

page E-23

Christine Chlenger
Deputy Register of Deeds

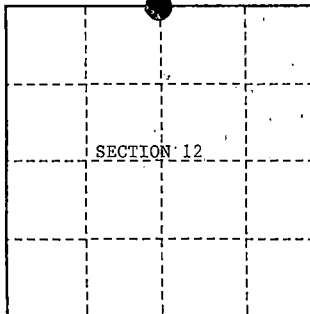

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post and maked the following BTs: Cedar, 8", N.28°E., 13 links; Black Ash, 10", S.43°E., 5 links.

In 1927, Goodman Company found 2½" Cedar post set by Wells Company in swamp. They set a flue pipe 34", 10" high. Found references as follows (no bearing marks): Cedar stump, 16", S.52°E., 11 links; Birch stump, 12", S.65°E., 4 links; Tamarack stump, 13", S.16°E., 14 links.

In 1936, J. Hammes found 1½" iron pipe and put location poster on a Cedar, 8", S.78°W., distance not listed.

In 1969, J. Resvick found iron pipe alongside 3" x 3" squared wood post. Location poster on 8" Cedar with Hammes' initials.

In 1975, J. Resvick returned to corner and found an unstamped brass capped monument set in place of pipe and post by unknown person.


In 1987, A. Harrison found corner as per Resvick and the remains of the stumps found by Goodman Company. Stamped monument cap and made new references.

In 1998, Alan Harrison, R.L.S., found monument and B.T.s as described. Cut down SE and SW B.T.s for G.P.S. observation; made new B.T.s: Black Ash, 6", N.52°E., 33.62 feet, Black Ash, 8", S.04°E., 43.06 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Brass Cap Monument stamped to identify corner.
2. Black Ash, 6", N.52°E., 33.62 feet (NBT)
3. Black Ash, 8", S.04°E., 43.06 feet (NBT)
4. Cedar, 14", N.24°W., 48.63 feet
5. Steel Sign Post, Northeast, 0.90 feet

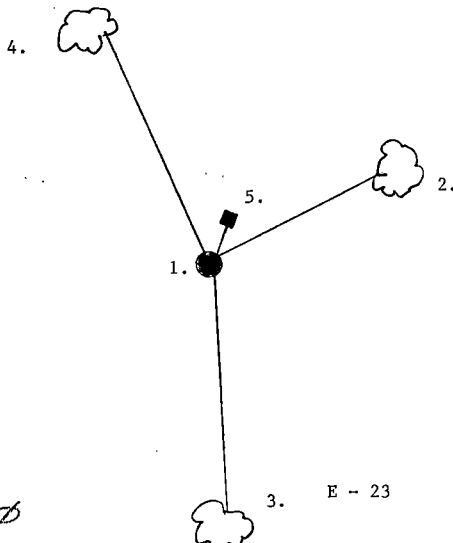

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No


- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

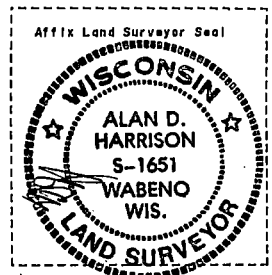

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 1-6-7-12, T.35N., R.16-17E., Forest Marinette Counties, Wisconsin.

State Plane Coordinates


N - 138497.05

E - 2371870.21

Geographic Coordinates

N - 45-32-07.87

W - 88-25-33.07

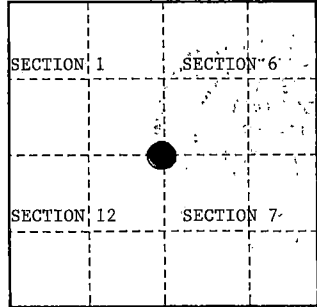

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post with the following BTs: Cedar, 16", S.55°W., 11 links; Cedar, 12", N.65°W., 23 links; Cedar, 12", N.56°E., 33 links; Cedar, 15", S.34°E., 42 links.

In 1928, Goodman Lumber Company found a 4" Cedar post believed to have been set by the Wells Company. They set a 36" blue pipe next to post. From post, they found a dead 16" Cedar which bears N.50°E., 32 links.

In 1934-35, J.J. Jenkins, Menominee County Surveyor, while surveying the east boundary of T.35N., R.16E., set a 4" iron pipe with brass cap stamped to identify the corner.

In 1969 J. Resvick (RLS) found County monument as per Jenkins and added the BTs.

In 1988, Alan Harrison (RLS) found monument and accessories as per Resvick and added a steel sign post.


In 1998, Alan Harrison (RLS) replaced tipped over County Monument and replaced S.E. and S.W. bearing trees.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 24th day
of March A.D., 1999, at
1:15 o'clock P.M. and recorded
in Vol. CORNER RESTORATION
page E-25
Christie Ehlig
Deputy Register of Deeds

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" X 60" Aluminum Monument stamped to identify the corner.
2. Black Ash, 8", N.74°E., 30.09 feet
3. Cedar 12" S.31°E., 56.88 feet
4. Black Ash 8" S.75°W., 48.48 feet
5. White Spruce, 4" N.57°W., 38.49 feet
6. Steel Sign Post, Northwest, 1.16 feet

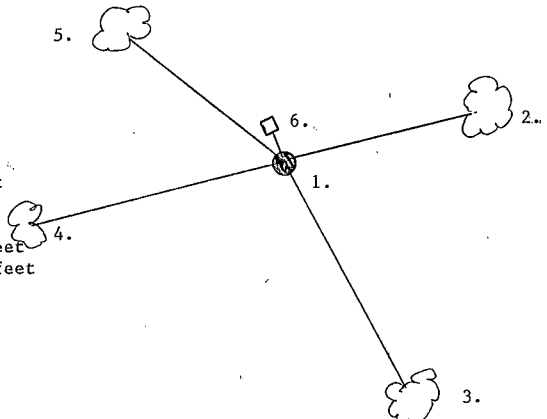

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


none

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

no

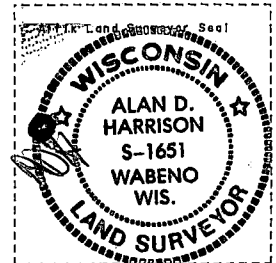

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

139176

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

⊙ = Corner monument restored.

Section Corner to Sections 1-6-7-12, T.35N., R.16-17E., Forest-Marinette Counties, Wisconsin.

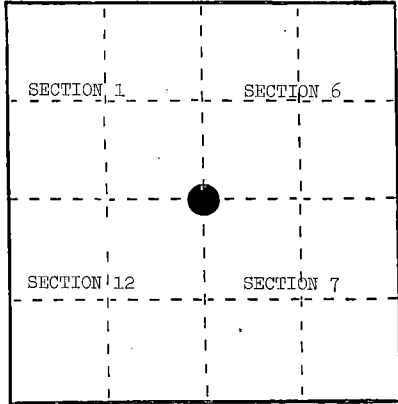

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set a wood post with the following BTs: Cedar, 16", S.55°W., 11 links; Cedar, 12", N.65°W., 23 links; Cedar, 12", N.56°E., 33 links; Cedar, 15", S.34°E., 42 links.

In 1928, Goodman Lumber Company found a 4" Cedar post believed to have been set by the Wells Company. They set a 36" flue pipe next to post. From post, they found a dead 16" Cedar which bears N.50°E., 32 links.

In 1934-35, J. J. Jenkins, Menominee County Surveyor, while surveying the east boundary of T.35N., R.16E., set a 4" iron pipe with brass cap stamped to identify the corner.


In 1969, J. Resvick (RLS) found County monument as per Jenkins and added the BTs.

In 1988, Alan Harrison (RLS) found monument and accessories as per Resvick and added a steel sign post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County Monument stamped to identify the corner.
2. Black Ash, 8", N.74°E., 30.09 feet
3. Black Ash, 3", S.44°E., 17.65 feet
4. Balsam, 6", S.53°W., 16.55 feet
5. White Spruce, 4", N.57°W., 38.49 feet
6. Steel Sign Post, Northwest, 1.16 feet

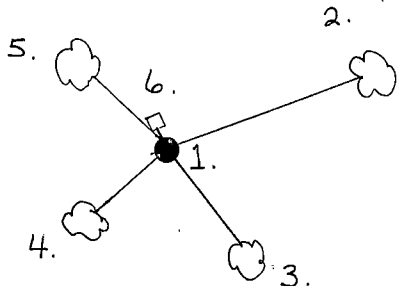

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 26th day of February, 1990, at 10:10 o'clock A.M. and recorded in Vol. 1010
page 25

CORNER RESTORATIONS

Paul J. Schumacher
Register of Deeds

43516010000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

2/20/90
Date

Certificate ready for filing: Alan S. Steege

District Ranger

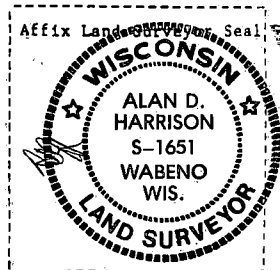

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 16th day of July, 1969, I found evidence of the Southeast Section corner of Section 1 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.

Set wood post.

Cedar 16, bears S55W, 11 lks.

Cedar 12, bears N65W, 23 lks.

Cedar 12, bears N58E, 33 lks.

Cedar 15, bears S34E, 42 lks.


1 chain North leave swamp.

Survey for Marinette County by J.J. Jenkins, Menominee County surveyor, in Dec. 1934 and Jan. 1935 and recorded in Marinette County.

Set 4" iron post for the corner to sections 1, 6, 7 and 12.

Description of corner evidence found:

Found 4 inch diameter iron post with brass cap marked.

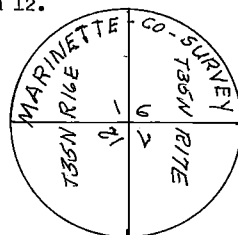Description of ~~monument and~~ accessories I established to perpetuate the original location of this corner:

Blazed and scribed the following new bearing trees.

Blk. Ash 8", bears N74E, 30.09 ft. or 45.591 lks.


Blk. Ash 3", bears S44E, 17.65 ft. or 26.742 lks.

Balsam 6, bears S53W, 16.55 ft. or 25.076 lks.

White Spruce 4, bears N57W, 38.49 ft. or 58.318 lks.



4351601.0000

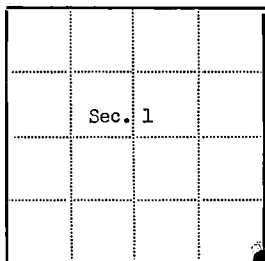

Resident witnesses.....

Dated at Rhinelander1969Wisconsin, this 30th day of JulySignature Jean F. ResvickTitle Cadastral surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. "S-802"DOCUMENT No. 98048Office of Register of DeedsCounty of ForestI hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 1970, and was filed in BookNo. Page No. E-25 of County Records.Signature Eugene StutzmanTitle Register of DeedsTownship 35 NorthRange 16 EastSection 1Index No. E-25

Page No.

E 25

143919


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter corner to sections 7 and 8,
 T.35N., R16E. Forest County, Wisconsin.

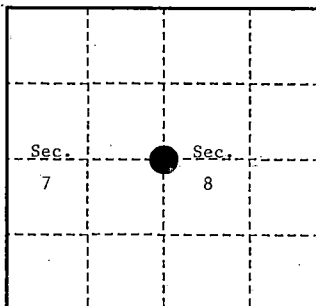

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James Mc Bride set wood post with the following B.T.s: Ironwood, 8", S.78°E., 14 links (9.24 feet); Linden, 20", N65°W., 5 links (3.30 feet).

On November 15, 1991, Alan D. Harrison found a 2" iron pipe and 4" squared cedar post. Old Connor Co. blazed lines North and South out of iron pipe. No evidence of original B.T.'s. Replaced iron pipe with a monument as best evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2½"x36" Aluminum monument with tablet stamped to identify corner.
- Sugar, 7", N.45°E., 55.10 feet.
- Sugar, 7", S.47°E., 20.89 feet.
- Black Cherry, 9", N.17°W., 44.67 feet.
- Steel Sign Post, 6', South, 1.48 feet.

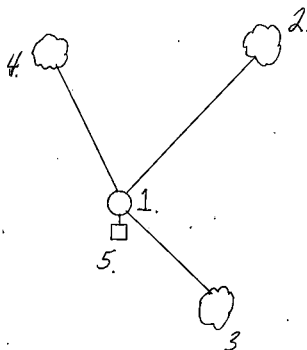

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 2nd day
 of March A.D., 19 92 at
2:00 o'clock P.M. and recorded
 in Vol. 64 of Platbooks
 page 5

Paul H. Schenck
 Register of Deeds

43516072000

G-5

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

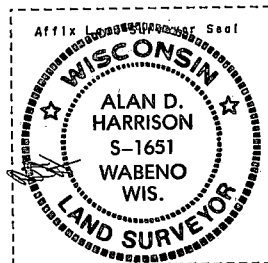

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 12/31/91
Signature Date


CERTIFICATE READY FOR FILING:

Sue Vap
District Ranger

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. G-9

Quarter _____ Corner to Section 8 9 T 35N, R 16E
(Section/Quarter)

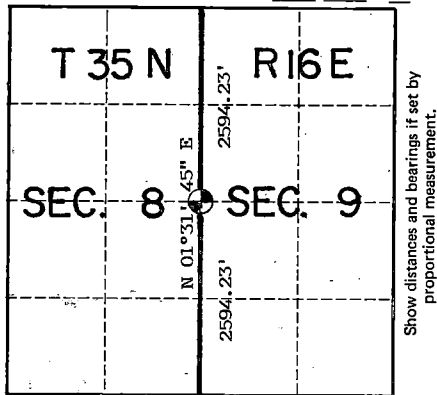

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

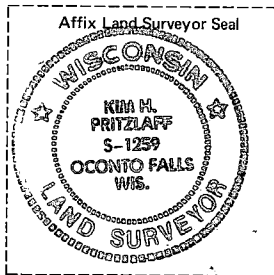

Set a 2"x 36" aluminum monument with cap stamped for corner. No suitable bearing trees fell within range, so four 1" x 24" iron pipe were set as shown with steel sign post adjacent to them. Bearings are magnetic.


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, contract surveyor, set this corner at 40 chains using the following bearing trees:

Fir	8"	N48W	4 links
Fir	8"	N67E	9 links

A search area for this corner was set up at single proportionate location. The corner position fell in recently logged Aspen slashing. No evidence of the corner or blazed lines were found. The corner was determined to be lost and was set at single proportionate measure.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

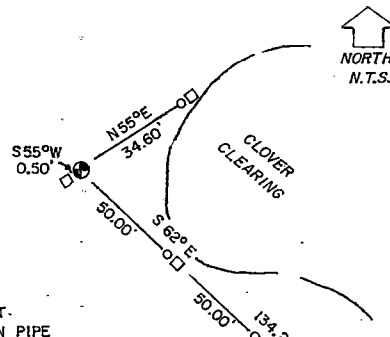

● = USFS MON.
□ = USFS SIGN POST.
○ = SET 1"x24" IRON PIPE

I, Kim H Pritzlaff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1093.
Date

Certificate Ready For Filing

Ralph H. H. H.
District Ranger

149054

4351608 2000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

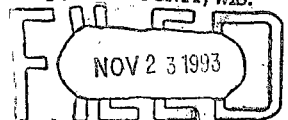

Paul A. [Signature] At 9 o'clock A.M.
Register of Deeds


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 9 and 10, T.35N., R.16E.

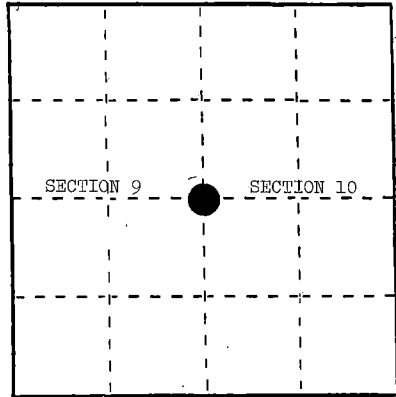

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Cedar, 12", N.44°E., 19 links; Cedar, 14", S.10°W., 9 links.

In 1928, Goodman Company proportioned $\frac{1}{4}$ corner, set 4" Elm post and 2" x 34" flue pipe.


In 1936, Hammes found 4 $\frac{1}{2}$ " Cedar stake, called it an original by G.L.O. field notes. Put location tag on south side of post.

October 11, 1984, Alan Harrison found Cedar post, as per Hammes. At S.10°W., 6.0', turned out 10" Cedar, too small for G.L.O.; N.44°E., 12.5', turned out to east "DBH" blazed 16" Cedar post is charred 1 $\frac{1}{2}$ ' up; at N.74°E., 33.8', found 2" iron pipe by Goodman Company--no post or hole. Accepted iron pipe, as wood post and BTs are newer and not original.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 30" aluminum monument stamped to identify the corner.
- White Ash, 8", N.28°E., 28.88'
- White Ash, 7", S.71°E., 28.05'
- White Oak, 14", N.75°W., 49.41'
- Steel Sign Post, Southwest, 1.11'

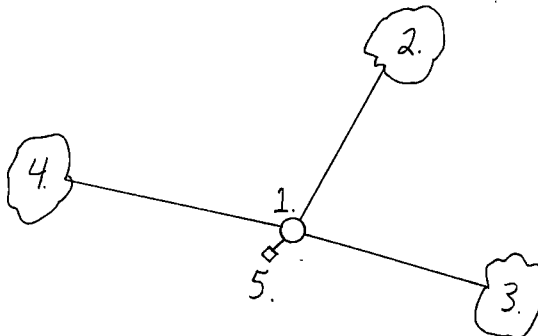

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 23rd day

of January, A.D., 1985, at

9:00 a.m.

recorded in Vol. CORNER RESTORATION

on page 13

by *John J. Hammes*
REGISTER

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Wood post found by Hammes at S.74°W., 33.8'.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/14/84
Date

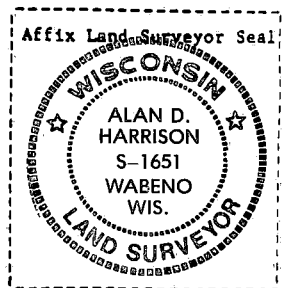

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 18th day of September, 1974, I found evidence of the east quarter corner of Section 10 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Surveyed by James McBride August 1858
North between Sections 10 and 11, 40.00 chains set post for corner of sections 10 and 11
Elm, 10", S59°E, 28 lks
Elm, 10", N44°W, 5 lks

Description of corner evidence found:

2" steel pipe, 20" above ground
Remains of large elm N44°W, 5 lks with overgrowth of bearing tree blaze

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced iron pipe with a 2 inch inside diameter, galvanized pipe 3 feet long, filled with concrete with a brass cap stamped T35N, R16E, 1/4, S10, S11, 1975, S-802
From which the following bear
Basswood, 20", S61°E, 74.44 feet
Basswood, 8", S66°W, 20.82 feet
Set steel sign post 0.5 ft NW of monument

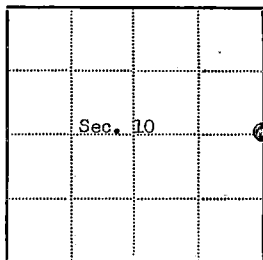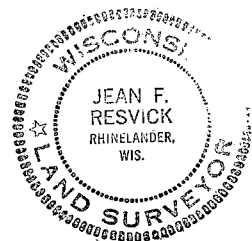

⊙ - Corner monument restored

□ -

Resident witnesses _____

Dated at Rhineland Wisconsin, this 20 day of March, 1975.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 Document Number 106863

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 31st day of March, 1975, and was filed in Book No. Corner Page No. G-17 of County Records.

Signature Eugene Satiny Title Register of Deeds

Township 35 North, Range 16 East, Section 10, Index No. G-17, Page No. _____

43516 102000

G 17

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.


Quarter Corner Common to Sections
11 and 12, T.35., R.16E., Forest
County, Wisconsin.

State Plane Coordinates

N - 135, 680.85
E - 2,366,642.59

Geographic Coordinates

N - 45-31-41.08
W - 88-26-47.27

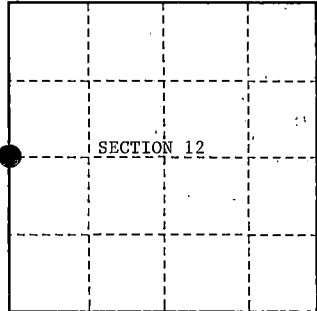

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post at 40 chains with: Sugar, 18", N83°E., 43 links, Sugar, 10", S45°W., 43 links.

In 1985, Kim Pritzlaff, R.L.S., recovered an iron pipe set in 1967 by Henry Gremmer, R.L.S. Replaced pipe with a 2" x 30" aluminum monument and the bearing trees as described below.


In 1998, Alan Harrison, R.L.S., found a monument and B.T.s as set in 1985. Cut down Maple, S.07°E., 6.69 feet for G.P.S. observations. Made 1 new bearing tree (NBT) as shown below.

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 24th day
of March A.D., 1999 at
1:15 o'clock P.M. and recorded
in Vol. CORNER RESTORATION
page 6-21
Christie Schling
Deputy Register of Deeds

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify corner
2. Sugar, 9", S.78°E., 27.19 feet
3. Sugar, 12", S.23°W., 45.11 feet (NBT)
4. Sugar, 7", S.75°W., 4.20 feet
5. Sugar, 9", N.25°W., 23.01 feet
6. Steel sign post S.75°W., 4.20 feet

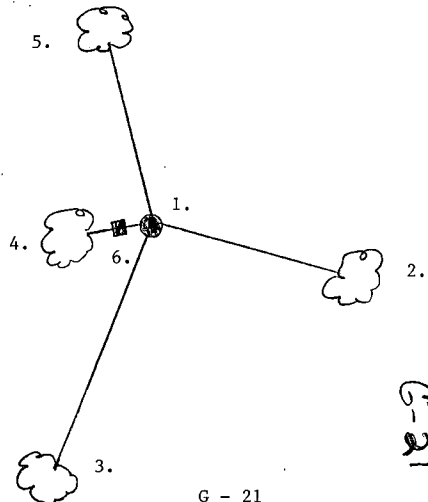

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

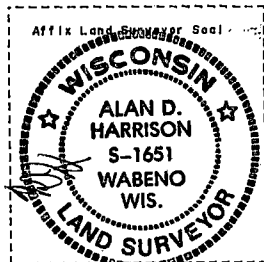

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 12 and 7, T.35N., R.16-17E. Forest/Marinette Counties, Wisconsin.

Geographic Coordinates: 45°31'41.859" North
 88°25'33.012" West

State Plane Coordinates: 135,863,552 North
 2,371,926.877 East

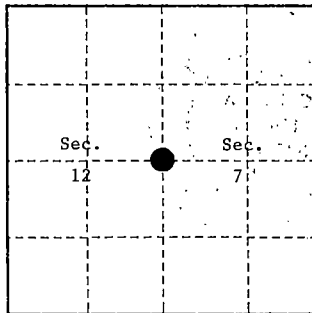

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 - Artemis Curtis set 1/4 post and made the following B.T.S.: Tamarack 16" S18°W 26 lks (17.16'), Tamarack 16" N38°E 48 lks (31.68')

In 1927- Goodman Co. found 3" cedar post in swamp and set 30" flue pipe and dead cedar 8" S45°W 13 lks (8.58').

In 1933 - J. Jenkins, set 4" iron post for 1/4 corner along side wood post.


In 1998 - Alan Harrison, R.L.S. found Marinette Co. monument tipped over with wood post along side. Set new monument and sign posts as below in middle of dead beaver flowage.

REGISTER'S OFFICE
 Forest County, Wis.
 Received for record this 24th day
 of March A.D., 1999 at
 1:15 o'clock P.M. and recorded
 in Vol. CORNER RESTORATION
 page 6-25
Christi Ehling
 Deputy Register of Deeds

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1.) 2 1/2" x 60" aluminum monument stamped with corner location.
 - 2.) Steel sign post North 0.50 feet.
 - 3.) Steel sign post South 0.50 feet.
- No other references within 250 feet.

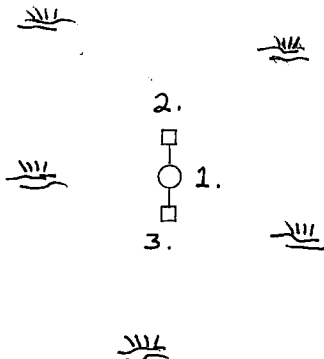

43516 12 2000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

no

(1) I, ALAN D. HARRISON

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger




U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 11-12,
 Township 35 North, Range 16 East,
 Forest County, Wisconsin.

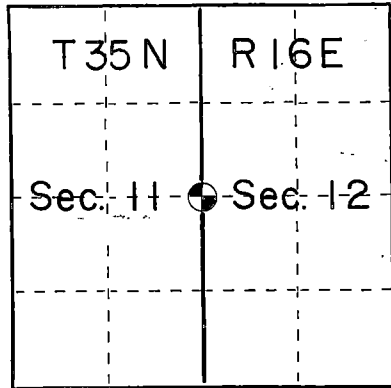

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post at 40 chains with:


Sugar 18" N83E 43 links

Sugar 10" S45W 43 links

Located a 2" iron pipe set by Henry Gremmer, RLS from old wood post during a survey in 1967. Accepted this iron pipe position. No corner evidence around

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

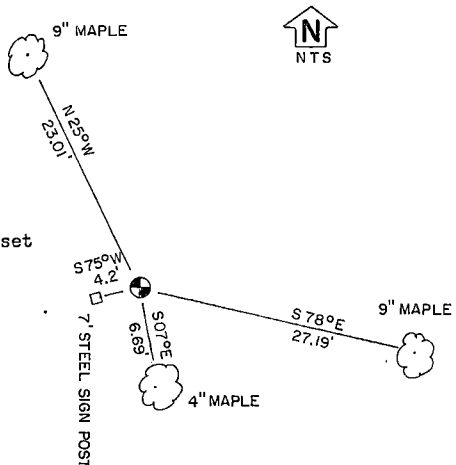

Set a 2"x 30" Aluminum monument with cap stamped for corner and accessories set to USFS standards.

REGISTER'S OFFICE
 Forest County, Wis.
 Received for record this 7th day
 of August A.D. 1985 at
3:00 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 Page G-21
Paul Aschenbrenner
 Register of Deeds

43516112000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



No discrepancy

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated position.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

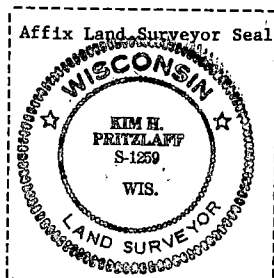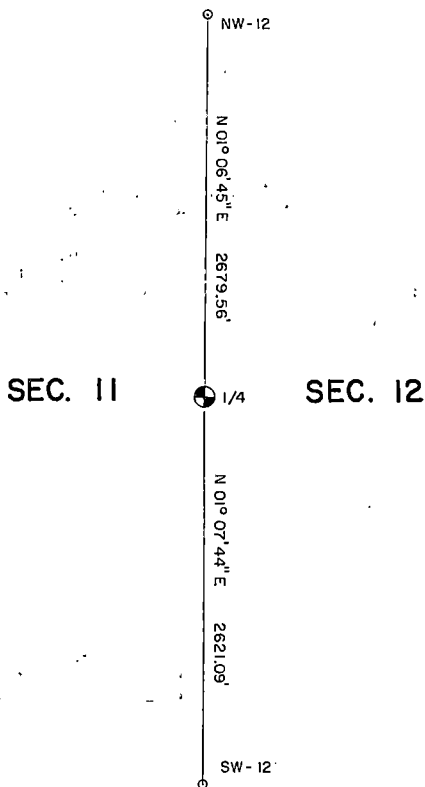

- (i) I, Kim H Pritzlaff
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature


Date

5-16-85

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. J-3

1/4 Corner to Section 18 7 T35N, R16E
(Section/Quarter)

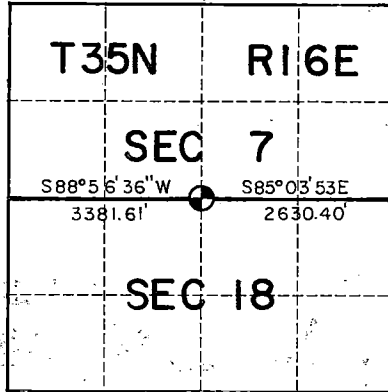

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Set a PK nail at the corner position with a 2"x 36" aluminum post stamped
Reference Monument North 25.00 ft.
Ties are to
aluminum nails 1-2 = North 25.00'
driven into tree 1-3 = S12°E 78.14'
centers which 1-4 = S52°W 92.80'
trees were blazed 1-5 = N18°W 53.92'
and scribed. 1-6 = North 25.70'

I, Kim H Pritzlaff, RIS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993
Date


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride set this corner at 40 chains west of his southeast corner of section 7 and marked the following bearing trees:

Spruce	10"	S15E	17
Cedar	10"	N14W	38

Located a road centerline and PI at this corner location. All other evidence of this corner location had been destroyed with road construction. John Hammes filed a CCC tag noting this corner to fall 2,941 ft east of Connors railroad. Using the present road centerline as control, I set this corner at proportionate distance between the two section corners already recovered. This position fit the distance recorded by Hammes, the swamp call to the west, and the road PI the best within a half of a chain. Using any one of these bits of record ties to the corner would have placed the other record over a chain out of place.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

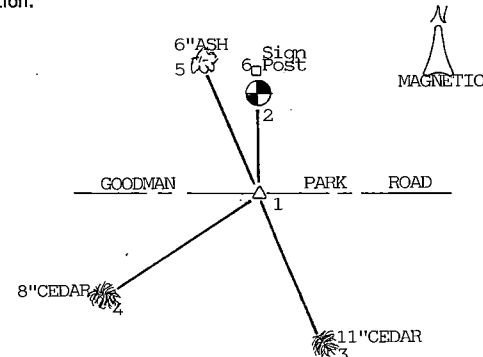

⊕ = Set 2"x36" Aluminum reference monument

△ = Set P.K. nail

Certificate Ready For Filing:

Ralph M. Bell
District Ranger

149052

435160700206

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

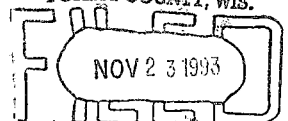


Paul A. [Signature] AL 9 O'clock A.M.
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. J-7

Quarter Corner to Section 8 17 T 35 N, R 16 E
(Section/Quarter)

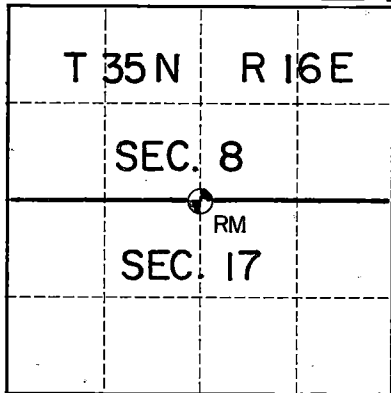

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

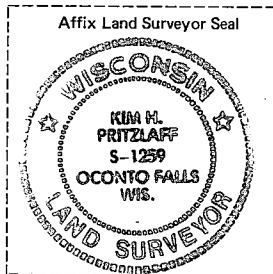

Set a railroad spike at the corner location with a 2"x 36" aluminum post with cap stamped Reference Monument as shown. Measurements are to aluminum nails driven into tree centers which trees were scribed and blazed. Bearings are magnetic

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, contract surveyor, set this corner position using the following bearing trees:


Hemlock 24" N10W 31

Hemlock 18" S46E 43

At 37.50 chains running west corrected a stream call fell running south

Located the centerline of Goodman Park Road and the stream which had been diverted from road construction and did not fit the call distances. There was no evidence of occupation at this corner other than the road centerline. I set this corner in the road centerline at single proportionate distance between the south section corners of section 8.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

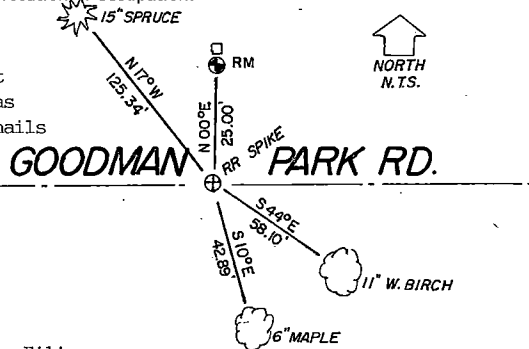

I, Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1923
Date

Certificate Ready For Filing:

Ralph L. ...
District Ranger

149055

4 35.1608 p0220

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.




At 9 O'clock A.M.
Paul A. [Signature] Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. J-9

Section Corner to Section 8 9 T 35N, R 16E
(Section/Quarter) 16 17

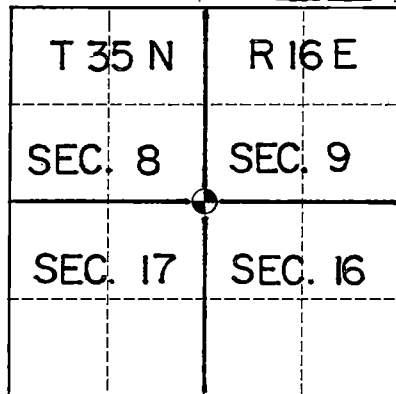

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Set this corner position with a railroad spike set in the pavement and a 2" x 36" aluminum post North 25.00 ft. as a Reference Monument. Other ties are to aluminum nails driven into the tree centers, which trees were blazed and scribed. Bearings are magnetic.

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.


In 1858 James McBride set this corner position at 80 chains with the following bearing trees:

Birch	20"	N37W	15
Sugar	10"	N16E	55
Sugar	10"	S53E	17
Birch	8"	S47W	13

Natural feature calls to the east of enter swamp at 58 chains, Stream at 74.75 chains, Leave swamp at 76.00 chains on line between sections 9 and 16 running West corrected.

The natural feature calls could not agree within a couple of chains. I therefore used the centerline of Goodman Park Road as the north-south control and proportioned the distance between the northwest corner of section 17 and the south quarter corner of section 9 for east-west control.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

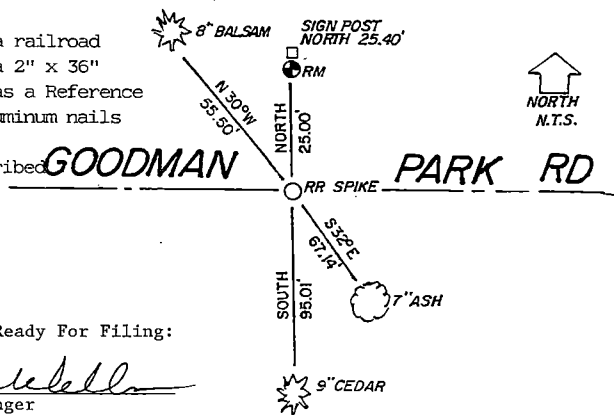

I, Kim H. Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H. Pritzlaff

Signature

1923

Date

Ralph M. Bell
District Ranger


Certificate Ready For Filing:

149056

43516080000

100

REGISTER'S OFFICE
FOREST COUNTY, WIS.

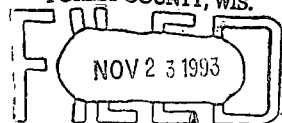


At 9 O'clock A.M.
Paul A. Anton
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. J-11

Quarter Corner to Section 9 16 T 35 N, R 16 E
(Section/Quarter)

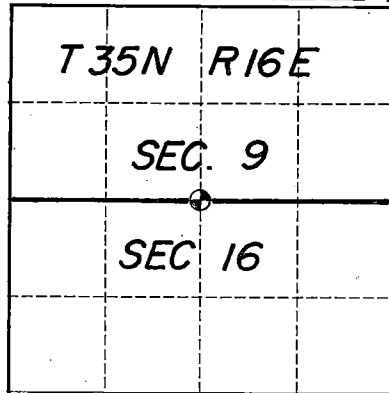

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993

Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, contract surveyor, set this corner at 40 chains with the following bearing trees:

Elm	10"	N17W	12
Elm	10"	S09W	42


1928 Goodman Lumber Company notes found a hardwood post at this corner and set a 2"x 32" flu pipe next to a 4" Hemlock post.

CCC Notes found a post at this corner measuring 406.7 feet west of road intersection

Road construction had obliterated this evidence. I set the corner in the present road centerline 406.7 feet west of the road centerline intersection with Michigan Creek Road. No other evidenc was located.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

Set a railroad spike at the corner location with a 2"x 36" aluminum post stamped Rference Monument as shown. Ties are to aluminum nails set in the tree centers which trees were blazed and scribed. Bearings are magnetic.

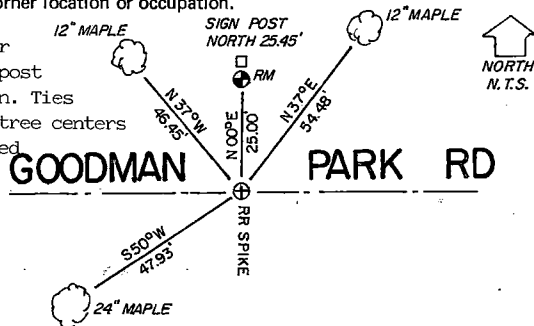

Certificate Ready For Filing:

Ralph H. H. H.
Acting District Ranger

149057

435168910020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

NOV 23 1996

At 9 O'Clock A.M.
Paul A. [Signature] Register of Deeds

139373


U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 9-10-15-16;
 T.35N., R.16E.; Forest County, Wisconsin

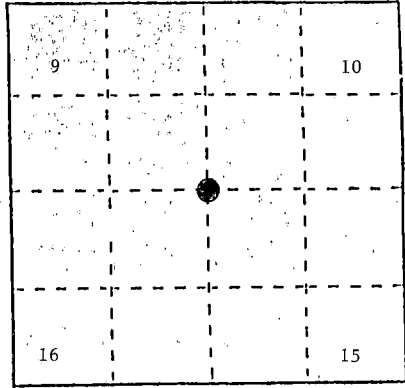

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post with the following B.T.'s:

Sugar	16"	N.47°W.	40 links	(26.40 feet)
Sugar	12"	N.63°E.	13 links	(8.58 feet)
Sugar	16"	S.62°E.	18 links	(11.88 feet)
Sugar	12"	S.72°W.	11 links	(7.26 feet)


In 1928 Goodman Lumber Company found an old hardwood post set by Blackwell Company and set a 2" x 30" flue pipe on the South side of town road.

In 1989 Alan Harrison (RLS) found no evidence of original or subsequent corner which was probably removed with road construction. Set corner position at double distance from Northwest section corner through West quarter corner Section 10 being Goodman Company set the quarter corner mid-point and on line between section corners in 1928.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1" x 24" Iron Pipe on South Edge of Road Set: ±1.5 feet below Road Surface
- Sugar, 8", N.28°E., 42.97 feet.
- Sugar, 15", S.54°E., 24.20 feet.
- 2 1/2" x 36" Aluminum Reference Monument with Tablet Stamped to identify the Corner. South 7.63 feet.
- Sugar, 14", S.01°W., 23.53 feet.
- Sugar, 5", N.59°W., 62.98 feet.
- Steel Sign Post, South, 7.03 feet.

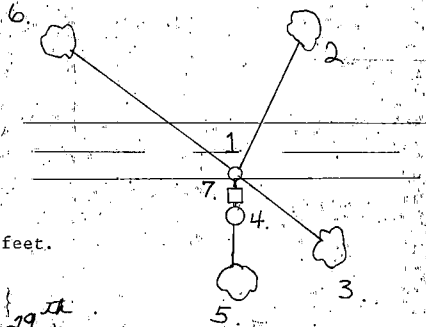

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 29th day
 of March A.D., 1990 at
 10:00 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 5-13

Paul A. Schenckner
 Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) An obliterated evidence location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

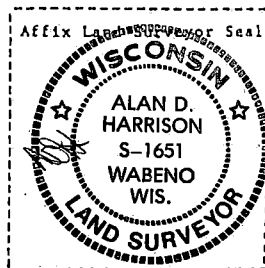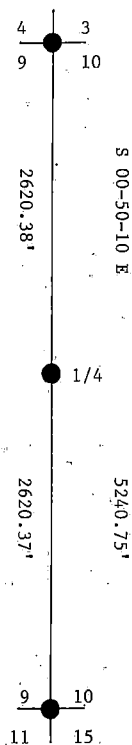

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/1/90
Signature Date

CERTIFICATE READY FOR FILING:

Dale S. Itaz
District Ranger

139374

R.O.D.


U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 10-15,
 T.35N., R.16E., Forest County,
 Wisconsin

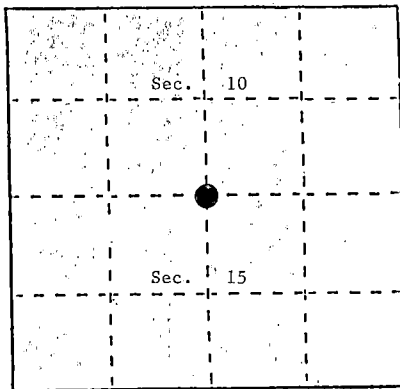

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post with the following B.T.'s: Sugar, 10", S.39°E., 23 links (15.18 feet); Sugar, 6", N.10°W., 35 links (23.10 feet).


In 1928 Goodman Lumber Company found a 3" Maple post set by Wells Company. Set a 4" Elm post and a 2" x 33" Flue Pipe on South side of town road.

In 1989 Alan Harrison (RLS) found no evidence of original or subsequent corner. Restored corner position by proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1" x 24" Iron Pipe set ± 1.5 feet below road surface.
- 2½" x 36" Aluminum Reference Monument, North 34.90 feet, with tablet stamped to identify the corner.
- Sugar, 8", S.52°E., 46.61 feet.
- Sugar, 10", S.30°W., 65.74 feet.
- Steel Sign Post, North, 35.72 feet.
- Steel Sign Post, South, 7.96 feet.

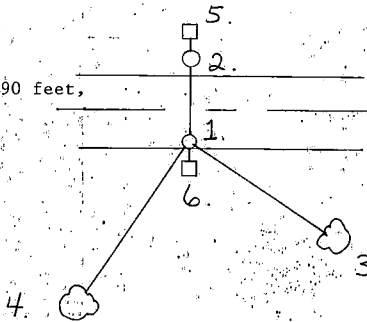

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 29th day
 of March A.D. 1990 at
 10:00 o'clock A.M. and recorded
 in Vol. 15 CORNER RESTORATIONS
 page 5-15

Paul Hollenbrenner
 Register of Deeds

J 15

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


- (gkh) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

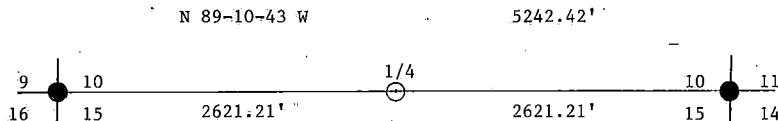

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/1/90
Signature Date

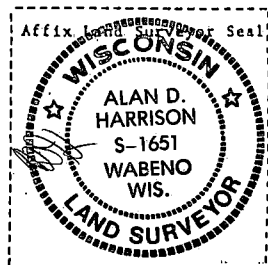

CERTIFICATE READY FOR FILING:

Paul S. Staeger
District Registrar

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest } ss.

I, Jean F. Resvick, do hereby certify that on the 28 day of March, 1977, I found evidence of the Southeast Section corner of Section 10 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride
North between Sections 14 & 15. 80.0 chains set post corner to
Sections 10, 11, 14, and 15.
Lind, 12", N39°W, 38 lks.
Fir, 10", N52°E, 44 lks.
Lind, 8", S18°E, 23 lks.
Elm, 10", S51°W, 43 lks.



Description of corner evidence found:

1 1/2 inch diam. pipe
Basswood clump bears N39W, 38 lks.
40.00 ch. east to found 1/4 corner
40.00 ch. north to found 1/4 corner

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced the iron pipe with a 2 inch inside diameter, galvanized pipe, 3 feet long with a brass cap stamped: T35N, R16E, S10, S11, S14, S15, 1977, S-802

From which the following bear:
Maple, 20", N50°E, 40.60 feet
Maple, 20", S16°E, 117.68 feet
Hemlock, 20", S22°W, 107.80 feet
Maple, 18", N19°W, 69.95 feet
Steel sign post, NW, 0.50 feet

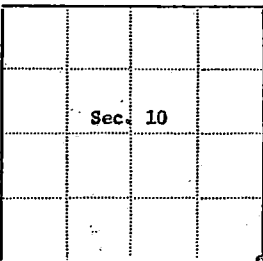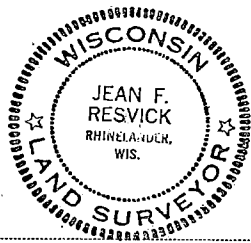

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 21 day of July 1977.

Signature Jean F. Resvick Title Land Surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13 day of Feb. 1978, and was filed in Book No. 113295 Page No. J 17 of County Records. 113295

Signature Eugene D. Statyn Title Register of Deeds

Township 35 North, Range 16 East, Section 10, Index No. J-17, Page No. 517

43516 100000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 24th day of April, 1973, I found evidence of the South Quarter corner of Section 11 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride.
39.875 chains west corrected between Sections 11 and 14.
Set quarter post
Elm 16°, N49E, 6 lks.
Brid 12°, S5E, 21 lks.

Description of corner evidence found:

Iron pipe from which a large elm stump bears N.49E 6 links.



Description of monument and accessories I established to perpetuate the location of this corner:

Replaced iron pipe with a 2 inch inside diameter galvanized iron pipe, 3 feet long filled with concrete to weigh 5 pounds per foot, with brass cap stamped

T35N R16E

S11 1
S14 4
1973
S-802

from which the following new blazed and scribed bearing trees bear:
S. Imple 6, S33E, 24.49 feet
Elm 8, N2W, 15.85 feet
Set steel sign post 1 foot NW of monument.

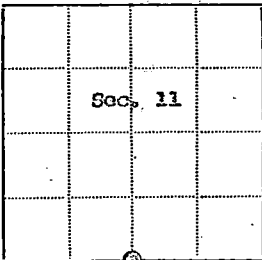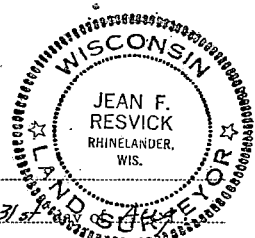

☉ = Corner monument restored

☐ =

Resident witnesses.....

Dated at Rhinelander

Wisconsin, this 24th day of April, 1973.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 # 104436

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 5 day of Nov, 1973, and was filed in Book No. 104436 Page No. J-19 of County Records.

Signature Eugene Stating Title Register of Deeds
16 East 11 J-19

Township 35 North, Range 16 East, Section 11, Index No. J-19

43516110020

19


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section corner to Sections 11-12-13-14,
Township 35 North, Range 16 East,
Forest County, Wisconsin

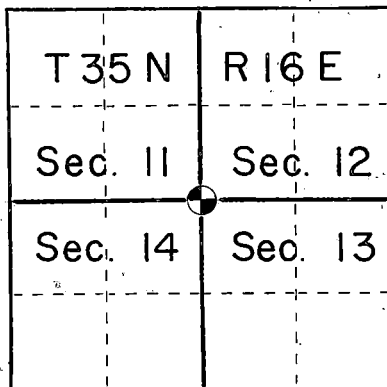

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 7th day
of August A.D., 1985, at
3:00 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page 1-21

Paul Aschenbrenner
Register of Deeds


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post with:
Hemlock 12" N05W 16 links
Sugar 14" N39E 13 links
Fir 10" S71E 26 links
Elm 10" S79W 27 links

Could not find any original or subsequent evidence of this corner. It was determined to be lost and was set by double proportionate measure from the quarter corner to 11-14; the Section corner to 12-13-7-18; the Section corner to 13-14-23-24; and the Section corner to 1-2-11-12.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

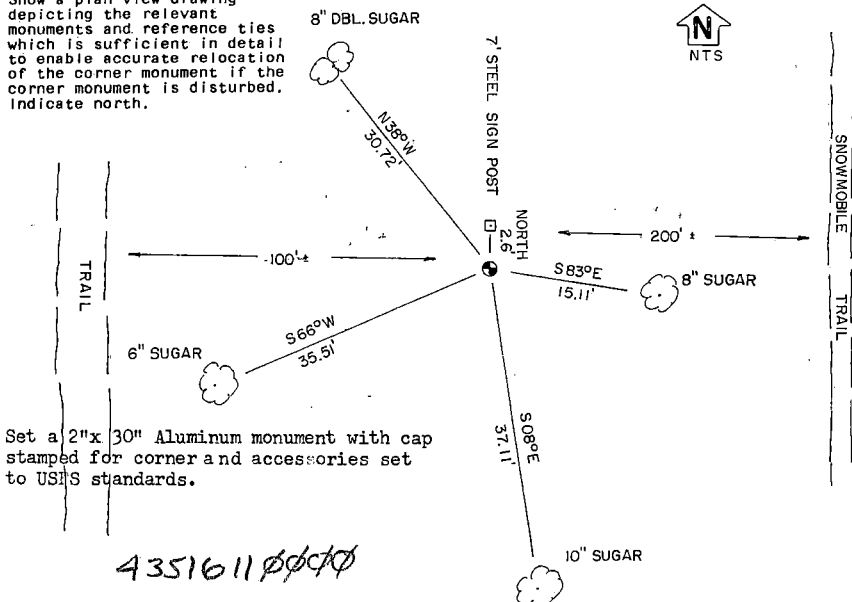

Set a 2"x 30" Aluminum monument with cap stamped for corner and accessories set to USFS standards.

4351611 P/P/P/P

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No discrepancy

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Obliterated evidence location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Lost methods of double proportionate measure as shown:

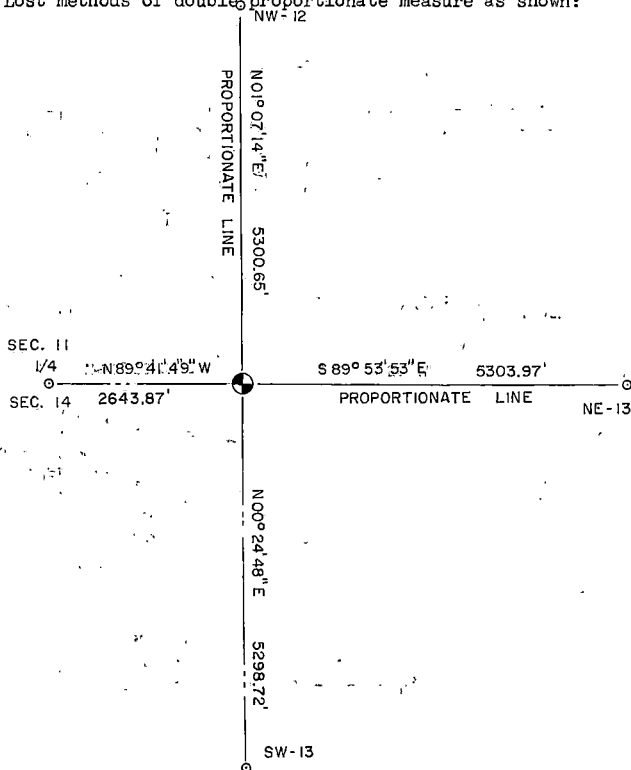


Kim H Pritzlaff

- (i) I, Kim H Pritzlaff (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

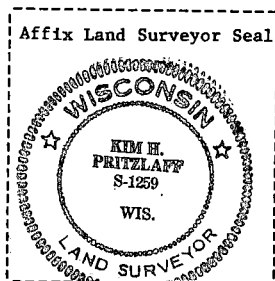

5-16-85

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections
 12 and 13, T.35N., R.16E., Forest
 County, Wisconsin

State Plane Coordinates


N - 133126.80

E - 2369336.72

Geographic Coordinates

N - 45-31-15.35

W - 88-26-10.14

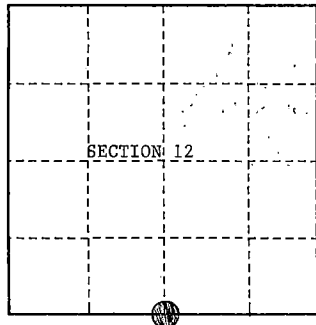

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post at the corner position with: Hemlock 12" S.18°W., 40 links, Ironwood 5" N.11°W., 13 links.

In 1985, Kim Pritzlaff, R.L.S., located a plantation post with 1½" iron pipe set adjacent to it. This post fit stream calls to east well and from the post S.18°W., 26.4 feet, located a Hemlock stump. The Hemlock stump helped verify the corner position and the post was therefore monumented using the original stump call.

In 1998, Alan Harrison, R.L.S., found monument and bearing trees as described. Cut down all bearing trees for G.P.S. observations. New bearing trees (NBT) as listed below.

REGISTER'S OFFICE


Forest County, Wis.

Received for record this 29th day
 of March, A.D., 2001 at
8:35 o'clock A.M. and recorded
 to Vol. Corner Restorations
123
Kay Swanson, Deputy
 Register of Deeds

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 30" aluminum monument stamped to identify corner
2. Elm, 5", N.76°E., 37.01 feet (NBT)
3. Sugar, 9", S.63°E., 50.53 feet (NBT)
4. Basswood, 12", S.06°W., 40.13 feet (NBT)
5. Steel sign post, Northwest, 0.45 feet

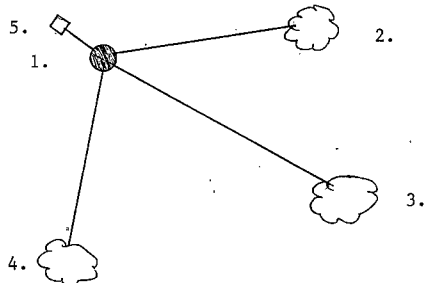

171122

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

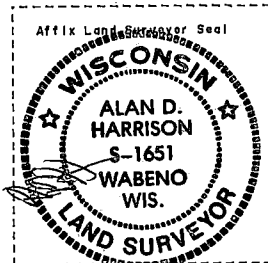

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 12 and 13,
Township 35 North, Range 16 East,
Forest County, Wisconsin

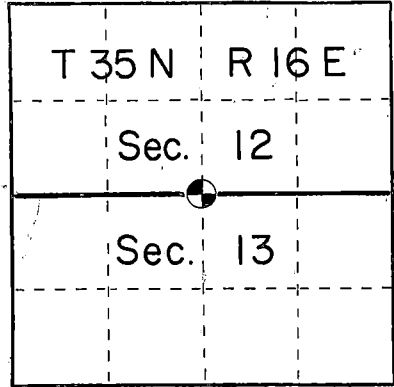


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post at the corner position with:
Hemlock 12" S18W 40 links
Ironwood 5" N11W 13 links

Located a plantation post with 1 1/4" iron pipe set adjacent to it. This post fit stream calls to east well and from the post S 18W 26.4 ft/ located a Hemlock stump. The Hemlock stump helped verify the corner position and the post was therefore monumented using the original stump call.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

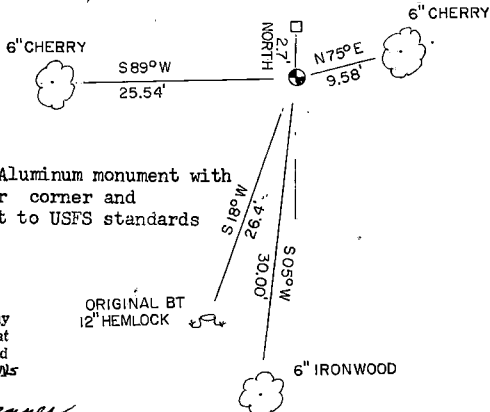

Set a 2"x 30" Aluminum monument with cap stamped for corner and accessories set to USFS standards

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 7th day
of August A.D. 1985 at
3:00 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page 23

Paul Aschbacher
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No discrepancy

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No

Kim H Pritzlaff

- (i) I, Kim H Pritzlaff (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

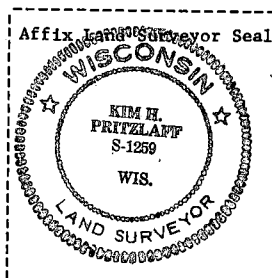

5-13-85

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick do hereby certify that on the 30th day of June, 19 69, I found evidence of the Southeast Section corner of Section 12 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new ~~monument and~~ accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis

80,000 chains North between Sections 13 and 18

Set wood post

Hemlock 16, bears S71W, 51 lks.

Hemlock 8, bears N38W, 28 lks.

Hemlock 14, bears N74E, 40 lks.

Hemlock 20, bears S40E, 23 lks.

Marinette County Survey in 1934 by J.J.


Jenkins. Recorded in Marinette County.

North between Sec. 13 and 18, 80.34

chains. Set a 4 inch diameter iron post for the corner to sections 7, 12, 13, and 18.

Description of corner evidence found:

4 inch diameter iron post with brass cap marked.

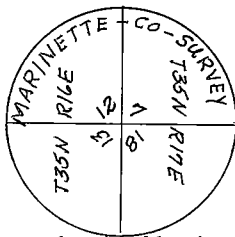Description of ~~monument~~ and accessories I established to perpetuate the ~~original~~ location of this corner:

Blazed and scribed the following new bearing trees.

White Spruce 4, bears N40E, 22.51 ft. or 34.106 lks.

Elm 4, bears S50E, 42.56 ft. or 64.484 lks.


White Spruce 5, bears S84W, 47.78 ft. or 72.394 lks.

Elm 3, bears N47W, 13.23 ft. or 20.045 lks.

1x4 cedar post bears West 2.0 ft. from Monument.



4351612.0000

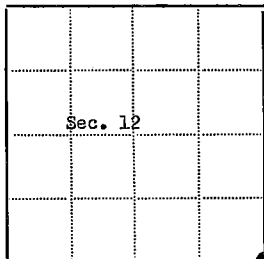

● = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland

Wisconsin, this..... day of

19 69Signature Jean F. ResvickTitle Cadastral surveyor

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802DOCUMENT No. 98047Office of Register of DeedsCounty of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 19 70, and was filed in Book No. Page No. J-25 of County Records.

Signature Eugene Stutz Title Register of DeedsTownship 35 North, Range 16 East, Section 12, Index No. J-25, Page No.

7 25

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 22nd day of July, 19 68, I found evidence of the North one-sixteenth corner ~~at~~ between Sections 13 & 18 Township 35 North, Ranges 16 and 17 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Range line re-surveyed by J. J. Jenkins, Menominee County. Surveyed in 1934 and 1935. Survey recorded in Marinette County. Set 4 x 4 cedar post for 1/16 corner.

Description of corner evidence found:

Point of 4 x 4 cedar post with top of post reset alongside. This post identified as that set by J. J. Jenkins by comparison of others set along range line.

Description of monument and accessories I established to perpetuate the original location of this corner:

Replace point of post with a 2-inch inside diameter, galvanized wrought iron pipe, 5 feet long, filled with concrete with brass cap marked



from which the following blazed and scribed bearing trees bear:


Maple 4", S81°E, 7.63 ft. or 11.56 lks.

Maple 4", N87°W, 73.65 ft. or 111.59 lks.

Centerline N & S road, West, 33 ft. or 50 lks.

Set point of post in mound of rock around monument.

43516133044

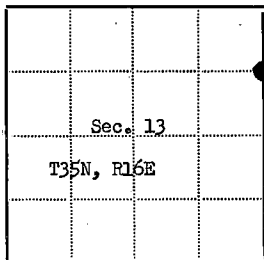

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhineland Wisconsin this 3rd day of September 1968.

Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official) DOC. NO.


Surveyors Registration No. S-802

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 31st day of January, 1969, and was filed in Book No. I Page No. K-25 of County Records.

Signature Eugene Stetson Title Register of Deeds


Township 35N, Range 16E, Section 13, Index No. K-25, Page No. 25

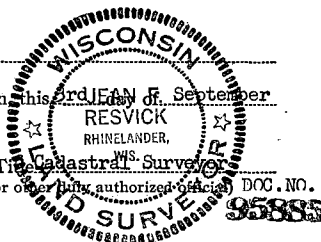

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. L-5

Quarter _____ Corner to Section 17 18 T 35N, R 16E
(Section/Quarter) _____

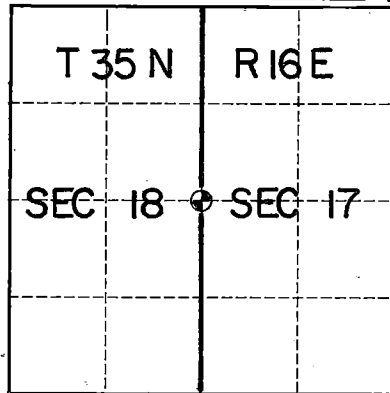

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Set a 2"x 36" aluminum post stamped for corner flush with ground. Ties are to 1"x 24" iron pipe and aluminum nails driven into the tree centers which trees were scribed and painted brown with minimal signing on the trees. Bearings are magnetic.

I, Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993
Date


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride set this corner at 40 chains running north between sections 17 and 18 hitting the lake at 21.61 chains, leaving lake at 35.82 chains and marking the following bearing trees at the quarter corner:

Cedar	14"	N81W	19
Hemlock	24"	N32E	12

The lake calls to the south all fit within a half chain and a search area was set up at the single proportionate position. This area fell in the recreation beach and corner evidence had been destroyed for beach improvements. I set this corner by lost methods of single proportionate measure which fit the lake calls extremely well.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

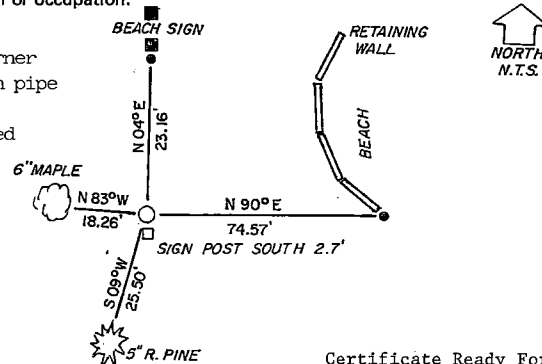

Certificate Ready For Filing:

Ralph Bell
District Ranger

149058

43516182000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature


Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date


Signature

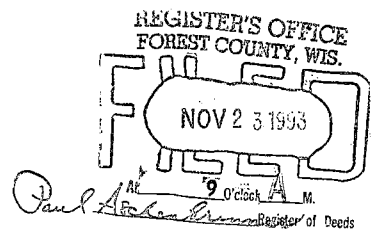

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. L-9

Quarter Corner to Section 16 17 T 35N, R 16E
(Section/Quarter)

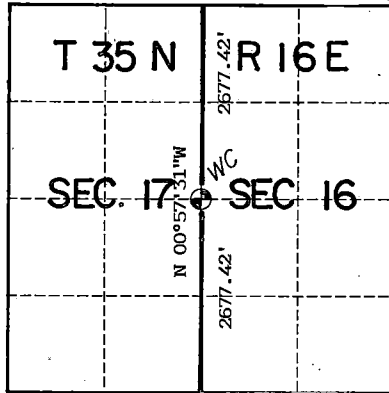

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

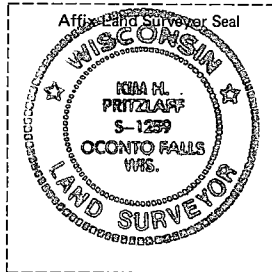

I, Kim H Pritzlauff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlauff
Signature

1998
Date

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, contract surveyor, set a wood post at 40 chains with the following bearing trees:


Tamarack	8"	S88W	7
Tamarack	8"	S52E	11

In CCC notes, R. Rieneke found a wood post with a 14" Spruce BT N52E for 31 links and placed a metal tag on a 5" Yellow Birch S13W for 9 links.

Both of the Tamarack trees and the yellow birch with metal tag made the search for this corner worth while. Beavers, however, had severely damaged the area flooding lands with over a 1000 ft. radius killing every tree in their path. After several trips to the site and many man hours of search in the water and muck proved unsuccessful, I determined the corner lost and set it at single proportionate measure.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

Set a 2"x 60" aluminum post stamped for corner with a 2"x 36" aluminum post stamped Witness Corner 1369.21 ft. west. Ties to the Witness Corner are to aluminum nails in the tree centers which trees were blazed and scribed. Bearings are magnetic.

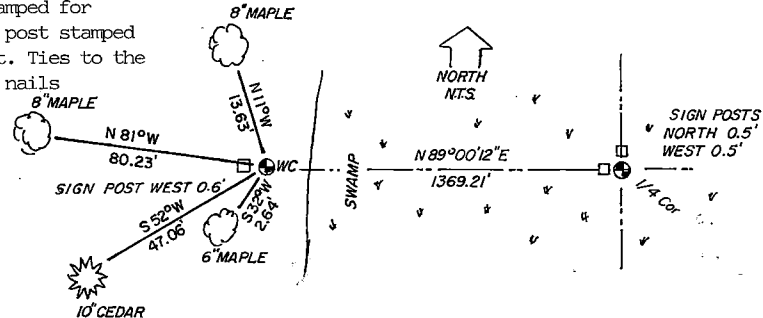

Certificate Ready For Filing:

Ralph Bell
Notary District Registrar

149059

43516172000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

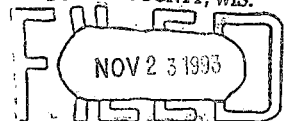


Paul H. [Signature]
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. L-9

Quarter _____ Corner to Section 16 17 T 35 N, R 16 E
(Section/Quarter) _____

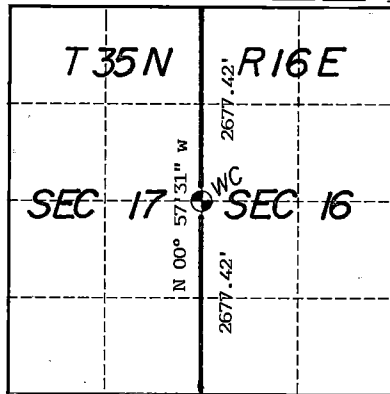

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

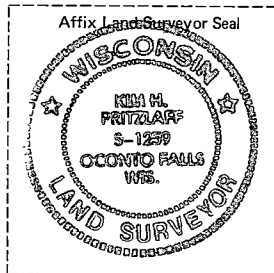

Set 2"x 60" aluminum post stamped for corner with 2"x 60" aluminum post stamped as Witness Corner 893.40 ft. south. Ties to the Witness Corner are to aluminum nails in the tree centers which trees were blazed and scribed. Bearings are magnetic

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.


In 1858 James McBride set this corner position at 40 chains with the following bearing trees:

Tamarack	8"	S88W	7
Tamarack	8"	S52E	11

In CCC notes, R. Reineke found a wood post with 14" Spruce BT N52E for 31 links and placed a metal tag on a 5" Yellow Birch S13W for 9 links.

Both the Tamarack BTs and metal tag on the yellow birch gave a lot of promise for corner evidence location. Beavers had, however, severely flooded and damaged the area in a radius of over 1000 feet. All Yellow Birch stumps were located in the area that were above water for metal tag evidence but none was found. After several man hours of search on different occasions I determined the corner to be lost and set it at single proportionate measure with Witness Monuments South and West.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

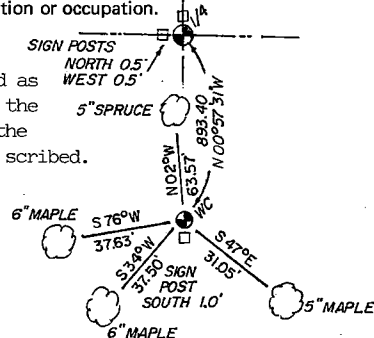

NORTH
N.T.S.

I, Kim H Pritzlaff, RLS No.1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Certificate Ready For Filing:

Kim Pritzlaff
Signature

1993

Date

Ralph Reineke
District Ranger

149060

43516172000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

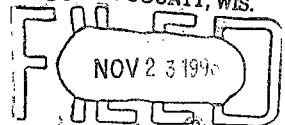


At 9 O'clock 11 M.
Paul A. Anderson Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. L,M-5

Meander Corner to Section 17 18 T 35N, R 16 E
(Section/Quarter)

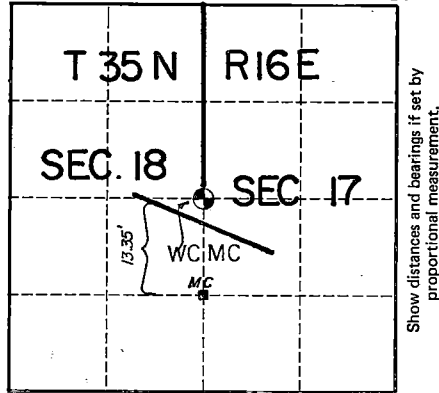

○ = Corner monument restored.



Set a 2"x 36" aluminum monument stamped Witness Corner to Meander Corner. Ties are to aluminum nails driven into the tree centers which trees were scribed, painted brown and minimally signed. Bearings are magnetic.


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride set a wood post at this corner location on the north shore of the lake at 35.82 chains, with the following bearing trees:

Hemlock	16"	N86E	22
Cedar	18"	N37W	21

Located the north shore of the lake at the intersection point which fell roughly 15 feet into the water. I set this corner on the west line of section 17 on solid ground where the west line intersected the shore line of the lake.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

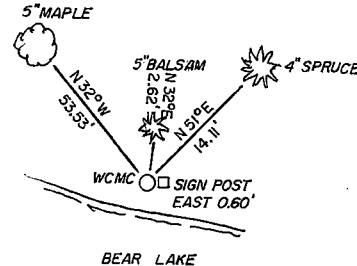

I, Kim H Pritzlaff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993
Date

Certificate Ready For Filing:

Ralph Leblond
Acting District Ranger

149061

43516181020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.


NOV 23 1993

At _____ O'clock _____ M.
Paul _____ Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. L,M-5

Meander _____ Corner to Section 17 18 T 35 N, R 16 E
(Section/Quarter)

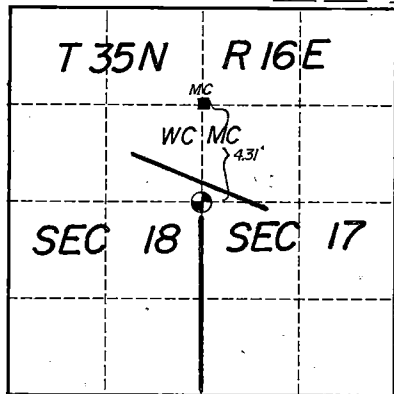


Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.

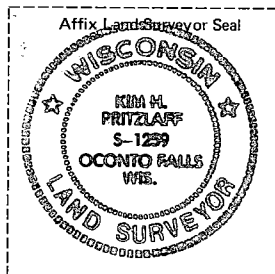

Set a 2"x 36" aluminum post stamped Witness Corner to meander Corner. Ties are to aluminum nails driven into the tree centers which trees were blazed and scribed. Bearings are magnetic.

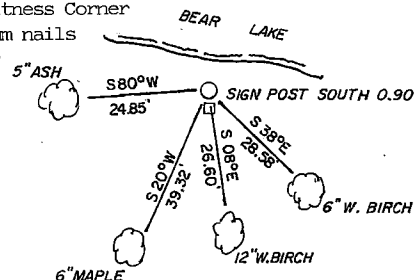

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride set a wood post at this corner location at 21.61 chains with the following bearing trees on the south shore of the lake:

Hemlock	12"	S42W	7
Hemlock	12"	East	12

The south shore of the lake was located within a half chain of the distance recorded by McBride falling in the water. I set this corner as a witness to the meander corner on solid ground, on the section line on the south shore of the lake.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

I, Kim H Pritzlaff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim H Pritzlaff
Signature

1993
Date

Certificate Ready For Filing:
Ralph M. Wells
Acting District Ranger

149062

43516183020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature


Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

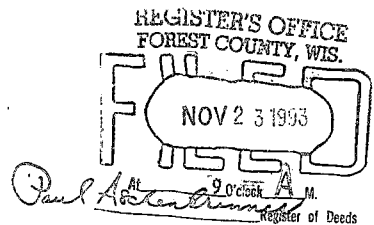


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner between
Section 14 and 13
Township 35 North, Range 16 East,
Forest County, Wisconsin

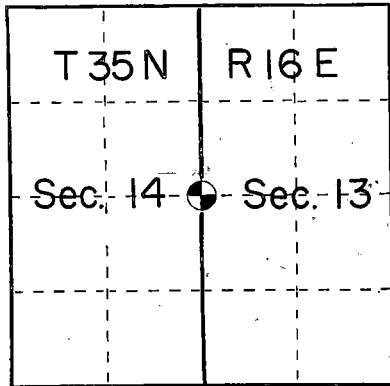

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858 James McBride set a wood post at 40.00 chains with:
Sugar 12" N44E 40 links
Sugar 14" N69W 25 links

Area had been recently logged off and fell in popple regeneration. Set this corner by lost methods of single proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Set a 2"x 30" Aluminum monument with cap stamped for corner and accessories set to USFS standards.

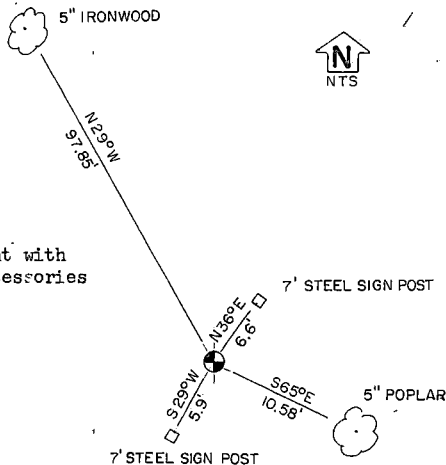

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 7th day
of August A.D., 1985 at
3:00 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page 1-21

Paul Aschbacher
Register of Deeds

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No discrepancy

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Obliterated evidence location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Lost corner proportionate methods.

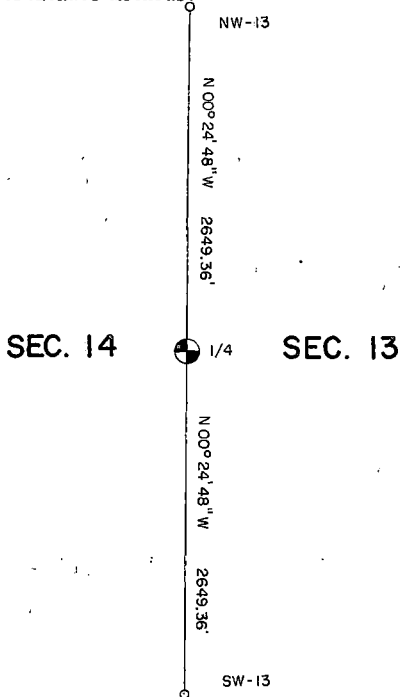

Affix Land Surveyor Seal



- (i) I, Kim H. Pritzlaff (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

5-16-85

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner between
Sections 13 and 18
Township 35 North, Range 16 east
and Range 17 East.
Forest and Marinette Counties.
Respectfully.

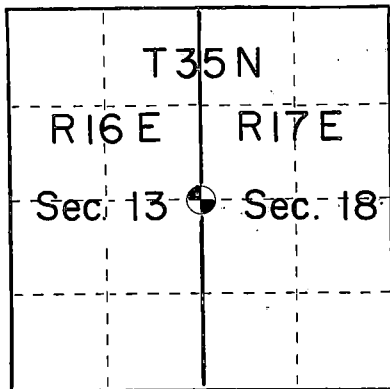

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Surveyed in 1857 by Artemas Curtis
Set wood post 40.00 ch. north of SE of Sec. 13- SW of 18.
Yellow Birch 6" N22°W, 23 lks.
Yellow Birch 6" S74°E, 18 lks.

4" iron pipe with brass cap, set by J.J. Jenkins, Menominee County Surveyor

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Existing Marinette Co. monument.
as previously stated.

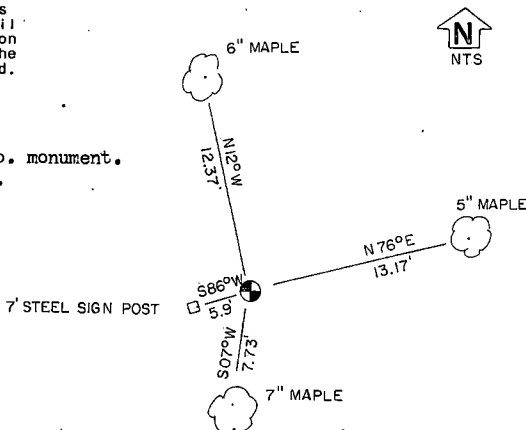

REGISTER'S OFFICE }
Forest County, Wis. }
Received for record this 7th day
of August A.D., 19 85 at
3:00 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page L-25

Paul Aschenbrenner
Register of Deeds

43516132000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

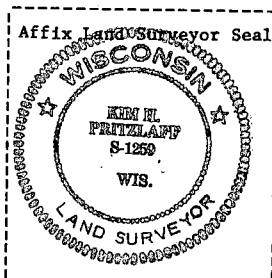

- (i) I, Kim H. Pritzlaff
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 22nd day of July, 1968, I found evidence of the East quarter corner of Section 13 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis

40.00 ch. North between Sections 13 & 18

Set Post

Yellow Birch, 6", N22°W, 23 lks.

Yellow Birch, 6", S74°E, 18 lks.

Marinette County survey in 1934 by J. J. Jenkins, Menominee County Surveyor.

Set 4-inch diameter iron post with brass cap for one-quarter corner between Sections 13 & 18.

Description of corner evidence found:

Marinette County survey 4-inch iron post with brass cap.

Description of ~~monument~~ accessories I established to perpetuate the ~~original~~ location of this corner:

Blazed and scribed the following bearing trees for corner location.

Maple 5" diam., bears S35°E, 32.68 ft. or 49.52 lks. dist.


Maple 5" diam., bears S58°W, 117.65 ft. or 178.26 lks. dist.

Center line of N. and S. road, bears west, 33 ft. or 50 lks. dist.

4 x 4 cedar post with signs, bears S45°W, 2 ft. or 3.10 lks. dist.



43516132444

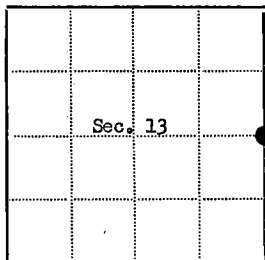

⊙ = Corner monument restored

□ =

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 3rd day of September 1968Signature Jean F. Resvick Title Cadastral Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)Surveyors Registration No. S-802 DOCUMENT NO. 95884Office of Register of Deeds County of ForestI hereby certify that the within instrument was filed in this office for record on the 31st day of January, 1969, and was filed in Book No. I Page No. I-25 of County Records.Signature Eugene Stagny Title Register of DeedsTownship 35 North, Range 16 East, Section 13, Index No. I-25, Page No. 25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Section corner to Sections 17, 18, 19, and 20, T.35N., R.16E.

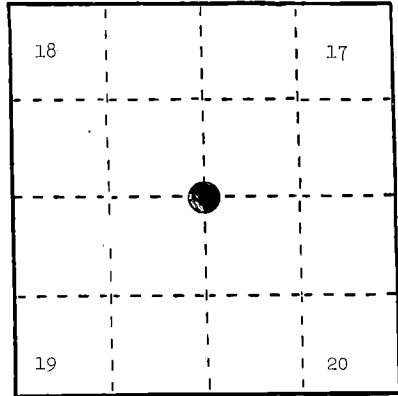

REGISTER'S OFFICE }
Forest County, Wis.

Received for record this 17th day
of March, A.D., 1984 at

10:40 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS

DATE N-5
Paul Hochendanner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Birch, 15", N.22°W., 48 links; Birch, 10", N.32°E., 28 links; Sugar, 20", S.20°E., 16 links; Hemlock, 30", S.41°W., 37 links.


In the 1930s, CCC Surveyor, R. Reineke, found Cedar post in place. Put metal tag on post. April 30, 1983, Neider and Reichelt found remains of Cedar post with location tag. Set a 3" Ironwood in post hole.

June 3, 1985, Harrison and Neider found corner and the following BTs: Yellow Birch stump (decayed), N.22°W., 31.7 feet; stump hole, N.32°E., 18.5 feet; possible stump depression, S.20°E., 10.6 feet; large stump hole and root holes, S.41°W., 24.4 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument, in a mound of stone, stamped to identify the corner.
- Sugar, 6", N.33°E., 54.79 feet
- Sugar, 7", S.72°E., 90.66 feet
- Sugar Clump, 4", S.22°W., 29.16 feet
- Basswood, 5", N.77°W., 21.88 feet
- Steel Sign Post, East, 1.96 feet

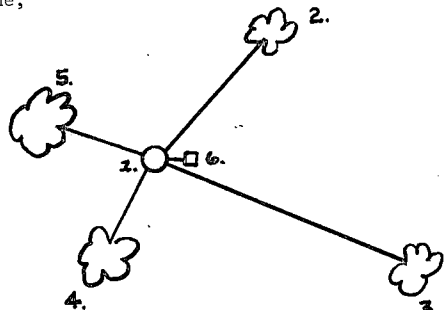

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

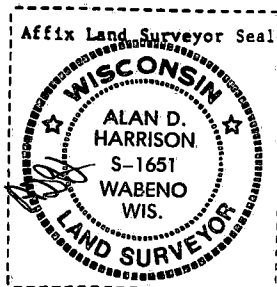

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 1/3/86
Signature Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 17 day of December, 19 79, I found evidence of the Southeast Section corner of Section 16 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride.
North between sections 21 and 22, at 80.00 chains set post corner to sections 15, 16, 21 and 22.
Tamarack 12", N42°W, 39 links
W. Pine 12", N25°E, 10 links
W. Pine 24", S83°E, 18 links
W. Pine 14", S59°W, 10 links.

Description of corner evidence found:

2" X 24" iron pipe with post point along side from which remains of original bearing trees; Rotten Tamarack stump, N42°W, 39 links; Rotten W. Pine stump N25°E, 10 links; Rotten W. Pine stump, S83°E, 18 links; Rotten W. Pine stump S59°W, 10 links.

Description of monument and accessories I established to perpetuate the location of this corner:


Replaced the iron pipe and post point with a 2 inch inside diameter galvanized iron pipe, 30 inches long, concrete filled, with brass tablet stamped as follows: T35N, R16E, S15, S16, S21, S22, 1979, S-1558.

Blazed and scribed the following new bearing trees:

Balsam Fir, 11", N43°E, 23.06 feet
White Pine, 13", S82°W, 70.81 feet
White Pine, 11", N31°W, 72.60 feet
Tamarack, 6", N1°E, 62.60 feet
Steel sign post, southeast, 1.0 feet

DOCUMENT NO.

119853

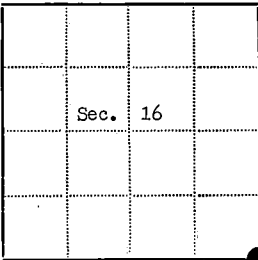

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 18 day of December, 19 79

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June, 19 81, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stategny Title Register of Deeds

Township 35 North, Range 16 East, Section 16, Index No. N-13, Page No. _____

43516160000

N13

DOCUMENT NUMBER **129850**

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section corner to Sections 13, 14, 23, and 24,
 T.35N., R.16E.


REGISTER'S OFFICE,
 Forest County, Wis.

Received for record this 14th day
 of March, A.D., 1980, at
10:25 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page N-21
Paul Archambault
 Register of Deeds

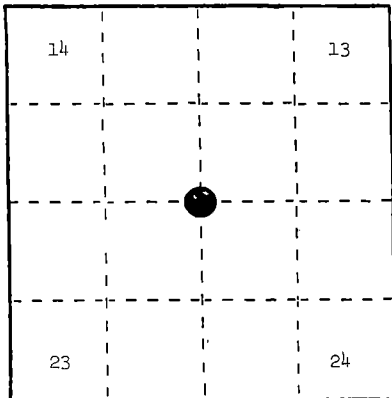

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
 In 1858, James McBride set wood post with the following BTs: Sugar, 12", N.24°W., 43 links; Hemlock, 30", N.38°E., 30 links; Sugar, 10", S.30°E., 48 links; Sugar, 12", S.63°W., 36 links.
 In September, 1936, Ken Schlytter found a hardwood post, which he believed to be a G.L.O. corner. He set a new Cedar post 36" above ground level and placed a metal location poster on said new post.
 March 19, 1972, Jean Resvick found post with poster attached.
 October 22, 1980, Milo Stefan found the following: 6" x 6" x 24" Cedar post with location poster attached; Stump hole from large Hemlock, N.38°E., 19.8 feet; Stump hole, N.24°W., 28.4 feet; Stump hole, S.63°W., 23.8 feet. Accepted post as the perpetuated position of the original corner. Placed a 2" x 30" aluminum pipe with cap stamped to identify the corner.
 (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.
- 2" x 30" aluminum monument stamped to identify the corner location.
 - Sugar Maple, 8", N.25°E., 23.42 feet
 - White Ash, 8", S.37°E., 31.95 feet
 - Sugar Maple, 8", S.52°W., 20.93 feet
 - Sugar Maple, 6", N.43°W., 47.81 feet
 - Steel Sign Post, North, 2.2 feet

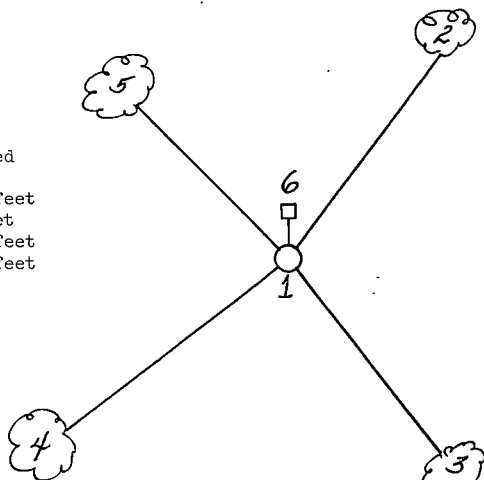

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E Stefan
Signature

3/12/86
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 13 and 24,
Township 35 North, Range 16 East,
Forest County, Wisconsin

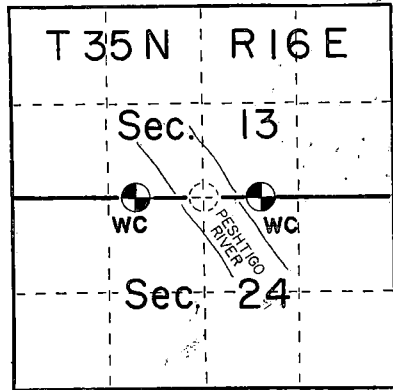

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 7th day
of August A.D., 1985 at
3:00 o'clock P.M. and recorded
in Vol. CORNER RESTORATIONS
page N-23

Paul Hochstetler
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James Mc Bride set a wood post at 42.50 chains on west bank of river for the meander corner with:

Elm 10" S32W 28 links


Elm 12" N34W 37 links

In the late 1960s and early 1970s, Henry Gremmer, RLS set this corner by single proportionate means using iron pipe on the east and north banks of the river. The corner was determined lost and used Henry's methods to relocate position. Set two witness corners on both banks of the river.

Government stream calls to the west did not fit well.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

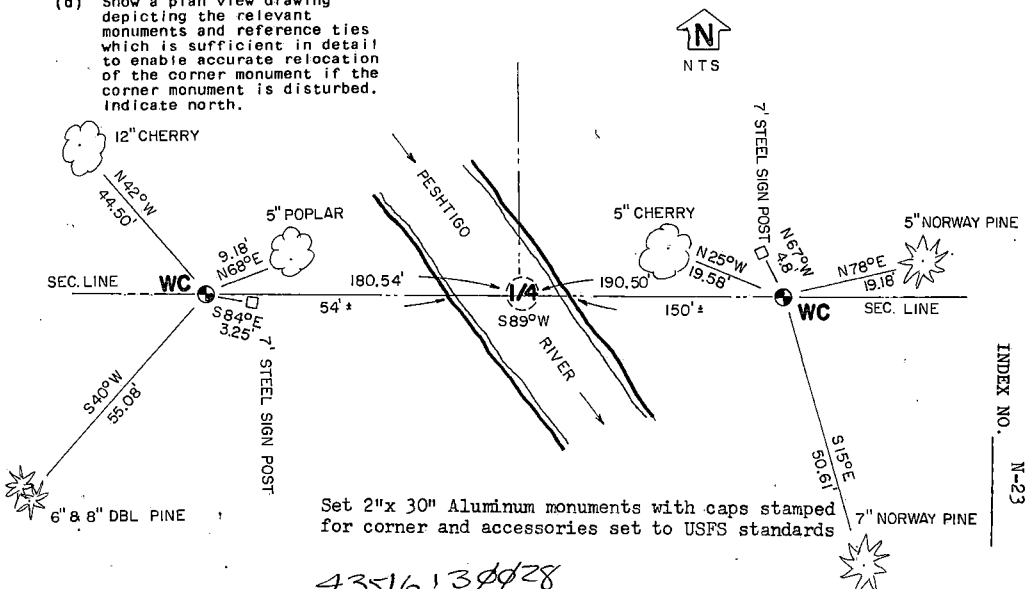

Set 2"x 30" Aluminum monuments with caps stamped for corner and accessories set to USFS standards

INDEX NO.
N-23

43516130028

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No discrepancy

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Obliterated evidence location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

With lost methods of single proportionate measure

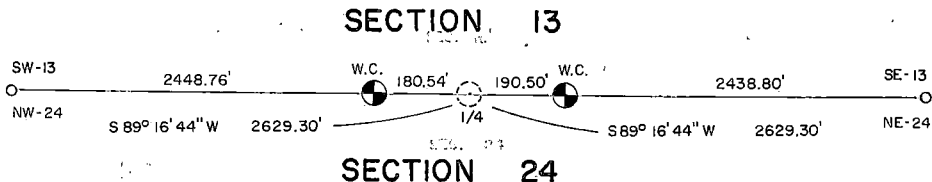

Affix Land Surveyor Seal



- (i) I, Kim H Pritzlaff (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

5-16-85

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick do hereby certify that on the 30th day of June, 19 69, I found evidence of the Northeast Section corner of Section 24 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new ~~monument and~~ accessories as described hereon to perpetuate the ~~original~~ location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.

80.00 ch. north between sections 19 and 24.

Set wood post.

Yellow Birch 20, bears S47W, 25 lks.

Elm 12, bears N62W, 75 lks.

Hemlock 12, bears N32E, 14 lks.


Sugar 16, bears S38E, 56 lks.

Marinette County survey in 1935 and 1935 by J.J. Jenkins. Recorded in Marinette County.

Set 4 inch diameter iron post for corner to sections 13, 18, 19 and 24.

Description of corner evidence found:

4 inch diam. iron post with brass cap marked.

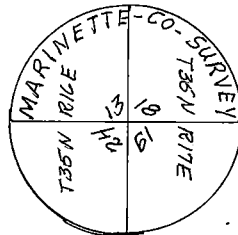

Description of ~~monument and~~ accessories I established to perpetuate the ~~original~~ location of this corner:

Blazed and scribed the following new bearing trees.



Elm 6, bears N43E, 38.98 ft. or 59.060 lks.

Elm 7, bears S 8E, 26.87 ft. or 40.712 lks.

Elm 4, bears S87W, 40.97 ft. or 62.076 lks.

Scotch Pine 3, bears N36W, 51.03 ft. or 77.318 lks.

43516130000

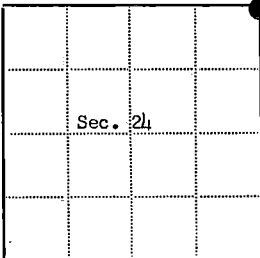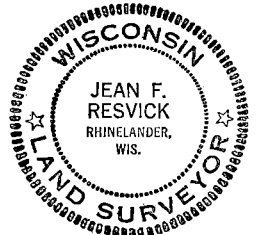

☉ = Corner monument restored

☐ =

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this.....day of June, 19 69.

Signature Jean F. Resvick Title Cadastral surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT No. 98045

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 22nd day of May, 19 70, and was filed in Book No. Page No. N-25 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 16 E., Section 24, Index No. N-25, Page No.

N25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 15 and 16,
 T.35N., R16E., Forest County, Wisconsin

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 20th day
 of December, A.D., 1980, at
1:00 o'clock P.M. and recorded
 in Vol. 300 of Records
 page 1-13

Paul Heckenhausen
 Register of Deeds

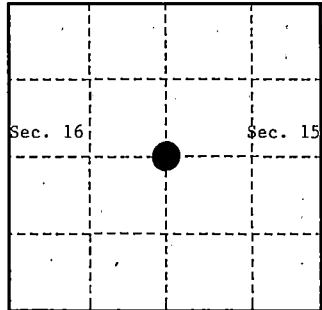

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Hemlock, 24", N.89°W., 4 links (2.64 feet); Sugar, 8", N.80°E., 21 links (13.86 feet).


In 1928, Goodman Company found 4" post set by Wells Company and a dead Maple B.T., 14", N.80°E., 22 links (14.52 feet). Set a Hemlock post, 3", and a 2" x 36" flue pipe.

In 1990, Alan Harrison (RLS) found a 2" flue pipe and post hole. At N.80°E., 14.52 feet found an Aspen stump where Maple could have grown. No other evidence of original corner or subsequent corner. Flue pipe accepted as best evidence of corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Sugar, 11", N.32°E., 13.33 feet.
3. Yellow Birch, 12", S.73°W., 18.08 feet.
4. Sugar, 6", N.38°W., 40.15 feet.
5. Steel sign post, Northwest, 0.85 feet.

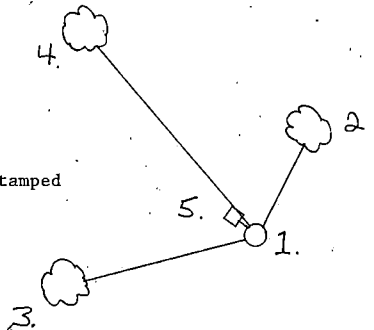

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

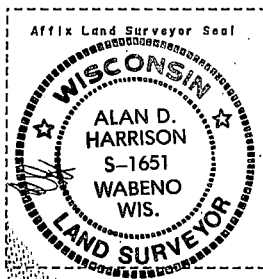

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 14 and 15,
 T.35N., R.16E., Forest County, Wisconsin.

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 20th day
 of December, A.D., 1990, at
 1:00 o'clock P.M. and recorded
 in Vol. Corner Restorations
 page 477

Paul H. Knecht
 Register of Deeds

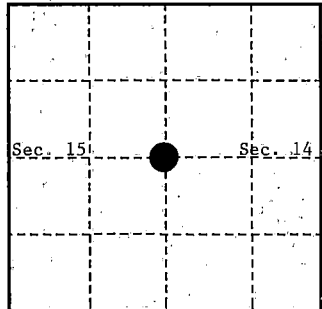

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Sugar, 12", S.76°E., 17 links (11.22 feet); Sugar, 14", N.77°W., 8 links (5.28 feet).


In 1928, Goodman Company found 3 1/2" Elm post set by Wells Company and following B.T.'s: Maple, 16", S.75°E., 17 links (11.22 feet). Set a 3" Ironwood post and 2" x 36" flue pipe.

In 1990, Alan Harrison (RLS) found 2" flue pipe and post hole. Stump hole, S.75°E., 11.22 feet from flue pipe. Accepted Goodman Company's perpetuation of original corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument with tablet stamped to identify the corner.
2. Black Cherry, 7", S.88°E., 54.34 feet.
3. Black Cherry, 7", S.11°E., 60.02 feet.
4. Aspen, 2", N.20°W., 10.69 feet.
5. Steel Sign Post, 6", Southwest, 1.04 feet.
6. Steel Sign Post, 6", Northwest, 0.74 feet.

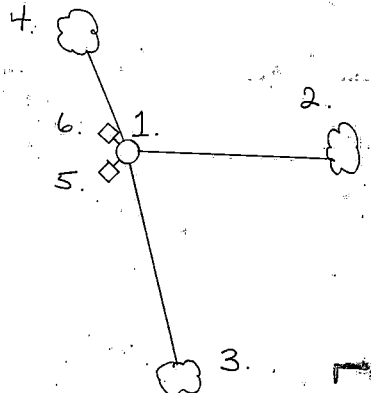

43516152666

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

10/10/90
Date

CERTIFICATE READY FOR FILING:


Baris Staeger
District Ranger

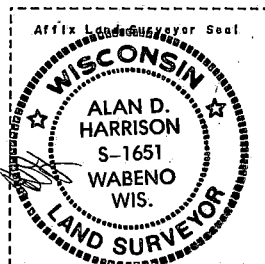

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. N-7

Quarter _____ Corner to Section 17 20 T 35N, R 16E
(Section/Quarter) _____

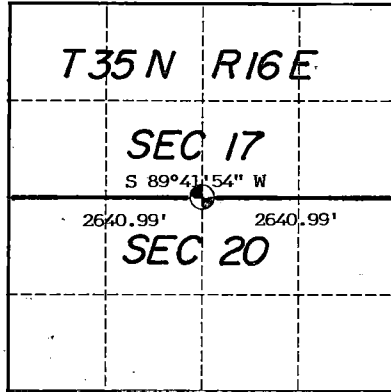

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Set a 2" x 36" aluminum post with cap stamped for corner at the corner position.
Ties are to aluminum nails driven into the tree centers which trees were blazed and scribed. Bearings are magnetic.


History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.

In 1858 James McBride, contract surveyor, set this corner at 39.98 chains the following bearing trees:

Sugar	10"	S54E	12 links
Elm	9"	N78E	15 links

At the single proportionate position, a search area was set up which fell in a cut over Aspen stand. No evidence of occupation or the corner position was found. The corner was determined to be lost and set by single proportionate measure.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

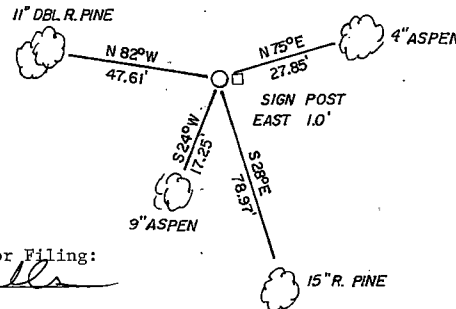

I, Kim H Pritzlaff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993

Date

Certificate Ready For Filing:

Ralph [Signature]
District Ranger

149063

43516170020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any: _____

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any: _____

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any: _____

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.



Paul A. [Signature]
9 O'clock P.M.
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INDEX NO. N-9

Section 16 Corner to Section 16 17 T 35N, R 16E
(Section/Quarter) 20 21

T 35 N		R 16 E	
SEC. 17		SEC. 16	
SEC. 20		SEC. 21	

Show distances and bearings if set by proportional measurement.

○ = Corner monument restored.



Set a 2" x 36" aluminum post with stamped cap at corner position. Ties are to aluminum nails driven into the tree centers, which trees were blazed and scribed. Bearings are magnetic

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.


In 1858 James McBride, contract surveyor, set this corner position at 80 chains with the following bearing trees:

Sugar	6"	N62W	31 links
Sugar	16"	N22E	30 links
Hemlock	8"	S35E	13 links
Sugar	8"	S38W	19 links

Swamp call North at 25 chains

At the double proportionate search area for this corner a large downed Hemlock tree was recovered. It was retraced back to its root system and N35W for 9 feet a rotted post was found. The three sugar bearing tree calls were measured and possible hardwood stump holes were located. The swamp call to the north of 25 chains fit within a chain of distance also. I accepted the rotted post and monumented same.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

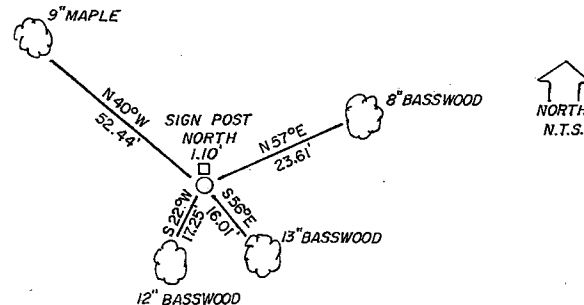

I, Kim H Pritzlaff, RLS No. 1259

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1992
Date

Certificate Ready For Filing:

Ralph Lebell
District Ranger

143064

4 351617 0000

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

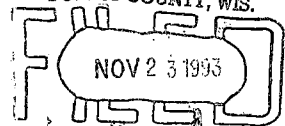


NOV 23 1993

Paul A. Schumacher
At 9 O'clock M.
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INDEX NO. N-11

Quarter _____ Corner to Section 16 21 T 35 N, R 16 E
(Section/Quarter) _____

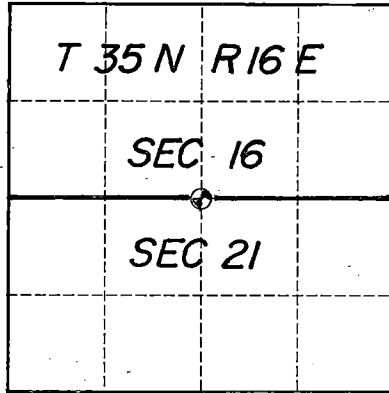

Show distances and bearings if set by
proportionate measurement.

○ = Corner monument restored.

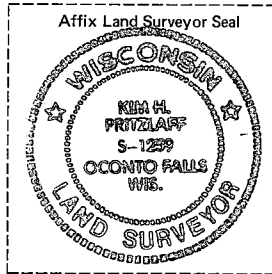

Set a 2"x 36" aluminum post with stamped cap. Ties are to aluminum nails set in tree centers which trees are blazed and scribed. Bearings are magnetic.

History of original corner establishment, record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence, and what you found and how the monument was set.


In 1858 James McBride set a wood post at this corner location at 40 chains with the following bearing trees:

Sugar	30"	N04W	5
Elm	6"	S04W	29

Natural feature call of the stream falling at 22.30 chains on the west corrected line would fit better at 57.70 chains. Possible transcription error.

Set up a search area at single proportionate measure point and found no evidence of occupation or corner. I determined the corner to be lost and set it at single proportionate measure.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material, except wood other than bearing trees.) Also, show any material discrepancies between the corner restored or re-established and the location of any other previous corner location or occupation.

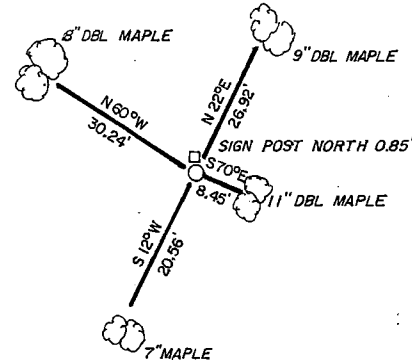

I, Kim H Pritzlaff, RLS No. 1259
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Kim Pritzlaff
Signature

1993

Certificate Ready For Filing:

Ralph C. Keller
District Ranger

Date

149065

43516160020

INDEX NO. _____

MAINTENANCE RECORD

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____

Condition of Ties _____

New Ties, if any:

Date

Signature

Condition of Monument _____


Condition of Ties _____

New Ties, if any:

Date

Signature

REGISTER'S OFFICE
FOREST COUNTY, WIS.

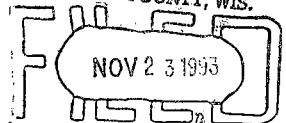

Paul Anderson 9 O'clock A.M.
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 13, 18, 19 and 24,
T35N, R16 - 17E, 4th P.M.

REGISTER'S OFFICE

Forest County, Wis.

Received for record this 22nd day

of November A.D. 1990 at


12:00'clock P.M. and recorded

In Vol. Corner Restorations

page 11-25

Paul H. Schenker

Register of Deeds

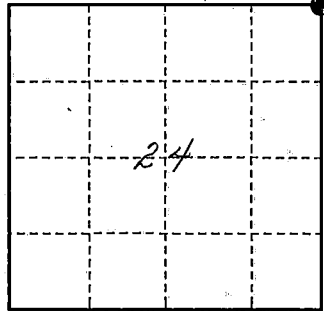

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857 Artemas Curtis established this corner at 80 chains North, and set a wood post. Bearing Trees:

Yellow Birch 20", S47°W, 25 Links

Elm 12", N62°W, 75 Links

Hemlock 12", N32°E, 14 Links

Sugar Maple 16", S38°E, 56 Links

1935 - J. J. Jenkins restored corner by setting a 4" iron post with brass cap.

1969 - Jean F. Resvick found the iron post by Jenkins and placed four new Bearing Trees and filed certificate in Forest County, Document No. 98045. Bearing Trees:

Elm 6", N43°E, 38.98'

Elm 7", S08°E, 26.87'

Elm 4", S87°W, 40.97'


Scotch Pine 3", N36°W, 51.03'

8/20/1990 - Milo E. Stefan found Jenkin's monument in good condition. Two Elm bearing trees dead and no sign post. We established two new bearing trees, took new distances to all bearing trees and placed a steel sign post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 4" x 36" Iron Post with Brass Cap, as set by Jenkins, Marinette County Monument
- 2) Rock Elm 5", N24°E, 16.56'
- 3) Rock Elm 8", N43°E, 39.29'
- 4) Rock Elm 4", S82°W, 35.99'
- 5) Red Pine 6", N14°W, 53.72'
- 6) Steel Sign Post, Northwest, 1.4'

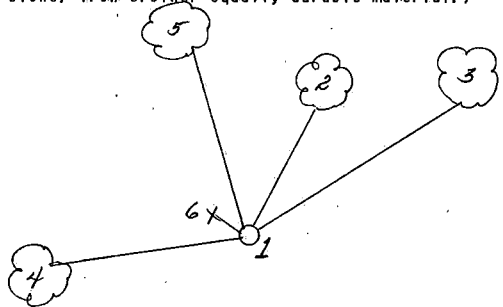

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

August 29, 1990

Date

CERTIFICATE READY FOR FILING:


Dale W. Staeger
District Ranger



Sheet 1 of 2

CERTIFIED CORNER ESTABLISHMENT

BEING THE SOUTH SIXTEENTH CORNER BETWEEN SECTIONS 19 AND 20,
TOWNSHIP 35 NORTH, RANGE 16 EAST, FOURTH PRINCIPLE MERIDIAN
COUNTY OF FOREST, STATE OF WISCONSIN

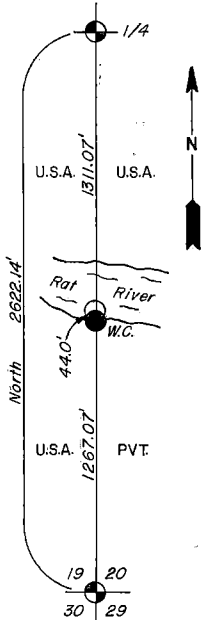Legend

- 2 inch inside diameter Bernstein Aluminum Monument, 5 feet long with aluminum cap stamped to identify corner, set 44 feet south on line from south sixteenth which falls in river.
- ⊕ Corners monumented and recorded.
- Unmarked corner in river.

- W.C. Witness corner
- U.S.A. U.S. Government land
- Pvt. Private Land

Scale 1 inch = 600 feet

Survey Notes

This south sixteenth corner between Sections 19 and 20, Township 35 North, Range 16E, Fourth Principal Meridian was established by the U.S. Department of Agriculture, Forest Service.

The purpose of this survey was to establish the south sixteenth between Sections 19 and 20 between corner positions of the original Government survey of 1858, and mark the boundary line between private land and U.S. Government.

The U.S. Government acquired title to the SESE, Section 19 in 1934.

Bearings shown are assumed bearings.

Corners Recovered

1. Section Corner to Sections 19, 20, 29 and 30

Recorded as document number 104437, dated November 5, 1973.

2. Quarter Corner Between Sections 19 and 20

Recorded as document number 113296, dated February 13, 1978.

DOCUMENT NUMBER

115179

REGISTER'S OFFICE
FOREST COUNTY, WIS.

FILED
NOV 27 1978

At 10:20 O'clock A.M.
Eugene A. Lefsky, Register of Deeds

43516192000

T35N R16E

C-5

Corner Established1. South Sixteenth Corner Between Sections 19 and 20.

Established south sixteenth corner at mid point and on line between the section corner and quarter corner. Corner position falls in river, therefore, set witness corner 44 feet south on line, on the river bank.

References to witness corner:

Ash 6, bears S41E, 25.39 feet

Ash 6, bears S43W, 4.89 feet

River, North 6 feet

Steel sign post bears NW, 0.40 feet

River is 278 feet across on section line

Surveyor's Affidavit

State of Wisconsin)
County of Forest) ss


I, Jean F. Resvick, Land Surveyor, U.S. Forest Service, and a registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed the East line of the SE 1/4, Section 19, Township 35 North, Range 16 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the survey notes are a correct representation of the corners recovered, corner established, and boundary line marked.

Jean F. Resvick

Land Surveyor, U.S. Forest Service
R.L.S. State of Wisconsin
Certificate S-802

Date of Survey: 1978

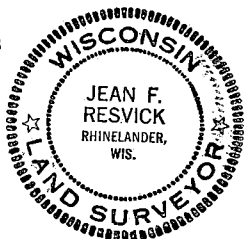


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 • = Corner monument restored.

Quarter corner to Sections 19 and 24,
 T.36N., R.15-16E., Forest County, Wisconsin.

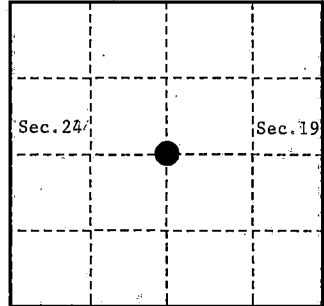

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858 Artemas Curtis set post and made the following references:
 Elm, 8", S.54°W., 26 links (17.16 feet); Hemlock, 10", N.61°E., 55 links (36.30 feet).

In 1976 Jean Resvick found squared post, iron pipe, and original B.T.'s.
 Made the following references: Maple, 7", S.31°E., 8.33 feet; Maple, 4", N.56°W., 7.74 feet; Steel sign post, northwest, 0.5 feet.

In 1989 Alan Harrison found corner as per Resvick and added references and sign post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" brass capped monument found in place..
2. Maple, 7", S.31°E., 8.33 feet.
3. Maple, 4", N.56°W., 7.74 feet.
4. Sugar, 8", S.22°W., 43.97 feet. (new)
5. Steel sign post, Southwest, 0.61 feet. (new)

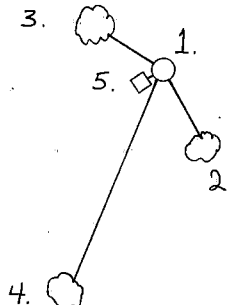

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of May A.D. 1991 at
1:00 o'clock P.M. and recorded
 in Vol. 6000 RESTORATIONS
 page P-1.

Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 4/18/91
Signature Date

CERTIFICATE READY FOR FILING:

David B. Steege
District Ranger

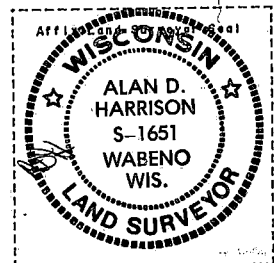

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 18 day of June, 19 77, I found evidence of the East quarter corner of Section 19 Township 35 North Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1858 by James McBride
40.00 chains north between sections 19 & 20, set post
Hemlock 24, S76E, 8 lks.
Hemlock 15, N57W, 16 lks.
20.00 ch. south to south bank of river, 380 lks. wide runs SE
29.00 ch. North leave swamp

Description of corner evidence found:



Scribe squared post.
Hemlock stump S76E, 8 lks.
Hemlock stump N37W, 16 lks.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post with a 2 inch inside diameter, galvanized iron pipe,
3 feet long filled with concrete with brass cap stamped:
T35N, R16E, 1/4, S19, S20, 1977, S-802

Blazed and scribed the following new bearing trees
Black spruce 9, N57E, 44.07 ft.
Cedar 7, N42W, 33.35 ft.
Set steel sign post 6 inches south of post

43516192000

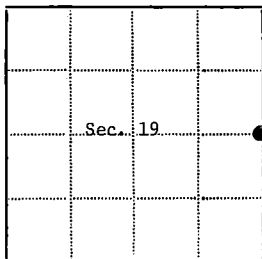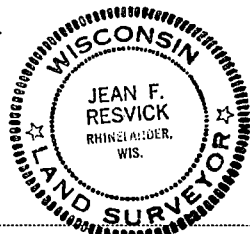

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 21 day of July, 19 77...

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113296

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February, 19 78, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North Range 16 East Section 19 Index No. P-5 Page No.

P 5

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 17 day of December, 1979, I found evidence of the East Quarter corner of Section 20 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride.
North between sections 20 and 21.
40.00 set $\frac{1}{4}$ section post
Tamarack 10", S2°E, 226 links
Tamarack 10", S7°W, 271 links.


Description of corner evidence found:

Description of monument and accessories I established to perpetuate the location of this corner:

Replace post and post point with a 2 inch inside diameter aluminum pipe 5' long capped with an aluminum tablet stamped:
T35N, R16E, $\frac{1}{4}$, S20, S21, 1979, S-1558.

Blazed and scribed new bearing trees:
Black Spruce, 6", S59°E, 45.36 feet
Tamarack, 2", S10°W, 37.28 feet
Black Spruce, 3", N79°W, 20.46 feet
Steel sign post, N45°E, 1.0 feet

DOCUMENT NO.
119856

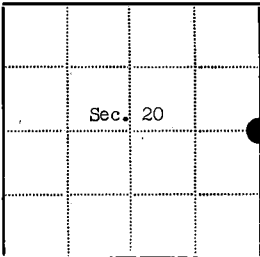

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 17 day of December 1979....

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1558.

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June 1981, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene J. Stutzman Title Register of Deeds

Township 35N, Range 16E, Section 20, Index No. P-9, Page No. _____

4 3516 20 2000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 17 day of December, 1979, I found evidence of the East Quarter corner of Section 21 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride.
40.00 chains north between sections 21 and 22.
Set $\frac{1}{4}$ section post.
Cedar 8", S88°E, 20 links
Cedar 12", S84°W, 4 links.

Description of corner evidence found:

4" X 4" Squared wood post with axle shaft
New Bt's 15-20 years ago, origin unknown
Tamarack 6", N.4°E, 10.63 feet
Tamarack 11", S.48°W, 5.96 feet
Call to creek north, fits well.
Cedar stump 383°E., 13.2 feet

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced wood post with a 2 inch inside diameter galvanized iron pipe, concrete filled, with brass tablet stamped:
T35N, R16E, $\frac{1}{4}$, S21, S22, 1979, S-1558.

Blazed and scribed the following new bearing trees:


Tamarack, 6", N4°E, 10.63 feet
Tamarack, 6", S29°E, 10.72 feet
Tamarack, 11", S48°W, 5.96 feet
Steel sign post, S45°W, 1.5 feet

DOCUMENT NO.

124233



43516212440

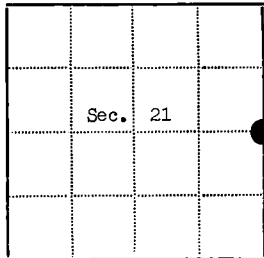

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 18 day of December 1979.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 15th day of September, 1983, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stasny Title Register of Deeds

Township 35N, Range 16E, Section 21, Index No. P-13, Page No. _____

P13


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Quarter corner to Sections 23 and 24, T.35N., R.16E.

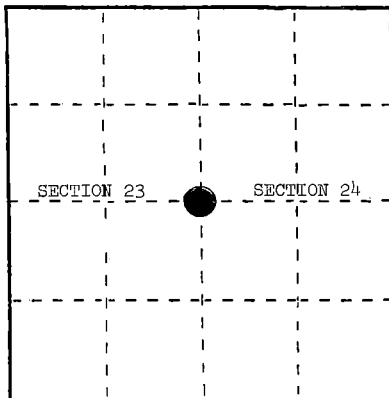

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this 14th day

of March A.D., 1986, at

10:35 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

page 21

Paul Aschendorfer
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set a wood post with the following BTs: Hemlock, 6", N.67°E., 4 links; Birch, 12", N.57°W., 8 links.

In April, 1983, Milo Stefan found no trace of this corner and restored it by lost methods. He placed a 2" x 36" aluminum monument in a mound of stone, with cap stamped to identify the corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Sugar Maple, 6", N.24°E., 29.35 feet
3. Black Cherry, 6", S.17°E., 24.36 feet
4. Sugar Maple, 8", S.74°W., 39.16 feet
5. Steel Sign Post, North, 2.7 feet

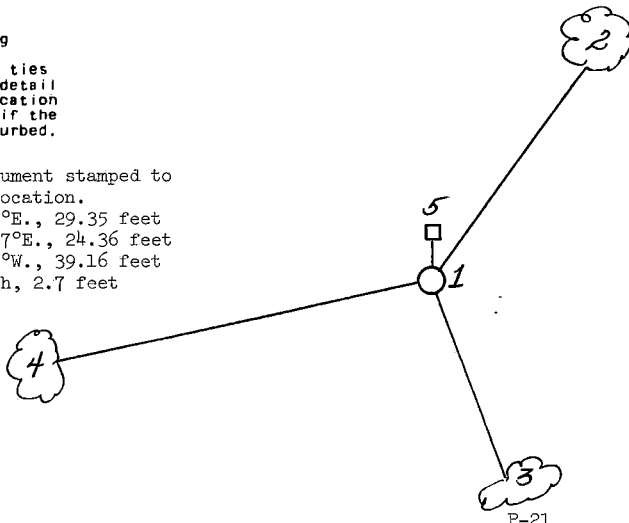

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No discrepancy.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Restored corner by lost methods, on line and midpoint between the section corners 1/2 mile north and 1/2 mile south.

Affix Land Surveyor Seal



- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/12/86
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 19 and 24,
 T35N, R16 and 17E.

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 2nd day
 of November A.D., 1990 at
1:00 o'clock P.M. and recorded
 in Vol Corner Restorations
 page P-25

Paul Hochstetler
 Register of Deeds

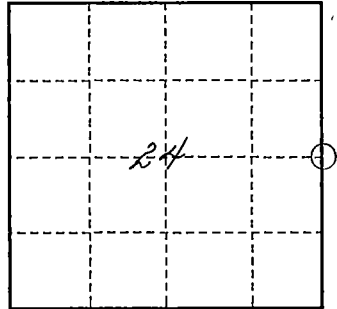

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - Artemas Curtis established this corner and set a wood post and made two bearing trees: Sugar, 6", N67°W, 25 Links and a Sugar, 12", S62°E, 39 Links


1934 - 1935 - J.J. Jenkins attempted to restore this corner by Lost Methods. He placed a 4" x 36" iron pipe with brass cap for the corner.

August 7, 1990 - Milo E. Stefan, in the section subdivision of Section 24 to the West, found this corner to be in error by 10.6 feet. In consultation with Nicolet National Forest Surveyor, Al Harrison, and Marinette County Surveyor, Jerome Pillath, decided to use the county monument as a Witness Corner and restore this corner at its proper location by single proportionate measure between the Section Corners North and South.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2½" x 36" aluminum monument in mound of stone
- 2) Sugar Maple, 16", N28°E, 40.54'
- 3) Sugar Maple, 16", S32°E, 4.35'
- 4) Sugar Maple, 10", S49°W, 24.84'
- 5) Sugar Maple, 10", N07°W, 21.57'
- 6) 4" x 36" iron pipe with brass cap buried to ground level, N06°-07.9'E, 10.6'
- 7) Steel Sign Post, Northwest, 2.10'

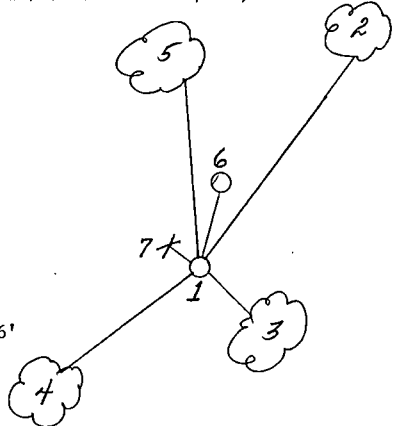

4351624 2000


(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing under g and h.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Not applicable.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

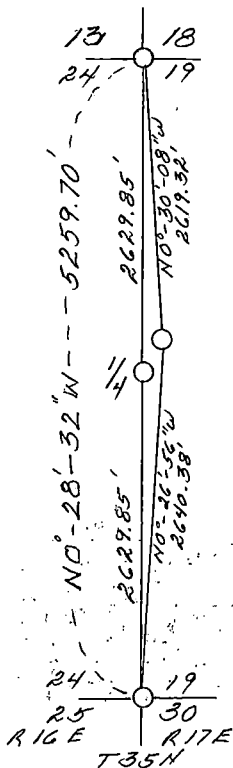

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

September 7, 1990
Date

CERTIFICATE READY FOR FILING:

Dale S. Stage
District Ranger



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

SS.

I Jean F. Resvick, do hereby certify that on the 2nd day of May, 1975, I found evidence of the West Quarter corner of Section 24 Township 35 North Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in August 1857 by Artemas Curtis
 Surveyed in December 1934 and July 1935 by J.J. Jenkins, Menominee County Surveyor. N00°29'W between Sections 19 and 24. 40.01 chains set a 4 inch iron post with a brass cap stamped; marquette Co.
 Survey, 1/4, T35N, R16E, T35N, R17E, 19, 24

Description of corner evidence found:

Monument as described above and in place.


Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:

Maple, 16", N30°E, 30.48 feet

Maple, 15", S50°E, 14.27 feet

Set a steel sign post on the south side of the monument.

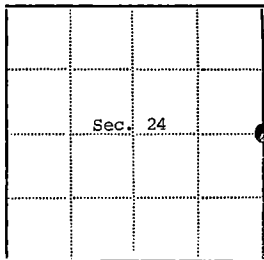

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 15 day of June, 1975...

Signature Jean F. Resvick Title Land Surveyor
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802DOCUMENT NUMBER
109581Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of July, 1975, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North Range 16 East Section 24 Index No. P-25, Page No. _____

43516242000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 2nd day of May, 1975, I found evidence of the South Sixteenth corner of Sections 19 and 24 Township 35 North Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in December 1934 and July 1935 by J.J. Jenkins, Menominee County Surveyor. N00°29'W between sections 19 and 24. 20.01 chains set a 4 inch cedar post for 1/16 corner.

Description of corner evidence found:



20.0 chains North of the section corner common to sections 19, 24, 25 and 30, found the remains of a cedar post and post point.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced post point with a 2 inch inside diameter galvanized pipe, 3 feet long filled with concrete, with a brass cap stamped: T35N, R16E, R17E, S 1/16, S19, S24, 1976, S-802.

Blazed and scribed the following new bearing trees:

Basswood, 10", N42°W, 29.27 feet
Maple, 9", S84°E, 34.73 feet
Set a steel sign post 0.50 ft. East of the monument.

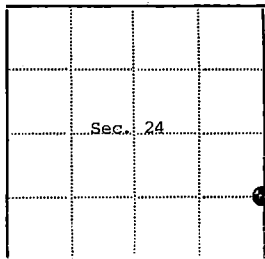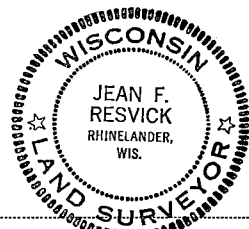

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 15 day of June 1976.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 109582

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of July 1976, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 16 East, Section 24, Index No. Q-25, Page No. _____

43516241000

Q25

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I, Jean F. Resvick, do hereby certify that on the 5 day of August, 1977, I found evidence of the South quarter corner of Section 19 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:



Surveyed in 1858 by James McBride
52.50 chains east corrected between sections 19 and 30, set post.
Yellow pine 8, N86W, 290 lks.
White pine 12, S87W, 283 lks.
8.5 ch. west leave marsh, bears NE-SW
13.0 ch. east leave marsh, bears NW-SW

Description of corner evidence found:

Yellow pine, 8 inch diameter when scribed
2 old posts found bear to yellow pine N89W, 283 lks.
No evidence of 12" white pine found
It is assumed that 50 years or more they had more evidence than is there today and being unable to find the white pine the post is accepted as found to be the corner.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced old post point with 2 inch inside diameter galvanized iron pipe, 6 feet long, the top 3 feet filled with concrete with brass cap stamped: T35N, R16E, S19, 1/4, S30, 1977, S-802
Blazed and scribed the following new bearing trees:
Tamarack 9, N4W, 168.22 feet
Tamarack 6, S15E, 141.40 feet
Set steel sign post on north side of monument.
Bearing trees are near north and south edges of swamp respectively

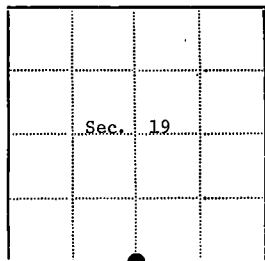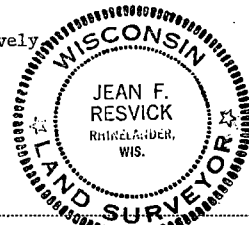

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 9 day of August 1977.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 113297

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of February 1978, and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 16 East, Section 19, Index No. R-3, Page No.

43516190020

R
3


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section corner to sections 19, 20, 29, and 30,
T.35N., R.16E., Forest County, Wisconsin.

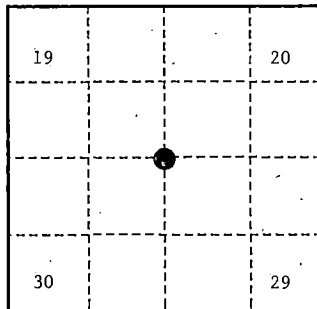

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Hemlock, 40", N.13°W., 35 links (23.10 feet); Birch, 8", N.39°E., 13 links (8.58 feet); Hemlock, 8", S.32°E., 19 links (12.54 feet); Hemlock, 12", S.43°W., 21 links (13.86 feet).

In 1973, Jean F. Resvick (RLS) found scribed 4" x 4" x 5' post, Hemlock stump N.13°W., 33 links (21.78 feet); Hemlock stump, S.32°E., 19 links (12.54 feet); Hemlock stump, S.43°W., 21 links (13.86 feet); Balsam (scribed), N.34°W., 8" D.P.H., 16.84 feet; Cedar (scribed), S.72°W., 8" D.P.H., 29.53 feet. Set 2" x 36" monument with stamped brass cap to identify corner and the following B.T.'s: Black Spruce, 4", N.08!E., 24.06 feet; Black Spruce, 4", N.26°W., 33.84 feet; Cedar, 8", S.72°W., 29.53 feet; Black Spruce, 7", S.14°E., 19.21 feet; Steel sign post, Southwest, 1.00 feet.

In 1990, Alan D. Harrison (RLS) found the monument and accessories as per Resvick with the Southwest B.T. dead but still standing. Replaced Southwest B.T..

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.


1. 2½" x 36" monument with brass cap stamped to identify the corner.
2. Black Spruce, 4", N.08°E., 24.06 feet.
3. Black Spruce, 7", S.14°E., 19.21 feet.
4. Black Spruce, 10", N.30°W., 16.18 feet.
5. Black Spruce, 4", N.26°W., 33.84 feet.
6. Steel Sign Post, Southwest, 1.45 feet.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 19th day
of December, A.D., 1990, at
2:45 o'clock A.M. and recorded
in Vol. 145 of Register of Deeds

DATE

Register of Deeds

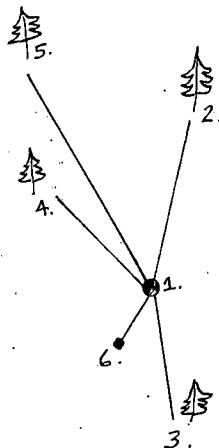

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(i) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

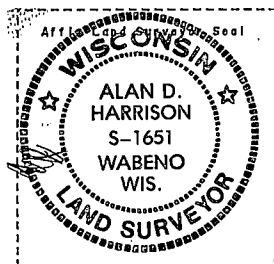

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

SS.

I Jean F. Resvick, do hereby certify that on the 6th day of June, 19 73,
~~XXXXXX~~ evidence ~~XXXXXX~~ was found of the southwest section corner of 19
 Township 35 north, Range 16 east, Fourth Principal Meridian, as described
 hereon; and that from this evidence I established a new monument and accessories as described hereon to per-
 petuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride

80 chains north between sections 29 and 30

Set post for Section corner 19, 20, 29 and 30

Hemlock 40, N13W, 35 lks.

Birch 8, N39E, 13 lks.

Hemlock 8, S32E, 19 lks.

Hemlock 12, S43W, 21 lks.

0.50 chain east leave Tamarack swamp bears NWSE

2.50 chains west leave Tamarack swamp bears NWSE

2.00 chains north leave Tamarack swamp bears SW

Description of corner evidence found:

Old scribed post 4"x4"x5 feet long

Hemlock stump remains N13W, 35 lks.

Hemlock stump, S32E, 19 lks.

Hemlock stump remains, S43W, 21 lks.

Balsam scribed, N34W, 16.84 feet

Cedar scribed, S72W 29.53 feet

2.50 chains west leave swamp

2.00 chains north leave swamp

Area east is Aspen but contains Cedar stumps accounting for swamp call of 0.50 chains east.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced old post with 2 inch inside diameter, galvanized iron pipe, 3 feet long, filled
 with concrete to weight 5 pounds per foot with brass cap stamped

T35N R16E

S19|S20

S30|S29

1973

S-802

From which the following blazed and scribed new bearing trees bear.


Black Spruce 4, N8E, 24.06 feet

Black Spruce 4, N26W, 33.84 feet

Cedar 8, S72W, 29.53 feet

Black Spruce 7, S14E, 19.21 feet

Set iron sign post 1 foot SW of monument

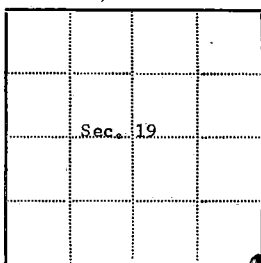

● - Corner monument restored

□ -

Resident witnesses

Dated at Rhineland19 73Signature Jean F. Resvick

(County Surveyor, Registered Land Surveyor, or other duly authorized official)


Surveyors Registration No. S-802Office of Register of DeedsCounty of Forest

I hereby certify that the within instrument was filed in this office for record
 on the 13th day of November, 19 73, and was filed in Book

Corner Restorations Page No. R-5 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 north, Range 16 east, Section 19, Index No. R-5, Page No. 43516190000

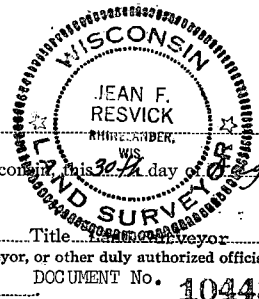R
5


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 20, 21, 28 and 29,
T.35N, R.16E, Forest County, Wisconsin.

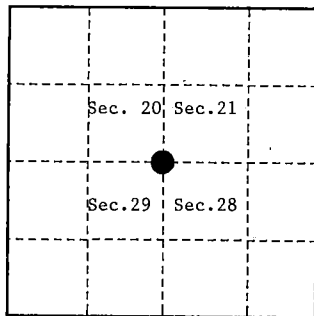

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original survey in 1858 by James McBride, set wood post and made the following bearing trees; Basswood, 36", N.33°E., 30 links, Birch, 24", S.41°E., 45 Links, Ironwood, 10", S.85°W., 50 links, Hemlock, 36", N.19°W., 23 links.


In 1936 J.Hammes, a Junior Foreman, with the Forest Service, found a wood stake with a metal location poster attached. Stake is on an old railroad right of way. Also found a 12" Elm bearing tree S.45°W., 20 feet from wood stake.

In 1995, Alan Harrison, RLS, found remains of a large Birch stump with 2 feet of heartwood standing. Pulled N.41°W., 29.70 feet to a point just West of railroad center. Pulled N.33°E., 19.80 feet to center of a very large Basswood stump which has 3 prodigies 8" to 14" in diameter, growing on edges. I accepted this bearing tree evidence as original and set a 2½" X 36" aluminum monument with an aluminum cap stamped to identify corner. Made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" X 36" aluminum monument with tablet stamped to identify corner.
2. Sugar, 7", N.48°E., 26.84 feet.
3. Sugar, 11", S.60°E., 53.59 feet.
4. Sugar, 10", S.11°W., 16.24 feet.
5. Sugar, 4", N.23°W., 30.36 feet.
6. Steel Sign Post, North, 1.18 feet.

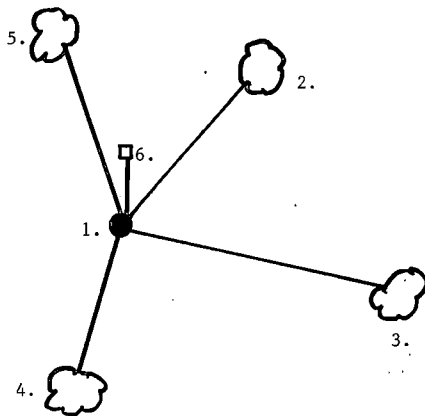

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 28th day
of July A.D., 19 95 at
2:00 o'clock P.M. and recorded
in Vol. Copy Restorations
page 35-16-2-9

Paul C. Kline, Deputy
Register of Deeds

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

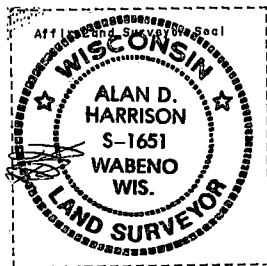

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Milo E. Stefan, do hereby certify that on the 5 day of September, 1979, I found evidence of the Northeast Section corner of Section 27 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in August 1858.
Set Post for Section Corner.
Birch 24", N84°E, 27 lks.
Elm 15", S48°E, 36 lks.
Sugar 8", S10°W, 15 lks.
Sugar 10", N86°W, 26 lks.

Description of corner evidence found:

Mound of stone with post hole, 20" in ground.
Decayed sugar stump, N86°W, 26 lks.
Stump hole, N84°E, 27 lks.
Stump hole, S48°E, 36 lks.
New Sugar BT's 12 - 15 years ago, no record available.

Description of monument and accessories I established to perpetuate the location of this corner:


Placed a 2 inch inside diameter galvanized iron pipe 30 inch long in post hole, concrete filled, with brass cap stamped:
T35N, R16E, S22, S23, S26, S27, 1979, S-1558. Replaced mound of stone.

From which the following bear:

Hemlock 20", N24°E, 92.63'
*Sugar Maple 10", S48°E, 7.38'
Hemlock 18", S31°W, 22.28'
*Sugar Maple 10", N82°W, 6.72'
Steel sign post, N45°W, 1.0'
*BT's scribed 12 - 15 years ago.

DOCUMENT NO.

119859

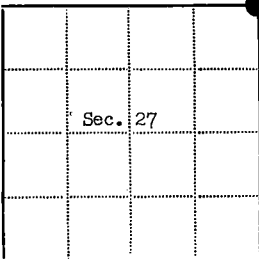

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 3 day of November 1980

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June 1981 and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stagny Title Register of Deeds

Township 35N, Range 16E, Section 27, Index No. R-17, Page No. _____

4351622000P

R17


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to Sections 23 and 26, T.35N., R.16E.

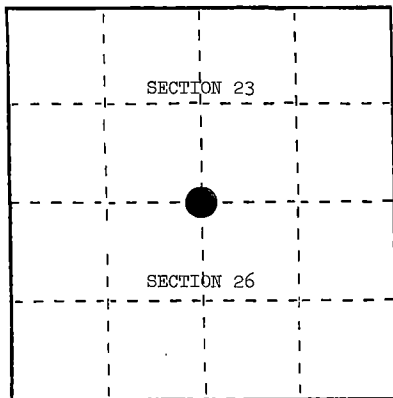

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 14th day
 of March A.D. 1986 at
10:25 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 19
Jan. Archendjaner
 Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set a wood post with the following BTs: Hemlock, 15", N.80°E., 24 links; Birch, 7", S.42°W., 10 links.

In April, 1983, Milo Stefan found a 4" x 4" wood post lying on the ground. The post was not scribed. No trace of BT remains were located from post and record bearings and distances. Wood post was not considered the correct position for the corner and had no supporting evidence. Set a 2" x 36" aluminum monument with cap stamped to identify the corner location at lost proportional position.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2" x 36" aluminum monument with cap stamped to identify corner location.
- Red Pine, 14", N.32°W., 101.64 feet
- Hemlock, 22", N.87°E., 40.03 feet
- Basswood, 7", S.23°W., 16.16 feet
- Steel Sign Post, North, 2.6 feet

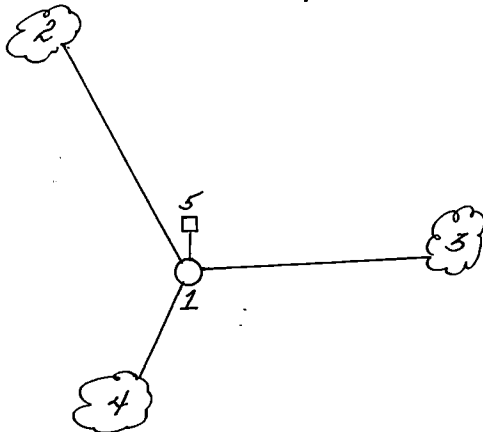

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Found wood post bears from set quarter corner position N.32-18-49W., 72.75 feet.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Corner restored by lost methods at single proportional position midpoint and on line to section corners 1/2 mile east and 1/2 mile west.



- (i) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/12/86
Date

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 5 day of September, 1979, I found evidence of the North East Section corner of Section 26 Township 35 North, Range 16 West, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed by James McBride in August 1858.
Set Section Corner Post.
Fir 10", N21°E, 35 lks.
Sugar 7", S64°E, 28 lks.
Hemlock 10", S11°W, 19lks.
Basswood 20", N61°W, 19 lks.

Description of corner evidence found:

6" X 4" cedar post with fallen old post along side.
Remains of large basswood in clump of young basswood
N60°W, 19 lks.


Description of monument and accessories I established to perpetuate the location of this corner:

Replaced cedar post with a 2 inch inside diameter galvanized iron pipe
36 inches long concrete filled with brass table stamped:
T35N, R16E, S23, S24, S25, S26, 1979, S-1558.

Placed mound of stone around monument.

From which the following bear:
Hemlock 20", S78°E, 63.46'
Sugar Maple 10", S3°E, 27.69'
Basswood 10", S64°W, 30.08'
Basswood 12", N10°W, 42.62'
Steel sign post, N60°E, 1.0'

DOCUMENT NO.
119860

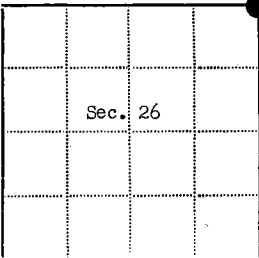

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 3 day of November, 19 80.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. 1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June, 19 81 and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stargatz Title Register of Deeds

Township 35N, Range 16E, Section 26, Index No. R-21, Page No. _____

43516230000

R21

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 24 & 25,
T35N, R16E, 4th P.M.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 20th day
of November, A.D., 1990, at
1:00 o'clock P.M. and recorded
in Vol. Corner Restorations
page R-23

Paul H. Schuchman
Register of Deeds

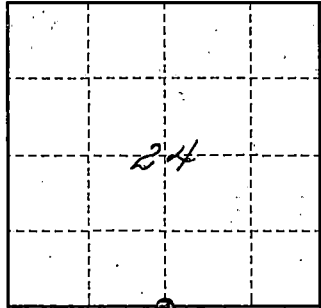

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858 James McBride set a wood post with the following BTs:


Sugar 8", N10°E, 21 Links Sugar 10", S40°W, 29 Links

7/19/1990 - Milo E. Stefan found a fallen cedar post with distances and bearings to Section Corners very reasonable. No evidence of original BTs remain. I accept this old post and restore this corner in the post hole from the fallen post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2 1/2" x 36" aluminum monument stamped to identify the corner.
- 2) Red Pine 7", N6°E, 24.89'
- 3) Red Pine 6", N77°E, 29.25'
- 4) Red Pine 6", S26°E, 18.92'
- 5) Red Pine 6", S48°W, 27.78'
- 6) 6' Steel Sign Post, SW, 1.4'

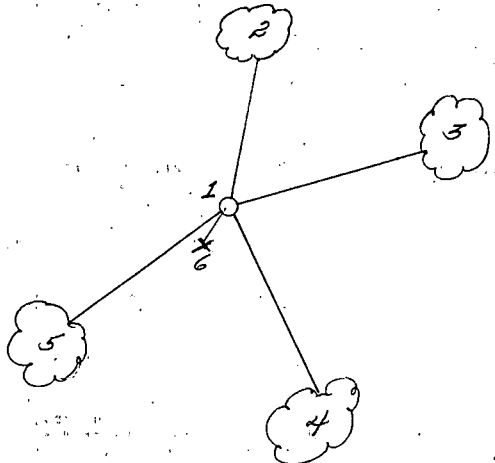

43516240020

(a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

N/A

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

August 17, 1990

Date

CERTIFICATE READY FOR FILING:

Dale S. Staeger
District Ranger



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 29th day of April, 1975, I found evidence of the Southeast Section corner of Section 24 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in August 1857 by Artemas Curtis
Surveyed in December 1934 and July 1935 by J.J. Jenkins, Menominee County Surveyor. N00°15'E between Sections 25 and 30. 79.90 chains set a 4 inch iron post with a brass cap stamped: Marinette Co. Survey, T35N R16E, T35N R17E, 19, 24, 25, 30.


Description of corner evidence found:

Monument as described above and in place.

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:

Cherry, 9", N60°E, 10.06 feet
Maple, 18", S51°E, 53.51 feet
R. Pine, 5", S65°W, 26.03 feet
Elm, 7", N53°W, 40.65 feet
Set a steel sign post north of the monument, 0.50 feet

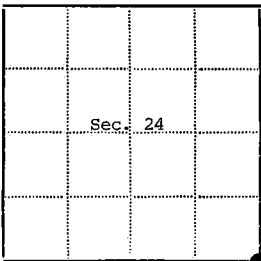

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland Wisconsin, this 15 day of June 1976.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 109583

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of July 1976 and was filed in Book No. Page No. of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 North, Range 16 East, Section 24, Index No. R-25, Page No.

4351624 00000

SEE ALSO D-1 T-25N-R15E

R25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument: restored.
 Quarter Corner between Sections 29 and 30,
 T.35N. R.16E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 119516.58431
 E- 2345990.46199

Geographic Coordinates
 N- 45-29-05.40961
 W- 88-31-41.51216

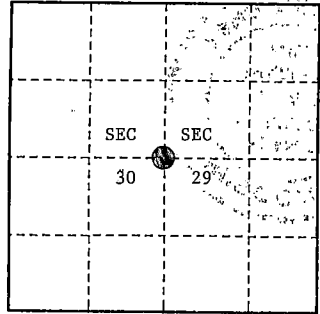


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
 Original Survey in 1858 by James McBride. Set wood post from which the following bear: Black Ash, 7", S.35°W., 14 lks., Cedar, 8", N.69°E., 6 lks. South, 22.00 chains stream 15 lks. wide runs Northeast.

In 1995, Alan Harrison, RLS with the Forest Service, established Global Positioning Satellite control on the Northeast Section Corner of Section 30 and the Southeast Section Corner of Section 30: Using this control and original calls, could not recover any corner evidence. Reestablished the corner position at mid-point and on line between the Northeast and Southeast Section Corners of Section 30. At the corner position, set a 2½"x36" aluminum pipe monument with an aluminum cap stamped to identify the corner. Blazed and scribed new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½"x36" aluminum monument with cap stamped to identify corner
2. Aspen, 12", N.67°E., 3.64 feet
3. Black Ash, 5", S.16°E., 18.12 feet
4. Black Ash, 5", S.12°W., 8.73 feet
5. Steel Sign Post, 0.90 feet Southeast of monument

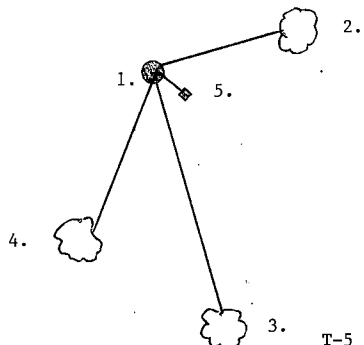

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes

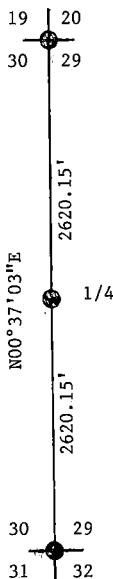


REGISTER'S OFFICE
Forest County, Wis.

Received for record this 30 day
of November A.D., 19 95 at
2:30 o'clock P.M. and recorded
in Vol. Concord Register
pages 35-36

Paul W. Deputy
Register of Deeds

Affix Land Surveyor Seal

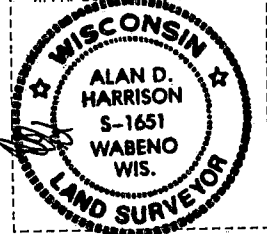

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Harry J. Stricker
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Milo E. Stefan, do hereby certify that on the 17 day of December, 19 79, I found evidence of the East Quarter corner of Section 29 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1858 by James McBride
40.00 set $\frac{1}{4}$ section post.
Sugar 8", N50°E, 20 links
Sugar 10", N20°W, 20 links.

Description of corner evidence found:

Wood post with location post, very rotten and fallen from which evidence of original bearing trees remains N20°E, 20 links.

Description of monument and accessories I established to perpetuate the location of this corner:


Replaced wood post with a 2 inch inside diameter, galvanized iron pipe, 3 feet long in mound of stone with tablet stamped:
T35N, R16E, $\frac{1}{4}$, S28, S29, 1979, S-1558.

Blazed and scribed the following new bearing trees:

Rock Elm 6", N4°W, 25.82 feet
White Spruce 10", N63°E, 11.30 feet
Rock Elm 6", S51°W, 25.79 feet
Steel sign post, southeast, .50 feet

DOCUMENT NO.

119857

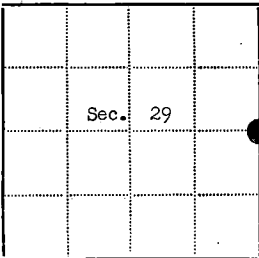

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 18 day of December 19 79.

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1558

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of June, 19 81, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugen Stutzman Title Register of Deeds

Township 35N, Range 16E, Section 29, Index No. T-2, Page No. _____

43516 29 2000

1
6

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 27-28,
T.35N., R16E., Forest County.

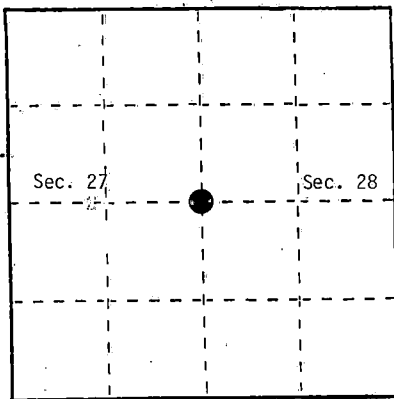

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 29th day
of March A.D., 1989 at

9:00 o'clock A.M. and recorded

in Vol. CORNER RESTORATIONS

Page 13

Paul H. Schenck

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set wood post with BTs: Hemlock, 5", N.70W., 5.28 feet; Yellow Pine, 12", S.73E., 6.60 feet. Running South on section line 14.50 chains, enter Spruce swamp, bears East and West, 27.50 chains leave Spruce swamp bears East and West. At 42.75 chains, stream 75 links wide bears Northeast.

In 1988, Al Harrison found old blazed line running North, South, and West. Found no material evidence of corner location. Set corner off swamp and stream calls. Also held blazed line.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. A 2½" x 60" aluminum monument stamped to identify the corner.
2. Cedar, 7", S.27E., 16.32 feet.
3. Hemlock, 10", S.51W., 33.10 feet.
4. Cedar, 14", N.19W., 16.15 feet.
5. Steel Sign Post, East, 0.91 feet.

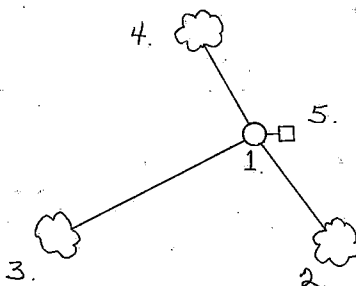

(e). Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) An obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.


Alan D. Harrison

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 3/2/89
Signature Date

Certificate ready for filing: Dale S. Staeg
District Ranger

Affix Land Surveyor Seal

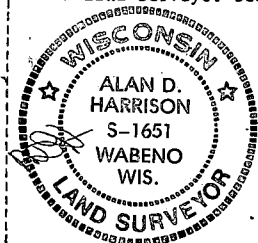


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner to Sections 26-27,
T.35N., R.16E., Forest County,
Wisconsin.

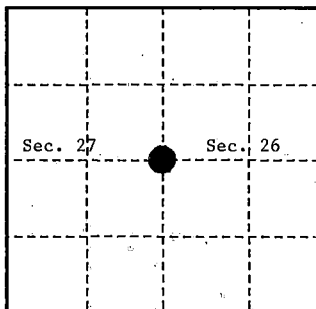

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set a wood post with the following B.T.'s: Hemlock, 30", S.74°W., 18 links (11.88 feet); Birch, 18", S.53°E., 17 links (11.22 feet).

In 1990, Alan D. Harrison (RLS) searched and found no evidence of corner or B.T.'s.. Corner restored by single proportionate measures.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Sugar, 7", N.80°E., 31.55 feet.
3. Sugar, 5", S.56°E., 39.17 feet.
4. Sugar, 7", N.52°W., 17.84 feet.
5. Steel Sign Post, 6', South, 1.54 feet.

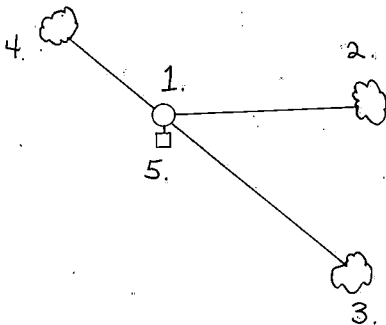

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 8th day
of April A.D. 1991 at
1:15 o'clock A.M. and recorded
in Vol Coover Restorations
page 17-17A

Paul H. Anderson
Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


No.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

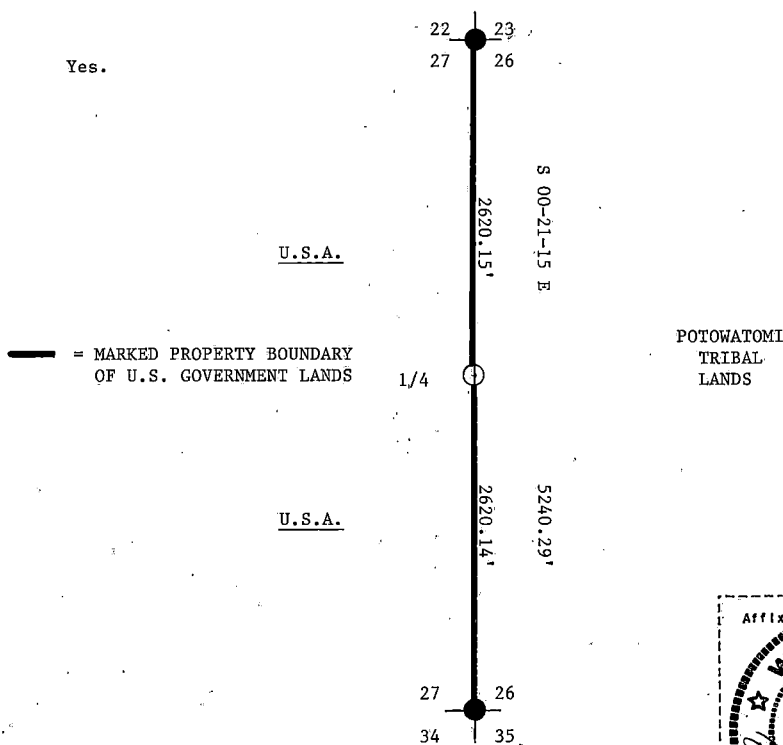

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

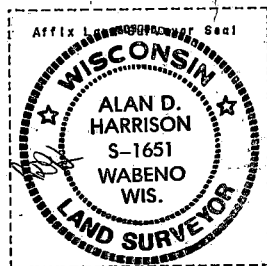

Alan D. Harrison 10/10/90
Signature Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards (Acting)
District Ranger


DOCUMENT NUMBER 129819

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter corner to Sections 25 and 26, T.35N., R.16E., Forest County, Wisconsin.

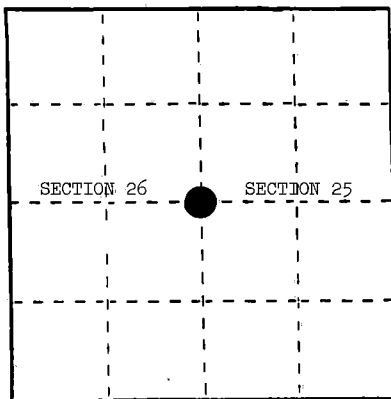

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 14th day
of March, A.D. 1982, at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page 1-21
Paul Aschenbrenner
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.
In 1858, James McBride set a wood post with the following BTs: Tamarack, 7", N.87°W., 27 links; Tamarack, 6", N.75°W., 22 links.


In March, 1935, L. Sobczak found a Spruce post in poor condition, which he replaced; however, he felt it was not an original corner due to no evidence of bearing trees. He set a metal location poster on a Spruce post 9 chains east of the corner.

In April, 1983, Milo Stefan found a location poster on a 6" Tamarack tree. Found no post or any original evidence. Set a 2" x 60" aluminum monument by lost methods.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument with cap stamped to identify corner location.
2. Tamarack, 4", S.48°E., 3.63 feet
3. Tamarack, 6", S.13°W., 28.61 feet
4. Tamarack, 4", N.55°W., 12.25 feet
5. Steel Sign Post, South, 2.13 feet

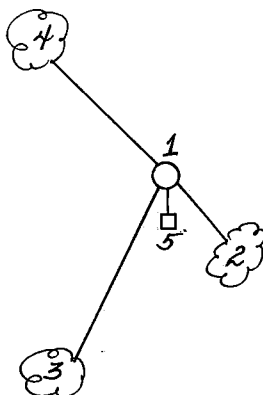

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Corner reestablished by proportionate measure between the section corners north and south.

Affix Land Surveyor Seal



(1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/12/86
Date

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Quarter Corner to Sections 25 and 30,
T35N, R16 - 17E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24 day
of January A.D., 19 90 at
12:00 o'clock P. M. and recorded
in Vol. 6000 Restoration
pages 1-25

Paul H. Schumacher
Register of Deeds

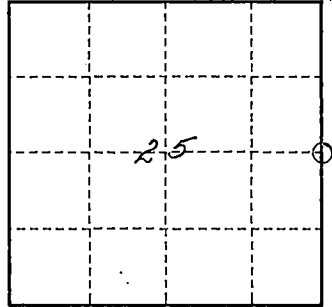

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - Artemas Curtis established this corner and set a wood post with two bearing trees: Elm, 10", S78°W, 17 Links and Ironwood, 8", N89°E, 25 Links.


1934 - 1935, J. J. Jenkins attempted to restore this corner by Lost Methods. He placed a 4" x 36" iron pipe with brass cap for the corner.

August 7, 1990, Milo E. Stefan in the Section Subdivision of Section 24 and restoration of the East Boundary of Section 25, found this corner to be in error by 3.56 feet. In consultation with Nicolet National Forest Surveyor, Al Harrison, and Marinette County Surveyor, Jerome Pillath, decided to use the county monument as a Witness Corner and restore this corner at its proper location by single proportionate measure between the Section Corners North and South.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 2½" x 36" aluminum monument in mound of stone
- 2) Sugar Maple, 8", N16°E, 30.65'
- 3) Sugar Maple, 8", S09°E, 32.69'
- 4) Sugar Maple, 8", S47°E, 51.54'
- 5) Sugar Maple, 8", S49°W, 41.76'
- 6) 4" x 36" iron pipe with brass cap buried to ground level, S13°-59.2'E, 3.56'
- 7) Steel Sign Post, Northwest, 1.4'

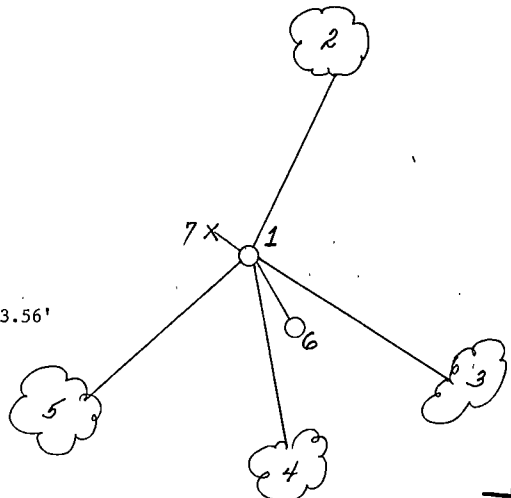

4351625 2000


- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See drawing under g and h.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Not applicable.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

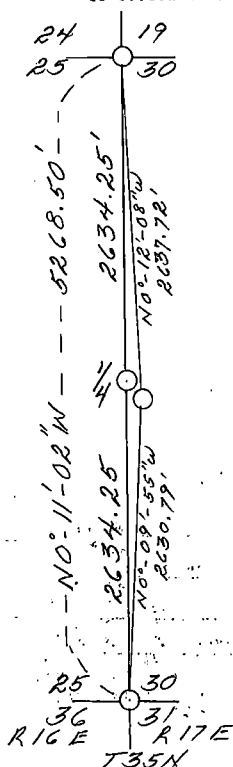

- (1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

September 7, 1990

Date

CERTIFICATE READY FOR FILING:

District Ranger



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I, Jean F. Resvick, do hereby certify that on the 29th day of April, 1975, I found evidence of the East Quarter corner of Section 25 Township 35 North Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis
Surveyed in December 1934 and July 1935 by J.J. Jenkins, Menominee County Surveyor. N00°15'E between Sections 25 and 30. 39.94 chains set a 4" iron post with a brass cap stamped: Marinette Co. Survey, 1/4, T35N, R16E, T35N, R17E, 25, 30



Description of corner evidence found:

Monument as described above and in place.

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following new bearing trees:

Maple, 7", S11°E, 28.81 feet
Maple, 6", S44°W, 39.80 feet
Set a steel sign post SE of the monument, 0.50 feet

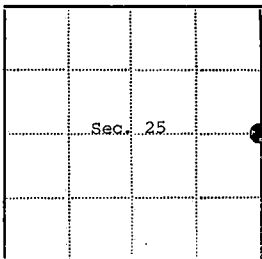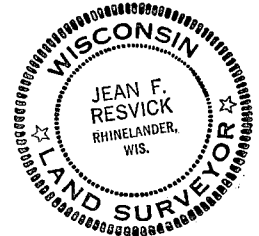

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelanders Wisconsin, this 15 day of June 1976.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 109584

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 2nd day of July 1976, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Eugene Stutz Title Register of Deeds

Township 35 North Range 16 East Section 25 Index No. T-25 Page No. _____

43516252000

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

} ss.

I Jean F. Resvick, do hereby certify that on the 29th day of April, 1975, I found evidence of the South Sixteenth corner of Sections 25 and 30 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in December 1934 and July 1935 by JJ Jenkins,
Menominee County Surveyor. N00°15'E between sections 25 and 30.
19.97 chains set a 4" cedar post for 1/16 corner.

Description of corner evidence found:

20.0 chains south from quarter corner between sections 25 and 30,
found a 4" scribed cedar post lying on the ground and the post point.

Description of monument and accessories I established to perpetuate the location of this corner:

Replaced the post point with a 2 inch inside diameter, galvanized pipe, 5 feet long,
filled with concrete, with a brass cap stamped:
T35N, R16E, R17E, S 1/16, S25, S30, 1976, S-802.
Blazed and scribed the following new bearing trees:
Aspen, 6", N15°W, 42.50 feet
Aspen, 9", N60°E, 9.54 feet
Set a steel sign post east of the monument, 0.50 ft.

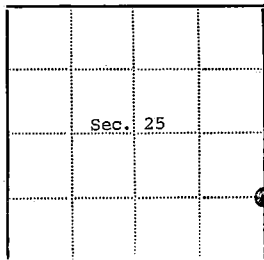

● - Corner monument restored

□ -

Resident witnesses.....

Dated at Rhineland, Wisconsin, this 15 day of June
1976.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802DOCUMENT NUMBER
109585Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record
on the 2nd day of July, 1976, and was filed in Book
No. _____ Page No. _____ of County Records.

Signature Eugene Statny Title Register of Deeds

Township 35 North, Range 16 East, Section 25, Index No. U-25, Page No. _____

43516751600

U25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Section Corner to Sections 25, 36, 30 and 31,
 T.35N. R.15-16E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 116850.14275
 E- 2340015.62615

Geographic Coordinates
 N-45-28-40.17336
 W-88-33-06.03910

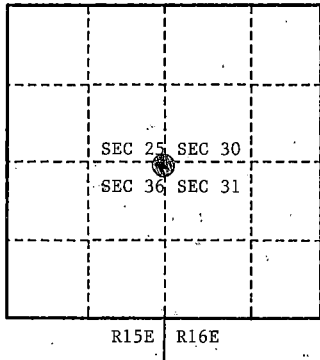

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1857 by Artemas Curtis. Set wood post from which the following bear; Hemlock, 10", S.54°W., 18 lks., Cedar, 10", N.34°W., 18 lks., Hemlock, 14", N.56°E., 39 lks., Hemlock, 10", S.14°E., 22 lks.

In 1980, William Cochrane, RLS with the Forest Service, found a 4x4 squared wood post in a mound of stone and bearing evidence on all 4 original bearing trees. In place of post, he set a 2½"x36" aluminum pipe monument with an aluminum cap stamped to identify the corner. Blazed and scribed the following; Spruce, 9", N.68°E., 32.73 ft., Spruce, 9", S.66°E., 14.51 ft., Spruce, 6", S.63°W., 31.88 ft., Spruce, 6", N.35°W., 22.35 ft.


In 1988, Alan Harrison, RLS with the Forest Service, found the NW bearing tree dead. Blazed and scribed a new bearing tree; Balsam, 8", N.09°E., 16.23 ft., Set steel sign post 0.50 ft. North of monument.

In 1995, Alan Harrison, RLS with the Forest Service, cut down all bearing trees for GPS observations. Made new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½"x36" aluminum monument with cap stamped to identify corner
2. Balsam, 9", N.05°E., 39.40 ft.
3. Aspen, 12", S.49°E., 41.35 ft.
4. Black Spruce, 9", S.46°W., 64.35 ft.
5. Aspen, 16", N.24°W., 25.84 ft.
6. Steel Sign Post, 0.50 ft. North of monument

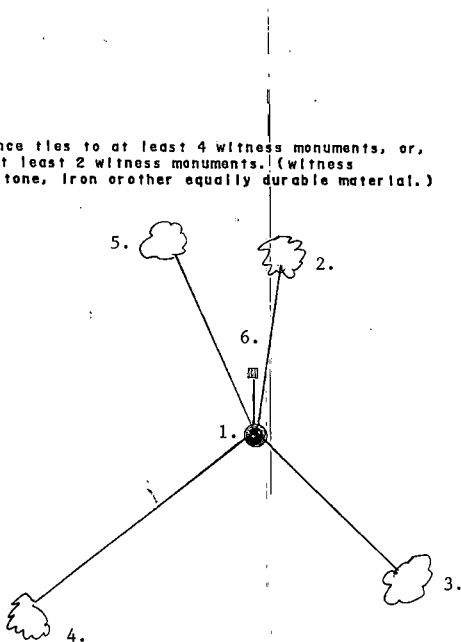

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None


- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2.)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO

REGISTER'S OFFICE
Forest County, Wis.
Received for record this 24 day
of June, A.D., 1995 at
1:20 o'clock P.M. and recorded
in Vol. County Restorations
page 35-156-11
John C. White, Deputy
Register of Deeds

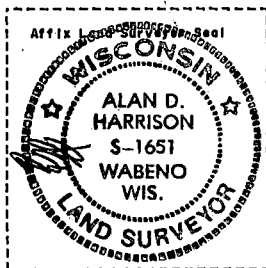

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Harry S. Hecker
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I William B. Cochran, do hereby certify that on the 15th day of May, 19 80, I found evidence of the Southwest Section corner of Section 30 Township 35 North, Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis.
North between Sections 31 and 36, 80.00 chains set post for corner of sections 25, 30, 31 and 36.
Hemlock, 10 inches, S54W, 18 links
Cedar, 10 inches, N34W, 18 links
Hemlock, 14 inches, N56E, 39 links
Hemlock, 10 inches, S14E, 22 links.

Description of corner evidence found:


Old 4 X 4 squared wood post in a mound of stone
Hemlock stump hole, S54W, 18 links
Broken cedar stump, N34W, 18 links
Hemlock stump roots, N56E, 39 links
Hemlock stump mound, S14E, 22 links.

Description of monument and accessories I established to perpetuate the location of this corner:

I replaced the post with a $2\frac{1}{2}$ inch diameter, aluminum pipe, 3 feet long, with an aluminum cap stamped:
T35N, R15E, R16E, S25, S30, S31, S36, 1980, S-1107

Blazed and scribed the following new bearing trees:

Spruce, 9 inches, N68E, 32.73 feet
Spruce, 9 inches, S66E, 14.51 feet
Spruce, 6 inches, S63W, 31.88 feet
Spruce, 6 inches, N35W, 22.35 feet.

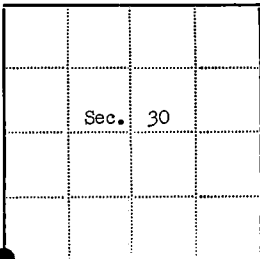

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Laona Wisconsin, this 28th day of May 19 80.

Signature William B. Cochran Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-1107 DOCUMENT 118067 No.

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 9th day of June, 19 80, and was filed in Book No. _____ Page No. _____ of County Records.

Signature Sharon Mueller Title Deputy

Township 35 North, Range 16 East, Section 30, Index No. V-1, Page No. _____

43515250000


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ● = Corner monument restored.

Quarter corner to sections 30 and 31,
 T.35N., R.16E., Forest County, Wisconsin.

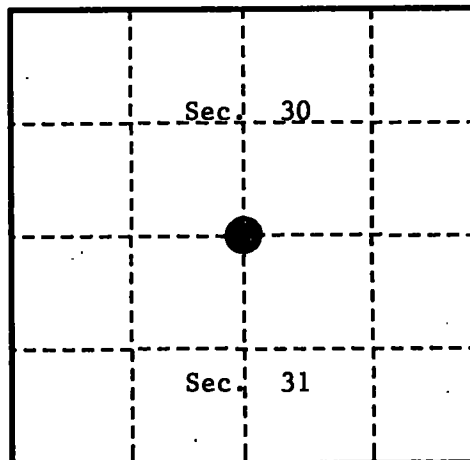

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Sugar Maple, 7", S.15°W., 23 links (15.18 feet); Sugar Maple, 8", N.34°W., 17 links (11.22 feet).

In 1979, Milo Stefan (RLS) found a strand of barb wire fence on the ground and about 20 feet north of the fence is a 20 inch Sugar Maple with a face on the southeast side which could be the Northwest B.T. (need chain saw to examine).


In 1985, Neider and Reichelt found the fence line and fence corner. Corner is south-southwest of an old clearing. Blazed trees facing corner area.

In 1990, Alan Harrison (RLS) found corner as per Neider and Reichelt. Accepted fence corner as best evidence of corner location. Set monument and made the following B.T.'s.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Sugar Maple, 8", N.80°E., 12.41 feet.
3. Basswood, 7", S.03°E., 8.33 feet.
4. Sugar Maple, 10", N.77°W., 17.90 feet.
5. Steel Sign Post, East, 1.19 feet.

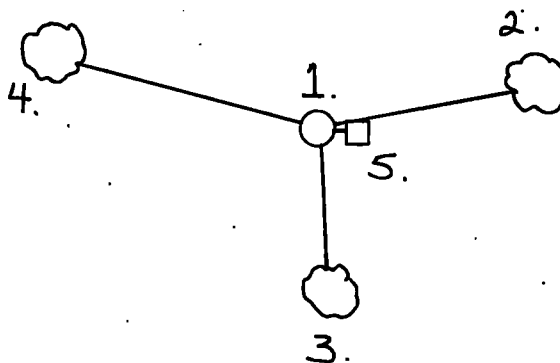

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of May A.D. 1991 at
1:40 o'clock 2 M. and recorded
 in Vol. COOPER RESTORATIONS
 page V-3.

Register of Deeds

Book 2, Page 46

43516300020

V-3

1-32

- (a) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

None.

(i) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature


Alan D. Harrison

Date

5/2/91

CERTIFICATE READY FOR FILING:

Paul B. Staeger
District Ranger

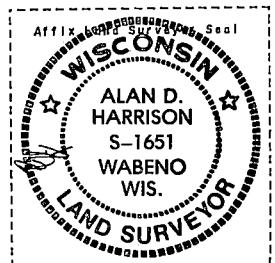

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to Sections 29, 30, 31 and 32,
T.35N. R.16E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
N- 116896.58448
E- 2345962.22409

Geographic Coordinates
N- 45-28-39.55273
W- 88-31-42.58965

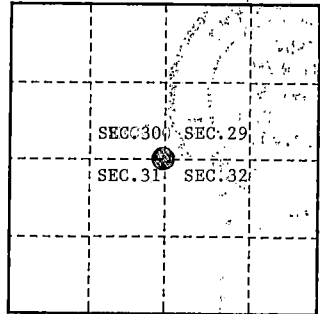


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed. Original Survey in 1858 by James McBride. Set wood post from which the following bear; Hemlock, 16", N.40°E., 31 lks., Hemlock, 12", S.28°E., 25 lks., Hemlock, 10", S.19°W., 30 lks., Hemlock, 24", N.45°W., 27 lks. South 8.00 chains, leave swamp, bears N-S.

In 1995, Alan Harrison, RLS with the Forest Service, established Global Positioning Satellite Control on the 1/4 corners 1/2 mile West, East and South, and on the Section Corner 1 mile North. Using GPS control and original calls, could not recover any corner evidence. The corner is reestablished using double proportionate methods between the South 1/4 corner of Section 30 and the South 1/4 corner of Section 29, and between the East 1/4 corner of Section 31 and the Northeast Section Corner of Section 30. At the corner position, set a 2½"x60" aluminum pipe monument with an aluminum cap stamped to identify the corner. Blazed and scribed new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 60" Aluminum Monument with tablet stamped to identify corner
2. Balsam, 5", N.51°E., 13.01 feet
3. Balsam, 5", S.18°E., 26.88 feet
4. Cedar, 12", S.60°W., 38.44 feet
5. Cedar, 11", N.68°W., 48.64 feet
6. Steel Sign Post, East, 0.50 feet

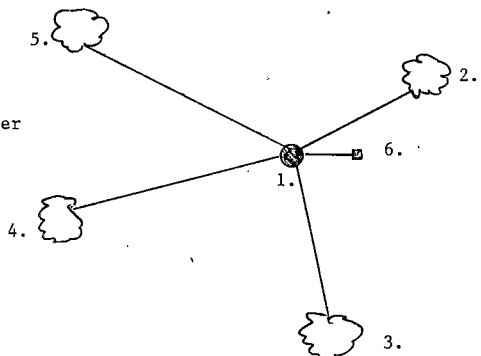

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes

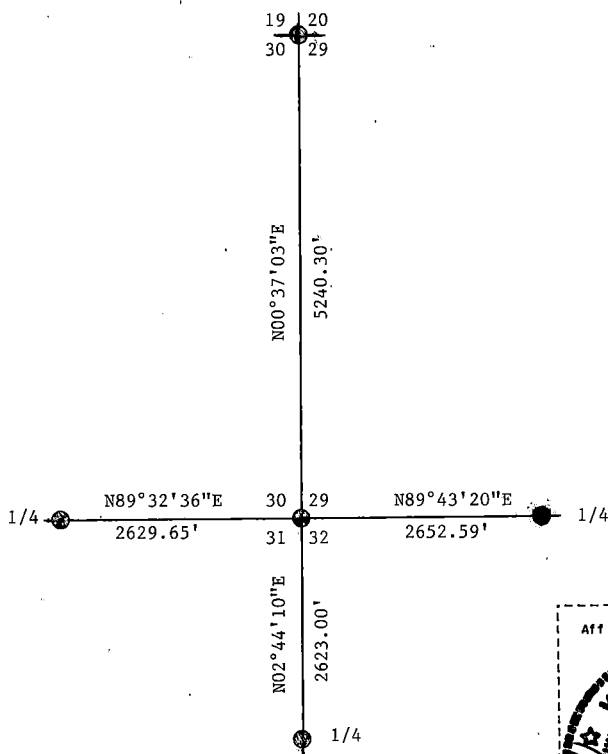

(1) I, Alan D. Harrison


(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

11/29/95
Date

CERTIFICATE READY FOR FILING:

Larry S. Stecker
District Ranger

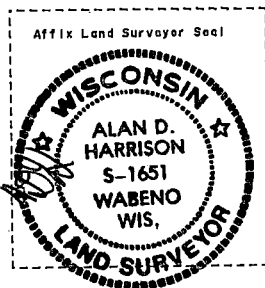

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24 day
of September A.D., 19 95 at
9:00 o'clock A.M. and recorded
in Vol. 200 page 354

John L. Harrison
Register of Deeds

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner between Sections 29 and 32,
 T.35N. R.16E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 116909.44398
 E- 2348614.77969

Geographic Coordinates
 N- 45-28-39.19282
 W- 88-31-05.36818

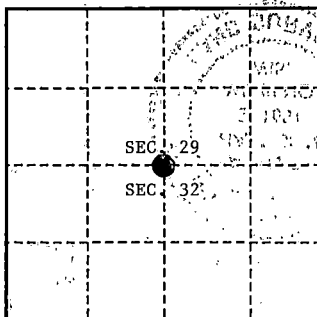

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


Original Survey in 1858 by James McBride. Set wood post and the following bearing trees; Sugar, 12", N.22°W., 26 lks., Sugar, 12", S.11°W., 52 lks., West 3.65 chains enter swamp, bears N-S. West 6.15 chains, stream 5 lks. wide runs North.

In 1995, Alan Harrison, RLS with the Forest Service, chained 80.35 chains from the South 1/4 corner of Section 28. Found the remains of a cedar post with a location poster attached. Found post hole near end of post. Swamp call to the West fits good. Accepted the wood post as the best available evidence for restoring the corner position. In post hole, set a 2½"x36" aluminum pipe monument, with an aluminum cap stamped to identify the corner. Made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½"x36" aluminum monument with aluminum cap stamped to identify corner
2. Balsam, 8", N.61°E., 50.88 feet
3. Aspen, 9", S.28°W., 56.60 feet
4. Sugar, 4", N.13°W., 32.16 feet
5. Steel Sign Post, 1.00 ft. North of monument

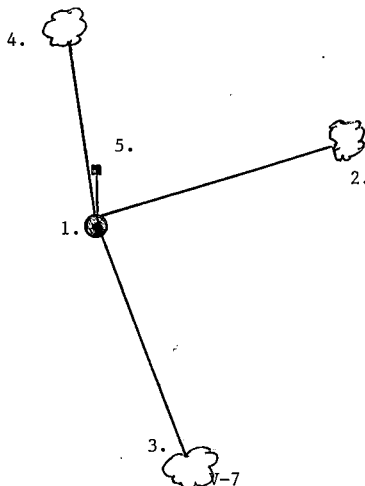

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2.)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 24 day
of January A.D., 1995 at
1:30 o'clock P.M. and recorded
in Vol. 200, Page 1
page 35 of 1

Alan D. Harrison
Register of Deeds

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.


Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

Affix Land Surveyor Seal

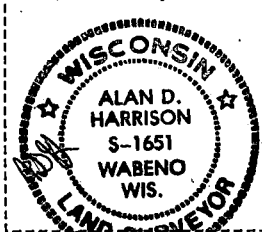

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner common to Sections 28 and 33, T.35N., R.16E., Forest County, Wisconsin.

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this 18th day
 of DECEMBER, A.D., 1982 at
11:00 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 11

Paul Hochstetler
 Register of Deeds

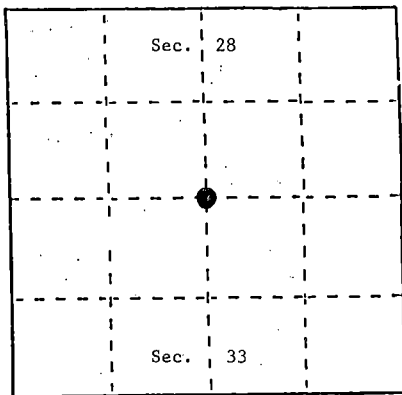

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set quarter post and made the following B.T.'s: Linen, 14", N.63°E., 18 links (11.85 feet); Hemlock, 10", S.16°W., 3 links (1.98 feet).

In 1936, a C.C.C. survey of Truck Trail #353 along the old grade found quarter post 11 feet East of station 170 + 43.


In 1984, Harrison and Neider found 2" iron pipe on hillside 60 feet West of F.R. 2134 (T.T. 353). Pipe was set by F.S. employee in early 1960's 40 chains South of iron pipe approximate center quarter corner.

In 1989, Harrison reconstructed road survey from bridge North to curve South of search area. Found a 1" iron bolt, 2' long buried under East side of road. At record original distance is basswood progeny. Centerline of old railroad grade 11 feet West.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1" diameter bolt 6" below road surface.
- 2½" x 36" aluminum witness monument stamped to identify corner location, East, 15.23 feet.
- Aspen, 10", S.71°W., 40.23 feet.
- Sugar, 5", N.46°W., 52.29 feet.
- Steel sign post, East, 16.18 feet.

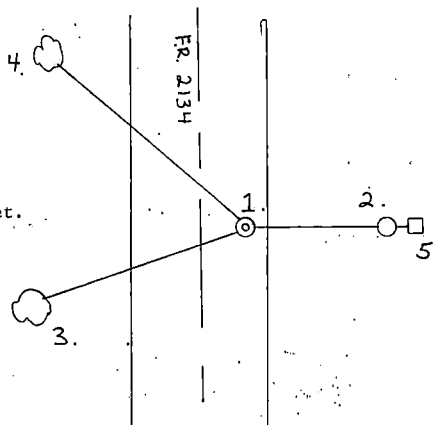

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


Iron Pipe found in 1984 has been removed by unknown person.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

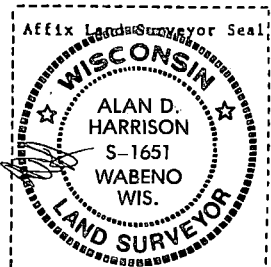

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/29/89
Signature Date

CERTIFICATE READY FOR FILING:

Dale S. Stoege
District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section corner to sections 17-18-33-34,
T.35N., R.16E., Forest County, Wisconsin.

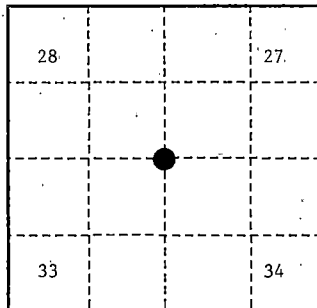

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood pst with the following B.T.'s: Sugar, 12", N.14°W., 34 links (22.44 feet); Sugar, 10", N.76°E., 12 links (7.92 feet); Sugar, 12", S.37°E., 75 links (50.16 feet); Sugar, 12", S.71°W., 29 links (19.14 feet).


In 1970, Godlevske found well point. No othe evidence of substantial B.T.'s or corner, stumps in area do not fit.

In 1990, Alan D. Harrison (RLS) found no evidence of corner or B.T.'s. Road work probably took out well point. Corner restored by double proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. indicate north.

- 2 1/2" x 36" aluminum monument with tablet stamped to identify the corner.
- Sugar, 20", N.21°E., 16.69 feet.
- Sugar, 11", S.50°E., 25.54 feet.
- Sugar, 9", S.72°W., 24.20 feet.
- Sugar, 12", N.89°W., 18.92 feet.
- Steel Sign Post, 6', South, 1.87 feet.

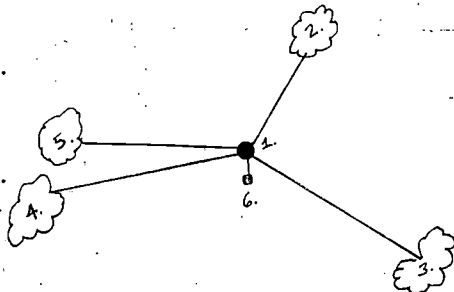

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 19th day
of December, A.D., 1970, at
2:42 o'clock P.M. and recorded
in Vol. 135-46
page 13

Register of Deeds

43516 28 0000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

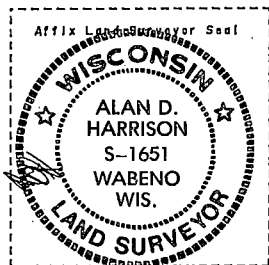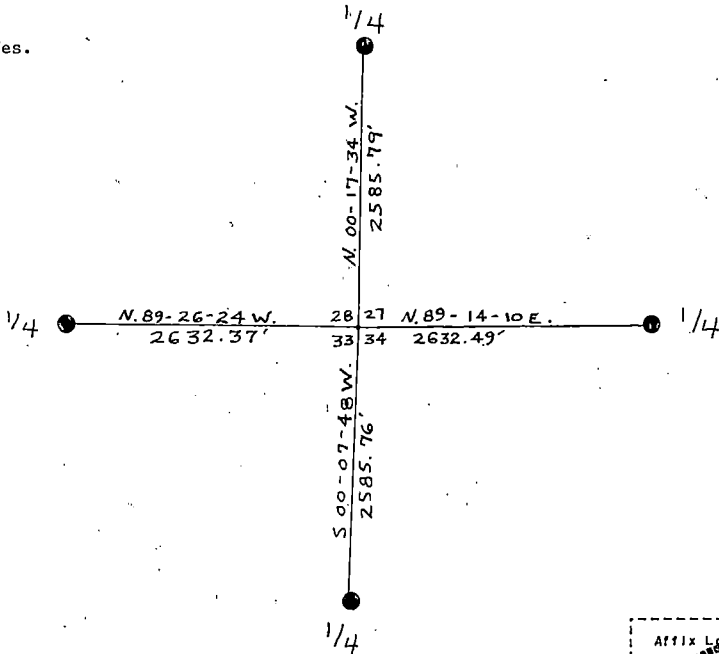

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/30/90
Signature Date

CERTIFICATE READY FOR FILING:

Dale's Staeger
District Ranger

136951

U. S. PUBLIC LAND SURVEY MONUMENT RECORD.


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner Common to Sections 27 and 34,
 T36N, R16E, Forest County, Wisconsin.

REGISTER'S OFFICE
 Forest County, WI

Received for record this 21st day
 of February, A.D., 1988
 at 10:10 o'clock A. M. and
 recorded in Vol. 15 of Records
Paul A. Schenck
 REGISTER

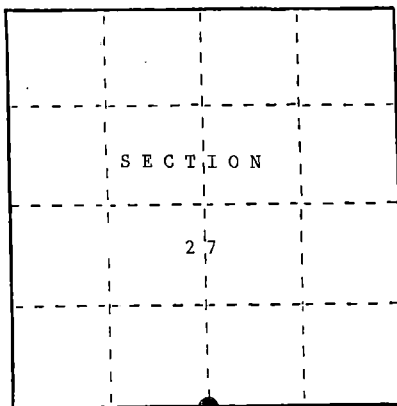

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post for the corner and the following corner references: Fir 8" S05°W 11 lks. Fir 6" N04°W 28 lks.


In 1988, John Schulke found no evidence due to timber cutting in the area.
 Placed 2 1/2" X 36" aluminum monument.

This certificate is filed to correct a distance error on the certificate filed as Document #136622.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2 1/2" dia. X 36" aluminum magnetic cap monument stamped to identify the corner.
- Sugar Maple 7" S20°E 118.42 feet
- Sugar Maple 5" S10°E 119.49 feet
- Basswood 6" S08°W 105.98 feet
- Chiseled an "X" on rock 7'X5 1/2" S05°E 45.45 feet
- Steel sign post West 1.0 feet

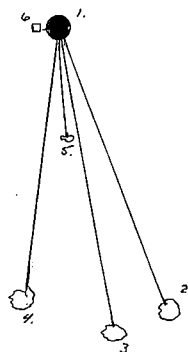

43516270020

115

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.



No Discrepancy, first cornr restoration.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No, see g and h.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Corner restored by proportionate method.

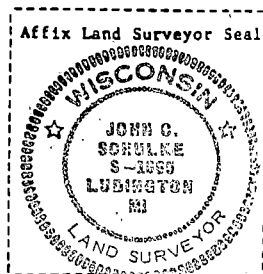

- (i) I, John C. Schulke
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke Jan 27, 1989
Signature Date
Certificate ready for filing: Darrell E. Richards
Asst. District Ranger

Register

DOCUMENT NUMBER 129875

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 27 and 34, T.35N., R.16E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day
of March A.D., 1986, at
10:40 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page V-15
Paul Hochendanner
Register of Deeds

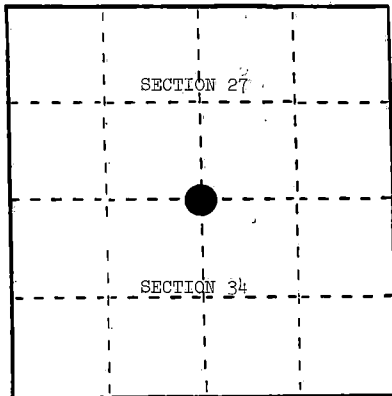

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Lynn, 16", N.32°W., 26 links; Ironwood, 8", S.89°E., 21 links.

March 8, 1935, L. Sobczak--hardwood post and metal tag on 10" Maple, east, 3.96 feet.


August 7, 1985, Weider and Reichelt found fallen Maple with metal tag and set picket in post hole.

August 13, 1985, Alan Harrison confirmed evidence and set corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a Municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed.
Indicate north.

1. 2" x 36" aluminum monument, in a mound of stone, stamped to identify the corner.
2. Yellow Birch, 7", N.5°E., 20.27 feet
3. Sugar, 13", S.41°E., 16.17 feet
4. Sugar, 11", N.57°W., 14.27 feet
5. Steel Sign Post, East, 1.05 feet

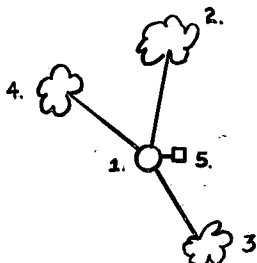

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.


(gah) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(type or print name) certify that the corner location shown
on this record was determined by me or under my direction and
control and that this U.S. Public Land Survey Monument Record is
correct and complete to the best of my knowledge and belief.

Signature

Date

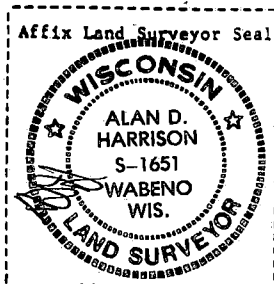


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

Section Corner to sections 26-27-34-35,
T.35N., R.16E., Forest County, Wisconsin.

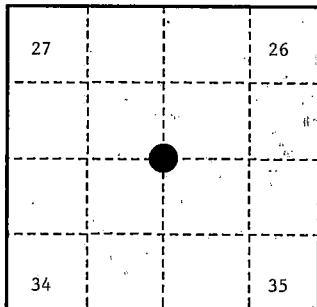

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set a wood post with the following B.T.'s: Elm, 12", N.02°W., 56 links (36.96 feet); Sugar, 15", N.80°E., 46 links (30.36 feet); Sugar, 15", S.30°E., 36 links (23.76 feet); Sugar, 15", S.49°W., 13 links (20.46 feet).

In 1990, Alan D. Harrison (RLS) searched and found no evidence of corner, corner restored by double proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 2 1/2" x 36" aluminum monument with tablet stamped to identify the corner.
- Sugar, 8", N.12°E., 32.35 feet.
- Sugar, 8", S.63°E., 40.23 feet.
- Sugar, 9", S.63°W., 28.91 feet.
- Sugar, 4", N.33°W., 33.49 feet.
- Steel Sign Post, 6', Northwest, 0.65 feet.

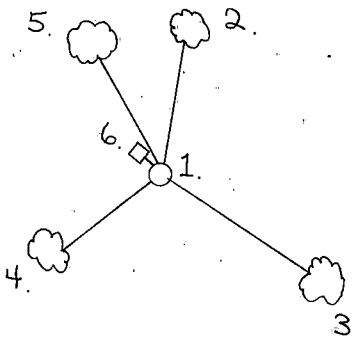

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 6 day
of April A.D. 1991 at
1:15 o'clock P.M. and recorded
in Vol. 696 RESTORATIONS
page 17

Paul H. Harrison
Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

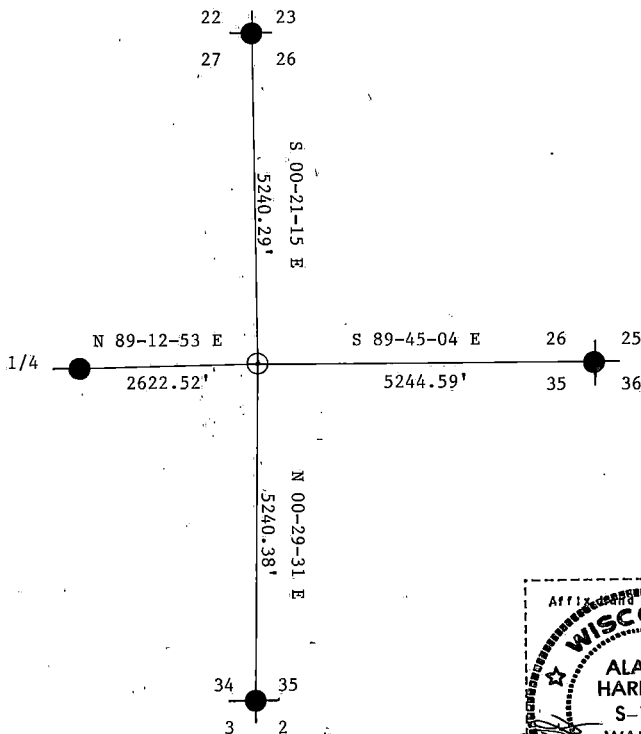


(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 10/10/90
Signature Date

CERTIFICATE READY FOR FILING:

Darrell E. Richards (Acting)
District Ranger

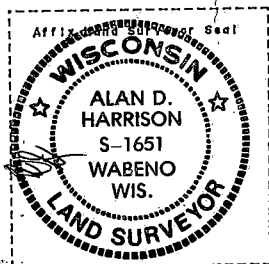


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to sections 26-35, T.35N., R.16E., Forest County, Wisconsin.

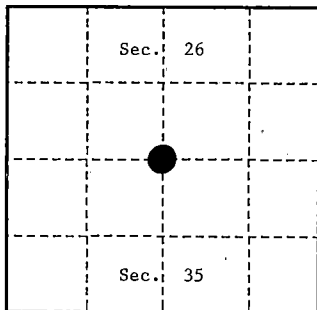

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Hemlock, 24", S.51°W., 24 links (15.84 feet); Elm, 14", N.54°E., 18 links (11.88 feet).


In 1935, Dangremond (C.C.C.) found square wood post 24" high, set location tag on a 5" maple, N.53W., 30 links (19.80 feet).

In 1990, Alan D. Harrison (R.L.S.) searched and found no evidence of corner or B.T.'s. Corner restored by single proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Black Cherry, 8", N.32°E., 64.68 feet.
3. Sugar, 16", S.18°W., 51.67 feet.
4. Black Cherry, 7", N.47°W., 25.20 feet.
5. Steel Sign Post, 6', West, 0.68 feet.

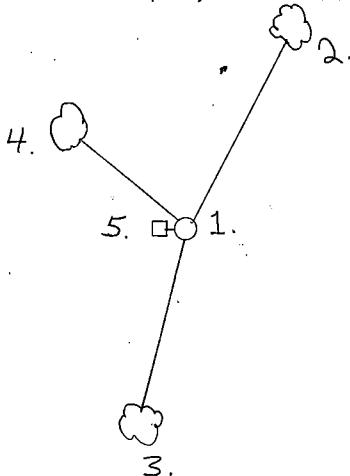

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of April A.D. 1991 at
1:15 o'clock P.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 19

Paul H. Schumacher
 Register of Deeds

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.


(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

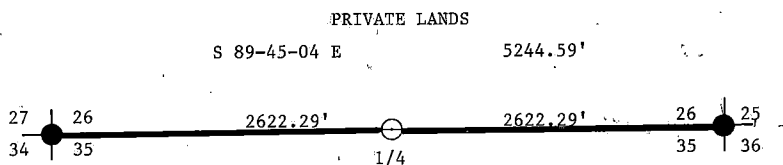

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

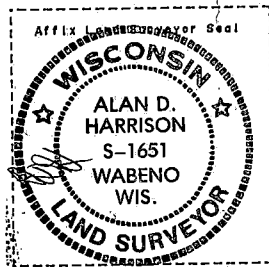

Alan D. Harrison 10/10/90
Signature Date

CERTIFICATE READY FOR FILING:

Darrell E. Rubeck (Acting)
District Ranger


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 25, 26, 35, and 36, T.35N., R.16E., Forest County, Wisconsin.

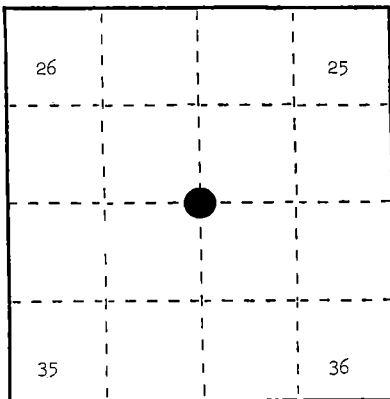

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 14th day
of March, A.D. 1982 at
10:35 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page V-21
Paul Hochembauer
Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


In 1858, James McBride set a wood post with the following BTs: Hemlock, 10", N.69°E., 40 links; Hemlock, 12", S.78°E., 23 links; Sugar Maple, 10", S.51°W., 47 links; Hemlock, 10", N.71°W., 22 links.

In June, 1982, Milo Stefan found a post hole 16" to 18" deep. From hole, he pulled in search of original BT evidence and found the following: Hemlock stump, N.78°E., 15.2 feet; Sugar stump, S.51°W., 31.0 feet; Stump hole, N.71°W., 14.5 feet; Stump hole, S.69°E., 26.4 feet. Accepted post hole as best available evidence and placed a 2" x 36" aluminum monument in a mound of stone, stamped for corner location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Basswood, 8", N.9°E., 23.00 feet
3. Black Cherry, 10", S.41°E., 35.52 feet
4. Basswood, 6", S.41°W., 44.86 feet
5. Sugar Maple, 6", N.62°W., 34.63 feet
6. Steel Sign Post, North, 1.1 feet

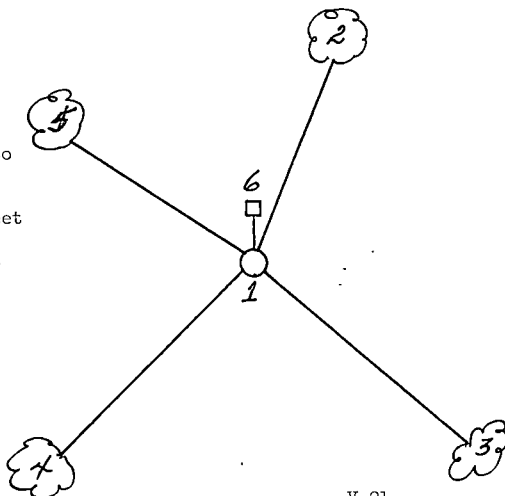

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (1) I, Milo E. Stefan
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/12/86
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.


Section Corner to Sections 25, 30, 31 and 36,
T35N, R16 - 17E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 30th day
of January, A.D., 1990, at
10:20 o'clock P.M. and recorded
in Vol. Janet Restoration

page 1-35

Paul H. Schenck
Register of Deeds

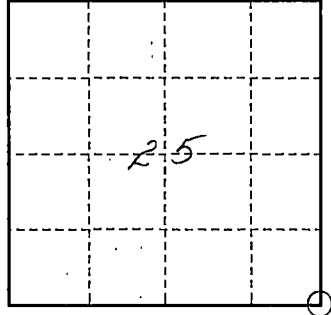

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

1857 - Corner was established by Artemas Curtis. He set a wood post with four bearing trees:

Lynn, 15", S25°W, 30 Links	Hemlock, 8", N13°W, 42 Links
Sugar, 16", N45°E, 26 Links	Sugar, 10", S57°E, 16 Links

1934 - 35, J. J. Jenkins recovered evidence of the original survey and restored this corner by placing a 4" x 36" iron pipe with brass cap. No bearing trees.

September 22, 1976, Jean F. Resvick recovered Jenkins monument and made four bearing trees:


Maple, 12", N40°E, 28.49'	Maple, 9", S38°E, 13.94'
Basswood, 7", S27°W, 17.55'	Basswood, 14", North, 30.04'

August 15, 1990, Milo E. Stefan found Marinette County monument and Southwest Basswood tree dead. No sign post. We restored corner by making one new bearing tree and placing sign post.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

- 1) 4" x 36" iron pipe with brass cap
- 2) Sugar Maple, 12", N44°E, 28.80'
- 3) Sugar Maple, 10", S42°E, 14.13'
- 4) Basswood, 8", S30°W, 18.90'
- 5) Basswood, 12", N02°W, 29.91'
- 6) Steel Sign Post, Northwest, 2.0'

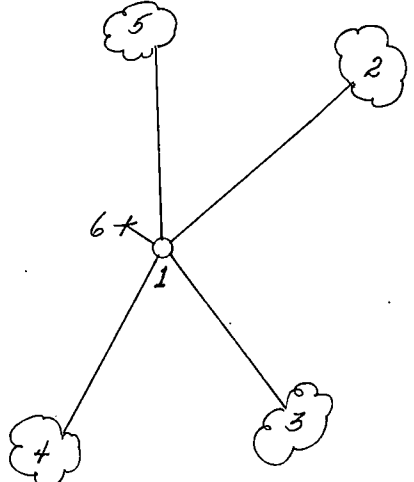

43516250000

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

Not applicable.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

A found perpetuated location.

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(1) I, Milo E. Stefan

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Milo E. Stefan

September 7, 1990

Date

CERTIFICATE READY FOR FILING:

Dale R. Staeger
District Ranger



CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I Jean F. Resvick, do hereby certify that on the 16 day of August, 1976, I found evidence of the Northeast Section corner of Section 36 Township 35 North Range 16 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Surveyed in 1857 by Artemas Curtis
80 ch. north between Sections 31 and 36, set post
Lynn 15, S25W, 30 lks.
Hemlock 8, N13W, 42 lks.
Sugar 16, N45E, 26 lks.
Sugar 10, S57E, 16 lks.
Marinette County Survey by J.J. Jenkins in 1934 and 1935
Set 4 inch iron post for Section corner with brass cap stamped
R16E, T35N, 25, 30, 36, 31, T35N R17E



Description of corner evidence found:

Monument as described by J.J. Jenkins

Description of monument and accessories I established to perpetuate the location of this corner:

Blazed and scribed the following bearing trees

Maple 12, N40E, 28.49 ft.
Maple 9, S38E, 13.94 ft.
Basswood 7, S27W, 17.55 ft.
Basswood 14, north, 30.04 ft.

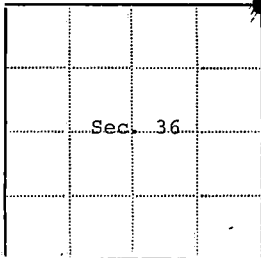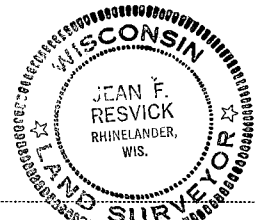

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelander Wisconsin, this 22 day of September 1976.

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 110922

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 31st day of January 1977, and was filed in Book No. Page No. of County Records.

Signature Eugene Statym Title Register of Deeds

Township 35 North, Range 16 East, Section 36, Index No. V-25, Page No.

43516250000

V25

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner between Sections 31 and 32,
 T.35N. R.16E., Forest County, Wisconsin

State Plane Coordinates, Wisconsin North Zone
 N- 114276.57715
 E-2346087.43976

Geographic Coordinates
 N-45-28-13.66772
 W-88-31-41.51402

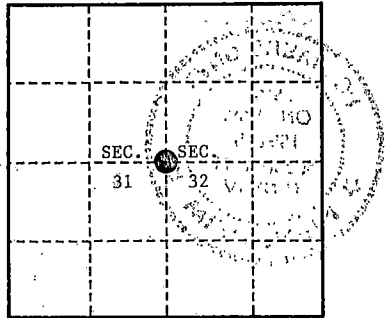

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1858 by James McBride. Set wood post and the following bearing trees;
 Cedar, 12", N.30°E., 15 lks., Cedar, 12", S.45°W., 27 lks.

In 1935, R. Dangremond found a scribed wood post. He placed a location poster on a
 11" Yellow Birch which bears S.45°E., 10.56 feet from the corner post.


In 1985, Alan Harrison, RLS with the Forest Service, found the Yellow Birch with
 location poster as described above. Also found the original Cedar bearing tree stump
 S.45°W., 17.82 feet from post. In place of post, set a 2"x60" aluminum monument with
 an aluminum cap stamped to identify the corner. Made the following bearing trees;
 Black Ash, 5", North, 17.07 feet, Cedar, 6", S.63°W., 17.40 feet, Black Ash, 6",
 N.45°W., 23.71 feet, Steel Sign Post, Southeast, 1.2 feet.

In 1995, Alan Harrison, RLS with the Forest Service, cut down the NW and SW bearing trees for
 GPS observations. Made 2 new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2"x60" aluminum monument with aluminum cap stamped to identify corner
2. Black Ash, 5", North, 17.07 feet
3. Black Ash, 5", N.85°E., 30.40 feet(New)
4. Black Ash, 8", N.24°W., 32.79 feet(New)
5. Steel Sign Post, 1.2 ft. Southeast of monument

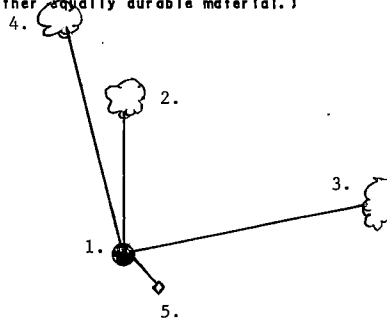

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)


- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 30th day
of January, A.D., 19 85 at
1:30 o'clock P.M. and recorded
in Vol. Land Restoration
page 354, X-5

John W. Harrison
Register of Deeds

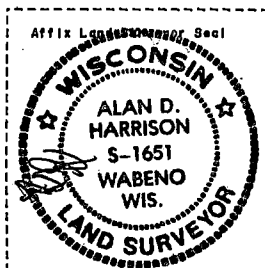

- (1) I, Alan D. Harrison
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

Harry A. Schaefer
District Ranger

Register

DOCUMENT NUMBER 129876


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
○ = Corner monument restored.

Quarter Corner to Sections 31 and 32, T.35N., R.16E.

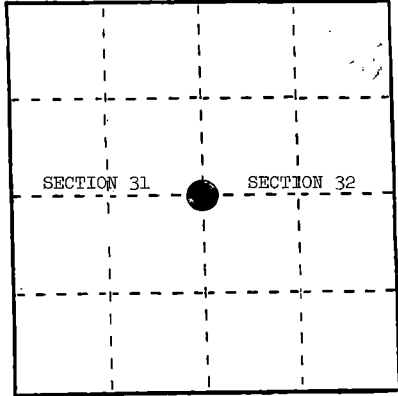

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 17th day

of March A.D., 1986 at

10:40 o'clock A.M. and recorded

In Vol. CORNER RESTORATIONS

Page 5

Register of Deeds

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Cedar, 12", N.30°E., 15 links; Cedar, 12", S.45°W., 27 links.


February 21, 1935, R. Dangremond found scribed wood post in good condition. Put tag on Yellow Birch, 11", S.45°E., 10.56 feet from corner.

August 13, 1985, Harrison, Neider, and Reichelt found Yellow Birch stub with tag, and at N.45°W., 10.56 feet found scribed post. From post at S.45°W., 17.82 feet, found 12" Cedar stump.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 60" aluminum monument stamped to identify the corner.
2. B. Ash, 5", North, 17.07 feet
3. Cedar, 6", S.63°W., 17.40 feet
4. B. Ash, 6", N.45°W., 23.71 feet
5. Steel Sign Post, Southeast, 1.2 feet

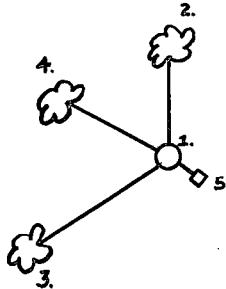

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 1/3/86
Signature Date

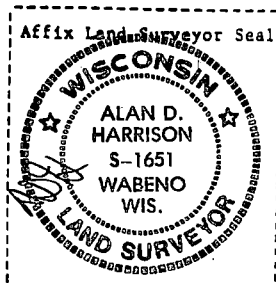


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter Corner to Sections 33 and 34, T.35N., R.16E.

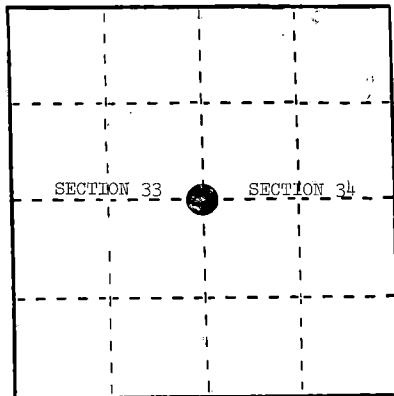

REGISTER'S OFFICE

Forest County, Wis.

Received for record this 17th day
 of March, A.D., 1984, at
10:40 o'clock A.M. and recorded
 in Vol. CORNER RESTORATION
 Page 13
Sam Aschenbrenner
 Register of Deeds


- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set wood post with the following BTs: Hemlock, 18", N.84°E., 16 links; Hemlock, 18", N.48°W., 17 links.
 March 7, 1935, L. Sobczak found Cedar post in good condition. Put tag on Maple stub, 10", N.80°E., 27 links.
 March 15, 1967, D. Seeberg found 6" Basswood with 4-sided blazes on top ridge east of small opening.
 August 13, 1985, Harrison and Neider found Basswood as per Seeberg. Old Maple stub on ground with metal tag. Hemlock stump northwest and stump depression northeast fit for original BTs.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed.
 Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner.
2. Sugar, 8", N.33°E., 26.55 feet
3. Basswood, 7", S.35°E., 31.60 feet
4. Sugar, 9", S.48°W., 25.88 feet
5. Steel Sign Post, East, 3.38 feet

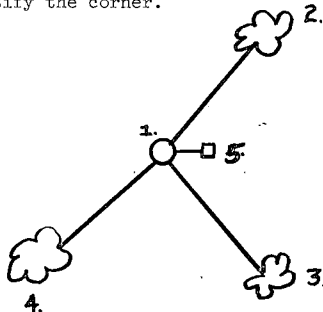

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

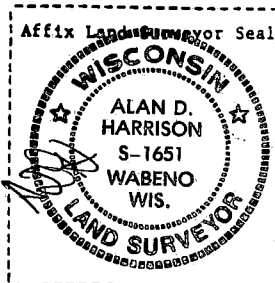

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

1/3/86
Date


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner to sections 34-35, T.35N.,
 R.16E., Forest County, Wisconsin,

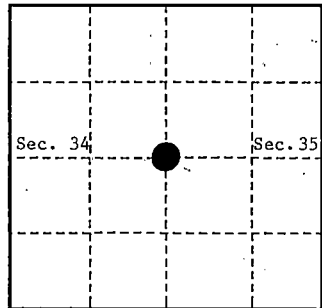

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1858, James McBride set a wood post with the following B.T.'s: Birch, 12", N.34°W., 12 links (7.92 feet); Sugar, 12", N.38°E., 38 links (25.08 feet).


In 1935, L. Sobczak (C.C.C.) found a Birch tree for the corner and put a metal poster on the same.

In 1990, Alan D. Harrison (R.L.S.) searched the area and found no evidence of corner or B.T.'s. Corner restored by single proportionate measure.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Basswood, 12", N.51°E., 13.21 feet.
3. Sugar, 4", S.33°E., 40.77 feet.
4. Sugar, 4", N.48°W., 29.18 feet.
5. Steel Sign Post, 6', North, 0.80 feet.

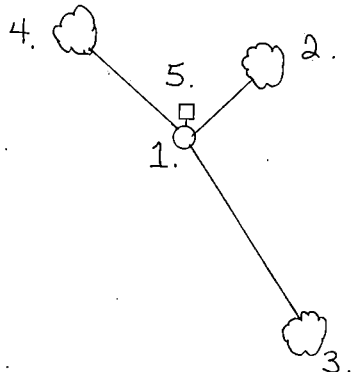

REGISTER'S OFFICE
 Forest County, Wis.

Received for record this 8th day
 of April, A.D., 1991 at
1:15 o'clock P.M. and recorded
 in Vol. 666 RESTORATIONS
 page 17

Paul A. Harrison
 Register of Deeds

43516342000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No.

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Yes.

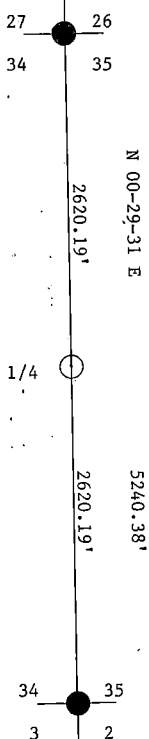

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 10/10/90
Signature. Date

CERTIFICATE READY FOR FILING:

Danrell E. Richards (Acting)
District Ranger



138857

R.O.D

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 O = Corner monument restored.

Quarter corner common to Sections 36 and 31, T.35N., R.16-17E., Forest and Marinette Counties, Wisconsin.

REGISTER'S OFFICE }
 Forest County, Wis. }

Received for record this 18th day
 of DECEMBER A.D., 1982 at
11:00 o'clock A.M. and recorded
 in Vol. CORNER RESTORATIONS
 page 225
Paul A. Schaeffer
 Register of Deeds

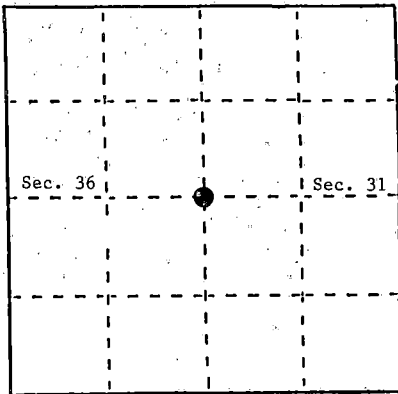

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemis Curtis set quarter post and made the following B.T.'s:
 Y. Birch, 12", N.80°W., 17 links (11.22 feet); W. Pine, 16", S.50°E.,
 24 links (15.84 feet).


In 1980, H. Neider found 4" Marinette County monument 4 feet into beaver flowage.

In 1989, Al Harrison found corner as per Gould and Neider. Beaver flowage dry. From monument at S.50°E., 15.84 feet is a 16"-18" W. Pine stump with B.T. blaze overgrowth.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
 Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. Marinette County Monument stamped to identify corner location.
2. W. Spruce, 13", N.20°E., 29.61 feet.
3. R. Elm, 5", N.82°W., 38.29 feet.
4. W. Spruce, 18", N.28W., 26.05 feet.
5. Steel sign post, South, 1.31 feet.

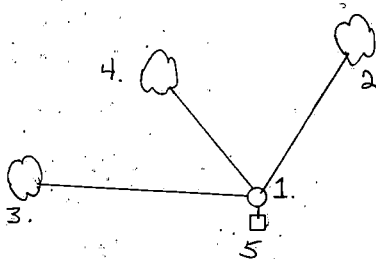

43516362444

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances, to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

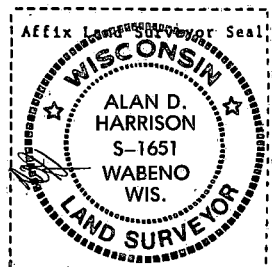

- (i) I, Alan D. Harrison (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 11/29/89
Signature Date

CERTIFICATE READY FOR FILING:

Dale D. Steege
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin

County of Forest

ss.

I Jean F. Resvick, do hereby certify that on the 5 day of June, 1973, I found evidence of the south quarter corner of Section 32 Township 35 north, Range 16 east, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Survey in 1857 by Artemas Curtis
40 chains west between section 5 and 32
Set post
Yellow Birch 22, N50W, 29 lks.
Yellow Birch 20, S25E, 19lks.
9 chains west enter swamp bears SW
13.3 chains west stream, 5 lks. wide, runs SSW
18 chains east enter open swamp

Description of corner evidence found:

1 3/4 inch axel 18 inch above ground
Birch stump bears S25E, 19 lks. look like face blaze has been blazed along side of older blaze remains badly charred.
Birch remains founded in mound, N50W, 29 lks.
Distance to stream and swamps check


Description of monument and accessories I established to perpetuate the location of this corner:

Replace axel with 2 inch inside diameter galvanized iron pipe, 3 feet long filled with concrete to weigh 5 lbs. per foot with brass cap stamped.

T35N R16E

S32 1/4
S5 4
T34N
1973
S-802

From which the following blazed and scribed new bearing trees bear:
Elm 4, S38E, 24,31 feet
Basswood 6, N28W, 24,91 feet
Sign post set 1 foot NE of monument

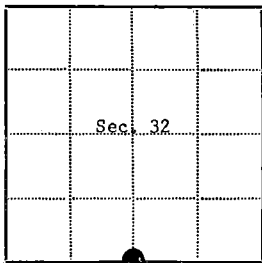

● = Corner monument restored

□ =

Resident witnesses

Dated at Rhineland Wisconsin, this 4 day of June, 1973

Signature Jean F. Resvick Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S-802 DOCUMENT NUMBER 104438

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 13th day of November, 1973, and was filed in Book Corner Restorations Page No. Z-7 of County Records.

Signature Eugene Stutzman Title Register of Deeds

Township 35 north, Range 16 east, Section 32, Index No. Z-7, Page No. 27

43516320020

