

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

1858 — Alfred Millard, set original corner post and made the following B.T.'s: Lynn, 10°, N 13° E, 30 lks., 19.80 feet. Sugar, 10°, S 68° W, 21 lks., 13.86 feet.

2002 — I found no evidence of the original corner post or accessories.

I found a 2" diameter by 36" long Iron Pipe in E—W dirt road & along an old fence line running North. I accepted the iron pipe as the best available evidence of the corner position. I Replaced the existing iron pipe with a 2 1/2" diameter Forest County Aluminum Monument stamped for the 1/4 corner.

(Check All That Apply) Corner was:

Restored through acceptance of an obliterated evidence location. Restored through acceptance of a found perpetuated location.

Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for

proportioning and determining the corner location).
Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).


Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).


LEGEND:

Forest County Aluminum Monument

--- X --- X --- Barb wire fence

Note: All distances are taken to nail in side of tree.

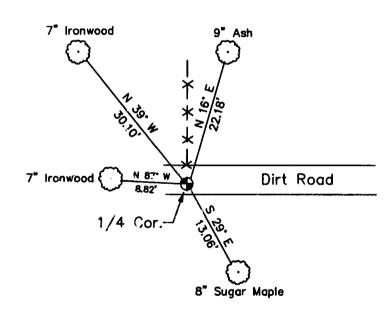

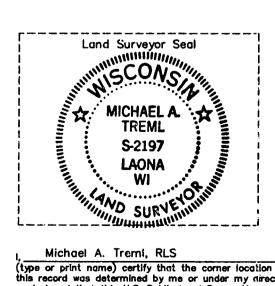

ASSUMED

T36N R13E SEC 5

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

The North Quarter __corner of Section 5 T. 36 N., R. 13 E. Förest County, W

Index No. A-7

ERTIFIED	LAND	CORNER	RESTORATION

ERTIFIED	LAND	CORNER	RESTORATION	
		•	-	

SS.	-	History of original corner establishment
JJ.		

I Thomas Arnott , do hereby
certify that on theBOthday
of April , 19.76 , I found
evidence of the section
corner of sections 3, 4, 33 & 34
Township. 36 & 37, North, Range
13 E, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

County of Forest

Resident witnesses:	
	·
	<u>.</u>

1			<u>.</u>
i		l	
ļ		I	1
	! :	¦_	
	' !	, 1	
	I I	, I	
1	r	-	
	51	EC	•
	l	ı	†
1	1	ξ	1
	1	۲	1
	l	ı	1
	ι	· !	
		1	i
ļ	I	l	I
<u> </u>	I	i	Į.
}	1	I	1
ŀ	1 .		1

O = Corner monument restored.

Y. Birch	16	N55W	6 Lks.
Hemlock	10	N21E	37 Lks.
y. Birch	18	S30E	52 Lks.
Y. Birch	18	S20W	· 46 Lks.

Description of corner evidence found:

Found Walker Monument 33 feet south

Description of monument and accessories I established to perpetuate the original location of this corner.

Set 12 well point in Road

Ties:

Maple	8	N27E	50.57	feet
Maple	14	S62W	64.31	
Walker	Mon.	south	33.00	feet

S-887 (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within

ARNOTT

Index No.

instrument was filed in this office for record on the 14th day of May 19.76. (Register of Deeds)

____ Document No.

Sta	ite of	Wisco	nsin	}
County	of	Forest	; 	ss.
of OCto evidence corner of Townshi	hat on to ober of the sect p. 36-	1/1 ions 3	175n 195 1 & 34	, do he
				ipal Meric
I establi	shed a	new moi	nument a	nd access
as descri			perpetuat	e the orig
				•
Resident	witnes	ses:		
Herbe	ert W	agonei	7	
	7.±.×	<i>31.67 X Y + + x - x</i>		***************************************
		•		
		•		***************************************
		······································		
		······································		
	 	······································		
	 -	······································		
		······································		
		······································		
	 - 	- 	······································	
		······································	······································	
		- 	······································	
	 - - - - - -	- 	······································	
		- 	······································	
		- 	······································	

O = Corner monument restored.

CERTIFIED	LAND	CORNER	RESTORATION
->		COMMEN	INESTONATION

Index No.A 15

History of original corner establishment:

Tamarac 14 S68W 26 Lks. Tamarac 14 N75E 7 Lks.

Description of corner evidence found:

2" iron pipe 5' long wath brass cap set by C.E. Walker in 1938 2 wood points found

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

 Cedar
 14"
 N28W
 14465 feet

 Cedar stump
 8"
 N60E
 9.70 feet (BT found)

 Cedar
 10"
 S57W
 14.40 feet (BT found)

THOMAS R.
ARNOTT
S-887

WIS.
OSURVENSES

SURVENSES

THOMAS R.

ARNOTT
S-887

Dated at Crandon	Wis this	20 t h	day of	October		19 75
0 0 11 54			•	***************************************	************	, - /
Signature Thomas R. August	TitleL	and Sur	veyor	Registra	tion No	S-887

Signature Thomas C. Registered Land Surveyor Registeration No. S=887.

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 28th day of October , 19 75

at 11 o'clock A. M.

Document Number

108073

By......Depu

State of Wisconsin ss.
County of Forest
I Thomas R. Arnott , do hereby certify that on the 20th day of October , 19.75 , I found evidence of the section corner of Sections 2,3,34 & 35
Township
location of this corner.
location of this corner. Resident witnesses:
location of this corner.
location of this corner. Resident witnesses: Herbert Wagoner
location of this corner. Resident witnesses: Herbert Wagoner

<u> </u>			
Υ '	ı		
!	1		l .
1	l l		i :
		1	l
		 	ı
	. – – – –		
		1	1
		ı	1
1		•	
	SE	c	
	- -	<u>-</u>	
]	. 2	?	I
			!
ļ		l	ŀ
į į		1	l
	<u> </u>	'	<u> </u>
<u> </u>	•	i	I
			l
	!	l	1
l I	1	l	i
	· 		ı

O = Corner monument restored.

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12th 1865

Lynn 12 N68W 4 Lks.
Sugar 8 N9E 35 Lks.
Sugar 14 S11E 20 Lks.
Lynn 16 S80W 33 Lks.

Description of corner evidence found:

2" iron pipe 5% long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple	4"	n8e	17.20 feet
Maple	1 <u>11</u> "	S48E	6.30 feet
Maple	811	s 56w	7.80 feet

THOMAS R.
ARNOTT
S-887

WIS.
OCTOBER

OCTOBER

WISHINGTON

OCTOBER

WISHINGTON

OCTOBER

OCTOBER

WISHINGTON

OCTOBER

O

Signature Tritle Land Surveyor Registration No. S=887.

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 27th day of October , 19.75 at 0:30 o'clock A. M.

(Register of Heeds)

DOCUMENT NUMBER

108044

 	••••		
1	φ		
1	 	1	
 · - 		 	
1	 		
 	_ SEC_	+	-
l 	T I	1	
 1	 		

retify that on the 20 th day of October 19.75, I found

corner of sections 2 & 35

Township 36-37, North, Range

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

Herbert Wagoner

13 E., Fourth Principal Meridian,

County of Forest

evidence of the 1/4

location of this corner.

Resident witnesses:

SS.

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. A /19

History of original corner establishment:

Lynn 12 N73W 10 Lks. Lynn 20 S74E 30 Lks.

Description of corner evidence found:

2th iron pipe 5th long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Wlker

Ties:

Maple 8" N38W 3.60 feet Maple 10" S70E 23.25 feet



Dated at, Grandon, Wis., this2:	3 rd day	v of0e	tober	, 1975
Signature Romes P. Accol Title Land (County Surveyor, Registered Land Surveyor, or controlled to the country Surveyor, or controlled to the controlled to th	Surveyor)	Registratio	n No S- 887
(County Surveyor, Registered Land Surveyor, or o	other duly autho	rized official	1)	
Office of Register of Deeds, County of Forest	t		, I hereby certify	that the within
nstrument was filed in this office for record on the27	'th	.day of	October	
1. 8:30 o'clock M. M.	Document		400045	
La Almia Malland				

(Register of beeds)

By.....Deputy

Index No. A 2.

History	of	original	corner	establishment:

Elm 12 Elm 15	N2LLW NLLLE S55E	28 Lks. 54 Lks.
Y. Birch 12		54 Lks. 45 Lks.
Y. Birch 22	S20W	7 Lks,

Description of corner evidence found:

2" iron pipe 5' long set by C.E. Walker in 1938 with brass cap Offset 25 feet west of corner

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker Set $1\frac{1}{4}$ " iron pipe at corner to ground level Ties:

Walker Mon. West 25 feet guy pole (3613-2E1) S29W 37.65 feet power pale (3613-1W1) S38E 41.85 feet

SESTIME COV	Silly
THOMAS	SINAM
THOMAS I ARNOTT \$-887	*
Wis,	15
SURV	E TORKE
	ہے وہ

		***	MANUFACTURE TO THE PARTY OF THE
Dated at Crandon Wis., this	23rd	day of October	, 1975
Signature Y homes R. Ruso W Title	Land Surve	yor Res	gistration No.S-887
(County Surveyor, Registered Land Surve	yor, or other duly au	thorized official)	•
Office of Register of Deeds, County of	Forest	, I hereby	certify that the within
instrument was filed in this office for record on the	27th	day of October	, 19 .75
at 8:30 o'clock M.		•	
Lugene States ny (Register of Geeds)		Document Number	108046
(Register of Heeds)			
	D		

State of Wisconsin


County of Forest ss.

certify that on the 17th day of October , 19.75, I found evidence of the section corner of sections 1,2,35 & 36

Township 36-37, North, Range 13 E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

Herbert	wagoner		•••••••
		•	

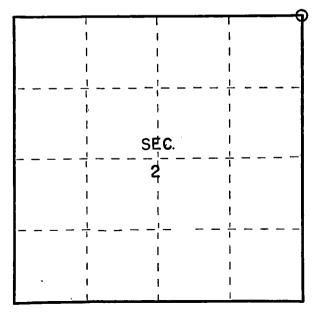

O = Corner monument restored.

IN 363 R. C. MILLER CO., BILWAUK

ı		
ŀ		
l		
j		
ı		
ŀ		

certify that on the.....

December

evidence of the

location of this corner.

Glen Barker

...Jim Claflin

O = Corner monument restored.

Resident witnesses:

Philip T. Hansen

36 & 37

County of ...

corner of...

Township.

Forest

Quarter

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

SS.

....., do hereby

31st

Section 1 and 36

13 East , Fourth Principal Meridian,

....., North, Range

HANSEN

ARGONNE,

WIS.

S-498

T36N R13E

1 1/4

CERTIFIED LAND CORNER RESTORATION

	Α	2	3
Index	No		

History of original corner establishment: Original corner established by A. Curtiss, Deputy Surveyor, in 1857 from which yellow birch 22" bears S70°W, 40 links, hemlock 12" bears N29°E, 36 links.

Corner recovered by C.E. Walker, County Surveyor, in 1938. Set 2-1/2" iron pipe with brass cap projecting 2 feet above ground. No record of BT's.

Description of corner evidence found: Recovered Walker's iron pipe with brass cap stamped - Pipe projects about two feet above ground.

No evidence of OBT's visible.

Forest Co. Forest Crop Survey $T_{\overline{36}N}^{\overline{37}} = R_{\overline{13}E}$ 1/4 Cor. $\frac{36}{1}$

C.E. Walker 10-5-38

Description of monument and accessories I established to perpetuate the original location of this corner. As monument was recovered in perfect condition, it was left as found.

NBT's - White spruce 10" $N26^{\circ}E$ 83.3 links scribed 1/4 BT White spruce 11" $S33^{\circ}W$ 97 links scribed 1/4 BT

Monument and BT's were painted blue.

Dated at	Argonne	, Wis., this	9th	day of	January	, 19 <u> 76</u>
Signature	GOUNTY Surveyor, Register	Title Re	gistered l	and Surve	yoxRegistra	ation NoS-498
Office of Regist	ter of Deeds, County of		rorest		, I hereby cer	tify that the within
instrument was	s filed in this office for rec	ord on the	Цth	day of.	February	, 19. 76
at 4:00 o'cle	ock P M.			DOC	UMENT NUMBER	108693
Luge	ne States (Register of Dyed	nss				1.0000
	(Register of Dued	s) [
By			Deputy			



Document Number

175890

REGISTER'S OFFICE Forest County, Wis.

Received for record this 16 day of June A.D., 2001 at 4:000 clock P.M. and recorded in Vol. Corner Restoration page 2-5

Kay Swanson, Deput Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

- 1865 James L. Nowlin, set original corner post and made the following B.T.'s: Tamarack, 4", S 87° E, 15 lks., 9.90 feet. Spruce, 5", N 10° W, 50 lks., 33.00 feet.
- 1988 William Kelly set a 1" X 30" Iron Pipe for the W 1/4 of Sec. 5. He describes the corner est. by occupation on his Certified Survey Map recorded in Volume 4, Page 50.
- 2002 I found no evidence of the original corner post or accessories.


 I found William Kelly's 1" diameter by 30" long Iron Pipe at old swamp road intersection(Pl of old Hwy. 32). I accepted the iron pipe as the best available evidence of the corner position. Replaced existing iron pipe with a 2 1/2" diameter Forest County Aluminum Monument stamped for the 1/4 corner.

Corner was: (Check All That Apply)

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
 Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for
- proportioning and determining the corner location).

 Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).

Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).

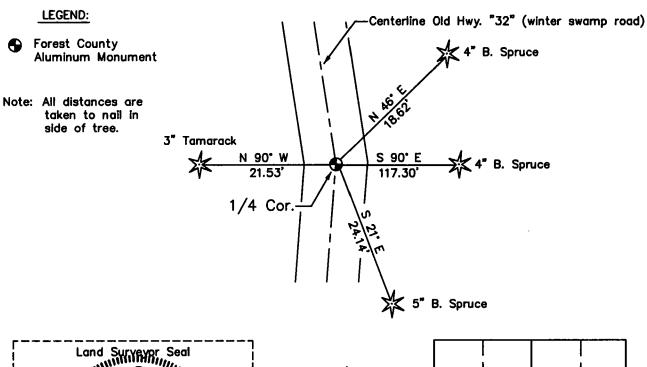



ASSUMED

T36N R13E

The <u>West Quarter</u> corner of Section 5 T. 36 N., R. 13 E. Forest County, W

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Muchael 4. Land 6/11/02

Index No. ____C-5

certify that on the	30thday
of April	
evidence of the 1/1	19.76, I found
corner of section	as 11 & 5
Tamabia	North Rance
Townsnip	36 North, Range ourth Principal Meridian,
	ourth Principal Meridian,
	nd that from this evidence
	nonument and accessories
as described hereon t	o perpetuate the original
location of this corner	
Resident witnesses:	
	······································
1	·
1	i
1	; ; ;
1 :	·
I	-¦
1	1 1
	i
	Ti I
1 5	다 ; _ I
φ	-;
1	4 1
i i	ı l
1	1 1
	1
1	i l
1	1 1

O = Corner monument restored.

State of Wisconsin

I Thomas Arnott do hereby

County of Forest

SS.

CEDITIES	LAND	CODNED	RESTORATION
CERTIFIED	LAND	CORNER	RESTURATION

Index No.

History of original corner establishment:

Original subdivision by James Nowlin 2 June - 12 June, 1865

Elm 20 N27E 100 Lks. Birch 8 N22W 80 Lks.

Description of corner evidence found:

Found 2" iron pipe 6" below road surface



Description of monument and accessories I established to perpetuate the original location of this corner.

Left 2" iron pipe in place

Ties:

Forest County Aluminum Monument N43W 44.24 feet 900 pole N51E 38.63 feet 584W 108.92 feet

Dated at Crandon, Wis., this		
Signature Thomas R. Must Title	Surveyor	Registration No.S=887
(County Surveyor, Registered Land Surveyor Office of Register of Deeds, County of	Forest	I hereby certify that the within
instrument was filed in this office for record on the	14th day of	May , 19.76
Lugene Statesmy (Register of Deeds)	Document	No. 109213

..Deputy

County of I	the 1/36 & 36 & 36 & Andrew Model Anew model hereon to his corner.	Arnot 19.7 1	al Meridian, this evidence d accessories the original
	SE	<u> </u>	
	 	 	1

= Corner monument restored.

CERTIFIFD	LAND	CORNER	RESTORATION	N(

Index No. C-11

History of original corner establishment:

Original Survey done by James L. Nowlin June 2 - June 12, 1865.

Lind 20 N31E 12 Lks. Sugar 8 N28W 14 Lks.

Description of corner evidence found:

2" iron pipe 5' Long with brass cap set by C.E.Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

Maple 10 S35E 20.23 feet Maple 10 S14W 27.15 feet



						-461	111111
Dated at	Crandon	, W	is., this	26	day of	Nov.	, 1976.
Signature	County Survey	or, Registered L	 Title and Survey	Surveyor	authorized officia	Regis 1)	tration NoS=8.8.7.
instrument was	ter of Deeds, Co s filed in this offi ock	ce for record	on the	Forest 26	day of	, I hereby c	ertify that the withir , 197.6.
		STATEZNY ter of Deeds)	r 	·	Document	Number	110606

By Cilien Schmist Deputy

	vitnesses:			
Herbe	rt Wag		 -	

	l i	1	1	
	1	1	l !	
	- - ·	¦ `	+ - 1	
			•	

O = Corner monument restored.

State of Wisconsin

I Thomas R. Arnott , do hereby certify that on the 20th day

County of Forest

October

corner of sections 2 & 3

evidence of the.....

SS.

...., 19...75..., I found

CEDTICIED			RESTORATION
	LAIND	CONNER	RESTORATION


History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12th 1865

30 Lks 35 Lks **Eind**cek 12 Hemlock N30E

Description of corner evidence found:

2" iron pipe found 5' long with brass cap set by C.E. Walker in 1938

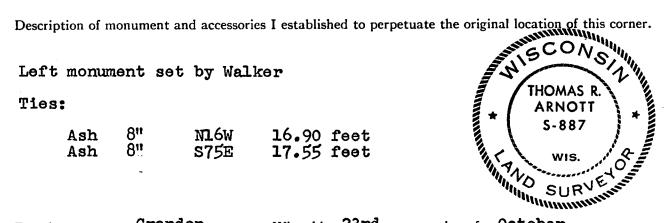

Dated at	Crandon	, Wis., this.	23rd	day of	October	, 19.75
Signature.7h	omos P. Alma	Title	Land	Surveyor	Regis	stration No. S=887
	(County Surveyor, Register	red Land Surve	eyor, or oth	her duly authorized	official)	
Office of Regis	ter of Deeds, County of]	Forest	;	I hereby	certify that the within
instrument wa	s filed in this office for red	ord on the	27t1	1 day	of October	, 19 75
	ock A. M.					
_	nestates	m I		Do	cument Number	108047

FOREST COUNTY, WI CORTNEY BRITTEN CLEEREMAN REGISTER OF DEEDS RECEIVED FOR RECORD

JAN 2 2 2018

Time: 11: 45 A.M. Vol.: Corner Restoration Page Number: 2-21

U.S. PUBLIC LAND SURVEY MONUMENT RECORD


(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The	EAST 1/4 corner of Section 2 , 1. 30 N., R. 13 E., Forest County, WI
Com	ner was (check all that apply)
	Restored through acceptance of an obliterated evidence location.
X	Restored through acceptance of a found perpetuated location.
	Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
	Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
	Check here if additional information is shown on the reverse side of this form.
and	cribe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, all other evidence considered in the recovery/restoration of the corner.
1800	5 - J.L. Nowlin set original 1/4 section post; Hemlock 12", N10°W, 15 links Hemlock 20", N17°E, 22 links.
1938	B - C.E. Walker set 2" x 5' long iron pipe with brass cap.
1975	5 - T. Arnott found monument set by Walker, references a new tie; Balsam 8", S20°W, 96.30 feet, and filed a tie sheet.
2019	9 - I found the bottom portion of the 2" monument set by Walker lying prone. I found the exisitng tie referenced by Arnott in 1975 in good condition. Using Arnott's tie, and bearings and distances referenced in Certified Survey Map Volume 4 Page 35 located in Section 1, I set an Aluminum Capped Forest County Monument at the Comer location.

Physical description of the monument set:

I set a 2.375" x 30" aluminum capped monument 2" above surface as the corner, and tied it out as follows.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

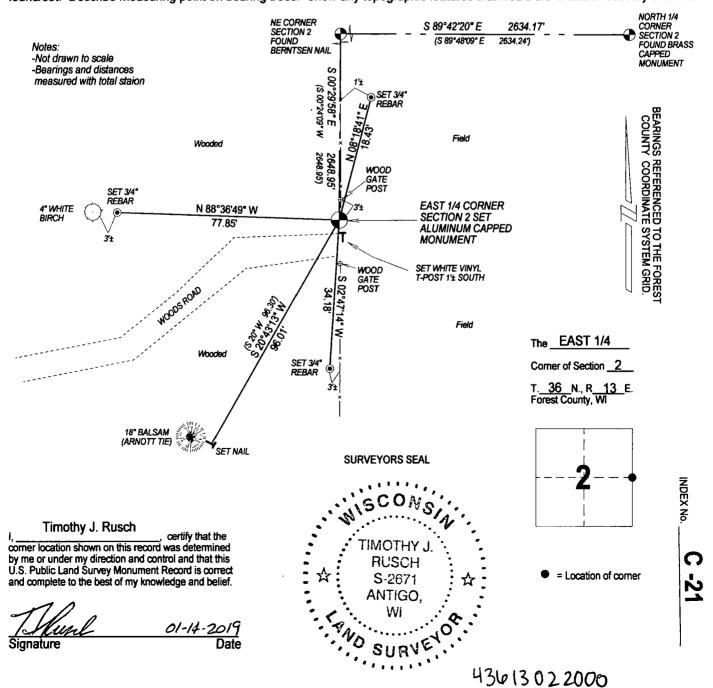

		1
1	1	
- 1		!
	l i	i i
		
- 1	1	1
	1	1
i i		sĖC

corner of sections 1 & 2

I Thomas R. Arnott do hereby

certify that on the 17th day

of October , 19.75 , I found

Township 36 North, Range 13 E Fourth Principal Meridian,

as described hereon; and that from this evidence I established a new monument and accessories

as described hereon to perpetuate the original

County of Forest

location of this corner.

Herbert Wagoner

Resident witnesses:

SS.

O = Corner monument restored.

CERTIFIED	LAND	CORNER	RESTOR	ATION

Index No. C - 21

History of original corner establishment:

Original subdivision by James L. Nowlin

June 2 - June 12th 1865

Hemlock Hemlock 12 20

NIOW NITE 15 Lks. 22 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Balsam 8" S20W 96.30 feet Nothing else in area to tie to THOMAS R.
ARNOTT
S-887
WIS.
October
19

Dated at	Crandon	, Wis., this	<u>23rd</u>	day of	October	 19 75
a.D	n 1	QL-	_	-		

Signature Themas C. Nuclear Title Land Surveyor Registration No. S=887 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 27th day of October , 19.75

at 8:30° clock A. M.


(Register of Deeds)

Document Number

108048

______Depu



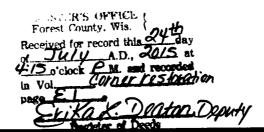



U.S. PUBLIC LAND SURVEY MONUMENTATION RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

NORTHWEST E-1 INDEX NUMBER:_ CORNER: TOWNSHIP: T36N RANGE: R13E SECTION:


TOWN/CITY/VILLAGE: TOWN OF LINCOLN

STATE: WISCONSIN COUNTY: FOREST

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858: ALFRED MILLARD, SET CORNER POST

12" ASPEN 10" FIR N20°E 23 LINKS N85°W 10 LINKS 10" WHITE BIRCH S5°W 20 LINKS 10" WHITE BIRCH S55°E 23 LINKS

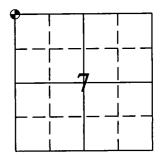


⊕ = CORNER LOCATION

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION AN OBLITERATED LOCATION

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

X CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

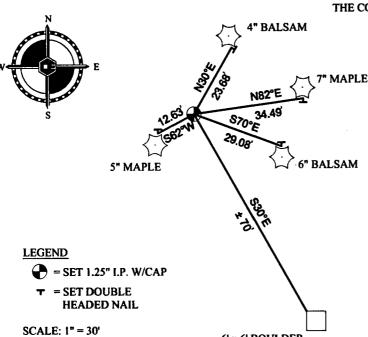

W 1/4 COR. SEC. 6 FND 1" I.P. W/ J. BLONDHEIM N0113'29"W 2632.19' 40 CH (GLO) LS 2800-008 CAP NW COR. SEC. 7 CALCULATED POSITION N0113'29"W 2632.20' 40 CH (GLO) W 1/4 COR. SEC. 7 CALCULATED POSITION NO113'29"W 2632.19' 0 CH (GLO) SW COR. SEC. 7 FND 1.25" OD IP, UP±1' SCALE 1"=2000"

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

6' x 6' BOULDER

CASEY J. PRIES PLS# S-3065, SET 1.25" x 36".I.P. WITH PLASTIC PRIES PLS-3065 CAP USING SINGLE PROPORTIONATE METHODS. CORNER IS LOCATED 125 FEET NORTH OF SWAMP EDGE.

SET THE FOLLOWING WITNESSES:

4" BALSAM 23.68 N_{30°}E 7" MAPLE N82°E 34.49 29.08 6' x 6' BOULDER S30°E 5" MAPLE S62°W

NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES WITH DOUBLE HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HEADED NAIL.

SIGNATURE:

7-24-15 DATE:

Index No. E-1

COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776

DRAWN:

FB 430, PG:71

JOB NO. DATE: 7/24/15 15127-B

William .

CONS

CASEY J.


PRIES

S - 3065 TOWNSEND WI

SURVE

I, <u>CASEY J. PRIES PLS S-3065</u>
CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.



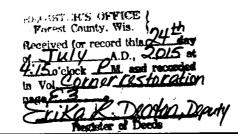



U.S. PUBLIC LAND SURVEY MONUMENTATION RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

NORTH 1/4 INDEX NUMBER: E-3 **CORNER:** RANGE: R13E T36N TOWNSHIP:_ SECTION:

TOWN/CITY/VILLAGE: TOWN OF LINCOLN

STATE: WISCONSIN COUNTY: FOREST

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865: JAMES L. NOWLIN, SET 1/4 SECTION POST 10" BIRCH N20°W

13" ELM

S45°E

150 LINKS

⊕ = CORNER LOCATION


CORNER WAS: (CHECK ALL THAT APPLY)


RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

 $\overline{[\mathbf{X}]}$ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

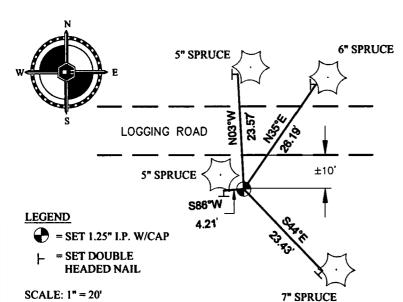

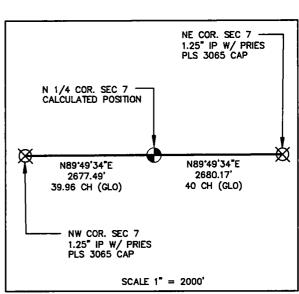

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CASEY J. PRIES PLS# S-3065, SET 1.25" x 36" I.P. WITH PLASTIC PRIES PLS-3065 CAP USING SINGLE PROPORTIONATE METHODS. CORNER IS LOCATED \pm 10 FEET SOUTH OF EAST-WEST LOGGING ROAD.

SET THE FOLLOWING WITNESSES:

6" SPRUCE 7" SPRUCE N35°E 26.19

5" SPRUCE 5" SPRUCE S44°E S86°W N3°W

23.43' 4.21' 23.57

NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES WITH DOUBLE HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HEADED NAIL.

SIGNATURE:

7-24-15 DATE:

Index No. E-3

CONS CASEY J. PRIES S - 30**6**5 TOWNSEND W SUR

I, <u>CASEY J. PRIES PLS S-3065</u>
CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.



COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776

DRAWN: MJT

FB 430, PG:71


DATE: 7/24/15

JOB NO. 15127-B

Decument Number

217628



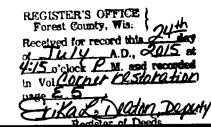



U.S. PUBLIC LAND SURVEY MONUMENTATION RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

CORNER: NORTHEAST INDEX NUMBER: E-5

SECTION: 7 TOWNSHIP: T36N RANGE: R13E


TOWN/CITY/VILLAGE: TOWN OF LINCOLN

COUNTY: FOREST STATE: WISCONSIN

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865: JAMES L. NOWLIN, SET CORNER POST

8" BIRCH 12" TAMARACK S30°E N29°W 100 LINKS NO MEAS. LISTED

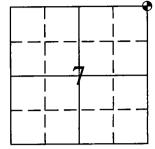

⊕ = CORNER LOCATION


CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

X CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

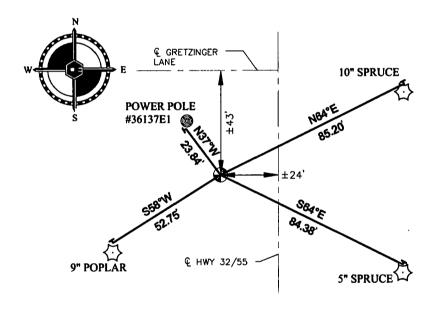

LEGEND

= SET 1.25" I.P. W/CAP

= SET DOUBLE HEADED NAIL

SCALE: 1" = 40'

NOTE: SEE DETAIL ON PAGE 2 FOR PROPORTIONING AND METHODS USED TO DETERMINE CORNER LOCATION.

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER.
(INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CASEY J. PRIES PLS# S-3065, SET 1.25" x 24" I.P. WITH PLASTIC PRIES PLS-3065 CAP USING DOUBLE PROPORTIONATE METHODS. CORNER IS LOCATED \pm 43 FEET SOUTH OF CENTERLINE OF GRETZINGER LANE, AND ALSO \pm 24 FEET WEST OF CENTERLINE OF HWY 32/55.

Page 1 of 2

MILLION,

SCONS

CASEY J.

PRIES S - 3065

TOWNSEND

SURVE

SET THE FOLLOWING WITNESSES:

 10" SPRUCE
 N64°E
 85.20'

 5" SPRUCE
 S64°E
 84.38'

 9" POPLAR
 S58°W
 52.75'

 POWER POLE #36137E1
 N37°W
 23.84'

NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES WITH DOUBLE HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HEADED NAIL.

SIGNATURE: Comp Be

DATE: 7-24-15

Index No. E-5

COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776


DRAWN:

FB 430, PG:72 DATE:

DATE: 7/24/15 JOB NO. 15127-B

CASEY J. PRIES PLS S-3065

CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

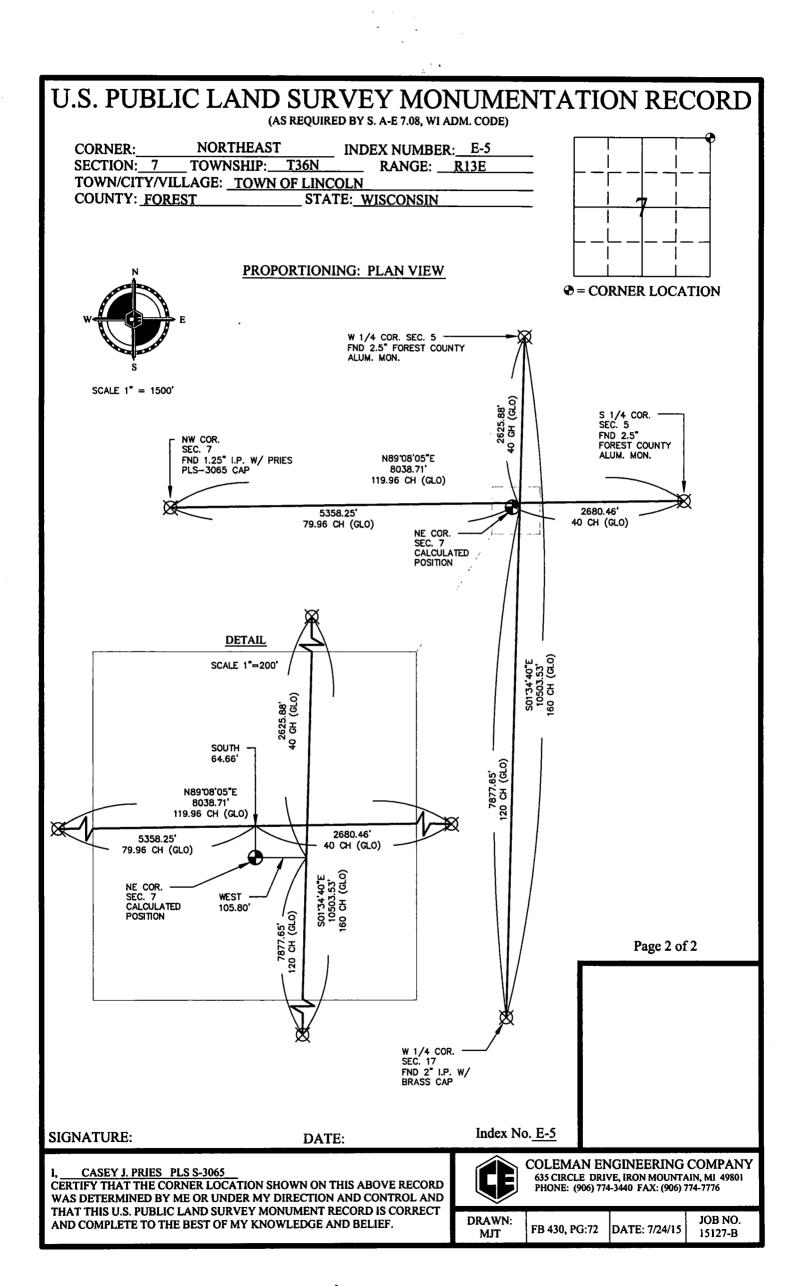

Document Number

175891

REGISTER'S OFFICE | Forest County, Wis. Received for record this 18 of June A.D., 2002 at 4:000 clock P.M. and recorded in Vol. Corner Restoration

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

1865 — James L. Nowlin, set original corner post and made the following B.T.'s: Birch, 8", S 59° E, 30 lks., 19.80 feet. Birch, 12", N 55° W, 28 lks., 18.48 feet.

2002 — I found no evidence of the original corner post or accessories.
 I found a wood post with a 4" X 4" squared top along remains of an old N—S fence line.
 I accepted the wood post as the best available evidence of the corner position.
 I Set a 2 1/2" diameter Forest County Aluminum Monument stamped for the 1/4 corner.

(Check All That Apply)


Michael S. French

Restored through acceptance of an obliterated evidence location. Restored through acceptance of a found perpetuated location.

Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location).

Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).

Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).

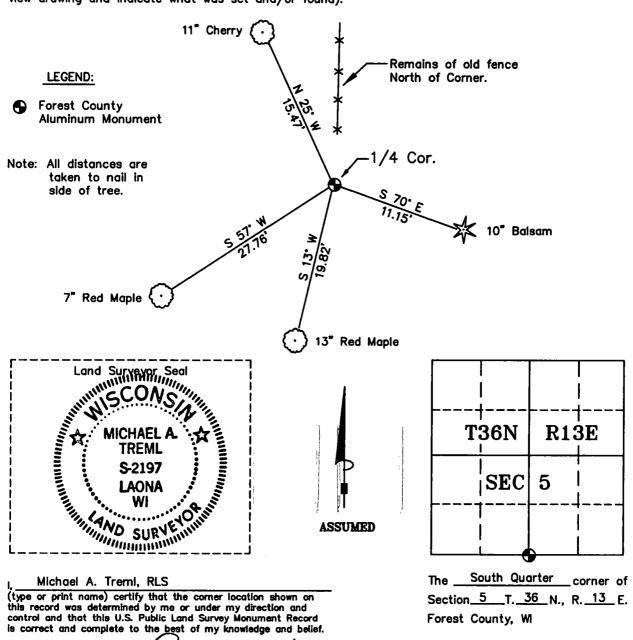

Index No. ____

	Forest		ss.		
I ThomasR. Arnott , do hereby certify that on the 13 Oct. day of Oct. , 1976 , I found evidence of the Section corner of Sec. 3. 4. 9. & 10 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner. Resident witnesses:					
		······			
	•••••	······································			
	,				
	····		 -1		
1					
 	¦	 			
	S[<u>EC</u> _ ;			
1		1			
		; ; ;			
		l l			

= Corner monument restored.

CERTIFIED	CORNER	RESTORATION

History of original corner establishment:

Original survey done by James L. Nowlin June 2 - June 12, 1865.

10 **L**2 Sugar Sugar

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E.Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

Maple	8	N42E S6W	48.38	feet
Maple	8	s6w	48.38 33.87	feet
Maple	6	NSOM	13.08	feet

ARNOTT S-887

Dated at, Wis.	, this <u>2</u> 6	day of	Nov	, 1976
Signature Tromas Minut T (County Surveyor, Registered Land	Title Surve	YOP authorized official	Regist	ration NoS-887
Office of Register of Deeds, County ofinstrument was filed in this office for record on	Forest		I hereby ce	ertify that the within
at 3:30 o'clock P. M. EUGENE STATEZNY	Υ	Document	Number	110607

Deputy

		rest		J • •	
certify th	nat on t	he	17th	, do hei	da.
of	of the	1/4	, 19.	.1.2, I fo	un
corner of	SACCI	COUR	α TO		
1 ownsni	PE	, Four	h Princi	North, Ra pal Merid	ing ia:
as descril	oed here	on; and tl	nat from	this evidend accessor	enc
as descri	bed her	eon to pe		e the orig	
location	of this c	orner.			
Resident	witness	es:			•
Herb	ert W	lagoner	•		
				• •	
•••••••	******				
				•	
•					
, , , , , , , , , , , , , , , , , , ,				T	
	 			T	
, , , , , , , , , , , , , , , , , , ,		 	·	T	
	 - -			 	· -
		! - I	· 	 	<u> </u>
					<u> </u>
		stc	-		· -
		sec	 		
		SEC 	 		· -

CERTIFIED-LAND	CORNER	PESTORATION
CEVILLER, FWIAD	CURINER	RESTURATION

History of original corner establishment:

Original subdivision by James L. Nowlin June 2- June 12, 1865

10 Lks. 12 Lks. Hemlock Birch

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Wakker

Ties:

N20W S50E 10.62 feet 10.80 feet Cedar Spruce



Dated at Grandon Wis.	this <u>LOUD</u>	day of UCTODOP	19
Signature County Surveyor, Registered Land	_ Title Land Survey	Or Registr	
Office of Register of Deeds, County ofinstrument was filed in this office for record on	Forest 28th	day of October	rtify that the within
at 11 o'clock A M.		and the second s	408054

(Register of Dodis)

Document Number

TOOL

State	of Wisco	onsin]
County of	Forest		} ss.
certify that of Octobe evidence of corner of Se Township as described I established as described location of t	the Soctions A E , For hereon; and hereon to	20th 197 19ction 2,3,10 1 urth Princip 1 that from tonument and	&11
Resident wi	tnesses:		
Herber	t Wagone	r	
		·	
	·		· ·
İ	! 	! 	!
	I	I	1
	 		
	l	1	l
		+0	! [
	- -	‡C	
İ	1	f	1
	l 1	1	
	¦		
	I	1	I
	l	1	1
	! !	! !	1
O = Corne	r monument	t restored.	

CERTIFIED	IAND	CORNER	RESTORATION
	ヒヘハレ	COMMEN	INESTORATION

Index No. E . 17

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12th 1865

Y. Birch 30 N77E 25 Lks Y. Birch 15 N12W 10 Lks

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this former.

Left monument set by Walker

Ties:

Maple	611	N43W S78E	7.65 feet
Maple	811. 1 ¹ 11	S78E	13.20 feet
Maple	811	S2W	6.05 feet



Dated at, Wis., this.	23rd	day of October	, 19. 7 5
Signature Crandon , Wis., this County Surveyor, Registered Land Surveyor	Land Surv	eyor Reg	istration NoS-88.7.
Office of Register of Deeds, County of	Forest	, I hereby	certify that the with
Lugene Statemy		Document Number	108049

y.....Deputy

State County of	of Wis		} ss.
certify that of Octobe evidence of corner of Township	on the the 1 2 & 11 36 E , I hereon; a d hereon	Z01 , 1 Fourth Prind that from the perpetus	, do hereb thda 975, I foun , North, Rang ncipal Meridian m this evidence and accessories ate the origina
Resident w	itnesses:		
Herber	trWagor	or	•••••
		· ••••••••••	
	•••••		
•			
	1 1	1	Į.
	I I	1	1
	1	-	- +
	1	1	!
		<u>S</u> ĘC	-
	I I	۲ ا	1
	 	1 -!	! - !
	1	1	1
	1	1	1

O = Corner monument restored.

CERTIFIED LAND CO	IRNFR REST	CRATION

Index No. E 19

History of original corner establishment:

Original subdivision by James L. Nowlin

June 2 - June 12th 1865

Birch 20 S47E 18 Lks Sugar 10 N36W 14 Lks

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 8" N40W 27.13 feet Maple 10" N85E 13.20 feet

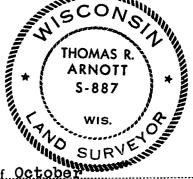

Dated at Crandon	, Wis., this 23rd	day of October	, 19 7.5
Signature & Rosson P. A.	Title Land Survey	o r Regist	
(County Surveyor, I	Registered Land Surveyor, or other duly at	thorized official)	-
Office of Register of Deeds, Count	y of Forest	, I hereby co	ertify that the within
instrument was filed in this office	for record on the 27th	day of October	19. 75
at 8:30 o'clock A. M.			

Eugene Statesoff.

(Register of Peds)

Document Number

108050





U.S. PUBLIC LAND SURVEY MONUMENT RECORD


NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added if necessary to conform with said requirements.

(a) Corner location: Township 36 North

Range 13 East

Town of Lincoln

Forest County, Wisconsin

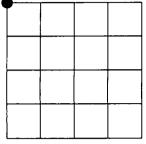

Section 12


(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablished through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

JUNE 1865 - JAMES KNOMLIN SET POST COMMON TO SECTIONS 1, 2, 11 AND 12: CEDAR 12, N35°E, 20 LINKS CEDAR 10, N75°W, 25 LINKS

1938 - C.E. WALKER SET 2" IRON PIPE, 5 FEET LONG WITH BRASS CAP.

OCTOBER 1, 2010 - I FOUND AND ACCEPTED A 2" DIAMETER IRON PIPE, CAPPED WITH BRASS AND STAMPED BY C.E. WALKER.

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

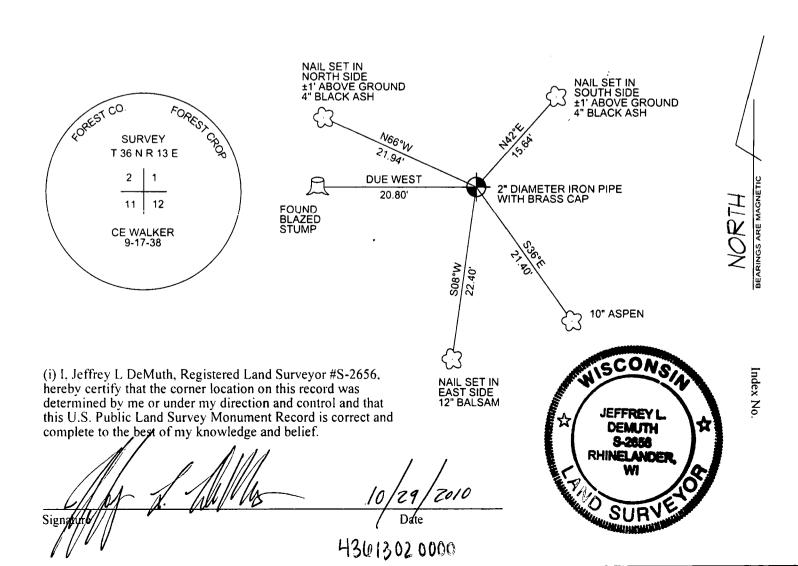

CERTIFIED	LAND	CORNER	RESTORATION
		~~···	

Index No. E 21

State of Wisconsin]	History of original corner_establishment:
County of Forest	ss.	Tristory of original corner astablishment.

Original subdivision by James L. Nowlin June 2 - June 12, 1865

Cedar 12 N35E 20 Lks. Cedar 10 N75W 25 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Resident witnesses:

location of this corner.

evidence of the Section

Herbert	Wagoner	
		•

Thomas R. Arnott do hereby

certify that on the 17th day of October 1975, I found

corner of sections 1, 2, 11, & 12


Township 36, North, Range

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

E..... Fourth Principal Meridian,

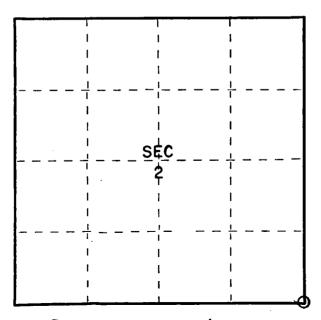


O = Corner monument restored.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by walker

Ties:

W. Birch 8" S80W 20.83 feet Balsam 4" S24E 25.02 feet

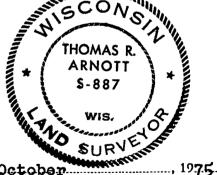

Jated at, VIS., tills		77
signature Thomas P. Dena H. Title I	and Surveyor Registration No. S-	887
(County Surveyor, Registered Land Survey	or, or other duly authorized official)	
Tor	est. I hereby certify that the	withi

(Register of Dergs)

Document Number

108051

= Corner monument restored.

State of Wisconsin

Thomas R. Arnott , do hereby

certify that on the _____day

of Nov., 19.76., I found evidence of the 1/4.

County of Forest

SS.

FRTIFIFD	LAND	CORNER	RESTORATION	

Index No. 2

History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865

 Cedar
 10
 N13E
 12 Lks.

 Cedar
 8
 S70W
 8 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

W. Birch 10 S73W 46.25 feet Poplar 10 S24E 36.38 feet

THOMAS R.

ARNOTT

S-887

WIS.

SURVENIENT

NOV.

Dated at Crandon , Wis., this 30 day of Nov. , 19 76.

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 30 day of Nov. , 19 76 at 1:30 o'clock ... A. M.

Lugen States of Description

Document Number

110637

Deputy

I Thom certify that of Septe evidence of corner of Septe 13-1 as described as described location of Resident with the september 1 septembe	the Sections 36 Li E, Follower moder and a new moder hereon to this corner.	rnott 10th 10th 10ff ection 1, 6, 7 urth Princip that from conument an perpetuate	ss. do hereby day 5, I found 2. & 12 North, Range al Meridian, this evidence d accessories the original
	•••••••••••	-	
	SE	c 2	
		 -	

= Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. E - 25

History of original corner establishment:

Aspen	12	N2OE	23 Lks.
Fir	10	N85W	10 Lks.
W. Birch	10	S5W	20 Lks.
W. Birch	1 0	S55E	23 Lks.


Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Ties:

Maple 8" N144W 15.00 feet
Maple 8" N74E 18.75 feet
Maple 8" S33W 4.00 feet

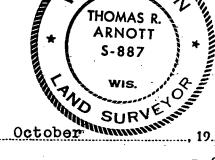

Dated at Crandon , Wis., this 28th day of October , 19 75

Signature I . A. H. Title Land Surveyor Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 28th day of October , 19 75

at 11 o'clock A. M.

Lugene States my (Register of Deeds)

Left monument set by Walker

Document Number

108075

,.....V V Dep



REGISTER'S OFFICE Forest County, Wis: Received for record this A.D., ock P.M. and





(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

WEST 1/4 CORNER:

INDEX NUMBER:_ G-1 **T36N** RANGE: R13E **SECTION:** TOWNSHIP:


TOWN/CITY/VILLAGE: TOWN OF LINCOLN

STATE: WISCONSIN

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858: ALFRED MILLARD, SET 1/4 SECTION POST

9" TAMARACK 5" TAMARACK N 72°E S 33°W 22 LINKS 35 LINKS

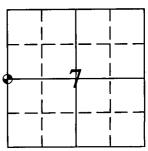

② = CORNER LOCATION

W 1/4 COR. SEC. 6 FND 1" I.P. W/ J. BLONDHEIM

LS 2800-008 CAP

NW COR. SEC. 7 CALCULATED POSITION

W 1/4 COR. SEC. 7 CALCULATED

SW COR. SEC. 7 FND 1.25

00 IP, UP±1

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING

NO113'29"W 2632.19' 40 CH (GLO)

NO113'29"W 2632.20' 7 CH (GLO)

N0113'29"W 2632.19' to CH (GLO)

SCALE 1"=2000"

THE CORNER LOCATION)


LEGEND

= SET 3" x 5' STAMPED ALUM, MONUMENT

= SET 5/8" REBAR W/ **CEC CAP**



SCALE 1' = 10'

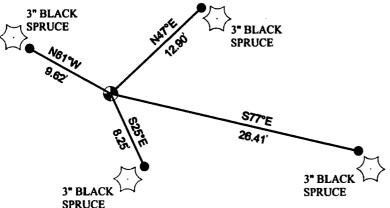

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CASEY J. PRIES PLS# S-3065, SET 3" x 5' STAMPED ALUMINUM MONUMENT USING SINGLE PROPORTIONATE METHODS.

SET THE FOLLOWING WITNESSES:

5/8" REBAR W/ CEC CAP 0.3' NW OF 3" BLACK SPRUCE N47°E 12.90' 5/8" REBAR W/ CEC CAP 0.5' NW OF 3" BLACK SPRUCE 26.41 **S77°E** 5/8" REBAR W/ CEC CAP 0.3' NE OF 3" BLACK SPRUCE S25°E 8.25 5/8" REBAR W/ CEC CAP 0.3' SE OF 3" BLACK SPRUCE N61°W 9.62

NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES. DISTANCES ARE MEASURED TO 5/8" REBAR WITH CEC CONTROL CAP.

CASEY J. **PRIES** S - 3065 TOWNSEND Wi SUR

SIGNATURE: (

7-24-15 DATE:

Index No. G-1

CASEY J. PRIES PLS S-3065 CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND

THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.




COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776


DRAWN:

FB 430, PG:79

JOB NO. DATE: 7/24/15

217628





U.S. PUBLIC LAND SURVEY MONUMENTATION RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

G-5 **EAST 1/4** INDEX NUMBER:_ CORNER: TOWNSHIP: T36N RANGE: R13E **SECTION:**

TOWN/CITY/VILLAGE: TOWN OF LINCOLN


STATE: WISCONSIN

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865: JAMES L. NOWLIN, SET 1/4 SECTION POST

8" CEDAR **6" SPRUCE** N30°W S5°E

30 LINKS

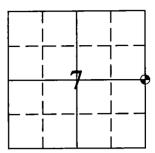

② = CORNER LOCATION

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

X CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS
(INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

POWER POLE #36137E11 11" TWIN **BALSAMS** 12.50 **LEGEND** = SET SURVEY SPIKE = SET DOUBLE **HEADED NAIL** 183,70 14" ASH SCALE: 1" = 80' @ HWY 32/55 **POWER POLE** #36137R1

NE COR. SEC. 7 1.25" IP W/ PRIES PLS 3065 CAP S0219'43"W 2627.05' 3 CH (GLO) E 1/4 COR. SEC 7 CALCULATED POSITION S0219'43"W 2627.05' O CH (GLO) SE COR. SEC 7 1.25" IP W/ PRIES PLS 3065 CAP SCALE 1"=2000"

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CASEY J. PRIES PLS# S-3065, SET SURVEY SPIKE USING SINGLE PROPORTIONATE METHODS. CORNER IS LOCATED ± 12.5 FEET EAST OF CENTERLINE OF HWY 32/55.

SET THE FOLLOWING WITNESSES:

11" TWIN BALSAMS 14" ASH N60°E 88.43' 77.15 S52°E S32°W POWER POLE #36137R1 163.10 **POWER POLE #36137E11** N29°W

NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES WITH DOUBLE HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HEADED NAIL.

SIGNATURE: Comp

DATE: 7-24-15

Index No. G-5

SCONS CASEY J. **PRIES** S - 3065 TOWNSEND SURV

I, <u>CASEY J. PRIES PLS S-3065</u>
CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.



COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776

DRAWN: **MJT**

FB 430, PG:73

DATE: 7/24/15

JOB NO. 15127-B

Thomas R. Arnott, do hereby

E ..., Fourth Principal Meridian,

certify that on the 12 day of 0ct 19.76, I found

as described hereon; and that from this evidence

I established a new monument and accessories

County of Forest

corner of sec. 9 & 10

36

SS.

....., North, Range

0 =	Corner	monument	restored
-----	--------	----------	----------

PERTIFIED	CORNER	RESTORATIO	N

Index No. G - 15

History of original corner establishment:

Original survey done by James L. Nowlin June, 2 * June, 12, 1865

Fir 7 N24E 50 Lks. Birch 12 N45W 10 Lks.

Description of corner evidence found:

2" iron pipe 5' long set by C.E.Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

 Poplar
 10
 North
 13.0½ feet

 Maple
 4
 \$73E
 25.70 feet

 W. Birch
 6
 \$47W
 22.19 feet

THOMAS R.
ARNOTT
S-887

WIS.
OF SURVENIENDED
NOV., 19.76...

Dated at Crandon , Wis., this 26 day of Nov. , 19.76.

Signature / home C. Kurs Title Surveyor Registration No.S-887

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 26 day of Nov. , 19...76. at 3:30° clock P. M.

EUGENE STATEZNY (Register of Deeds)

Document Number

110608

y Eilen Schmidt Deputy

County of....

Forest

corner of Sections 10 & 11

location of this corner.

Resident witnesses:

I Thomas R. Arnott do hereby certify that on the 20th day of October , 19.75, I found

evidence of the 1/4

as described hereon; and that from this evidence

I established a new monument and accessories as described hereon to perpetuate the original

Herbert Wagoner

36 , North, Range E., Fourth Principal Meridian,

SS.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Orginal subdivision by James L. Nowlin June 2 - June 12th 1865

25 Lks. 33 Lks Hemlock 16 20 Elm

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 8" S79E S15W 19.40 feet 19.55 feet Maple 8"

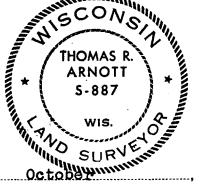

Dated at Crandon , Wis.	, this	23rd day of	October	, 19 <u>75</u> .
Signature V. Signature V. County Surveyor, Registered Land				
Office of Register of Deeds, County of	Forest		, I hereby o	ertify that the withi
instrument was filed in this office for record on	the	2 7th day d	of October	, 19 75 .
at 8:30 o'clock M.				108052

corner of sections 12 & Township, 36-....., North, Range Fourth Principal Meridian. as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original

Resident witnesses:

location of this corner.

Herbert Wagoner			
	•		
		-	

	- 5	·	
	l	i	l .
	' 	i I !	! . !
	¦ I	¦	
		l to	i i
	 	EC	;
	l • • •	F :	! ! .
	 	! !	. -
	·	·	
	, 		

O = Corner monument restored.

History of original corner establishment:

Tamarac	9	N72E	22 Lks.
Tamarac		S33W	35 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 6" N37E 14.85 Maple 6" S42E 5.75	feet Feet
--	--------------

October SURVENDER 28th Land Surveyor

	108076
at 11 o'clock M.	
instrument was filed in this office for record on the 28th	day of October 19 75
Office of Register of Deeds, County of Forest	
(County Surveyor, Registered Land Surveyor, or other duly author	orized official)

.Deputy

Document Number

COTICIED	LARID	CODNICD	RESTORATION
	LAINII	LURIVER	RESTORATION

		\sim	•
1	🚨		_
Index	NO.		

State of Wisconsin

County of Forest History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865

 Cedar
 8
 N22E
 5
 Lks.

 Cedar
 10
 N85W
 6
 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

B. Spruce 6 S56E 8.79 feet B. Spruce 4 N33W 13.48 feet

	HISCONO	May My
	THOMAS R.	V WIII
*	\$-887	**************************************
* LEAST	Wis.	X =
ARRIVA		9.55.55.55.55.55.55.55.55.55.55.55.55.55
	Monning	, 19

	1 1
 SEC 12	
12	
 ;	

I Thomas R. Arnott do hereby

certify that on the _____6 ____day

of Nov., 19.76., I found evidence of the 1/4 corner of Sec. 11 & 12

Township 36, North, Range 13 E, Fourth Principal Meridian, as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

location of this corner.


Resident witnesses:

O = Corner monument restored.

Dated at@randon	., Wis., this	40	day ot	VOV	, 19 <i>(</i> .D.
Signature Thomas Acrost (County Surveyor, Registere	Title	Surveyor		Regi	istration No. S=887
• • • • •					
Office of Register of Deeds, County of		Forest	·	, I hereby	certify that the within
instrument was filed in this office for reco	ord on the	2	day of	Nov.	
at 3:30 o'clock P. M.					
EUGENE STATEZNY	·		Document	Number	110609

By Cilen Ochmidt Deputy

SIGNATURE:

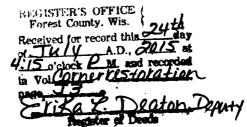

flegister of Dec	900
U.S. PUBLIC LAND SURVEY MO	
(AS REQUIRED BY S. A-E 7.08, WI CORNER: SOUTH 1/4 INDEX NUMBE	
SECTION: 7 TOWNSHIP: T36N RANGE: TOWN/CITY/VILLAGE: TOWN OF LINCOLN COUNTY: FOREST STATE: WISCONSIN	
HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TO OTHER EVIDENCE CONSIDERED:	RESTORATIONS FESTIMONIAL, OR
1865: JAMES L. NOWLIN, SET 1/4 CORNER POST 30" HEMLOCK N35°W 10 LINKS 12" CEDAR S25°W 15 LINKS	⊕ = CORNER LOCATION
CORNER WAS: (CHECK ALL THA	т арргу)
RESTORED THROUGH ACCEPTANCE OF REST	TORED THROUGH ACCEPTANCE OF DUND PERPETUATED LOCATION
DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND) AND COR	ISIDERED A LOST CORNER AND REESTABLISHED OUGH LOST CORNER PROPORTIONATE METHODS CLUDE A PLAN VIEW DRAWING SHOWING DISTANCES DIRECTIONS TO OTHER PUBLIC LAND SURVEY ENERS USED FOR PROPORTIONING AND DETERMINING CORNER LOCATION)
12" MAPLE STUMP W/4" TWIN MAPLE STUMPS ON NW SIDE	CORNER LOCATION
N38°E STIMBS	LE
N33°W	SCALE 1"=2000'
= SET 1.25" I.P. W/CAP	
T = SET DOUBLE HEADED NAIL S28°E 7.05	N89'39'44"E N89'39'44"E 2487.88' 2543.85' 39.12 CH (GL0) 40 CH (GL0) ★
● = SET 5/8" REBAR W/ CEC CAP 15" MAPLE STUMP W/2 STUMPS ATTACHED	S 1/4 COR. SEC. 7 CALCULATED
\$48°W\$44°W	SEC 7 POSITION FND 1.25"
± 208.00 44.56	OD IP, UP ± 1'
TO FENCE CORNER	SE COR. ————————————————————————————————————
4" MAPLES W	1.25" IP W/ PRIES PLS 3065 CAP
FENCE LINE SCALE: 1"=20"	
DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPET (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHA	
CASEY J. PRIES PLS# S-3065, SET 1.25" x 24" I.P. WITH PLASTIC PRIES P METHODS. CORNER IS LOCATED N48°E ±208' FROM FENCE CORNER (
SET THE FOLLOWING WITNESSES: 5/8" REBAR W/ CEC CAP 0.8' WEST OF TWIN 15" MAD E STIMBS	
TWIN 15" MAPLE STUMPS 5/8" REBAR W/ CEC CAP 0.7' NORTH OF 15" MAPLE STUMP	N38°E 7.03'
W/ TWO OTHER STUMPS ATTACHED	S28°E 7.05'
4" MAPLE (GROUP OF 3)	S44°W 44.56'
5/8" REBAR W/ CEC CAP 0.7' SE OF 12" MAPLE STUMP WITH TWIN 4" MAPLE STUMPS ON NW SIDE	N33°W 25.22' CASEY J. PRIES
NOTE: ALL WITNESS TREES HAVE CHEST AND STUMP BLAZES WITH HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HOR TO 5/8" REBAR WITH CEC CONTROL CAP. ALL EXISTING STUMPS BLAZES.	EADED NAIL TOWNSEND
	Wood and the second
SIGNATURE: DATE: 7-24-15	Index No. J-3

DATE: 7-24-15

I, <u>CASEY J. PRIES PLS S-3065</u>
CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT


AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776

DRAWN: MJT

FB 430, PG:72 DATE: 7/24/15 JOB NO. 15127-B

217630

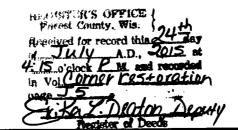

U.S. PUBLIC LAND SURVEY MONUMENTATION RECORD

(AS REQUIRED BY S. A-E 7.08, WI ADM. CODE)

SOUTHEAST CORNER:

INDEX NUMBER: J-5

TOWNSHIP:_ T36N SECTION: 7

RANGE: R13E

TOWN/CITY/VILLAGE: TOWN OF LINCOLN

COUNTY: FOREST


STATE: WISCONSIN

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865: JAMES L. NOWLIN, SET CORNER POST 20" HEMLOCK N 54°W 10 L 10 LINKS

12" CEDAR N 76°E

◆ = CORNER LOCATION

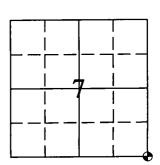

CORNER WAS: (CHECK ALL THAT APPLY)


RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION


RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

X CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING

THE CORNER LOCATION)



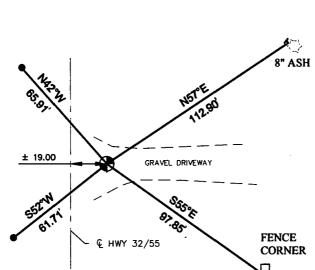

LEGEND

= SET 1.25" I.P. W/CAP

= SET DOUBLE **HEADED NAIL**

= 5/8" REBAR W/ CEC CAP

NOTE: SEE DETAIL ON PAGE 2 FOR PROPORTIONING AND METHODS USED TO DETERMINE CORNER LOCATION.

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

CASEY J. PRIES PLS# S-3065, SET 1.25" x 24" I.P. WITH PLASTIC PRIES PLS-3065 CAP USING DOUBLE PROPORTIONATE METHODS. CORNER IS LOCATED ± 19 FEET EAST OF CENTERLINE OF HWY 32/55.

SET THE FOLLOWING WITNESSES:

SCALE: 1"=50"

N57°E 8" ASH 112.90 FENCE CORNER 97.85' 61.71' S55°E S52°W 5/8" REBAR W/ CEC CAP 5/8" REBAR W/ CEC CAP N42°W 65.91

NOTE: WITNESS TREE HAS CHEST AND STUMP BLAZES WITH DOUBLE HEADED NAIL AT BASE. DISTANCES ARE MEASURED TO DOUBLE HEADED NAIL, OR TO 5/8" REBAR WITH CEC CONTROL CAP.

Page 1 of 2

CONS CASEY J. **PRIES** S - 3065 TOWNSEND W SURV

SIGNATURE:

DATE: 7-24-15 Index No. J-5

CASEY J. PRIES PLS S-3065

CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.




COLEMAN ENGINEERING COMPANY 635 CIRCLE DRIVE, IRON MOUNTAIN, MI 49801 PHONE: (906) 774-3440 FAX: (906) 774-7776

DRAWN: MJT

FB 430, PG:73

DATE: 7/24/15

JOB NO. 15127-B

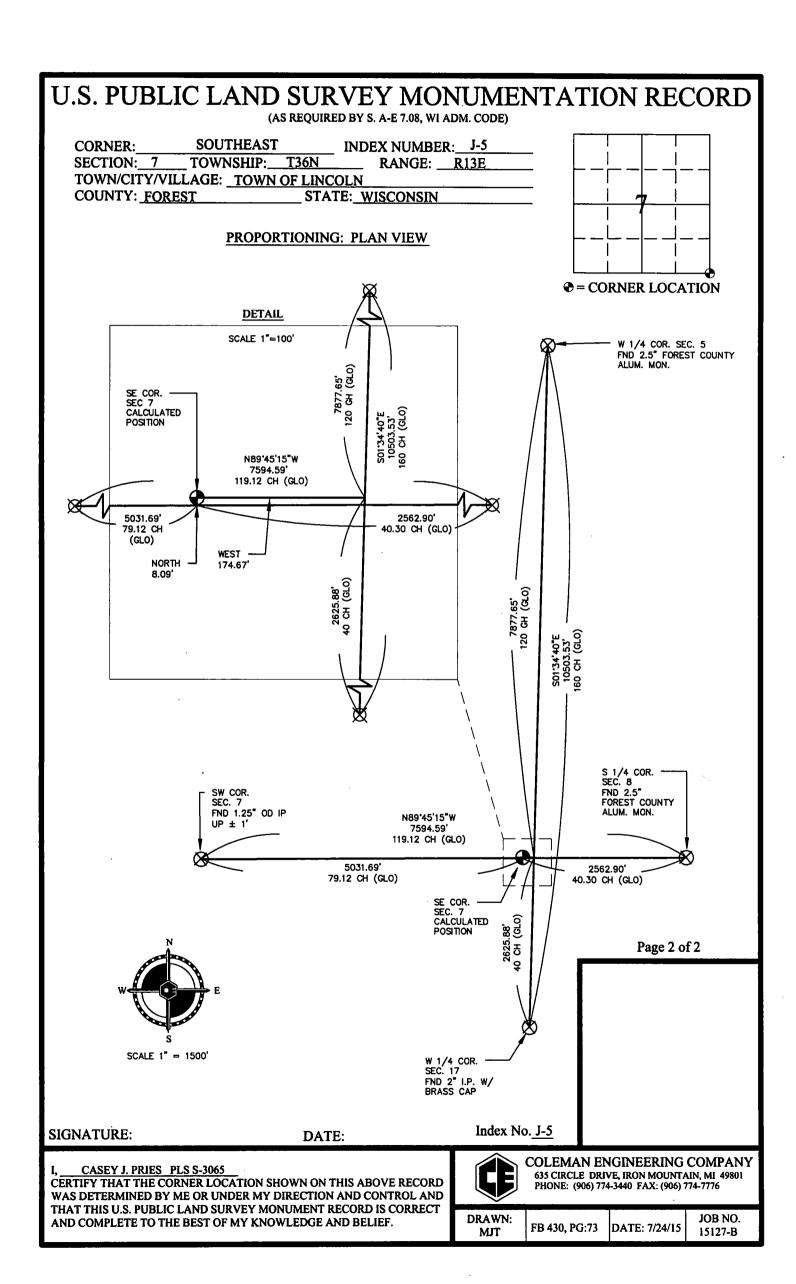

-9)	
2	
_	
₹.	
- 3	•
<u> </u>	
	Ţ
-	993
-	•
- T	A
	Θ
2	0.0
=	Ø
=	
=	(C)
3	•
3 3 5	
7	
3	
=	

State	of Wisconsii		ks.		
County of	Forest		ю.		
Township 13 E	omas Fogarty n the6th July1/4 sections 8 & 1 36, Fourti I hereon; and the	, North , North n Principle Me	, Range		
l established	l a new monum I hereon to pen	ent and acces	ssories		
Resident wit	nesses:				
Kory Rentmeester, Brad Nelson					
<u>N</u> : <u>584</u>	ty Coordinates 420.241 (feet) 368.992 (feet)		<u> </u>		
	Ψ				
	SEC	,			
	17	 			

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION				Index No J _ 7
History of original	comer	establishm	ent:	
1865 - James L. I Spruce Spruce	Nowlin s 6 4	et original South N9W	comer post and mad 20 Lks. 35 Lks.	de the following B.T.'s:
1976 - Thomas R He set the	. Arnott followir	found wood	d post and replaced	it with a new Forest County aluminum monument.
Spruce Spruce Spruce	6 6 6	N56E S24W S39E	22.97 feet 36.32 feet 14.26 feet	
2005 - I found a I Set the fo			ninum monument an	nd set the following ties:
Rebar 5/8			N27°45'14 " E	19.20 feet Q
Rebar 5/8			N51°51'54"W	10.50 feet 30.000 feet
Rebar 5/8 Rebar 5/8			S35°42'34 " E S29°09'14 " W	23.72 feet
N REBAR	***************************************	RUCE	*4" SPRUCE REBAR *4" SPRUCE *4" SPRUCE REBAR	μ_{l}
Dated at	randon (County	R. Togo Surveyor/Re	, · · · · · · · · · · · · · · · · · · ·	17thday ofNovember, 20 05
Office of Register of				thereby certify that the within
•	d in this	office for n	ecord on the	18th_day of November, 2005

O = Corner monument restored.

State of Wisconsin

SS.

CERTIFIED I A	ND CORNER	RESTORATION

Index No.

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

Spruce 6 South 20 Lks. Spruce 4 N9W 35 Lks.

Description of corner evidence found:

Wood post found



Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced wood post with a new Forest County aluminum monument

Ties:

Spruce	6	N56E	22.97 feet
Spruce	6	S39E	14.26 feet 36.32 feet
Spruce	6	S24W	36.32 feet

Dated at	Crandon	, Wis., this	9th	day of J	anuary	19. 76
Signature	County Surveyor, Regis	Title	Surveyo)? authorized official	Registi	ration No. S-887
Office of Regis	ster of Deeds, County o	frecord on the	Forest	day of	, I hereby ce January	rtify that the withir
at 11 o'cl	lock A. M. State (Register of De				v	108532
P	(Register of Do	f ^{ls)}	Deputy			

ARNOTT 5-887

..... Document Number

110610

State of Wisconsin

= Corner monument restored.

County of.....

Forest

SS.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

O = Corner monument restored.

State of Wisconsin

County of Forest

SS.

CERTIFIED 14	IND	CORNER	RESTORATION

History of original corner establishment:

June 2- June12th 1865 Original Subdivision by James L. Nowlin

Birch 22 N26W 50 Lks Hemlock 25 S64E 22 Lks

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

17.15 feet White Spruce 8" White Spruce 10" S6E

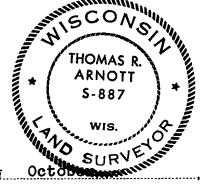

Dated at Chandon	Wis., this	23rd day of	Oct	CODE	mini ¹ , 19.75	
Signature / homas E. Alica	Title Land	Surveyor	•	Regis	stration No. S= 887	
(County Surveyor, Registered	l Land Surveyor, or	other duly authorized	d official)			
Office of Register of Deeds, County of instrument was filed in this office for reco	Forest	2 7th da	v of	, I hereby o	certify that the within	n
at 8:30 o'clock M.			,			
Engene States	Ц	Doc	ument	Number	108 053	
(Register of Deeds)	A .					

State of Wisconsin

Thomas R. Arnott do hereby

certify that on the 10 Sept. day of Sept. , 1975 , I found evidence of the 1/4 corner of Sec. 11 & 1/4

Township 36 , North, Range 13 E ... Fourth Principal M ...

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

Herbert Wagoner

County of Forest

location of this corner.

Resident witnesses:

SS.

CERTIFIED LAND CORNER RESTORATION

Index No.

History of original corner establishment:

Original survey done by James L. Nowlin June 2 - June 12, 1865 Hemlock 9 N80E 10 Lks. Lind 7 N8W 10 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left Monument set by Walker

Ties:

Maple 0 500E 19.25 16	Maple Maple	6 6	NllE S80E	23.60 fee
-----------------------	----------------	--------	--------------	-----------

THOMAS R. ARNOTT S-887

WIS. OF MANAGEMENT S-887

		Addition of the second
Dated at, Wis., this	day of	19 <u>76</u>
Signature Thomas Rugal Title	Surveyor	Registration No. S-887
(County Surveyor, Registered Land Surveyo	er, or other duly authorized official	1)
Office of Register of Deeds, County of Forest instrument was filed in this office for record on the at 3:30 o'clock P. M.	26 day of	, I hereby certify that the within Nov
EUGENE STATEZNY (Register of Deeds)	Document	Number 110611
Bu Lilen Schmitt	Deputy	

Index No. 21

History of original corner establishment:

Original subdivision by James L. Nowlin

June 2 - June 12, 1865

Lind Birch

20 **1**5 N23W N29E 20 Lks. 35 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1936.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 8"
Maple 6"

N14E 19987 feet S63W 20.40 feet N62W 10.40 feet THOMAS R.
ARNOTT
S-887
WIS.
October

Dated at Crandon		28 t h	day of	October	19 75
ignature Thomas R. Ru					
ignature / Tomas C. Kl.	Title La	and Surve	yor	Regist	tration No. S-887

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 28th day of October , 1975 at 11 o'clock A. M.

M.

(Register of Teeds)

Document Number

108077

.....Deputy

Thomas R. Arnott dertify that on the 21 st of October 19 77 vidence of the 1/4 orner of sections 12 & 13 Cownship 36 North Principal M is described hereon; and that from this described hereon to perpetuate the ocation of this corner. Resident witnesses:	th, I Mer
ertify that on the 21 st of October , 19 77. vidence of the 1/4 orner of sections 12 & 13 Township 36 , North 13 E , Fourth Principal M s described hereon; and that from this established a new monument and ac s described hereon to perpetuate the ocation of this corner. Resident witnesses:	th, I Mer
ertify that on the 21 st of October , 19 77. vidence of the 1/4 orner of sections 12 & 13 Township 36 , North 13 E , Fourth Principal M s described hereon; and that from this established a new monument and ac s described hereon to perpetuate the ocation of this corner. Resident witnesses:	th, I Mer
orner of sections 12 & 13 Cownship 36 , North 13 E , Fourth Principal M s described hereon; and that from this established a new monument and acts described hereon to perpetuate the ocation of this corner. Resident witnesses:	th, i Mer evi
orner of sections 12 & 13 Cownship 36 , North 13 E , Fourth Principal M s described hereon; and that from this established a new monument and acts described hereon to perpetuate the ocation of this corner. Resident witnesses:	th, i Mer evi
Township	th, I Mer evi
s described hereon; and that from this established a new monument and ac s described hereon to perpetuate the ocation of this corner. Resident witnesses:	evi
established a new monument and ac s described hereon to perpetuate the ocation of this corner. Resident witnesses:	cces
Resident witnesses:	e or
Resident witnesses:	
·	
S+C	
S+C	
S+C	
SFC	
1 10 1	
	_
1.1	
i '	
	- -
	_
i j l	
i i i	
, , , , , , , , , , , , , , , , , , ,	

O = Corner monument restored.

PEDTICIEN	LAND	CODNED	RESTORATION
CKIILIC	LAND	CORNER	RESTURATION

Index No. 23

History of original corner establishment:

Original survey by James: L. Nowlin 2 June - 12 June, 1865

Cedar 12 N54E 20 1ks. Birch 10 N32W 15 1ks.

Description of corner evidence found:


2th iron pipe 5' long with brass cap set by C.E. Walker in 1938. Also found old wood post.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

Cedar 8 S40E 23.49 feet Cedar 6 S25W 13.84 feet

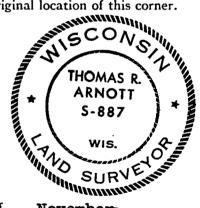

Dated at Crandon	, Wis., this	3 .rd	day of	November	, 19. 37
Signature Thomas R. Accounty Surveyor, Reg	\ //	-			• •
Office of Register of Deeds, County instrument was filed in this office for	of	Forest	day of	, I hereby certify	that the within
at // o'clock M			Dan Wa	1127	· <u> </u>

By.....Deputy

(Register of Deeds)

	CERTIFIED LAND	CORNER	PESTOPATION
7		CURINER	KESTUKATIUN

Index No. J 25

History of original corner establishment:

Spruce 5 NLE 32 Lks. Spruce 8 N30W 24 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Cedar	· 6 ^{tt}	NLIW	14.78 feet
Spruce	10"	N76E	29.35 feet 31.85 feet
Cedar	12"	S17 W	31.85 feet

THOMAS R.
ARNOTT
5-887
WIS.
OCTOBER

SURVENIENT

OCTOBER

WIS.
OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCTOBER

OCT

Dated at Crandon ,Wis., this 28th	day of October 19 75
Signature V. Acut Title Land Surva (County Surveyor, Registered Land Surveyor, or other duly	Vor Registration NoS-887
Office of Register of Deeds, County of Forest instrument was filed in this office for record on the 28th	day of October 19.75
Lugene Statesne	Document Number 108078

Deputy

N. C. MILLEN CO., BILWA		 			······································		
CON MYOL		 		 		 - -	
		 	SE				
		 - - ·		- 		† – · !	-

State of Wisconsin

Forest

I Thomas R. Arnott do hereby

certify that on the 5th day of January , 19.76, I found

evidence of the 1/4

corner of sections 17 & 18

Township.........., North, Range 13 E Fourth Principal Meridian,

as described hereon; and that from this evidence I established a new monument and accessories

as described hereon to perpetuate the original

Hertbert Wagoner

County of.....

location of this corner.

Resident witnesses:

· SS.

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

25 Lks. 30 Lks. \$33W N83E 10 Tamarac Tamarac 20

Description of corner evidence found:

25 Lks: Found original BT stump S33W



Description of monument and accessories I established to perpetuate the original location of this corner.

Set 21 iron pipe 4 long with brass cap N33E 16.5 feet from Original stump Ties:

Power	Pole:	(3613-18R21)	NLW	91.56 feet
Cedar		8	S50W.	51.16 feet
Spruce	•	5	N72W	44.40 feet

Dated at	Crandon	, Wis., this	9th	day of	January	, 19. 76
Signature.	us Henry	Title	Survey	or	Registra	tion NoS-887
(C	County Surveyor, Regis	tered Land Surveyor	, or other duly	y authorized om	icial)	
Office of Register o	f Deeds, County of		Forest	, ,	, I hereby cert	ify that the within
Office of Register o	d in this office for r	ecord on the		9 th $_{ m day\ of}$	January	, 19 7 6
at11o'clock						
Kugen	77	gnef		- Docume	n n t Number	108534
//	(Register of De	49 °) /1	•			

Jocamo

State of Wisconsin	} ss.
county of Forest	
Thomas Fogarty	, do hereb
ertify that on the $__ 7 \frac{\Pi}{}$	da;
ertify that on the7 <u>th</u> _ fJuly	, 2005, I found
vidence of the1/4	<u> </u>
omer of <u>sections 17 & 18</u>	
ownship <u>36</u>	
13 E, Fourth P	rinciple Meridian
s described hereon; and that	
established a new monument	
s described hereon to perpet	uate the original
cation of this comer.	

Kory Rentmeester, Brad Nelson	_
Forest County Coordinates:	
N: 581835.266 (feet)	
E: 835863.372 (feet)	_

Resident witnesses:

) — —		EC	
	1	7	

O = Corner monument restored.

CERTI	FIED LAN	ID CORN	IER REST	ORATIO	ON			Index No. L - 5	
Histor	y of original	comer est	ablishment:						
1865 -	James L. N Tamarac Tamarac	lowlin set (10 20	original com S33W N83E	er post a 25 Lks 30 Lks		le the following	j B.T.'s:		
1976 -	Thomas R. original stu Power pole Cedar Spruce	mp and se	t the followi BR1) N S	3T stump ng tles: V4W 350W 172W	91.56	feet feet	I feet long with	i brass cap N33E 16.5 feet from	1
2005	- I found a 2 Set the foll			cap and p	ower p	ole (3613 - 18	R1) 91 feet to	the North.	
	Rebar 5/8	•		N68°10'0	9 " E	106.29 feet			
	Rebar 5/8	•	;	S68°49'46	8 " E	120.18 feet			i
	Rebar 5/8	•		S2°40'04'	_	168.25 feet			,
	Rebar 5/8	•		N2°59'06'	"W	91.05 feet			,
POWER	POLE (3613		▲ NØ2-	59-06¥	POWER	POLE (3613-1:	BRI) July SCON	SINAMA	
REBAR	168.2	5,	91	.05′	REBAR		THOMA FOGAF S-175		•

POWER POLE (3613-18R2)	i	——1 .8 ′	Will SCONS/Non	
S02-40-04E	NØ2-59-06W	EBAR	The Witter	
168.25	91.05′ R	LOAN	THOMAS R.	Y.
2.45'	// \		FOGAHIY	ሥነ
	70 0 55		S-1752	•
HIGHWAY	32 & 55		Signed Day, 14. 1	
	. 1.		Wis.	
	\$		MILLO SUBJECTION	
T.P. W/ BRASS CAP	8 6		100	
(52's WEST OF HWYE)	` \}. \\ \	ZC>	17 1111	
	→		"	
REBAR •	●REBAR 20:		•	
م	A			
10	₩ 11* P	ΩPI ΔR		
11° POPLAR 🎇		Or LEWI		

Dated at Crandon	, Wis., this		y of November	, 20 <u>.05</u>
Signature Thomas R. F. (County Surve	Title nyo/, Registered Land Surveyo	Registered Lan	<u>d Surveyor</u> Regist ^{æd official)}	ration No. <u>S-1752</u>
Office of Register of Deeds, Con	•	t	, I hereby	certify that the within
instrument was filed in this office	e for record on the	18 11	day of Novembe	<u> </u>
at $\frac{2:40}{}$ o'clock $\frac{P}{}$	M.			
Kay Swanson, D	eputy	· — — -		
// (Regis	tter of Deeds)			

189291

CERTIFIED LA	ND CORNER	RESTORATION

1865 - James L. Nowlin set original corner post and made the following B.T.'s: Spruce 10 N64E 20 Lks.

18 Lks.

27.73 feet

33.56 feet

S31°09'08"W

S31°05'45"E

N30°27'00"E

2005 - I found a Forest County aluminum monument and all of Arnott's B.T. stumps. Set the following ties:

1976 - Thomas R. Arnott found 1.5" iron pipe and wood post. He replaced these with a new Forest County aluminum monument and set the following ties:

63.97 feet

53.05 feet

49.35 feet

Milliani

5.95 feet (BT found) 4.73 feet

S64W

W8M

N2E

East

S6W

Index No	<u>9</u>
----------	----------

State of Wisconsin County of Forest	
IThomas Fogarty, do here certify that on the13 th do f, 2005, I four evidence of the1/4, 2005, I four evidence of the1/4	ge , ce s
Resident witnesses: Kory Rentmeester, Brad Nelson Forest County Coordinates:N: _581844.574 (feet)E: 841340.184 (feet)	
SEC	

O = Comer monument restored.

Rebar 5/8"	N37°51'19"W	56.35 feet 111115C	ONS MANAGEMENT OF THE PROPERTY
10' DEAD CONIFEROUS TREE		III. W.	7
* ** *** **** **** **** **** **** ****	" DEAD CONIFEROUS TREE	E THON	MAS R.
P		FOG	ARTY :
REBAR () REBAR	}	THOM FOG	ر کار کی جا
		🗒 🚶 Gree	n Bay, in the state of the stat
			Vis(∅, 📭 ()
2 2 2		May C	Manual Comments
FORE	ST COUNTY ALUMINUM MO	NUMENT	Annin'i DS
N		1/100	1111
6 A 5 9		•	[\
9.00			· 1
めため できたべ できたべ PREBA	.D		
REBAR ● • REBA	IN .		
in the same of the			
8' DOUBLE MAPLE 🗱 🌃	S" TAMARAC		
	-		
Dated at Crandon	, Wis., this <u>1</u>	7th day of	<u>November</u> 20 <u>05</u>
	<i>,</i>	•	
Signature / from K. F. County Surveyor	Registered Land Surveyor of	Registered Land Surveyor other duly authorized official)	Pr Registration No. S-1752
· · · · · · · · · · · · · · · · · · ·		du ou ou daily add to the control of	
Office of Register of Deeds, Coun			, I hereby certify that the within
instrument was filed in this office t	for record on the	$\angle \underline{\mathcal{S}} \stackrel{\cancel{+h}}{=} \underline{\hspace{0.2cm}}$ day of	November 2005
at <u>2 4 0</u> o'clock			
	•		
Kay Sevanson, A	Deputy		
(Régister	of Deeds)		
-	v		

Histon	of	original	comer	establi	shment
	,				

8

12

10

12

6

Spruce Spruce

Spruce

Spruce Spruce

Spruce

Rebar 5/8"

Rebar 5/8"

Rebar 5/8"

	ŀ		
	ł		
	L		
•	۱		
	i		
	I		
	I		
	1		
	ı		
	ı		
	ŧ		

COTICICO	I A SID		RESTORATION
	I AINII	LINKINER	REVIDEATION

Index	No.	1	 ĸ.	,(ļ

History of original corner establishment:

Original	subdivision	bу	James	Nowlin	June	2	-	June	12,	1865
-----------------	-------------	----	-------	--------	------	---	---	------	-----	------

Spruce 10 N6LE 20 Lks. s6Liw 18 Lks. Spruce

Description of corner evidence found:

12" iron pipe found Wood post found BT found on Spruce 12

N8W

5.95 feet



Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced iron pipe and wood post with a new Forest County aluminum monument Ties:

Spruce	12	n8w	5.95 feet (BT found)
Spruce	10	N2E	4.73 feet
Spruce	12	East	27.73 feet
Spruce	6	s6W	33.56 feet

Dated at Crandon	, Wis., this	.9th	day of	January	. 1 9 76
Signature County Surveyor, Regis	TitleSurvey	ror other duly a	uthorized offici	Registr	ation Nos_887
Office of Register of Deeds, County of instrument was filed in this office for r					
at 11 o'clock A. M. Lugene Elatip (Register of De	ny eds)		Document	t Number	108535

O = Corner monument restored.

State of Wisconsin

Thomas R. Arnott do hereby certify that on the 31st day of December, 19.75, I found

evidence of the 1/4

as described hereon; and that from this evidence I established a new monument and accessories

as described hereon to perpetuate the original

Herbert Wagoner

...., Fourth Principal Meridian,

corner of sections 16 & 17

County of Forest

location of this corner.

Resident witnesses:

SS.


State	of Wisconsin	} ss
	~	:د م

County of Forest

I Thomas R. Arnott , do hereby certify that on the 9th day of September , 19.75, I found evidence of the 1/4 corner of sections 15 & 16 Township. 36, North, Range 13 E Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

Herbert	Wagoner	 	
	_		
	••••		

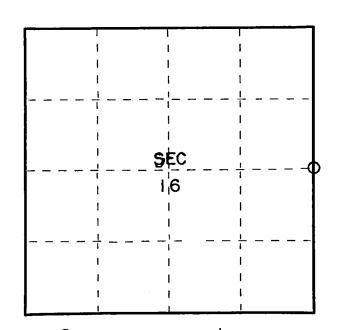

= Corner monument restored.

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

12 12 Lks. Sugar 12 N20E Fir 13 Lks.

Description of corner evidence found:

2" iron pipe with brass capp set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this trunger

Left monument set by Walker

Ties:

22.85 feet 6.65 feet 18" S6LE Maple MOSN Maple 20"

Dated at Crandon , Wis., this 11th day of November , 1975 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 11th day of November 19.75... ________O'clock 108206

Deputy

(Register of Docks)

Document Number

History of original corner establishment:

State of Wisconsin

O = Corner monument restored.

Original survey by James L. Nowlin June 2 - June 12, 1865

2" iron pipe 5' long with brass cap set by C.E. WAlker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.




ated at	Crandon	, Wis., this	30	day of	Nov	
ے gnature	Thomas Acros (County Surveyor, Regist	Title	Surveyo:	P authorized official	Regi)	stration Nos.88
ffice of Ro	egister of Deeds, County of was filed in this office for r	ecord on the	Porest	day of	, I hereby	certify that the wit
	o'clock M.			Document		110638
, 0	(Register of Do	dis)	Deputy			

State of Wisconsin County of Forest ss.

I. I. R. Ritter, do hereby certify that on the 7th to 15th day of October, 19 18, I found evidence of the Gov't & Sub-Division corner of Section 19

Township. 36, North, Range 13 East, Fourth, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

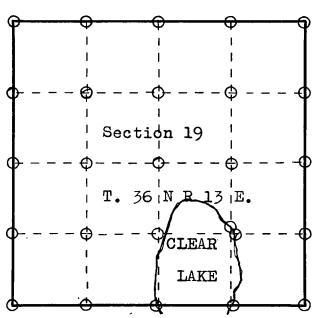

O = Corner monument restored.

History of original corner establishment:

ORIGINAL DOCUMENT #33370 Filed Oct 7, 1918 at 10 A.M. by E O Woodbury

Description of corner evidence found:

It assumed that Mr. Ritter found evidence of the original Gov't Stakes, which were of wood, and it appears that he replaced them with stakes of Pipe as noted in the notes he made of this survey.

ORIGINAL DOCUMENT IS ATTACHED TO THE BACK OF THIS PAGE.

Description of monument and accessories I established to perpetuate the original location of this corner.

Dated at	Crando	n, v	Wis., this	165	day of	October	1918	
Signature	I R. (County	Ritter Surveyor, Registered	Title Land Surveyo	County or, or other dul	Surveyor y authorized official	Registrati	on NoForest	Co.
instrument w	vas filed in t	eds, County ofhis office for record	d on the E. O. W	oodbury,	day of the then	October Register o	19.18	đ
ANNA PE	TERSON	28th di	ay of d	anuary,	.1965. Vol	l. 1 of Sur	veys has be	en
By Kan	(U. Un	fee	years be	andomi	y a few or	f the pages	survive to	

P.fe.		3'6	Var. 16 ft.	c 3 / 1	North 9	Pepe	3	"PNar.	3° ′	- Gi
		39.60 38.60	2.60 LA	Z ·			40	Oleks	ø.	2
	7 F		_		0					ο.
		5			اوي					9
24 0 g		.01	1.1	·	Var	. λ •			•	Var
Pipe	Var.		90 ,	. —	<u> </u>	<u> </u>	Var	8. P.	<u>, </u>	9.6
7 O	•	, 2			3	,		"3		12
					,		•			0
	•	Val		:				Var		-
						,				,
Pihi		: (Var. 3	0 ,	B	γ.		Var.	g : ,	910
<i>i</i> .		3"			3		(8		
			Yrr •	*				5 1		- 1
	•				0	· ·				0
V 4		653			ar.			· Pope	· .	ar.
4.4		. 01	Riff	•	> 6	h	R. A.	e da	, \$.a.	A
00	Var.	5	Pg 0 /		3.		Var.	1 2 g Pi	, Al	20
11	•					CLE	ar			41.4
		Var				LAK	re	Var.	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	07
.'					C				* \$ \bar{\bar{\pi}}	
		<u> </u>		•		•				ŀ
Pipe		3:00	Nar. 3 Rr. 56 f.	· ,	<u>_e</u> ''@	Pipe_	2"A	Var.	90 1	aon
Plat of Se						orth Rang	. 13	of A Prin	inal Maridi	an Caala
Plat of Se						orth, Rang	. 13	of 4 Prince	cipal Meridi	an Sca
		The fig	gures in re	d ink are	the le	ngths of the	ne lines as	stated in t	he field-note	es of the
rnment si	-	_	,		т ъс	• • •	·			,
			35 . 3.		T 3.0					•

DESCRIPTION

OF SECTION, QUARTER SECTION AND QUARTER QUARTER SECTION CO

GOVERNMENT CORNERS	Bearing Trees	In. Dia.	Courses they bear	Links Distant	Bearing Trees	In. Die.	Courres they bear	Links Distant	Bearing Trees	In. Dia.	Courses they bear	Links Distant	Bes Tr
No. 1. N. W. Sec. Cor. indentified,	Pipe	" و	West	3311	Pile	9"	Bush	3311					
2. N. E. Sec. Cor. indentified,	11 .	1	1 ~ .	ا ا	1.0	1	10	,	li .				
3. S. E. Sec. Cor. indentified,	Pipe	1	1.	' !	2/.	٠,		1				'	
4. S. W. Sec. Cor. indentified,	Pipe	1	ا ما		۱ ۵ .	į .	بدأ	′					
5. N. ¼ Sec. Cor. indentified,	-'	11		33 ft.			<i>n</i>	,			N		
6. E. ¼ Sec. Cor. indentified,	Pipe	. "	ا ما		1 ~		ا ما	'					
7. S. ¼ Sec. Cor. indentified,	/		1 /	33ft.	1 -/	ł	'	/					
8. W. 1/4 Sec. Cor. indentified,				33 ft.					, a				
Subdivision Corners	/	-						,					
No. 1. Center ¼ Sec. Cor.	Pipe	21"	North	33 ft.	Pipe	21	South	334				! : a	
2. North 1/8s N. W. qr.,	11 -/		l .	33/h	1 /-		اما	, ,					'
3. East 1/8 N. W. qr.,	Pipe	22	East	33 ft.	Pipe	$2\frac{\mathcal{E}''}{2}$	Okest.	23 ft.			•		
4. South 1/8s N. W. qr.,	Pipe	25	North	33 ft.	Pipe	24"	South	33 ft.					
5. West 1/8s N. W. qr.,	Pipe	2"	Okest	33 ft.	Pipe.	2"	East	33 pt			 	ι,	
6. Center 1/16s N. W. qr.,	Pipe	25"	South	33-JA	Pipe	22	North	33 ft					
7. North 1/8s N. E. qr.,	Pipe	3"	North	334	Pipi	9"	South	33 fh	_				
8. East 1/8 s N. E. qr.,	Pipe	25	Okest	33ft.	lipi	2"	East	33-U					
9. South 1/8s N. E. qr.,	Pife	25	North	33ft.	Pipe.	22"	South	33 ft.					
10. Center 1/16s N. E. qr.,	Pipe	22	North	33-11.	Pipe.	22"	South	33 ft.			-	٠	
11. East 1/8 S. E. qr.,	Pipe	2"	Okest	33/1	Pipe	9"	East	33ft.		, .	!		
12. South 1/8 S. E. qr.,	Pipe	2"		33.fh			South	33 ft	د		r =.	-	
13. West 1/8 S. E. qr.,	Pipe	20	North	33 ft.	Pipe.	22	South	33-11		r ,,			
9 Meander Posts 14. Center 1/16s S. E. gr.,	PIL	22	North	6ft		22	South	6/1	Ripe	25"	North	6 ft.	Rij
15. South 1/8s S. W. qr.,	Pipe	23	North	33 fr	Pipe	25	South	33/1.					
16. West 1/8 S. W. qr.,	Pipe	2/2	Okest	33 ft.	Pipe	2至	Cears	33/1.	-				
	Pipe	25	North	33 ft.	Pife	22	South	33 f.f.			·		
erioria. Granda e de la companya de la companya de la companya de la companya de la companya de la companya de la compa Granda e de la companya de la companya de la companya de la companya de la companya de la companya de la comp				·								•	
· · · · · · · · · · · · · · · · · · ·								v.: ∉	:			.	
NAMES OF SWORN ASSISTANTS													
CHAINMEN					····	LAG!							AXM
Okm Vanzi Walter Korth	le.		0	and	ren AXMAN		lett	ing	er	2	Cur	de	yo
Cernest Vang	ile		Wı	udley n Oman	Leadi rro		j aù		-	الله الله	Dar	~	L
en en e n en			108	an Dav	/15		٠				- 1		
•			1										

FOREST	COUNTY, WIS. (SS
I_{e}	ceived for record the Z_dan
cf	A. D. 19/8, at 10
o'clock	9 M., ond recorded in Vel.
	Dunys page 18 of
-	ED 1100 day
en en sam de En es	- RECEIVER
- 10	19-36-13-

134722

State of Wisconsin County of Forest ss.
County of Forest
I Kim H Pritzlaff , do hereby certify that on the 17th day
certify that on the 17th day of February , 19 88, I found
evidence of the Quarter
corner of Sections 18 & 19
Township
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.
Resident witnesses:
Marke E Teuteberg, RLS
Harry Smith

Т 3	6 N	R I3E
	SEC.	18
	SEC.	19

Corner monument restored.

PRITZLAFF

History of original corner establishment:

In 1865 James Nowlin, contract surveyor with the government, set this corner using a wood post and the following bearing trees: Spruce 10" Show 16 links Hemlock 8" North 13 links

In 1918 I.R. Ritter resurveyed Section 19 and restores this corner using a 3" iron pipe and two 21/21 iron pipe set east and west as accessories.

Description of corner evidence found:

I located a large diameter iron pipe just west of the gravel roadway in a fence intersection to the west. 33 feet to the west I also found a 22" iron pipe as Ritter's accessory. I accepted the iron pipe on the west edge of the road bed as Ritter's p rpetuation which fit his record distance to the east within 8 feet. I kept the iron pipe as the actual corner and tied it in with the a cessories shown below.

Description of monument and accessories I established to perpetuate the original location of this corner 1259



43613180020 Set an 8 penny aluminum spike in the two trees shown along with a 6 foot steel sign post and a 1"x 24" iron pipe in the fence line as shown for accessories.

Wis., this 19th day of February, 19.88... Dated at Oconto Falls

Title Registered Land Surveyor Registration No. 1259 (County Surveyor Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 26th day of February, 1988 o'clock A. M.

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

FOUND PERPETUATED LOCATION

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO.

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

2/19/80 Date Signature

MISCONS Affix Land Surveyor Scal KIM H. PRITZLAFF S-1259 Wis. WO SURVE

cument Number	189290
2	

		CERTIFIED LAND CORNER RESTORATION
State of Wisconsin	١	History of original corner establishment:
	3 88.	

State County of _	of Wisc		}	8 .	
i The certify that configured of evidence of comer of Township 13 E as described as described location of the certification of the certification in the certification of the certi	d hereon; danew m	Fourth Prand that nonument to perpet	, North, rinciple Me from this e and acces	ridian, vidence ssories	
Resident wit	nesses:				
Kory Re	ent <u>meest</u> e	er, B <u>rad N</u>	e <u>lson</u> _		
Forest Cour	nty Coordi	inates:			
				8.	TAMARAC
	SI	EC	 		FI
	1	7			

 SEC	
17	
 ! !	 !

History of original or	omer establishment:				
1865 - James L. No Spruce Spruce	6 N55W 2	r post and made the folio 20 Lks. 5 Lks.	owing B.T.'s:		
1918 - I. R. Ritter re Iron Pipe 2" Iron Pipe 2"	East 33	vith 2" Iron pipe and set t feet feet	the following ties:		
Found 2" refe	erence pipe 32.91 fee (3613 - 20W7) N	e 30" below ground and t east of comer and set to 42E 123.13 feet 75E 81.35 feet	set new Forest Count he following ties:	ty aluminum monument flush.	
Found power		monument and remnant 123 feet Northeast of con nce pipe) N89°52'0 \$19°01'5 \$87°34'0	mer and set the follow 00"E 33.01 feet 56"E 31.54 feet	ring ties:	
N 13.5 S87-34- 69.09 REBAR FOREST COUNTY ALUMINUM (33'2 EAST OF R	H I CHWAY	POWER POLE POWER POLE POWER POLE POWER POLE	DE OLD 2º PIPE)	THOMAS R. FOGARTY S-1752 Green Bay Wis.	721013 (8000)
Signature Thrus	County Surveyor, Registere Deeds, County of on this office for record	Format		November, 20 05	
. 0	son, Depute (Register of Deeds)	<u>-</u>	-		

Index No. N - 5

43413 18 0000

State of Wisconsin

Thomas R. Arnott

County of Forest

SS.

....., do hereby

= Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No.

THOMAS R

ARNOTT S-887

43613180003

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

Spruce 20 Lks. 15 Lks. Spruce

Remonumented in Oct. 1918 by I.R. Ritter with a 2" iron pipe with 2" iron pipe reference pipe 33' east and 33' west of section corner.

Description of corner evidence found:

Found 2" iron pipe 30" below ground level and found reference pipe 32.91' east of section corner.

Description of monument and accessories I established to perpetuate the original location of this wife.

Set new Forest County Aluminum monument 30" long on top of 2" iron in inchination pipe and flush with the ground surface.

Ties:

Power pole (3613-20W7)
Iron pipe 2th set by Ritter 123.13 feet East 32.91 feet S75E 81.35 feet

Wis., this 3rd day of March, 19 76. Dated at..... nomos Alle Title Surveyor Registration No. S-887. Signature.... (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 3rd day of March 19...76 at 10:30'clock A. M.

Document Number

108834

Number	9292
ocument	ଫ ଟ ୍ୟ

State of Wisconsin
County of Forest
I
Resident witnesses:
Kory Rentmeester, Brad Nelson
Forest County Coordinates:
N: 579166.625 (feet) E: 838632.786 (feet)

	SE	EC_	
	1	7	
			— — —

O = Comer monument restored.

Index No. _ N - 7

43613170020

				index No !
History of original of	omer e	stablishment	•	
1865 - James L. No Tamarac Tamarac	owlin se 12 10	t original cor S5W N75E	ner post and mad 35 Lks. 30 Lks.	de the following B.T.'s:
1976 - Thomas R. / He replaced	Arnott fo	und 1" iron n pipe with a	pipe and original new Forest Cou	BT stumps. nty aluminum monument and set the following ties:
Tamarac	8	S41E	24.54 feet (BT	found)
Tamarac	8	S57W	17.42 feet	·
Tamarac	8	N79W	11.44 feet	
2005 - I found a Fo Set the folio Rebar 5/8" Rebar 5/8" Rebar 5/8" Rebar 5/8"			N15°41'34"W S86°52'19"W S11°49'53"E S17°06'21"W	67.79 feet 34.08 feet 22.87 feet 67.03 feet
10. bine * 4.1.	· . \$17- 90 67- 61	S86-52-19W 3.2%	344 <u>0.3,61</u>	THOMAS R. FOGARTY S-1752 Green Bay, Wis. O

Dated at	Crandon	_, Wis., this	<u>17th</u>	day of	November	<u>., 20.05</u>
Signature The	(County Surveyor Regist	Title end Land Surveyor	Registered, or other duly	Land Surveye authorized official	or Registration	1 No. <u>S</u> -1752
Office of Register	of Deeds, County of_	Forest	<u>t</u>		, I hereby certi	ify that the within
instrument was fill at 2:40 o'cloc	led in this office for reco	ard on the $_$ $_$	8 th	day of	<u>November</u>	, 20 <u> <i>0</i> 5</u>
Kay Sw	anson, Depui	ty		_		

FOREST COUNTY ALUMINUM MONUMENT

State County of	of Wisco		} ss.
I Thoms certify that of Januar evidence of the corner of Sanuar Township I Sanuar as described I established as described location of t Resident with	the 1/sections 36 For hereon; and hereon to his corner.	nott 6th 19 14 17 & 17 & 11 Princ that from nument a perpetuat	, do hereb da d6, I found 20
	· · · · · · · · · · · · · · · · · · ·) "	1
			1
	! ! :	 	·
] 	l I	 	į
	SE	FC	1
			-
	! <u></u>	i O	1
	l <u> </u>	I '	 - -
1	! !	i I	1
	<i>t</i> 1	l i	
	<u> </u>	<u> </u>	1
O = Corner	r monument	restored.	

ERTIFIED	LAND	CORNER	RESTORATION
			11401011

Index No. 17

ARNOTT S-887

History of original corner establishment:

Original subdivision b	рд	James	Nowlin	June	2	-	June	12,	1865
------------------------	----	-------	--------	------	---	---	------	-----	------

 Tamarac
 10
 N75E
 30 Lks.

 Tamarac
 12
 S5W.
 35 Lks.

Description of corner evidence found:

l" iron pipe found Original BT stumps found Old BT blaze found on Tamarac

S41E

24.54 fee

Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced iron pipe with a new Forest County aluminum monument Ties:

'amarac	8	SLIE	24.54 feet	(BT found)
lamarac	8	S57₩	17.42 feet	
l'amarac	8	N79W	11.hli feet	• •

Dated atCrandon	, Wis., this	9th d	lay of	January	
Signature I homens Acres	Title	Surveyor		Regist	ration No.S=887
(County Surveyor, Registe	red Land Surve	yor, or other duly aut	horized officia	al)	
Office of Register of Deeds, County of instrument was filed in this office for re	1 4b	Forest 9th	day of	, I hereby ce	rtify that the within
at	cord on the		day 01		, 17
Lugene State (Register of Deed	mml	De	ocume nt	Number	108536
(Register of Deed			0 0 04:10 110	1,0212-01	

By_____Deputy

Stock No. 26273

VOL CR PAGE N9

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

1865 - James L. Nowlin, set original corner post and made the following B.T.'s: Elm, 12", N 30° E, 43 lks., 28.38 feet. Hemlock, 12", N 32° W, 22 lks., 14.52 feet.

2000 — I found no evidence of the original corner. I found an old fence intersection running North—South & West. The fence intersection also checks very well with measurements to the corners West & South. I thus accepted the fence intersection as the best possible evidence of the corner position. For the corner I set a Forest County Aluminum Monument and made 4 new B.T.'s.

(Check All That Apply) Corner was:


X Restored through acceptance of an obliterated evidence location.


Restored through acceptance of a found perpetuated location.

Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location).

Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).

Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).

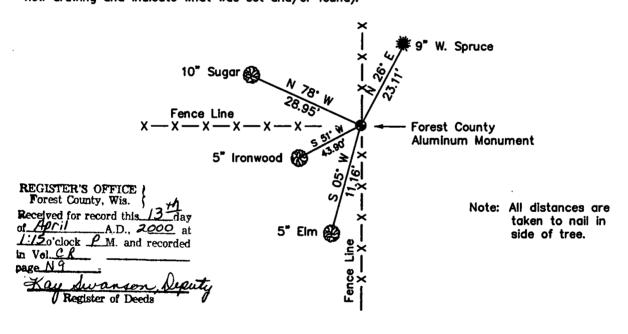

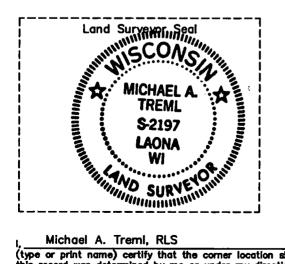

ASSUMED

T36N **R13E** SEC 20

Michael A. Tremi, RLS (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Northeast Section 20 T. 36 N., R. 13 E. Forest County, W

/1 Signature Date

County o		
, •	f Forest	} ss.
		1-1
certify th	nas R. Arnott at on the 9th	, do here
of Se	ptember , 19.7	.5, I fou
evidence	of the Section sections 15, 16,	
corner of	sections 15, 16,	.21 .& .2
1 ownsnip	36, N E, Fourth Princip	al Meridi:
	ed hereon; and that from t	
I establis	hed a new monument and	i accessor
	oed hereon to perpetuate	the origin
location of	f this corner.	
Resident	witnesses:	
Resident	withesses.	
Hert	bert Wagoner	
TOT.	net.r wagonet.	•••••
		• • • • • • • • • • • • • • • • • • • •
_		
~ ——		
-	1 1	
 -	1 1	l
-	1 1 1 1	l
		 -
		 -
	SEC	
	SEC 2/2	
		 - -
	SEC 22	
	SEC 2/2	
	SEC 222	
	SEC 2 2 2	
	SEC 222	
	SEC 2/2	
	SEC 22	
	SEC 2/2	
	SEC 2/2	

O = Corner monument restored.

CERTIFIED	LAND	CORNER	RESTOR	RATION

Index No. N. 13

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

Elm 12 S40W 3 Lks. Lind 8 N10E 15 Lks.

Description of corner evidence found:


2" iron pipe 54 long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 8" N16E 30.60 feet Maple 8" S67E 4.65 feet

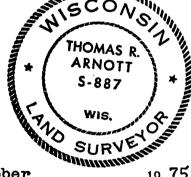

Dated at Crandon	, Wis., this	24th	day of		
Signature Thomas R. Acus	Title	Land Sur	rveyor	Reg	istration No. S=887
(County Surveyor, Regist	ered Land Survey	or, or other duly	authorized o	official)	
Office of Register of Deeds, County of		Forest		I hereby	certify that the within
instrument was filed in this office for re	cord on the	27th	day	of October	19.75
at 8:30 o'clock A. M.			-		
Eugene States	1		Dear	mant Number	108054
LUGUALI XXXXIII	MAL		Docu	ment Number	

.....Deput

retify that on the 9th day of September , 19.75, I found evidence of the 1/4 corner of Sections 15 &22 Township 36, North, Range 13 E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.
Resident witnesses:
Herbert Wagoner
Φ
sec
22

State of Wisconsin

County of...

Forest

SS.

O = C	orner	monument	restored.
-------	-------	----------	-----------

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

8 Lks. 18 Lks. S41W Aspen 14 NTOM Aspen

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C. E. Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this community of the community

Left monument set by Walker

Ties:

N32E S18E 19.25 feet 9.00 feet Maple Maple



THOMAS R

ARNOTT

5-887

Wis., this 24th day of October 19.75. (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 27th day of October , 19 75. 8:30 o'clock A M. 108055

State	of Wisc	consin	1
County of	Fores	<u>t</u>	} ss.
certify that of Septe evidence of corner of Se Township	on the ember the sections 36 E F hereon; and a new mil hereon to	9th , 19 ction 14, 15 ourth Prince of that from	, do herebydayday
Resident wi	tnesses:		
Herber	rt Wago:	ner	
	1	1	
	1	1	I
	! !	-¦	
	l I	1	i
	1	т с	!
	: {	⋭ C -¦	· +
	1 2	2,2	!
	I I	l I	!
	1	-¦	
	t .	1	!
		1	

O = Corner monument restored.

Index No. N 1

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

Aspen 20 S82W 12 Lks. Lind 10 S73E 17 Lks.

Description of corner evidence found:


2" iron pipe with brass cap 5' long set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 6" S84W 12.52 feet Maple 5" S18E 9.40 feet

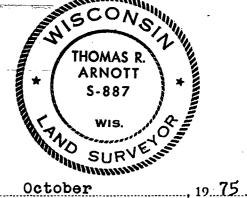

Dated at Crandon Wis., this 24th day of October Signature Registration No.	s-887
(County Surveyor, Registered Land Surveyor, or other duly authorized official)	
Office of Register of Deeds, County of Forest , I hereby certify that	the within
instrument was filed in this office for record on the 27th day of October	, 1975
at 8:30 o'clock M.	
Eusene States 108056	
By Document Number 108056	

State of Wisconsin
County of Forest ss.
I Thomas R. Arnott , do hereby certify that on the 10th day of September , 19.75, I found evidence of the 1/4 corner of sections 14 & 23 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.
Resident witnesses:
Herbert Wagoner

sec !
O = Corner monument restored.

CERTIFIED	IAND	CORNER	RESTORATION
	Laile	COMILIA	RESTURATION

History of original corner establishment:

June 2 - June 12, 1865 Original subdivision by James L. Nowlin

Birch N50W 3Lks Birch S30E 20 Lks.

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

3.10 feet 22.33 feet 10" Maple S36W **S69E** Maple

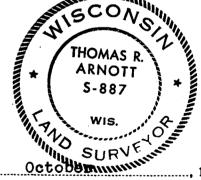

Wis., this 28th ..day of.....

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest ..., I hereby certify that the within October 10.75 28th instrument was filed in this office for record on the.....

(Register of Deeds)

Document Number

108079

State of Wisconsin

CERTIFIED	IAND	CORNER	RESTORATION
CERTIFIED	LAND	CORNER	KES LOKA HON

Index No. A N 2

History of original corner establishment:

Original Subdivision by James L. Nowlin June 2 - June 12, 1965

Sugar 20 N12E 25 Lks. Lind 12 N67W 40 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by 6.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple Maple Maple	8" 8" 8"		N20E S72E S66W	12.10 31.51 29.81	feet
-------------------------	----------------	--	----------------------	-------------------------	------



Dated at Crandon Wis 28th day of October 19.75

Signature / Worker K. Michael Title Land Surveyor (County Surveyor Registered Learning Surveyor and John Surveyor de Land Surveyor (County Surveyor Registered Learning Surveyor)

Office of Register of Deeds, County of Forest 28th 20th October 12.75

Engene Batations

Document Number

108080

State of Wisconsin County of Forest I Thomas R. Arnott day of September 10th day of September 1975, I found evidence of the 1/4 corner of Sections 13 & 24 Township 36 North, Range 13 E Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner. Resident witnesses: Herbert Wagoner SEC 2/4			and the same
I Thomas R. Arnott day of September 10th day of September 1975 I found evidence of the 1/4 corner of sections 13 & 24 Township 36 North, Range 13 E Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner. Resident witnesses: Herbert Wagoner	State	of Wisconsin]
Township	County of	Forest	} ss.
Herbert Wagoner	Township 1.3 as described I establishe as described	E, Fourth Princi hereon; and that from d a new monument ar l hereon to perpetuate	North, Range pal Meridian, this evidence decressories
SEC	Resident wi	tnesses:	
SEC	Herber	t Wagoner	
ii			
ii		••••••••••••••••••••••••••••••••	
iii			0.1.0
ii			
ii		, → φ	
ii		l 1	1
ii			
ii		! !	+
iii		1. I I I	
2,4	L	sŧc_	<u> </u>
		2,4	1
		l	1
			<u> </u>
		!	!
O = Corner monument restored.	L		

Index No. N23

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1965

 Hemlock
 20
 N60E
 20 Lks.

 Sugar
 8
 S60W
 15 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple 6" S79W 18.18 feet Maple 8" N14E 87.30 feet monument on south line of pipe line.

THOMAS R.

ARNOTT

S-887

WIS.

OSURVEY

TODOR

TOD

Dated at	Crandon	, Wis., this	28th	day of	October		, 1975
Signature 7	omor R. Aus	Title	Land Sur	veyor	Regi	stration No.	s-887
G,	(County Surveyor, Regist	tered Land Surv	eyor, or other du	ly authorized o	fficial)		
Office of Regist	er of Deeds, County of filed in this office for r	Fore	st 28th	dav (certify that	the within
at11 o'clo	ock M.		,	-	nt Number		081

By......Deputy

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through 1).

(a) Identify the corner by reference to the U.S. public land survey system.

O . Corner monument restored.

Section corner to Sections 13, 18, 19 & 24, T36N, R13E

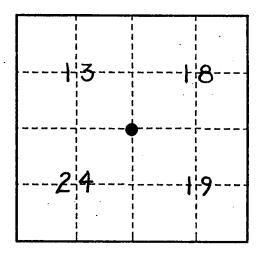

(b) Describe any record evidence, monument syldence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, Alfred Millard D.S. set post with the following BT's:


Hemlock, 10" - N20°E, 22 links Hemlock, 10" - N22°W, 15 links Y. Birch, 11" - S75°W, 43 links Y. Birch, 18", S60°E, 58 links


December 22, 1992, John Garske found 2 1/2" O.D. iron pipe with 2 1/2" brass cap stamped: Forest Co. Forest Crop Survey, section corner, S13, S18, S19, S24, T36N, R13E, 9-1-38, C.E. Walker. Monument protrudes 3'± above ground. No record of Walker's notes can be found.

I accepted the Walker monument after finding several others of similar type in the area which have been accepted and recorded by local surveyors. Mr. Walker's work in the 30's appears to have been of good quality as testified by other surveyors I have talked with.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron orother equally durable material.)
- (d) Show a plan view drawing depicting the relevent monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

Left monument found as noted above.

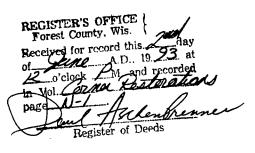

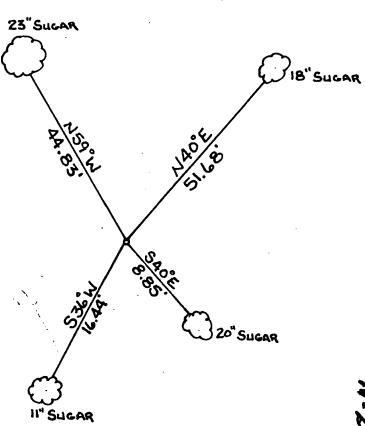

N-25

N-1-36-14 N25-36-13

reestobilshe	material discrepance d and the location o and direction. Show	of that corner as	previously resto	red or reastablished	
above. Show and (1) the	the distances beteen	n the corner as pr or reestablished,	sviously restore		
mon amen ()	The diaming i	(4), 40040.			
•		• •.			
	•				
		0	•	:	
	ner restored through twated location 7	acceptance of (1)		svidence location, or,	(2)
Found monu	ıment		•		
		·			
(a B b) Was the	corner reactablishes	d through lost con	rner propertions	te methods? If so, show	• • •
method, as evid	including the directions or used for pro	tions and distance	ss to other publ	ic land survey corners (
Not ap	pplicable				
		•			
		•			
		+			
			•		
					. -
	•		•	S G O N S 7	1
				JOHN R. GARSKE	E
		•		S-1685 IRONWOOD	
,	n R. Garske			MICHIGAN	
on this reco	Int name) certify the ord was determined by that this U.S. Publicomplete to the best	y me or under my o Ic Land Survey Mor	lirection and nument Record is	SURVEY	
John	Rade	1-18	93	•	
Signature			Date		
CERTIFICATE	READY FOR FILING:	Su	e Vap	-10-12-9-1	
			Distrifet Ranger		
				•	

The state of the second section of the second

0 =	= Corner	monument	restored.
\sim		IIIOIIGIIICIIC	

OFDITIES	LAND	CODNED	DECTODAT	ACIT
CERTIFIED	LAND	CURNER	RESTURAT	IUN

History of original corner establishment:

Hemlock	10	N20E	22 Lks.
Hemlock	10	N22W	15 Lks.
Y. Birch	11	S75W S60E	43 Lks. 58 Lks.
Y. Birch	18	S60E	58 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple	4	N1.2V
Maple	16	S45E
Maple	12	\$25W

15.55 feet 8.62 feet 16.50 feet

THOMAS R ARNOTT S-887

Lucene Staternel	Do	ocument Number	108649
instrument was filed in this office for record on the	ne 26th	day of Januar;	y
Office of Register of Deeds, County of	Forest	I hereby	certify that the within
(County Surveyor, Registered Land S	urveyor, or other duly auth	iorized official)	•
Signature / Lomo Henall Tit	le Surveyor	Regi	istration NoS=887
Dated at Wis., Wis., U		., 0	
Dated at Crandon ,Wis., tl	his 26th d	ay of January	19.76

70

4361224

State of Wisconsin History of original corner establishment: SS.

Forest

certify that on the 17th day of February 1988 I found

cyidence of the Quarter corner of Sections 19 & 24

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

Marke e Teuteberg, RLS

Harry Smith

....., do hereby

County of Forest

location of this corner.

Resident witnesses:

Kim H Pritzlaff

In 1858 Alfred Willard, contract surveyor with the government set a wood post at this corner location using the following bearing trees:

N80W 16 links Sugar 10" Sugar 10" S70E 22 links

In 1918 I.R. Ritter restored this corner using a 3" iron pipe and two more 3" iron pipes set east and west for accessories.

Description of corner evidence found:

During a private survey in the northeast quarter of Section 19, I located a 2" iron pipe in the centerline of the intersection of two town roads. The iron pipe fit Ritter's distances and the other two witness corners were destroyed by road building and cultivation to the west. I accepted the iron pipe as the corner perpetuation and monumented same.

						••••••	Description of monument and accessories I established to perpetuate the original location of this corner. Compared to perpetuate the original location of this corner. Compared to perpetuate the original location of the lo
-	 - - -	T	3	6	N	. .	Corner is presently marked "OAK S80N S60F O NORTH N.T.S. With a 2" iron pipe with the top flared from plowing. Used 13 a l"x 2h" iron pipes for corner ties as shown,
ע ע	SEC.	24	. (S	EC	9 -	an & penny aluminate cold butter and a 6 foot steel sign post as accessories Dated at Oconto Falls Wis., this 19th day of February 19 88 Signature Title Registered Land Surveyor Registration No. 1259 (County Surveyor, Registered Land Surveyor, or other duly authorized official)
	! ! !			_	<u> </u>		Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 26th day of February 1988 (Register of Deeds) By Deputy

	7	
-	172	
	E	
	•	

State of Wisconsin County of Forest ss.
IKim H Pritzlaff, do hereby certify that on the 17th day of February, 19.88, I found evidence of the Quarter
Resident witnesses:
Marke E. Teuteberg, RLS
Harry Smith

T 36 N	R I3E
- SEC19-	SEG20-
 	

O = Corner monument restored.

Index No.P-5

History of original corner establishment:

In 1865 James Nowlin. contract surveyor with the government, set this corner using a wood post and the following bearing trees:

Tamarack 20" N30E 6 links Tamarack 15" S80W 20 links

In 1918 I.R.Ritter resurveyed Section 19 and restored this corner using a 2" iron pipe and two 22" iron pipe as accessories set east and west from the corner 33 feet distant.

Description of monument and accessories I established to perpetuate the original location of this ceres are

Description of corner evidence found:

During a survey in the northeast quarter of Section 19 I located a 2" diameter iron pipe with brass cap set at this corner location. Under the ice about 20" I recovered another 2" iron pipe next to the brass capped pipe and some reinforceing rods. Also recovered was a 21/2" iron pipe to the east a distance of 33 feet and two Tamarack trees blazed and facing the corner I accepted this evidence as the corner perpetuation and re-tied the corner in as shown.

10" TAM.	ZV ZW 7." TA	1 <i>M</i> .	CON	SIA	
The 2" iron pipe with brass cap was kept as the corner position. The pipe was tilted to the west. It set four 8 penny spikes in which a 6 foot steel sign (15) (15) (15) (15) (15) (15) (15) (15)	6' SIGN 35 M	NORTH N.T.S.	WIS.		43013192000
Dated at Oconto Falls	Wis., this 19th	day of	February	19 88	
Signature From H. Puff	Title Registered	i Land Surveyor	Registration No		
(County Surveyor, Register)	ed Land Surveyor, or other	duly authorized official)			
Office of Register of Deeds, County of instrument was filed in this office for reco	76+	h	I hereby certily that	t the within	
	ord on the	day of	rebi dar y	, 199.9	
at 8.50 o'clock A. M. (Register of Deeds	nner	· ·			

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No descrepancy

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other sublic land survey corners used as evidence or used for proportioning in determining the corner location?

No

(i) 1. Kim H Pritzlaff
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature Date

Affix Land Constraint Scal

KIM H.

PRITZLAFF
S-1259

Wis.

	of Wisconsin Forest	} ss.
I	nas R. Arnot n the 5th nry ne 1/4 ections 19 8 36 C , Fourth Pr hereon; and that fr a new monumen hereon to perpet	day 19, do hereby 19, I found 20, North, Range om this evidence t and accessories
Resident witr	nesses:	
Herbert	Wagoner	
1	; ; !	1
	SEC	-
!		
1 1 1	 	1 1 1

= Corner monument restored.

	ERTIFIED	LAND	CORNER	RESTORATION
--	----------	------	--------	-------------

Index No.


History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

Tamarac Tamarac 20 15 N30E S80W 6 Lks. 20 Lks.

Description of corner evidence found:

 $1\frac{1}{2}$ " iron pipe found set by I.R. Rittermin 1918

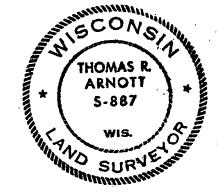

Description of monument and accessories I established to perpetuate the original location of this corner.

Replaced iron pipe with 2" steel pipe with brass cap

Ties:

Tamarac Tamarac **6** 8 s69E s75W 42.62 feet 75.05 feet

Dated at Crandon	, Wis., this	9th	day of	January n	
Signature / Roman Alexe (County Surveyor, Registo	Title S1	ırveyor r other duly au	thorized official)	Regist	ration NoS.+887
Office of Register of Deeds, County of instrument was filed in this office for rec	Fore	est		., I hereby ce	rtify that the withir
at 11 o'clock A. M. Lugene States (Register of Deep			Documen t		108537
(Register of Deet	(s)				

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

1865 — James L. Nowlin, set original corner post and made the following B.T.'s: Hernlock, 18", S 46° W, 12 lks., 7.92 feet. Hernlock, 12", S 35° E, 20 lks., 13.20 feet.


2000 — I found no evidence of the original corner. I found a wood stake at the intersection of old fence lines running South & West. I thus accepted the wood stake and fence line intersection as the best possible evidence of the corner position. I replaced wood stake with a Forest County Aluminum monument and made 4 new B.T.'s described below.


(Check All That Apply) Corner was:

X Restored through acceptance of an obliterated evidence location.
Restored through acceptance of a found perpetuated location.
Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for

proportioning and determining the corner location). Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).

Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).

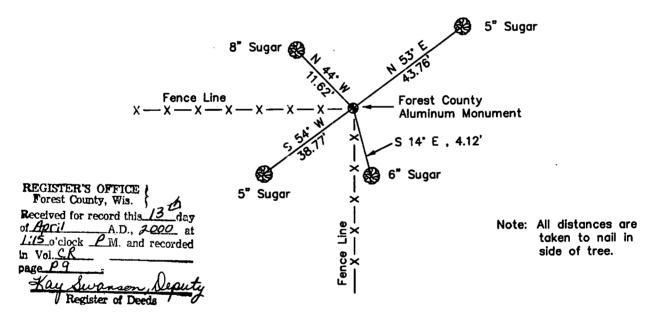

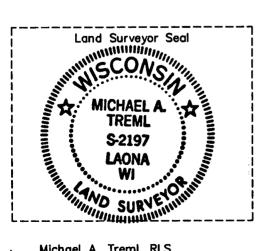

ASSUMED

T36N R13E SEC 20

The East One-quarter corner of Section 20 T. 36 N., R. 13 E. Forest County, W

Michael A. Tremi, RLS (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Michael A. Treml

Index No. P9

evidence of the 1/4 corner of sections 21 & 22

I Thomas R. Arnott do hereby certify that on the 8th

as described hereon; and that from this evidence

I established a new monument and accessories as described hereon to perpetuate the original

County of Forest

of September

SS.

36 North, Range E Fourth Principal Meridian,

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

Ironwood 3 Lks. N50E L7 Lks. 10 Sugar

Description of corner evidence found:

2" iron pipe 5% long with brass cap set by C.E.Walker in 1938 offset 25 feet south of corner

angle iron found at location of corner

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

25.00 feet Walker monument South 27.75 feet U.S.G.S. Benchmark controt mon. Maple . 6" 41.05 feet

THOMAS R ARNOTT S-887

Dated at	day or0c.toner
Signature Crandon , Wis., this 24th County Surveyor, Registered Land Surveyor, or other	rvevor Registration No
(County Surveyor, Registered Land Surveyor, or other	duly authorized official)
Office of Register of Deeds, County of	, I hereby certify that the within
nstrument was filed in this office for record on the 27th	day of
nt. 8:30 o'clock M.	
I a serie State and	Dogument Number 108057
Taralis Salatrament	Dogument Mumber 1000

CERTIFIED	CODNED	DESTOR	ATION
	COMINE	INES FOR	$\Delta II \cup II$


ginal corner establishment:

County of Forest

I. Thomas: R. Arnott , do hereby certify that on the8thday of...September...., 19.75., I found evidence of the 1/4 corner of sections 22 & 23 Township 36 North, Range 13 E...., Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

Herbe	rt Wagor	1er		
•	_		•	

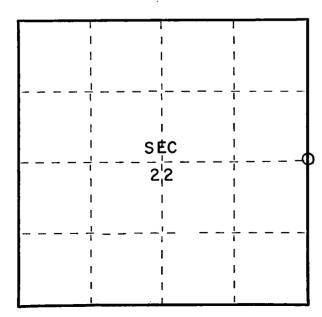

O = Corner monument restored.

Original subdivision by James L. Nowlin June 2 - June 12, 1938

15 10 10 Lks. Birch N30E N33W 33 Lks. Birch

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this correction of this correction.

Left monument set by Walker

Ties:

9.40 feet Maple 1011 N33W N19E 19.50 feet Maple



Dated at Crandon Wis., this	day oructor	0er19
Signature Thomas E. Senot Title L	and Surveyor	Registration No.S. 887
(County Surveyor, Registered Land Surveyo	r, or other duly authorized official)	
Office of Register of Deeds, County of	Forest I	hereby certify that the within
instrument was filed in this office for record on the	27th day of Octo	ober, 1975.
at 8:30 o'clock A. M.	•	
J. Maria J. St. Thomas		108058
	Dogument Munh	" TABAS

Document Number

CERTIFIED	LAND	CORNER	RESTORATION
------------------	------	--------	-------------

Index No. P21

History of original corner establishment:

Original subdivision by James Nowlin June 2 # June 12, 1865

Sugar 10 NLOW 10 Lks. Sugar 15 S65E 18 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple Maple 6 14

SlµE West

27.58 feet 42115 feet

THOMAS R. ARNOTT S-887
WIS. OF SURVEY STREET

Dated at Crandon	, Wis., this	20th	day of	Febu a ry	19. 76
Signature / homas Auno (County Surveyor, Regist	~u //				
Office of Register of Deeds, County of instrument was filed in this office for r	oned on the	Forest 20th	day of	, I hereby	certify that the within
at o'clock A. M.			day or	2.0.0.00.00.00	
Eugene States	ny		Documen	t Number	108787
// (Register of /The	eds)//				

By......Deputy

CERTIFIED LAND CORNER RESTORATION

ir	ndex No. / P25
10 Lks. 25 Lks.	
er in 1938	
26.00 feet	THOMAS R ARNOTT S-887 WIS. O SURVEYSERS 19.76
ny ofJanuaryRegis Regis	stration No.S-887
day of Janaary day	
ocument Number	108650

D. BILTANCARE	
	l
	ı
ف	ł
Ė	I
0	l
מ	ł
5	l
_	l

State of Wisconsin							
County of Forest ss.							
I Thomas R. Arnott , do hereby certify that on the 30 day of Nov. , 19.76 , I found evidence of the section corner of sec. 19. 20. 29 & 30 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.							
Resident witnesses:							
20 1							
<u></u>							
O = Corner monument restored.							

CERTIFIED LAND CORNER RESTORATION

Index No. 7. 5....


History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865.

No ties in book

Description of corner evidence found:

R.R. Spike found

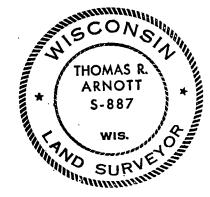

Description of monument and accessories I established to perpetuate the original location of this corner.

Left R.R. Spike

Ties:

Elm 4 N46E 46.69 feet Power pole (54-AA5) S39E 27.12 feet Firehydrant N74W 20.32 feet

Dated at Crandon	,, Wis., this	3 :0	day of	Nov.	, 19.76
Signature home Much (County Surveyor, Reg	Title	Surves	70 ° authorized official	Regi	istration NoS=887.
Office of Register of Deeds, County instrument was filed in this office for	of	Forest		, I hereby	certify that the within
at 11:30 o'clock A. M. Ligent Solution (Register of I					110643
(Register of I	(Jefds)				

COTICICO	LAND	CODNIED	DECTODATION	
EKIILLU	LAND	CURNER	RESTORATION	

Index No. A

ss. History of original corner establishment:

Original survey by James L. Kowlin June 2 - June 12, 1865

Hemlock 8 N46E 22 lks. Hemlock 20 S15W 25 lks.

Description of corner evidence found:

None; in middle of city road Reset post by running lines back from in the city.




Description of monument and accessories I established to perpetuate the original location of this corner.


11/4" iron pipe set at 1/4 corner

Ties:

Forest County Alu. Mon. S82W. 50.11 feet SE cor south gate post of cemetary N55W 58.78 feet SW cor east gate column of cemetary N49E 41.10 feet

Dated at Crandon	, Wjs., this	2 nd	day of	November	19. 77
Signature R. Rices (County Surveyor, Register	Title	Surveyor	authorized of	Registrat	ion No. S=887
Office of Register of Deeds, County of instrument was filed in this office for re-	cord on the	rest	day o	, I hereby certi f November	fy that the within 1977
at	my		Doc. No	. 1127	Ó O
By(Register of Deec		Deputy			

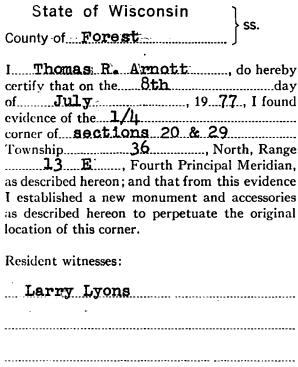

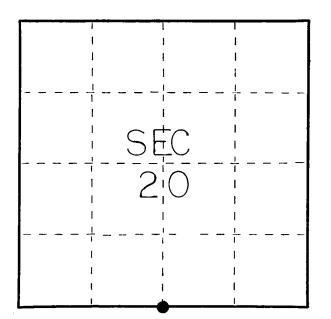

O = Corner monument restored.

180537

REGISTER'S OFFICE | Forest County, Wis. Received for record this 29 da _dav A.D., 2003 at 2015 clock A.M. and recorded in Vol. Corner Restoration Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(As Required by WI Adm. Code)

History of original corner establishment and subsequent restorations and descriptions of any record, monument, occupational, testimonial or other evidence considered:

1865 — James Nowlin, set original corner post and made the following B.T.'s: Birch, 20", N 35° W, 20 lks., 13.20 feet. Birch, 10", S 80° E, 20 lks., 13.20 feet.

2003 - I found no evidence of the original corner post or accessories. I found a 2" diameter Forest County Aluminum Monument at a 4 way fence line intersection running North, South, East & West. I accepted the Monument as the best available evidence of the corner position and made the following B.T.'s.

(Check All That Apply) Corner was:

Restored through acceptance of an obliterated evidence location.
Restored through acceptance of a found perpetuated location.
Considered a lost corner and reestablished through lost corner proportionate methods (include a plan view drawing showing distances and directions to other Public Land Survey Corners used for proportioning and determining the corner location).

Restored or reestablished in a location that differs from a previous restoration or reestablishment (include a plan view drawing and indicate what was set and/or found).


Describe the monument and accessories used to perpetuate the location of this corner (include a plan view drawing and indicate what was set and/or found).



Found Forest County Aluminum Monument


— X —— X —— Barb wire fence

Note: All distances are taken to nail in side of tree.

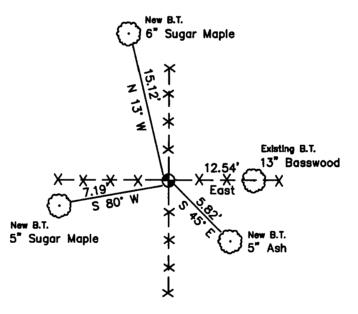



ASSUMED

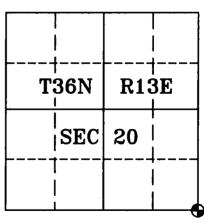

Southeast corner of Section 20 T. 36 N., R. 13 E. Forest County, W

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief

03 Date

R-9Index No.

County of	Forest	J 33 .
certify that of May evidence of the corner of Ray Township Ray as described I established	the 1/4 ctions 21 36 chereon; and that hereon to perpo	& 28
Resident wit	nesses:	
		·····
		,
1		1
	 	1
 		
1	1 	1 1
!	SEC	1
 	2,8	 -
1		1
		<u> </u>
		1
	·	I

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. R11

THOMAS R. ARNOTT S-887

History of original corner establishment:

Original subdivision by James Nowlin 2 June - 12 June, 1865

Birch 20 S20W 18 Lks. Ironwood 10 N78W 13 Lks.

Description of corner evidence found:

Local testamony of Omer Lundt who saw a iron pin before road was units graded and blacktoped

Description of monument and accessories I established to perpetuate the original location of his porter.

SURVEY SURVEY SURVEY SURVEY SURVEY SURVEY SURVEY WAS Ties:

Forest County Aluminum monument	N46W	36.07 feet
W. Birch 10	S59E S8W	41.77 feet
power pole (3613-28W8)	s8w	117.16 feet

Dated at	Crandon	,Wis., this	14th day of	Мау	, 19.76
Signature.	(County Surveyor, Regis	Title tcred Land Surveyo	Surveyor	Reg	istration No.S=887
Office of Regist	ter of Deeds, County o	fthe	Forest Llµthday of	, I hereby May	certify that the within
	ock P. M.				109215
ruge	(Register of De	eds	Document	140.	

I Thomas R. Arnott do hereby

certify that on the 8th day of September , 19.75, I found

evidence of the section

corner of sections 21, 22, 27 & 28.

Township 36, North, Range
13 E, Fourth Principal Meridian, as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

Herbert Wagoner

County of Forest

location of this corner.

Resident witnesses:

SS.

Index No. R13

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865 Original information on ties missing from field notes on hand at the courthouse.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938. old wood post

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Hemlock	10"	и8и	17.80	feet
Hemlock	12"	N79E	10.50	feet
Ia ple	811	S31E	17.20	feet

THOMAS R.
ARNOTT
S-887

WIS.

SUR

tober 19.79

Dated at Crandon	., Wis., this 24th day	of October 19.75
Signature Thomas R. Lewo	Title Land Surveyor	Registration No. S=887
(County Surveyor, Register	ed Land Surveyor, or other duly author	ized official)
Office of Register of Deeds, County of	Forest	, I hereby certify that the within
nstrument was filed in this office for rec	ord on the 27th	day of October , 19.75
1t 8:30 o'clock A. M.		
& State	. / Bear	umant Number 108059

der of Deeds Document Number

By.....Deputy

	1	1	
l	Ī	i	
1	1	I	
		!	_
	i	1	
ŀ	1	1	
ł	ī	SĘC - 22 2	
- 			
	1	<i>د</i> اد	
	ı	ı	

I Thomas R. Arnott , do hereby certify that on the 8th day

of September , 19.75, I found

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

County of Forest

evidence of the....1/4

corner of 22 & 27

location of this corner.

Herbert Wagoner

Resident witnesses:

SS.

E...., Fourth Principal Meridian,

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. 12-R-15

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

Tamarack 10 N7W 10 Lks. Tamarack 6 S30E 15 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938. Also found old wood post.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Hemlock 12" N48W 31.28 feet Hemlock 14" S72W 29.15 feet



Dated at Crandon	, Wis., this	day ofOctober	, 19. 75
Signature Promes P. Regist (County Surveyor, Regist	Title Land Survered Land Surveyor, or other duly	eyor Real Action R	egistration NoS.887
Office of Register of Deeds, County of instrument was filed in this office for re	Forest 27th	day of October	y certify that the within
at 8:30 o'clock AM.		Document Number	108060
(Register of Dec	eds) Deputy		

Oluto	7		ss.
County of	Forest		J
certify that of Septe evidence of corner of Se Township	hereon; and danew more hereon to p	197 ion 22, 23, rth Princip that from t	26 & 27 forth, Range al Meridian, his evidence l accessories
Resident wi	tnesses:		
Herbe	rt Wagon	ər	
		••••	
	•		
			l I
	! ! !:		
	1		
	 a-		
_ _	SE	.C 	¦
	ا . د د	2	
	l 1	i	
	! <u>'</u>	i	¦
	[[
			i
			<u> </u>

Corner monument restored.

State of Wicconcin

OFDTIFIED	LANID	CODNED	DECTODATION
CERTIFIED	LAND	CURNER	RESTORATION

Index No. R 17

History of original corner establishment:

Original Subdivision by James L. Nowlin June 2 - June 12, 1865

Sugar 20 N24W 13 Lks. Sugar 15 N9E 45 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple	8¥	N18W	30.60 feet
Hemlock	12‼	S56E	27.45 feet
Maple	6"	S24W	7.55 feet
марте	Ο	524W	(•55 Tees



Signature Crandon , Wis., this 24th day of October , 1975 ...

Signature Registration No. 887 ...

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 27th day of October , 1975 ...

at 8:30 o'clock A. M.

Eugene Atatemy (Register of Deels)

Document Number

108061

O = Corner monument restored.

State of Wisconsin

ERTIFIED LA	AND	CORNER	RESTORATION
-------------	-----	--------	-------------

Index No. R19

History of original corner establishment:

Original subdivision by James L. Nowlin J

June 2 - June 12, 1865

Birch 12 N5E 50 Lks. Lind 10 S18W 40 Lks.

Description of corner evidence found:

2" iron pipe with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corper

Left monument set by Walker

Ties:

Hemlock 18" NLE 35.90 feet Maple 6" S34W 33.35 feet

tober 19.75

THOMAS R

S-887

Dated at Grandon Wis., t	his <u>24th</u> day of UCLODOR 19	ב.
	his 24th day of October, 19.6	-

Signature / Norman L. Alexa Title Land Surveyor Registration No. S=887.

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 27th day of October , 19.75 at 8:30 o'clock A. M.

(Register of Deds)

Document Number

108062

.....De

1141 900 H. C. MILLER CO., MILER

History of original corner establishment:

Original subdivision by James Nowlin June 2 * June 12, 1865

37 Lks. 26 Lks. Birck Ironwood


Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument an	d accessories I e	established t	o perpetuat	te the oi	riginai	location of	i this corner.		-
Left monument set	by Walker					See WIE	CONS	The state of the s	Ì
lies:							THOMAS R. ARNOTT		
Maple: Maple:	1/1 8	N18W S38E	29	9.64 8.28	feet feet	* (5-887		
Maple	8 8 0	s18W	12	2.99	feet	THE ALL	WIS.		
						Milling	SURVE	RIE	
Dated atCrandon	, W	is., this	20th	day o	ofF	abuary		, 197	<u> 7</u> 6.

Dated at Crandon ,	, Wis., this 20th	day of Fr	ebuary	, 19 76
Signature Thomas Muse (County Surveyor, Regist	Title Survey	O P aly authorized officia	Reg	istration NoS=887
Office of Register of Deeds, County of instrument was filed in this office for read	ecord on the2	Oth day of	, I hereby Febuar	y
Engene States (Register of Plea	eds)	Document	Number	108788
Ву	V. Deput	ty		

State of Wisconsin SS. County of Forest I Thomas R. Arnott , do hereby certify that on the 19th day of Febuary , 19.76 , I found evidence of the section corner of sections 23, 24, 25 & 26 Township 36, North, Range E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner. Resident witnesses:

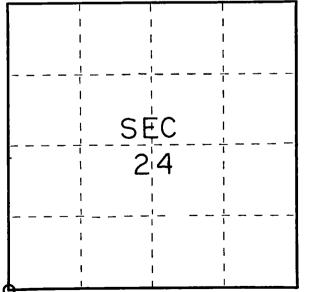

O = Corner monument restored.

REGISTER'S OFFICE Forest County. Wis.

Received for record this 18 day of Movember D. 2005 at 3:550'clock L. M. and recorded in Vol. Corner Restoration page B-23

Kay Swanson, Diput Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES L. NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: FIR 8" S63°E 15 LINKS CEDAR 12" N37*W 10 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5'ONG WITH BRASS CAP.

1977 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES: CEDAR 10" N46"E 16.79 FEET CEDAR 8" S47"E 9.13 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☑RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" x 30" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


CEDAR 12" N43°E 17.15 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


BALSAM 8° N78°W 21.52 FEET - SET D.H. NAIL IN TREE.
CEDAR 11° S52°E 16.93 FEET - SET D.H. NAIL IN TREE.
CEDAR 14° S14°W 25.93 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE NORTH 1/4
CORNER OF SECTION 25
T. 36 N., R. 13 E.,
FOREST COUNTY, WISCONSIN

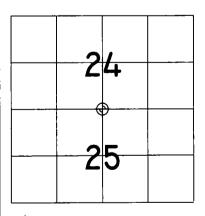

= LOCATION OF CORNER

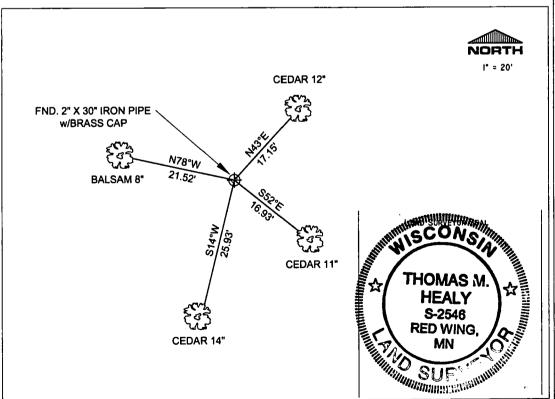

THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY HE OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD

JZ M. Her 1/-17-03

INDEX No. ______R-23_____

4361324 0020

R-23

State	of Wisco	nsin] 55
County of	Fores	t	} ss.
certify that of	on the 1/4 tober the 1/4 ections 36 E , Fou hereon; and d a new mon l hereon to his corner.	9. tht	7, I found 7, I found 25 forth, Rang al Meridian his evidence d accessorie
Resident wi	tnesses:		
••••		·····	
	•••••		
	l 1		
	1 i 1 1		
	¦	 -	 '
		<u>-</u>	- -
		- †	
	 		
	! !	l 1	

O = Corner monument restored.

CERTIFIED	LAND	CORNER	RESTORATION
------------------	------	--------	-------------

History of original corner establishment: 2 June - 12 June, 1865 Original survey by James L. Nowlin

15 lks.
10 lks. Fir Cedar 12

Description of corner evidence found:


22 iron pipe 51 long with brass cap set by C.E. Walker in 1938.

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker.

Ties:

16.79 feet 9.13 feet Cedar 10 N46E SL7E Cedar

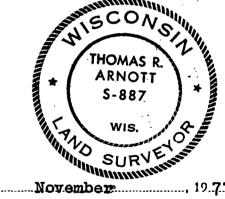

Dated at, Wis., this	day of	November 19.77
Signature Thomas R. Auco Title (County Surveyor, Registered Land Surveyor)	Surveyor	Registration No.S=887
Office of Register of Deeds, County of	•	•
instrument was filed in this office for record on the		
ato'clock		
to an extension	Dec. W	119909

(Register of Deeds)

O = Corner monument restored.

State of Wisconsin

Thomas R. Arnott ,, do hereby certify that on the 19th day

County of Forest

SS.

CERTIFIED	LAND	CORNER	RESTORATION

History of original corner establishment:

Hemlock	12	NДOE	7 Lks.
Ironwood	8	ni 8w	27 Lks.
Ironwood	8	858W	28 Lks:
Hemlock	8	\$25E	31 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

faple:	8	N34W
Hemlonk	16	S27E
Hemlock	14	S43W

37.62 feet

THOMAS R ARNOTT 5-887


						486868888
Dated at	Crandon	, Wis., this.	26th (lay of	January	. 197.6
	(County Surveyor, Regis					
Office of Re	gister of Deeds, County of	f	Forest		, I hereby ce	rtify that the within
at 11	o'clock					108652

ORIGINAL ON FILE IN CO CLERK'S OFFICE COPY HERE FOR REFERENCE

RECORD AND CERTIFICATION OF U.S. **PUBLIC LAND SURVEY CONTROL STATION**

ED716 687					*			
District		Project ID		Located By	1	,	•	
7		1591-0	9-00	J. R. WAL	LIN	- SURVEY C	DORDINA TOR	
Comer			Township	Range (E,W)	,	County		
W 1/4	COR.	3EC.30	36 N	135		FOREST		
Wisconsin C			East (X)		North (Y)		Elevation (Z)	Zone
NAD	83(1991)	2,244,3	308,15	635	5,799.16		<u></u>
Control Stat			East (X)		North (Y)	· · ·	Elevation (Z)	Zone
	•							
				, CONTROL	DATUM			
Horizontal -	• 1	NORTH AMERICA	N, 1888 83(1	१५ ।)	Vertical -	MEAN SEA LEVEL	, 1929 ADJUSTMENT	
				SURVEY (CONTROL			
Horizontal	-		Order		Vertical -		Order	

SKETCH

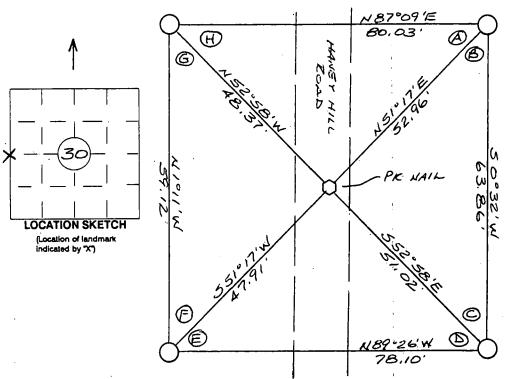

ON APRIL 12, 1995 WE DUG FOR ARNOTT'S 1/2" 1.P. -FOUND IT BENT AND LAYING ON TOP OF THE OLD PAVIT. NO SIGN OF ARNOTT'S WOOD POST - THE ONLY TIE LEFT WAS THE P.P. NTOE 78.42' WE SET A P.K. NAIL TO AGREE WITH THE C-E Y6 AND NE COR. OF SEC. 25, T36N, RIZE AS SHOWN ON CSM BY W. COCHRANE DOCT 140203 VOL 4, P. 108-108A AND MONUMENTED IT

JUNE 14, 1995 I hereby certify that on the date of the above corner was located by a marker and/or references established by

NOTE ABOVE

I further certify that to perpetuate the location of said corner, on the date of

14,1995 at the exact location thereof, a permanent marker or witness monuments consisting of

BERNTSEN MAGNE77C

ALUMINUM MONUMENTS were located as shown above.

ANGLE A=35°51'56"

B=50°44' 30"

C= 53° 29' 36"

D= 36° 28' 58"

E = 39° 16' 56" F > 52° 28' 17" G = 51° 45' 49"

H:39°53′58"

nison COORDINATOR

43612252000

178830

REGISTER'S OFFICE Forest County, Wis.
Received for record this 18 day of March A.D., 2003 at
11:15 o'clock A.M. and recorded in Vol. Corner Restoration
page T-5

// Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

> 1865 - ORIGINAL SURVEY BY JAMES L. NOWLIN JUNE 2 - JUNE 12, 1865. SUGAR BIRCH S16**W** N34E

1976 — THOMAS ARNOTT, S-887 STATES IN CERTIFIED LAND CORNER RESTORATION FORM, I FOUND P.K. NAIL AND REPLACED IT WITH R.R. SPIKE, HIGHWAY DEPARTMENT FOUND R.R. SPIKE AND REPLACED WITH BRASS CAP IN 1971.

LEFT BRASS CAP

CHISELED X IN SIDEWALK MAG. ALUM. MON. MAG. ALUM. MON. SE COR. TAVERN

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☑RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


> FOUND ABOVE MONUMENT AS RECORDED AT FOREST COUNTY REGISTER OF DEEDS, NOVEMBER 1976, DOCUMENT NUMBER 110844, INDEX NUMBER T5. MONUMENT SUBSEQUENTLY DESTROYED BY CONSTRUCTION, REPLACED SEPTEMBER 2002 AS FOLLOWS: SET MAG NAIL: N 571,266.72 E 853,833.92 WISCONSIN COUNTY COORINATE SYSTEM "FOREST COUNTY"

SET THE FOLLOWING ACCESSORIES:


REFERENCE MONUMENT N37'02'54"W
REFERENCE MONUMENT N30'26'57"E
REFERENCE MONUMENT S61'23'40"E
REFERENCE MONUMENT S23'16'49"W

NORTH 1" = 30"



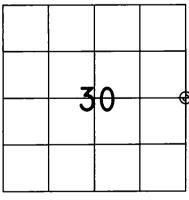

= LOCATION OF CORNER

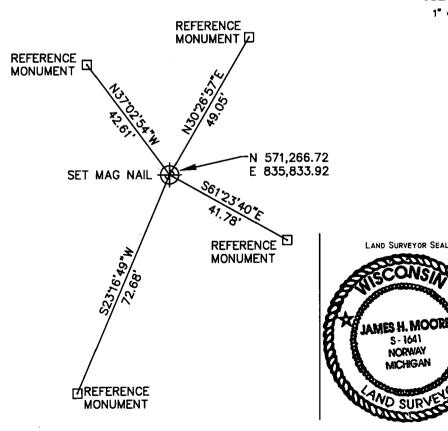

43613302000

JAMES H. MOORE MEJCERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONLMENT RECORD D COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF. 3-18-03

T-5 INDEX No.

176809

REGISTER'S OFFICE Forest County, Wis. Received for record this 27 day of september A.D., 2002 at 9:00 0°clock A.M. and recorded in Vol. Corner Restoration pageZ Swanson Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - ORIGINAL SURVEY BY JAMES L. NOWLIN JUNE 2 - JUNE 12, 1865.

S16W N34E 15" 20" SUGAR BIRCH

1976 - THOMAS ARNOTT, S-887 STATES IN CERTIFIED LAND CORNER RESTORATION FORM, I FOUND P.K. NAIL AND REPLACED IT WITH R.R. SPIKE, HIGHWAY DEPARTMENT FOUND R.R. SPIKE AND REPLACED WITH BRASS CAP IN 1971.

LEFT BRASS CAP

CHISELED X IN SIDEWALK MAG. ALUM. MON. MAG. ALUM. MON. SE COR. TAVERN 42.48 FEET 48.94 FEET 102.10 FEET 49.90 FEET

ORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

3 CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

JRESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


> FOUND ABOVE MONUMENT AS RECORDED AT FOREST COUNTY REGISTER OF DEEDS, NOVEMBER 1976, DOCUMENT NUMBER 110844, INDEX NUMBER T5. MONUMENT SUBSEQUENTLY DESTROYED BY CONSTRUCTION, REPLACED SEPTEMBER 2002 AS FOLLOWS: SET MAG NAIL: N 571,266.72 E 853,833.92 WISCONSIN COUNTY COORINATE SYSTEM "FOREST COUNTY"

SET THE FOLLOWING ACCESSORIES:


REFERENCE MONUMENT N37'02'54"W N30'26'57"E REFERENCE MONUMENT S61'23'40"E REFERENCE MONUMENT S23'16'49"W 49.05 41.78

NORTH

THE EAST 1/4 CORNER OF SECTION 30 _ N., R. <u>| 13</u> E., T. 36 FOURTH PRINCIPAL MERIDIAN, MARINETTE COUNTY, WISCONSIN

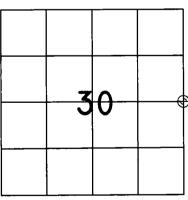

= LOCATION OF CORNER

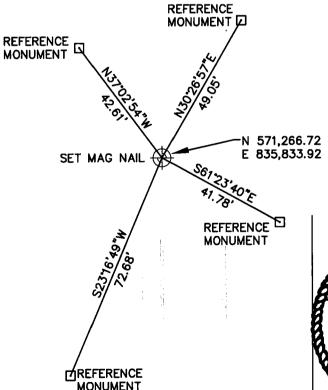

LAND SURVEYOR SEAL SCONSI AMES H. MOOR S-1641 NORWAY

١.	JAMES	Н.	MOORE
٠,			

EXCERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD

9-25-02

T-5 INDEX No.

Thomas R. Arnott do hereby

certify that on the......day

of Oct , 19.72 , I found

evidence of the 1/4 corner of sec. 30 & 29 13 E Fourth Principal Meridian. as described hereon; and that from this evidence

I established a new monument and accessories as described hereon to perpetuate the original

County of Forest

location of this corner.

Resident witnesses:

SS.

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865.

12 Lks. 45 Lks. Sugar S16W 20 N3LE Birch

Description of corner evidence found:

Brass cap in pavement set by the highway department 1971, I found P.K. nail and replaced that with R.R. Spike

Description of monument and accessories I established to perpetuate the original location of this corner.

Left brass cap

Ties:

Crandon , Wis., this 30 day of Nov. 19 76 Title Surveyor Signature Thomas Acrost Registration No.S-887 (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the day of Nov. 1976. at 11:30 o'clock A.M. Document Number 110644

(Register of Dege



SURVEYERE 76

County of	Forest	t-	53.				
I Thomas R, Arnott , do hereby certify that on the 8th day of July , 1977 , I found evidence of the 1/14 corner of sections 28 & 29 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.							
Resident wi	tnesses:						
Larry 1	Lyons		••••••				
		•••••••••••••••••••••••••••••••••••••••					
<u></u>		 					
	 	1 I					
	¦ 	 +					
	, , , , ,						
	; <u>5</u> E	<u>r (</u>					
	2	8					
		ı — — <u>—</u> — — — — — — — — — — — — — — — —					
 			•				
O = Corner	monument	restored					

CEDTICIED	LAND	CODMED	RESTORATION	
CERTIFIED	LAND	CURNER	RESTURATION	ı

Index No.

History of original corner establishment:
Original survey by James L. Nowlin June 2 - June 22, 1865

Hemlock 6 N60E 35 lks. Sugar 12 S40W 10 lks.

Description of corner evidence found:

None; in middle of old woods road reset post by runming line back from in city

Description of monument and accessories I established to perpetuate the original location of this corner.

58 Forest County Aluminum monument set

Ties:

Maple 6 S13E 44.99 feet Maple 8 S77W 45.44 feet



Detail of Grandon	337'- 41-'-	24	less of Non	- and be an	10 77
Dated at Crandon					
Signature / Domas R. Ne (County Surveyor,	Registered Land Surveyor	Surveyor r, or other duly at	thorized official)	Registration N	No <u>00.1</u>
Office of Register of Deeds, Cour instrument was filed in this office	for record on the	est ZIL	day of	I hereby certify th November	at the within
at o'clock M			Doc. No.	112699	
(Register	attending of Deedis)				

Ву.....

..Deputy

CERTIFIED	IAND	CORNER	RESTORATI	\cap N
OEN III IED	LAND	COMMEN	NESTONATI	\mathbf{v}

Index No. 113

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865
Original information on ties missing from the field notes on hand at the courthouse.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Ties:

Maple 9" S40W 13.25 feet
Maple 7" S19E 6.25 feet

Dated at Crandon Wis., this 24th day of October No. S-887

Signature County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest I hereby certify that the within

instrument was filed in this office for record on the 27th day of October 1975

(Register of Deeds)

8:30_{o'clock}

Document Number

108063

State County of	of Wisc		} ss.
certify that of	on the nuary the 1 section E Fo hereon; and a new m	9,53 /4 26 & 36 ourth Prince d that from	, do hereby 2
location of t	his corner. tnesses:		te the origina
	·		
	 	 - 	1 1 1
	! !	1 1	1 1 1

			1
	; ; ; ;		
) -	SE 2	<u>C</u>	¦ ¦
		6	1
	 		
	! !	i 	l I

O = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No.

History of original corner establishment:

Original Subdivision by James Nowlin June 2 - June 12, 1865

 Sugar
 15
 N50W
 12 Lks.

 Sugar
 20
 S6E
 13 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

 Maple
 10
 N1

 Maple
 10
 \$330

2.35 Feet 28.61 feet

THOMAS R. ARNOTT S-887
WIS. OF SURVENIENT OF

	93				pr.	Milling
Dated at	Crandon \	, Wis., this	15t h	day of	Jan uary	, 19 7 9
Signature.	County Surveyor, Reg	Title	Surveyor or, or other duly au	thorized offici	Regi	istration No. s.= 887
Office of Regi	ister of Deeds, County as filed in this office for	of record on the	Forest 15th	day of	, I hereby Januar	certify that the with
at50'c	clock M. (Register of L					108575
By ((Register of I	Peeds	Deputy			2370

CERTIFIED	LAND	CORNER	RESTORATION
		COMITEIN	KESTOKATION

Index No. 121

History of original corner establishment:

Original Subdivision by James: Nowlin June 2: - June 12, 186	Original	Subdivision	bу	James:	Nowlin	June	2: -	June	12,	186
--	----------	-------------	----	--------	--------	------	------	------	-----	-----

 Sugar
 12
 N22E
 20 Lks.

 Hemlock
 20
 S43W
 26 Lks.

Description of corner evidence found:

2" iron pipe with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Popple.	8	S32E	12.70 feet	;
Popple	B	S30W	17.80 feet	
Tamarac	8	N52W	73.15 feet	;

MIN	WIS.	, , o o o o o	- <u> </u>
William	SUR'	E VICES	•
January	********	,	19 76

ARNOTT

Dated at	Crandon	, Wis., this	15th	day of	January	, 19 76
Signature /	Lomas Drs	Title	Surveyor	·	Registratio	n No S-8 87
Agriata C	(County Surveyor, Reg	istered Land Surve	yor, or other duly	authorized of	ficial)	
Office of Regi	ster of Deeds, County	of	Forest		, I hereby certify	that the within
nstrument w	as filed in this office for	record on the	15	thday o	. January	
	clock P. M.				•	

Lusene	Register of Jeeds)
	(Register of Heeds)

_____ Document Number

108576

By_____Deputy

	I I
 	-
 	<u>SEC</u>
 	

O = Corner monument restored.

State of Wisconsin

County of.....

Forest

corner of sections 25 & 26

location of this corner.

Resident witnesses:

retify that on the 8th day of January 19 76, I found evidence of the 1/4


as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

...., Fourth Principal Meridian,

189322

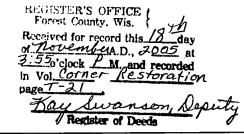

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES L. NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: SUGAR MAPLE 12" N22"E 20 LINKS HEMLOCK 20" S43°W 26 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
POPPLE 8" \$32°E 12.70 FEET
POPPLE 6" \$30°W 17.80 FEET
TAMARACK 8" N52°W 73.15 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

MRESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE

□RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


TAMARCK 9" N52"W 73.29 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


ASPEN 6" N43"E 18.33 FEET - SET D.H. NAIL IN TREE.
ASPEN 7" S49"E 19.77 FEET - SET D.H. NAIL IN TREE.
ASPEN 5" S48"W 10.53 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE WEST 1/4
CORNER OF SECTION 25
T. 36 N., R. 13 E.,
FOREST COUNTY, WISCONSIN

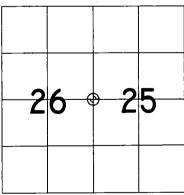

= LOCATION OF CORNER

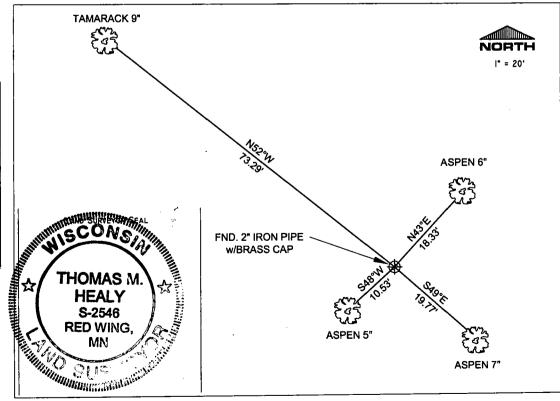


THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT NAME)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

TZ M. H. //-/7-05

INDEX No. T-21

189308

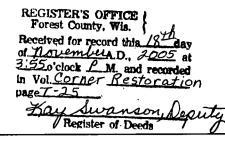

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - ALFRED MILLARD, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: HEMLOCK 10" N40°E 58 LINKS HEMLOCK 12" S30°W 32 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
WHITE SPRUCE 6" S66°E 7.45 FEET
WHITE SPRUCE 6" S01°E 17.45 FEET
WHITE SPRUCE 6" S85°W 4.85 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

MRESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

□RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


WHITE SPRUCE 6* WEST 4.94 FEET - SET D.H. NAIL IN TREE. WHITE SPRUCE 8* S63*E 7.27 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


SUGAR MAPLE 7" N33°E 29.15 FEET - SET D.H. NAIL IN TREE.
WHITE SPRUCE 14" S07*W 23.16 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE EAST 1/4 CORNER OF SECTION 25 T. <u>36</u> N., R. <u>13</u> E., FOREST COUNTY, WISCONSIN

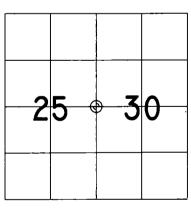

= LOCATION OF CORNER

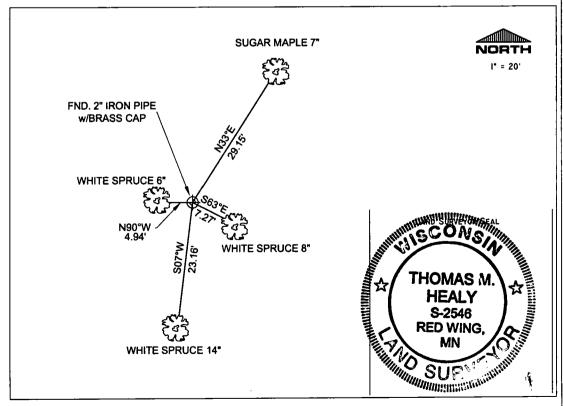

THOMAS M. HEALY R.L.S. 2546

(TYPE OF PENT HAME)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX NO.

FRTIFIFD	LAND	CORNER	RESTORATION
EKIIFIED	LAND	CORNER	RESTORATION

		1 25
Index	No	2


ss. History of original corner establishment:

Hemlock	10	NLOE	58 Lks
Hemlock	12	\$30₩	32 Lks

Description of corner evidence found:

2" iron Description Left mo	or monu	ment ai	iu acces	sories I esta	long	set by	C.E.	Walk	cation	THO AR S.	MAS R. NOTT 887	TANAMAM * WOOD
	110110110	300	by we	TVOL		•					•	
Ties:												
W.•	Spruc Spruc Spruc	е	6 6 6	1.6		\$66E \$1E \$85W		1	7.45	feet feet feet		
Dated at	Cran	don	·	, Wis.,	this	15th	day o	f Ja	nuar	y		19. 76 .
Signature.	Those		De	T	tle	Survey	or			Registra	tion No	s- 88
J	(Co	unty Sur	veyor, Re	ristered Land	Surveyor,	or other dul	y authorize	ed official)	_		
Office of Reinstrument	egister of	Deeds,	County	of	For	est 16+1			, I he	reby cert	tify that t	he with
instrument	was filed	in this	office for	r record on	the	1201	<u>.</u> da	ay ot	<u>0</u>	amuar.)		, 194.
By	o clock	Sta	egister of	De Colo		Deputy		ment	Numbe	ər	108	577

State of Wisconsin	} ss.
I Thomas R. Arnott certify that on the 8th of January , 1 evidence of the 1/4 corner of sections 25 & Township 36	day 976., I found
as described hereon; and that fro I established a new monument as described hereon to perpetu location of this corner.	ncipal Meridian, om this evidence and accessories
Resident witnesses:	
· · · · · · · · · · · · · · · · · · ·	

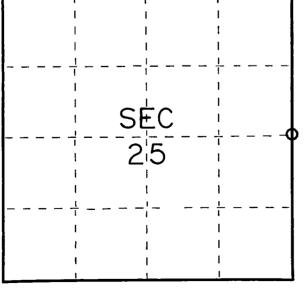

O = Corner monument restored.

Index No. V-1

COCHRANE

S-1107

HILES.

WISCONSIN

State of Wisconsin County of Forest.

SS.


IWilliam B. Cochrane do hereby certify that on the 28 th day of September 19.80, I found evidence of the Northwest Section corner of Section 31 13 East Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original

Resident witnesses:

 $\langle \rangle$

location of this corner.

Miles H. Cochrane Dennis E. Statezny

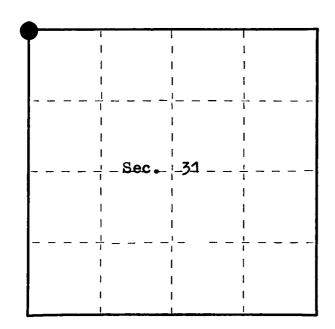

O = Corner monument restored.

History of original corner establishment:

Surveyed in 1858

North between sections 31 and 36. 80.00 chains set post cornanications 25. 30. 31, and 36, Ranges 12 and 13 East

Sugar, 18", N 28° E, 32 links Lynn, 10", N 50° W, 40 links Ironwood, 10", S 60° W, 34 links Ironwood, 10", S 45° E, 16 links

Description of corner evidence found:

North-South gravel road and "T" road West. Iron pipe buried below the road surface. Nomoriginal evidence was found.

This position was tied into the subdivision of section 31 and found to agree with other measurements.

Description of monument and accessories I established to perpetuate the original location of this corner.


I set a reference monument N 36° W, 42.58 feet from the corner. The reference monument is a 2½ inch diameter aluminum pipe. 30 inches long, with a Forest County aluminum cap stamped:

T36N, R12E, R13E, S25, S30, S31, S36, 1980, S-1107, REFERENCE MONUMENT A power pole #3612-25R2, bears N 54° W, 40.96 feet from the corner A power pole #3613-30L3, bears N 43° E, 25.01 feet from the corner

Dated at Hiles	, Wis., this 8 th	day of December	
Signature William B. Con	Title Land Surveyor, or other du	veyor Reg	stration No. S-1107
Office of Register of Deeds, Count instrument was filed in this office	y of Forest for record on the 19th	, I hereby	certify that the within
at 11:30 o'clock A. M.			119136
Lugenet Blat (Register o	of Geeds)	···	







TRANSPORTATION DISTRICT 7
Hanson Lake Road
P.O. Box 777
Rhinelander, WI 54501-0777

Telephone (715) 365-3490 FAX (715) 365-5780 TDD (715) 365-5719

10

DORA C JAMES COUNTY CLERK COURTHOUSE CRANDON WI 54520

SUBJECT: Project I.D. 1595-09-00

West County Line-Crandon

USH 8

Forest County

As required by Section 59.635 of Wisconsin Statutes, this letter is to notify you that the following survey monuments will be destroyed by the construction of the above projects in the summer of 1995.

West 1/4 Corner Section 30, T.36N., R.13E.

These survey monuments have been referenced by Wisconsin Department of Transportation survey crews. Original reference sheets are enclosed for your land corner files.

If you have any questions please call me at 715/365-5741.

David D. Kircher, P.E.

District Planning & Design Supervisor

1992, that I did locate the above corner which was evidenced

DDK:JW:11

J:VPLANVMONUMENT.LTR

"People who care, creating quality transportation today and tomorrow."

: I further certify the location of such corner I did, at the thereof, place a permanent marker consisti	that to perpetuate exact location	2	
; I further certifiestablish 4 references or witness monument of 5/8" x 24" REINFORCING BARS U	nts consisting	SE	AL
located as shown	above:		
Signature Registered Land Surveyor	Registration No.	Title	

corner of sec. 30 & 31

location of this corner.

Resident witnesses:

Thomas R. Arnott, do hereby

certify that on the......day

of Nov 19.76, I found evidence of the 1/4

I established a new monument and accessories as described hereon to perpetuate the original

County of Forest

SS.

O = Corner monu	-	•
ı	_	1
1	1	1
ı	l	1
I	I	I
ı	ı	ı

CERTIFIED LAND CORNER RESTORATION

Index No. V 3

History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865.

Sugar 22 N30E 28 Lks. Fir 12 S58W 15 Lks.

Description of corner evidence found:

R.R. Spike



Description of monument and accessories I established to perpetuate the original location of this corner.

Left R.R. Spike

Ties:

Power Pole (63AA74) iron pipe	838°21'E	21.41 feet 41.9 feet
Balsam 6	S30E	62.77 feet
power pole (30)	S42W	46.69 feet

Dated atCrandon	Wis., this	3.0	day of	Nov.	
\mathcal{L}	Title	Surve	yor	Regi	stration No.S-887
Office of Register of Deeds, County ofinstrument was filed in this office for recor	d on the	Forest 30	dav of	, I hereby Nov.	certify that the within
at 11:30° clock A M.	-				110645
Lugene States (Register of Deeds)	ny		Document	Number \cdot	
Ву	V	Deputy			

I establish	ed a neved hereo	v monur n to per	nent an	this evidend d accessorie the origina
Resident v	vitnesses	:		
*		•••••		
		······································		······
	ı	ı		l
	1	į į		1
	 	;- ·		†· Ⅰ
	l I	SFC		1 [
	- 	SEC 30		누
	1			
i	<u>.</u>			L

O = Corner monument restored.

State of Wisconsin

Thomas R. Arnott, do hereby

....., Fourth Principal Meridian,

certify that on the......day

of Oct. , 1972 , I found

evidence of the section corner of sec. 29, 30, 31 & 32

Township 36, North, Range

County of Forest

SS.

CERTIFIED LAND CORNER RESTORATION

Index No.

History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865.

 Sugar
 15
 N29W
 20 Lks.

 Sugar
 12
 N77E
 30 Lks.

Description of corner evidence found:

R.R. Spike found



Description of monument and accessories I established to perpetuate the original location of this corner.

Left R.R. Spike

Ties:

P.K. Nail in island surface	N61E	31.05 feet
P.K. in power pole	S26E	61.25 feet
Chisled X in sidewalk	s46w	34.60 feet 36.91 feet
Chisled X in sidewalk	N52W	36.91 feet

Dated at Crandon	, Wis., this	30day of	Nov	, 1976
Signature / Nomes Auto (County Surveyor, Register	Titlered Land Surveyor, o	Surveyor or other duly authorized off	Regist	tration NoS-887
Office of Register of Deeds, County of	Bores	t -	, I hereby c	ertify that the within
at 11:30 o'clock AM.		Documen		110646
(Register of Deed	(s)			

176810

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 27 day
of September A.D., 2002 at
9:00 o'clock A.M. and recorded
in Vol. Corner Restoration
page V-5

Kay Suranam, Deput
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - ORIGINAL SURVEY BY JAMES L. NOWLIN JUNE 2 - JUNE 12, 1885.

SUGAR

15° 20°

N29W N77E 20 LINKS 30 LINKS

1972 - THOMAS R. ARNOTT, S-887 STATES IN CERTIFIED LAND CORNER RESTORATION FORM, R.R. SPIKE FOUND

LEFT R.R. SPIKE

TIES:

P.K. NAIL IN ISLAND SURFACE N81'E 31.05 FEE
P.K. IN POWERPOLE S26'E 61.25 FEE
CHISLED X IN SIDEWALK S48'W 34.60 FEE
CHISLED X IN SIDEWALK N52'W 36.91 FEE

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

JCONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


FOUND ABOVE MONUMENT AS RECORDED AT FOREST COUNTY REGISTER OF DEEDS, NOVEMBER 1976, DOCUMENT NUMBER 110846, INDEX NUMBER V5. MONUMENT SUBSEQUENTLY DESTROYED BY CONSTRUCTION REPLACED SEPTEMBER 2002 AS FOLLOWS:

SET MAG NAIL: N 568,607.07 E 835,948.52 WISCONSIN COUNTY COORDINATE SYSTEM "FOREST COUNTY"

SET THE FOLLOWING ACCESSORIES:

REFERENCE MONUMENT N59'31'08"W 52.43
REFERENCE MONUMENT N60'54'37"E 65.87
REFERENCE MONUMENT S37'27'29"E 51.42'
REFERENCE MONUMENT S50'12'05"W 43.08

NORTH

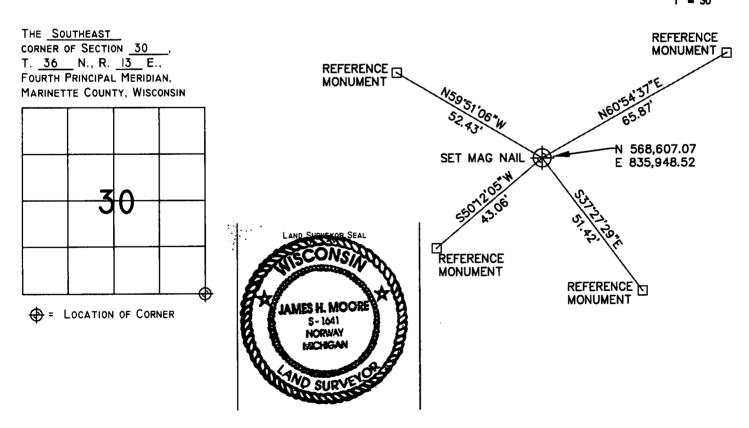

I. JAMES H. MOORE

(TYPE OR PAINT MANA) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED

ME OR UNDER HY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD

IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. V-5

9-25-02

Y-5



178829

REGISTER'S OFFICE Forest County. Wis. Received for record this 18 day
Received for record this /b day
of March A.D., 2003 8
11:15 o'clock A.M. and recorde
In Vol. Corner Restoration
page V-5
Kay Swanson, Deput
Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1885 - ORIGINAL SURVEY BY JAMES L. NOWLIN JUNE 2 - JUNE 12, 1885.

SUGAR 15" N29"W 20 LINKS
SUGAR 20" N77F 30 LINKS

15° 20"

N29W N77E

1972- Thomas R. Arnott, S-887 states in certified land corner restoration form, R.R. Spike found

LEFT R.R. SPIKE

P.K. NAIL IN ISLAND SURFACE P.K. IN POWERPOLE CHISLED X IN SIDEWALK CHISLED X IN SIDEWALK N81E S26E S46W

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

TRESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)


FOUND ABOVE MONUMENT AS RECORDED AT FOREST COUNTY REGISTER OF DEEDS, NOVEMBER 1976, DOCUMENT NUMBER 110646, INDEX NUMBER V5. MONUMENT SUBSEQUENTLY DESTROYED BY CONSTRUCTION REPLACED SEPTEMBER 2002 AS FOLLOWS:


WISCONSIN COUNTY COORDINATE SYSTEM "FOREST COUNTY" SET MAG NAIL: N 568,607.07 E 835,948.52

SET THE FOLLOWING ACCESSORIES:

REFERENCE MONUMENT REFERENCE MONUMENT REFERENCE MONUMENT REFERENCE MONUMENT 52.43° 65.87°

NORTH 1" = 30'

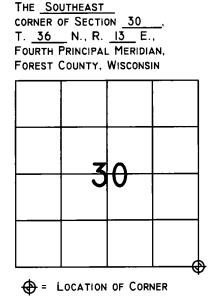

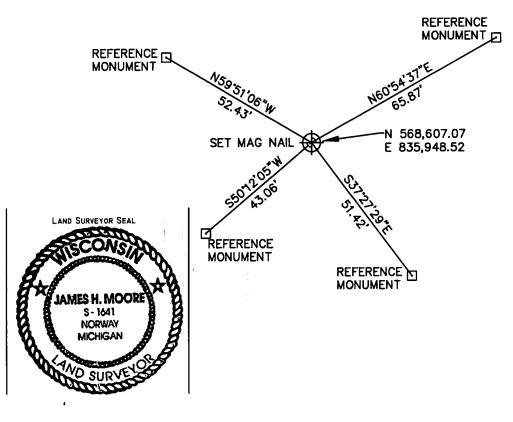

CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY TROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD



171982

REGISTER'S OFFICE Forest County, Wis.
Received for record this a day
9:000 clock A M. and recorded in Vol. Corner Restoration
nage V-07
Kay Swanson, Deput

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES L. NOWLIN, DEPUTY SURVEYOR, SET POST FOR CORNER AND ESTABLISHED 2 BEARING TREES AS FOLLOWS;

SUGAR

N 60W S 60°E

16 LINKS 15 LINKS

1977 - THOMAS R. ARNOTT, SET FOREST COUNTY MONUMENT BY RUNNING LINES BACK IN FROM CITY.

ESTABLISHED THE FOLLOWING WITNESSES:

NE COR CROSSING LIGHT CONTROL BUILDING

29.90 FEET

NW ANCHOR BOLT ON CROSSING LIGHT

55.10 FEET 42.60 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND EXISTING FOREST COUNTY MONUMENT AND UPDATED WITNESSES TO REFLECT CHANGES IN LOCATION OF WITNESS **FEATURES:**

ESTABLISHED THE FOLLOWING WITNESSES:

NE COR CROSSING LIGHT CONTROL BUILDING POWER POLE NW ANCHOR BOLT ON CROSSING LIGHT

S 72' 32' 49"E


29.83 FEET 55.09 FEET

S 06' 13' 17"E

S 88' 02' 37"W

32.69 FEET 4.42 FEET

FOUND NAIL AND DISC IN RAILROAD TIE S 15' 16' 39"W

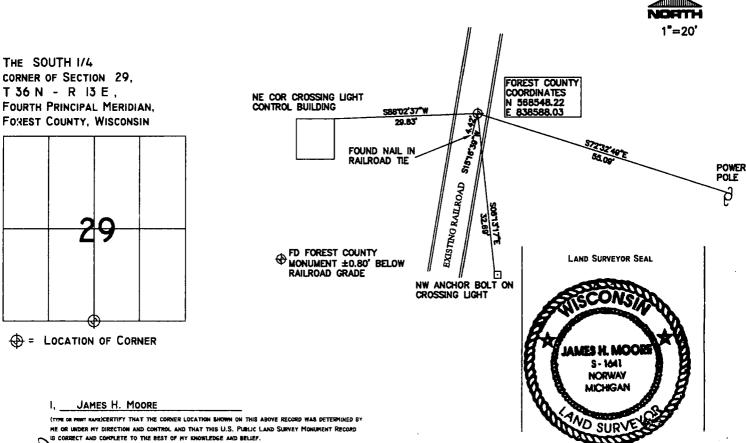

INDEX NO.

= Corner monument restored.

State of Wisconsin

SS.

FRTIFIFD	CORNER	RESTORATION

Index No.

History of original corner establishment:

Original survey by James L. Nowlin June 2 - June 12, 1865

Birch 14 N60W 16 1ks. Sugar 12 S60E 15 1ks.

Description of corner evidence found:

None; in middle of R.R.

Reset post by running lines back from in the city.



Description of monument and accessories I established to perpetuate the original location of this corner.

Set Forest County Alu. Mon. at 1/4 location below R.R. grade.

Ties:

NE cor crossing light control building S85W 29.90 feets
Power pole S76E 55.10 feet
NW anchor bolt on crossing light S4E 42.60 feet

Dated at Crandon	., Wis., this2nd	day of November	, 19.77
Signature Thomas C. News	Title Surveyor	Registration	
(County Surveyor, Registere	ed Land Surveyor, or other duly au	thorized official)	•
Office of Register of Deeds, County of	Forest	I hereby certify	that the within
Office of Register of Deeds, County of instrument was filed in this office for reco	ord on the 310	day of November	
at / M. M.			
(Register of Deeds	Deputy		

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


(a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

Section ¢orner 28, 29, 32 &33 T36N, R13E

REGISTER'S OFFICE | +L
Forest County, Wis.

Received for record this. 30 day
of Consulty A.D., 19.84 at
8:36 o'clock M.M. and recorded
in Vol. of CORNER
page V-9 RESTORATIONS
Register of Deeds

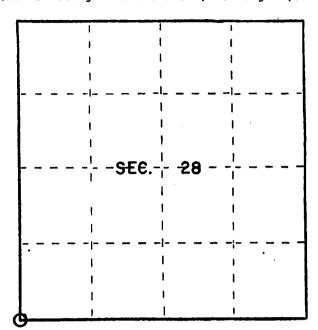

b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found fence corner and old iron pipe.

Replaced iron pipe with Forest County Aluminum monument.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

 Describe witness monuments.
- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

DOCUMENT NO. 125073

12"MAPLE

B"MAPLE

B"MAPLE

S56W

FOREST CO. ALU. MON. SET

W. C. C. ALU. MON. SET

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location.

(g&h) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NO

(i) I. Thomas R. Arnott. Surveyor (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature R. Accord

27 Jan 89

Affix Land Surveyor Seal

THOMAS R.

ARNOTT

S-887

CRANDON

WIS.

SURVEYOR

OR OF THE STREET OF THE

ERTIFIED	LAND	CORNER	RESTORATION


		V	1	
Index	No	, .		•

State of Wisconsin

County of Forest ss.

I Thomas Arnott ,, do hereby certify that on the 14th day of May , 19.76 , I found evidence of the 144

Resident witnesses:

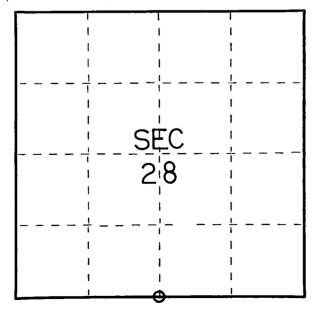

O = Corner monument restored.

History of original corner establishment:

Original subdivision by James Nowlin 2 June - 12 June, 1865

 Sugar
 8
 \$60E
 6 ? Lks.

 Sugar
 12
 \$N\(\pm\)8W
 30 Lks.

Description of corner evidence found:

Used ROW plat to locate corner



Description of monument and accessories I established to perpetuate the original location of this corner.

Set 5/8" rebar pin in road

Ties:

Forest County Aluminum Monument S48E 50.38 feet guy pole S46W 43.32 feet power pole (3613-28L12) N55W 39.67 feet

Dated at	Crandon	, Wis., this		day ot	Мау	·, 19 76
Signature. 7	County Surveyor, Registe	Title	Surve	yorauthorized official)	Registration No. S=887
instrument was	s filed in this office for rec	For cord on the	est 14th	day of	, I he	reby certify that the withing, 19.76.
	OCK P. M. (Register of Deed	my		Document	No.	109223
Ву	(Register of Deed	7 /	Deputy			

ı		
l		
l		
ì		

FRTIFIFD	IAND	CORNER	RESTORATION

Index No. V 13

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

15 15 Hemlock 6 Lks. N35E 16 Lks. Sugar

Description of corner evidence found:

2" iron pipe 5' long with brass cap offset 33 feet east of corner. set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker set BR spike at location of corner

Ties:

37.86 feet power pole (3613-27L1) N50E 33.00 feet Walker monument East SLI6W 49.05 feet road sign

Dated at Crandon , Wis., this 30th day of October , 19.75

Signature Title Land Surveyor Registration No. S=887

(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 30th day of October 1975 at lo'clock lo M.

..... Document Number

108113

O = Corner monument restored.

State of Wisconsin

Thomas R. Arnott , do hereby

certify that on the 15th day

of September , 19 , I found

corner of sections 27, 28, 33 & 34 Township.........., North, Range 13 E Fourth Principal Meridian,

as described hereon; and that from this evidence I established a new monument and accessories

as described hereon to perpetuate the original

Herbert Wagoner

evidence of the section

County of Forest

location of this corner.

Resident witnesses:

SS.

THOMAS R ARNOTT S-887

43613280000

WIND SURVEYS

State of Wisconsin

O = Corner	monument	restored
------------	----------	----------

CERTIFIED LAND CORNER RESTORATION

Index No. V 15

108573

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1864

Spruce 4 N10E 5Lks.
Spruce 5 S50E 14 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938 Wood post found

Description of monument and accessories I established to perpetuate the original location of this corner. Left monument set by Walker Ties: THOMAS R ARNOTT N26E 12.11 feet Spruce 5-887 S70E 25.22 feet Spruce N50W 32.20 feet Spruce WIS MINIMANIAN SURVEY Wis., this 15th day of January 19.76... Crandon Dated at..... (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 15th day of January 19.76. at 3 o'clock P. M.

Document Number

Thomas R. Arnott , do heretify that on the			Wiscons Forest		} ss.
rowner of sections 26, 27, 34, 8 Township 36, Fourth Principal Mer as described hereon; and that from this evi I established a new monument and access as described hereon to perpetuate the or ocation of this corner. Resident witnesses: SEC					
Corner of Sections 26, 27, 31, 8 Township 36 , North, I 13 E , Fourth Principal Mer as described hereon; and that from this evi I established a new monument and acces as described hereon to perpetuate the or ocation of this corner. Resident witnesses: SEC	ofJ evidenc	anuar;	ysectio	, 19 on	7.6, I f
13 E Fourth Principal Mer as described hereon; and that from this evil established a new monument and access as described hereon to perpetuate the or ocation of this corner. Resident witnesses: SEC	corner o	of sect:	io as 26,	27.	34&:
Restablished a new monument and access described hereon to perpetuate the or ocation of this corner. Resident witnesses:]	.3E	, Fourth	Princip	oal Meri
Resident witnesses:	I estab	lished a	new monun	nent an	d access
				petuate	the or
	Resider	nt witness	ses:		
				,	•
SEC : 26		T I	·		
SEC		1	·		
SEC : 26 :		1 1 1 - 1 - 1	·		
SEC		1 1 1 - 1 - 1	·		
2.6			·		
			·		
			SEC		
 			SEC		
			SEC		
			SEC		

O = Corner monument restored.

ERTIFIED LAI	ND CORNER	RESTORATION
--------------	-----------	-------------

History of original corner establishment:

Original Subdivision by James Nowlin June 2 - June 12, 1865

36 Lks. 37 Lks. N41E N33W Sugar 10 18 Sugar

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938 Tios:

Description of monument and accessories I established to perpetuate the original location of this corner.


Left monument set by Walker

Ties:

Maple	6
Maple	16
Maple	6

N17E S51W S79W

7.12 feet 26.43 feet 31.57 feet

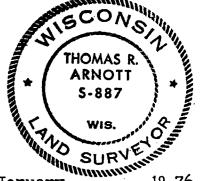

Dated at Crandon	, Wis., this 15th	day of	anuary 1976
Signature home Almo	V I	vor	
Office of Register of Deeds, County of instrument was filed in this office for r	ecord on the	t, 15th day of	I hereby certify that the within January
Lugene States	ns	Docum e nt N	umber 108574

State	of Wisco	onsin	
County of	Forest		ss.
certify that of Janua evidence of toorner of SS Township 13 E as described I established	the 1/2 ctions 36 hereon; and la new mo	Arnott, 7th	day D., I found tth, Range Meridian, s evidence accessories
Resident wit	nesses:		
		······································	
	••••••		
	' 		
		-	
	SE	EC	
	2	6	
	_	1 1	
	-	-	
	· 	· ·	

O = Corner monument restored.

CERTIFIED	CORNER	RESTORATION

Index No. V 19

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

Hemlock 10 N2W 4 Lks. Sugar 12 S2E 28 Lks.

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple Maple nse s80e 32.10 feet 21.15 feet

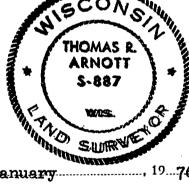

Dated at Crandon	, Wis., this	9th	day of	anuary	1976.
Signature (County Surveyor, Regis	Title Stered Land Surveyo	Surveyo	or uthorized official)	Registra	ntion No. S-887
Office of Register of Deeds, County of instrument was filed in this office for	f Fo:	rest		., I hereby cer	tify that the withir
at 11 o'clock M.	- my		Document	Number	108538

By......Deputy

189310

REGISTER'S OFFICE
Forest County. Wis.

Received for record this 18 day of 100 ember A.D., 2005 at 3:550'clock 1 M, and recorded in Vol. Corner Restoration page V-19

Kay Swanson Deput

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES L. NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: HEMLOCK 10" N02°W 4 LINKS SUGAR 12" S02°E 28 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
MAPLE 6° N05°E 32.10 FEET
MAPLE 8° S80°E 21.15 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

□RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE W/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:

SUGAR MAPLE 8" N19°E 33.41 FEET - SET D.H. NAIL IN TREE. SUGAR MAPLE 9" S80°E 20.94 FEET - SET D.H. NAIL IN TREE. SUGAR MAPLE 6" S32°W 30.11 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:

SUGAR MAPLE 9" S69"W 20.54 FEET - SET D.H. NAIL IN TREE.


ALL TREES HAVE CHEST & STUMP BLAZES.

THE NORTH 1/4


CORNER OF SECTION 35

T. 36 N., R. 13 E.,

FOREST COUNTY, WISCONSIN

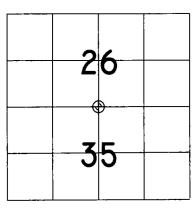

= LOCATION OF CORNER

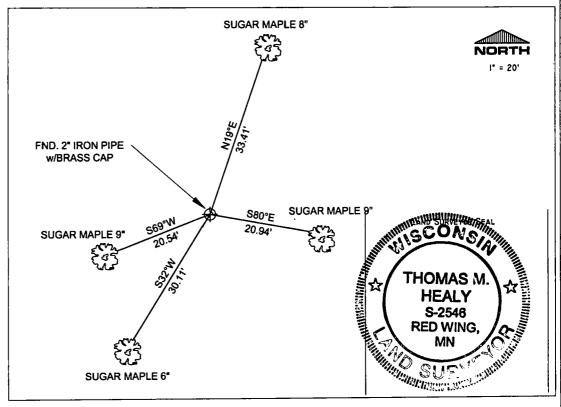

THOMAS M. HEALY R.L.S. 2546

(TYPE OR PERHT MANY)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY
ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD
IS CORDERY AND COMPLETE TO THE REST OF MY KNOWLEDGE AND SELIEF.

Th. H. Hand 11-17-05

INDEX No. V-19

	I AAID	CODNIED		
F D 1 (F1F1)	1 4 13111	THUNED		
	LAIND	COMITEIN	RESTORATION	

Index No. V 21

ARNOTT S-887

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

 Sugar
 10
 N23E
 13 Lks.

 Hemlock
 12
 S67W
 16 Lks.

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E.Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left	monument	set 1	by Walker		
lies:	Maple Mapke Ash		10 6 8	ng gw N16E S60W	34.60 fe 29.08 fe 25.47 fe

Dated at Crandon	, Wis., this 15th .	day of D o	ecember	, 19. 75
Signature / Roma Auco (County Surveyor, Regist	Title Land Surveyor, or other d	yoy uly authorized officia	Regis	stration No\$-887
Office of Register of Deeds, County of instrument was filed in this office for r	Forest		, I hereby o	ertify that the within
at 11 o'clock A. M.	gn11	Document	Number	108377

By......Deputy

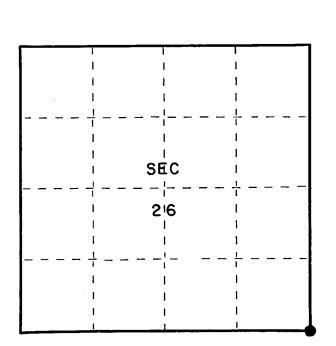

O = Corner monument restored.

State of Wisconsin

I Thomas R. Arnott , do hereby

certify that on the 5th day of December , 19.75, I found

corner of sections 25, 26, 35, & 36 Township 36, North, Range

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

..... Fourth Principal Meridian,

evidence of the Section

County of Forest


location of this corner.

Resident witnesses:

SS.

Document Number

189323

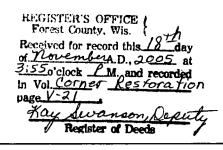

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: SUGAR 10" N23°E 13 LINKS HEMLOCK 12" S67°W 16 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1975 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
MAPLE 10" N89"W 34.60 FEET
MAPLE 6" N16"E 29.08 FEET
ASH 8" S60"W 25.47 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

☐RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

SET THE FOLLOWING WITNESSES:

 WHITE ASH 9"
 N86°E
 8.12 FEET - SET D.H. NAIL IN TREE.

 SUGAR MAPLE 8"
 S01°E
 11.81 FEET - SET D.H. NAIL IN TREE.

 WHITE ASH 10"
 N36°W
 13.06 FEET - SET D.H. NAIL IN TREE.

 SUGAR MAPLE 5"
 S70°W
 5.32 FEET - SET D.H. NAIL IN TREE.


ALL TREES HAVE CHEST & STUMP BLAZES.

THE NORTHEAST


CORNER OF SECTION 35

T. 36 N., R. 13 E.,

FOREST COUNTY, WISCONSIN

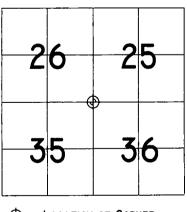

= LOCATION OF CORNER

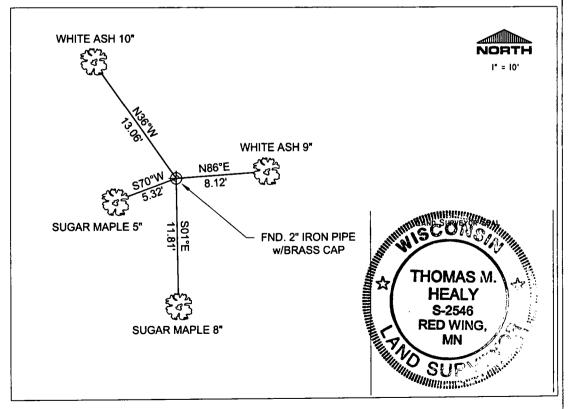

THOMAS M. HEALY R.L.S. 2546


(TYPE OR PRINT NAME) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

JZ M. Hand 11-17-05

INDEX NO. V-21

Document Number

189321

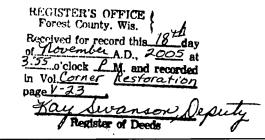

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: BIRCH 30" N32"W 15 LINKS SUGAR 8" S60°E 18 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1975 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
MAPLE 6" N36"E 4.74 FEET
YELLOW BIRCH 12" S46°E 13.05 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☑RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


SUGAR MAPLE 6° N09°E 16.30 FEET - SET D.H. NAIL IN TREE. SUGAR MAPLE 12° N47°E 5.37 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


SUGAR MAPLE 6" \$78"W 18.49 FEET - SET D.H. NAIL IN TREE. ASPEN 3" \$13"E 8.30 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTH 1/4 CORNER OF SECTION 25 T. 36 N., R. 13 E., FOREST COUNTY, WISCONSIN

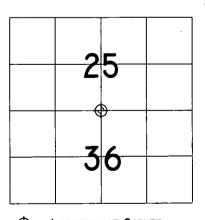

= LOCATION OF CORNER

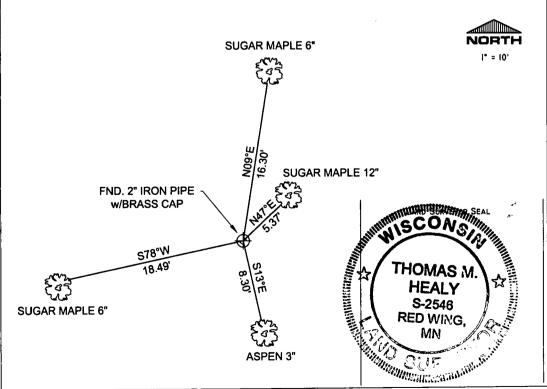

THOMAS M. HEALY R.L.S. 2546

(TYPE OR PERMITHANE)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY TYPE OF PROFILE THE THE CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

INDEX No. ____V-23

Resident witnesses:

location of this corner.

State of Wisconsin

corner of sections 25 & 36

I Thomas R. Arnott do hereby

certify that on the 5th day of December , 19.75, I found evidence of the 1/4

Township 36 North, Range

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

....... Fourth Principal Meridian,

County of Forest.

SS.

O = Corner monument restored.

Index Nb. W23

History of original corner establishment:

Original subdivision by James L. Nowlin June 2 - June 12, 1865

B**irch** Sug**ar** 30 8

N3*2*W S60E

18 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple Y. Birch 6 12 N36E S46E

4.74 feet 13.05 feet THOMAS R.
ARNOTT
S-887
WIS.
SURVENIENTERS

Dated at Crandon	Wis., this	15th	day of	December	, 19 7 .
	_	•	-		•

Signature Thomas Auso Title Land Surveyor Registration No. S-887.
(County Surveyor, Registered Land Surveyor, or other duly authorized official)


(Register of Depts)

Document Number

_____Dep

Decument Number

189309

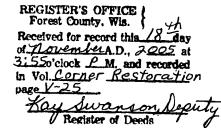

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - ALFRED MILLARD, SURVEYOR, SET POST

SET THE FOLLOWING WITHESSES: IRONWOOD 8" N64"E 22 LINKS SUGAR 12" S33"W 53 LINKS SUGAR 18" \$688"E 14 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1975 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
MAPLE 10" N29"W 13.27 FEET
ASH 8" N34"E 22.48 FEET
MAPLE 12" S55"W 41.67 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

□RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:

WHITE ASH 13" N40°E 22.62 FEET - SET D.H. NAIL IN TREE.
SUGAR MAPLE 12" S55°W 41.26 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


 SUGAR MAPLE 6*
 S23*E
 11.44 FEET - SET D.H. NAIL IN TREE.

 SUGAR MAPLE 12*
 N40*W
 17.20 FEET - SET D.H. NAIL N TREE.


 STEEL SIGN POST
 S02*W
 2.26 FEET

ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTHEAST
CORNER OF SECTION 25
T. 36 N., R. 13 E.,
FOREST COUNTY, WISCONSIN

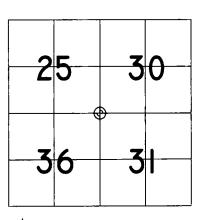

= LOCATION OF CORNER

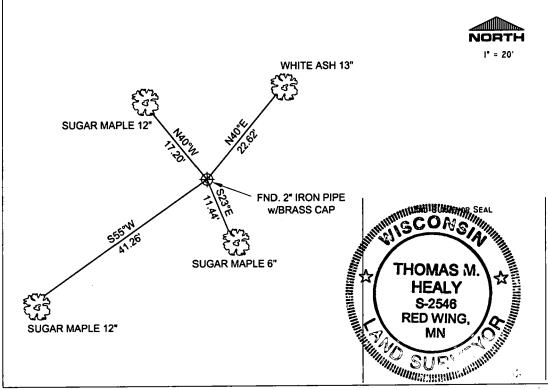

THOMAS M. HEALY R.L.S. 2546

(TYPE OR PRINT MANE) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

H M. Hand 11-17-05

INDEX No. _____V-25

State of Wisconsin	State	of	Wisconsin
--------------------	-------	----	-----------

Otato	•••••••••••	SS.	
ounty of	Forest]	

I Thomas R. Arnott do hereby
certify that on the 5th day
of December , 19.75 , I found
evidence of the Section
corner of sections 25,36, 30 & 31
Township 36, North, Range
13 - 14 E, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:	

	! •	,
	i i	
	l	
	l !	1
l	! ! :	ļ
	1	1
	1	I
	t I	1
	SEC	1
	1	
	3,6	ι
	1 2/0	1
	1	1
	1	1
	i	
	r ₁ -	
ļ	l I	1
	1 [-	1
1	I i	ı
		1

O = Corner monument restored.

History of original corner establishment:

Eronwood	8	N6 ЦЕ	22 Lks.
Sug ar	12	nôw	25 Lks.
Sugar	12	533W 568E	53 Lks. 14 Lks.
Sugar	18	S68E	lų Lks.

Description of corner evidence found:


2" iron pipe 5' long with brass cap set by C.E.Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left moument set by Walker

Ties:

Maple	10	N29W	13.27 feet
Ash	8	n34 е s55w	22.48 feet 41.67 feet
Maple	12	S55W	41.67 feet

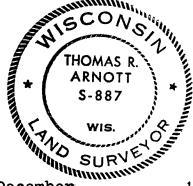

Dated at Crandon	, Wis., this	day of December	, 19. 75
Signature homes According (County Surveyor, Registere	,		
Office of Register of Deeds, County of	Forest	, I hereby certify	that the with
instrument was filed in this office for reco	ord on the 15th	day of December	19 7 !
at 11 o'clock A. M.		Document Number	

(Register of Deeds)

Deputy

COCHRANE

S-1107 HILES. WISCONSIN

State of Wise	
County of Fores	
Township	chrane , do hereb 28 th da
Resident witnesses:	. Cochrane
	E. Statezny

= Corner monument restored.

History of original corner establishment:

Surveyed in 1864 by James L. Nowlin

From the 14 corner between sections 5 and 32 on the township line, North with % section line 55.00 chains, then West 40.00 chains to line between sections 31 and 32 and at North side of lake set Meander Corner post.

- Y. Pine, 15", N 64° E, 15 links Y. Pine, --, N 83° W, 17 links

Description of corner evidence found:

No evidence of the original corner was found. From the section corner common to sections 29, 30, 31, and 32 measuring South and using the center line of the city street determined from measurements between the side-walks, I was able to re-establish the location of this corner.

At the corner position I set a 2½ inch diameter aluminum pipenning

T36N R13E, S31, S32, 1980, S-1107, MEANDER CORNER

No accessories were available.

The section corner common to sections 29, 30, 31, and 32 bears North 2° 34' 10" West, 1626.8 feet.

					80-
Dated atHiles					
ignature William B. Cos (County Surveyor, R	Maueritle La egistered Land Surveyor	nd Survey or other duly aut	orhorized official)	Registration No.	-1107
Office of Register of Deeds, County	of Fo	rest	, I he	reby certify that th	he within
nstrument was filed in this office for	or record on the	19th	day of Dec	ember	, 1980
$t^{11:30}$ o'clock $\stackrel{A}{\longrightarrow} M$.					
Legent Sto	anne	•••••	DOCUMENT NO.	119137	
7 (Register of	Deedk) 7 /)				

State	of Wisc	onsin]
County of	Forest	•••••	} ss.
certify that of Sept evidence of corner of 13 E as described I establishe	on the the West Section 36 hereon; and the decimal to the terms of the	28 th 19 8 Quarter 31 , N urth Princip I that from tonument and	Jorth, Range al Meridian, his evidence the original
Resident wi	tnesses:		
<u>r</u>	liles H.	Cochran	.e
I	ennis E	Statez	yy
	1		
	 	I :	
	 <u> </u>	i	
	! !		
	 _ Sec.	i ¦_ 31	 -
Ī	1 1		
	 	 	
	I I	, , [

= Corner monument restored.

	ERTIFIED	LAND	CORNER	RESTORATION
--	----------	------	--------	-------------

COCHRANE

S-1107

HILES.

WISCONSIN

History of original corner establishment:

North between sections 31 and 36. 40.00 chains set % section master section and section an

Hemlock, 10", N 42° W, 22 links Elm, 12", S 82° E, 17 links

Description of corner evidence found:

North-South gravel road. Fence line west. Iron pipe buried below the road surface. No original evidence could be recovered. This position was tied into the subdivision of section 31 and found to agree with other measurements.

Description of monument and accessories I established to perpetuate the original location of this corner.

I set a reference monument N 89° W, 29.70 feet from the corner.

The reference monument is a 2½ inch diameter aluminum pipe, 30 inches long, with a Forest County aluminum cap stamped: T36N, R12E, R13E, 14, S31, S36, 1980, S-1107, REFERENCE MONUMENT A power pole #3613-31L6, bears N 46° E, 41.97 feet from the corner.

Dated at	Hiles	, Wis., tl	is 8 t	h	day of	Decembe	r , 19 80 .
	Illian B. Con	Irane Titl	_e Land	Sur	veyor	R	egistration No. S-1107
	(County Surveyor,	Registered Land St	rveyor, or o	ther duly	y authorized of	ncial)	
Office of Reg	gister of Deeds, Coun	ty of	ores c			, I herel	by certify that the within
instrument v	was filed in this office	for record on th	e19	th	day o	f Decemb	er , 19 80
V	, ,						by certify that the within er 19 80
By (Register	of Deedid		Denuty			-20100

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

1/4 Corner 32 & 33 T36N, R13E

REGISTER'S OFFICE


Forest County, Wis.

Received for record this 30 day

of 200 day

RESTORATION

Register of Deeds

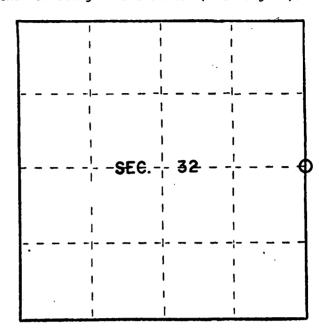

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

No evidence found. Single proportionate distance used for new location.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

 Describe witness monuments.
- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

6"W. BIRCH N88W STRE 42.26' 11"W. FINE

TOERST CO. ALU. MON. SET

8" W. BIRCH

8" W. BIRCH

SE'COR

SEC 32

125074

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

N/A

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Single proportionate distance.

(g&h) was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

Single proportionate distance. See (d) for method .

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Thomas R. Rust

27 An 184

Affix Land Surveyor Seal

BOOKS THOMAS R.

ARNOTT

S-887

CRANDON

WIS.

SURVEYOR SEAL OF THE SEAL OF

Index No. X 13

June 2 - June 12, 1865

Document Number 108114

instrument was filed in this office for record on the 30th day of October 1975

43 Lks. 30 Lks.

CERTIFIED LAND CORNER RESTORATION

Original subdivision by James L. Nowlin

History of original corner establishment:

Birch

Birch

Ties:

Dated at.....

0ak

Maple

_____**1**.o'clock......

(Register of

State of Wisconsin County of Forest ss.
I Thomas R. Arnott , do hereby certify that on the 15th day of September , 19.75 , I found evidence of the 1/4 corner of sections 33 & 34 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.
Resident witnesses:
Herbert Wagoner

!		. 1
- -		-
 	<u>S</u> EC	
) 	
 -	· - -	-

O = Corner monument restored.

County of	Fores	d t		ss.
IThomas certify that of	on the 7th 14 the 1/2 ctions 36 chereon; and 1 a new mo hereon to his corner.	h 34 & 11 & 11th Pr that fi	197	da., I found tth, Rang Meridian s evidence
1	1	I	1 1	
	SE	 	 -	
1	3	4 - -	1 1 1 1	
O = Corner	r monument	l l ! ! restor	 ed.	

State of Wisconsin

ったりせっこうり	I ARID		RESTORATION
. F R I (FIFI)	IAINII	CURINER	RESTURATION

ARNOTT

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

N40E N38W Hemlock Birch

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

THOMAS I

ARNOTI

5-887

Description of monument and accessories I established to perpetuate the original location of the corner.

Ties:

Balsam	10	N1 3E	12.09 feet
Maple	6	S 88E	13.63 feet: 18.02 feet
Balsam	10	s64w	18.02 feet

Dated at Crandon	, Wis., this	9th day of.	January	1976.
Signature County Surveyor,	Title Si Registered Land Surveyor,	1rveyor or other duly authorized	Regist	tration Nos_887
Office of Register of Deeds, Cour instrument was filed in this office at M M	for record on the	9thday	, I hereby c	ertify that the within ary 1976.
Lugene State (Register	of Deeds	Docum	ent Number	108539



189312

REGISTER'S OFFICE Forest County, Wis. Received for record this 18 day of 11 overwers D., 2005 at 3:550'clock 1 Mp and recorded M and recorded
Restoration In Vol. Corner page X- /7 Kay

Register of Deeds

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES L. NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: HEMLOCK 15" N40"E 4 LINKS BIRCH 8" N38"W 35 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
BALSAM 10" N13"E 12.09 FEET
MAPLE 6" S88"E 13.63 FEET
BALSAM 10" S64"W 18.02 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

©RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE w/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


MAPLE 12" N22°E 37.49 FEET - SET D.H. NAIL IN TREE. TWIN MAPLE 10" N89°E 13.86 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


SUGAR MAPLE 6" \$45°E 25.47 FEET - SET D.H. NAIL IN TREE. BALSAM 11" \$52°W 18.07 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE WEST 1/4 CORNER OF SECTION 35 T. 36 N., R. 13 E., FOREST COUNTY, WISCONSIN

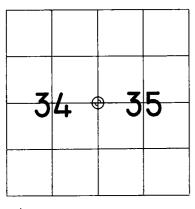

= LOCATION OF CORNER

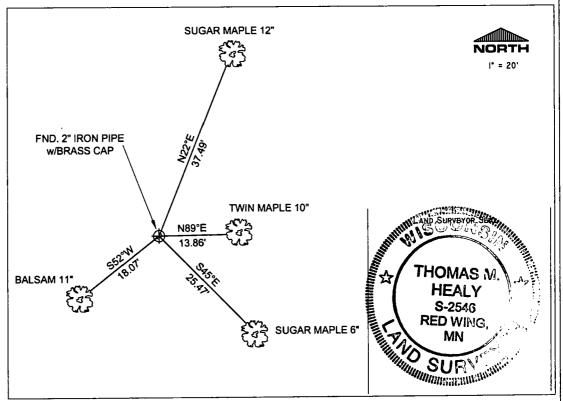

THOMAS M. HEALY R.L.S. 2546

X-17 INDEX NO.


43613342000

State of Wisconsin

County of Forest ss.

I Thomas R. Arnott , do hereby certify that on the 28th day of January , 19.76 , I found evidence of the 1/4 corner of sections 35 & 36 Township 36 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

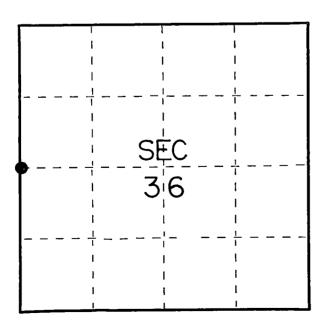

O = Corner monument restored.

History of original corner establishment:

Original subdivision by James Nowlin June 2 - June 12, 1865

Tamarac 12 N21E 125 Lks.
Tamarac 10 N9W 100 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938 Wood Post found

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

B. Spruce

4 4 N7W N53E 34.01 feet

ARNOTT 5-887


WIS.


WIS.

ORVETORS

Dated at Crandon	, Wis., this	2nd	day of	.Febuary	. 1976
Signature / homos Dinot	Title	Surveyor		Registrati	on No. S. 887
(County Surveyor, Registered	d Land Surve	yor, or other duly	authorized officia	1)	
Office of Register of Deeds, County of	E	orest		, I hereby certify	y that the within
instrument was filed in this office for reco	rd on the	2nd	day of	Febuary	
at o'clock A.M.					4.00.000
Eugene States	nil		Document	Number	108672

By.....Deputy



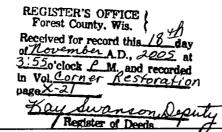

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1865 - JAMES NOWLIN, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES: TAMARACK 12" N21"E 125 LINKS TAMARACK 10" N09"W 100 LINKS

1938 - C.E. WALKER, FOUND WOOD POST. SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES:
BLACK SPRUCE 4" N07°W 34.01 FEET
BLACK SPRUCE 4" N53°E 47.70 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

☑RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

□RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2" IRON PIPE W/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


BLACK SPRUCE 5" N02"W 34.15 FEET - SET D.H. NAIL IN TREE. BLACK SPRUCE 5" N59°E 47.80 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


BLACK SPRUCE 4° S13°W 34.84 FEET - SET D.H. NAIL IN TREE. BLACK SPRUCE 4° N85°W 10.73 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE EAST 1/4 CORNER OF SECTION 35 T. 36 N., R. 13 E., FOREST COUNTY, WISCONSIN

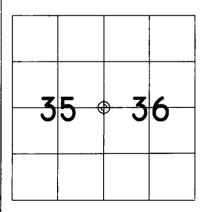

= LOCATION OF CORNER

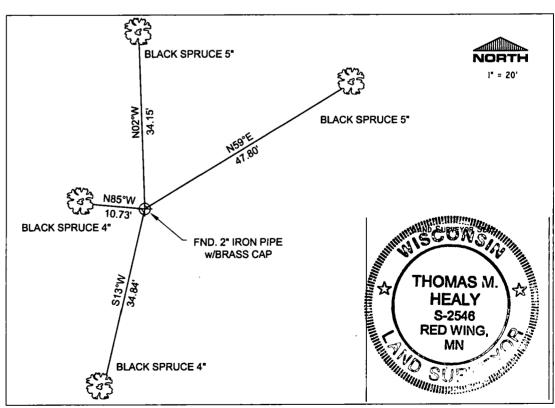

THOMAS M. HEALY R.L.S. 2546 (TYPE OR PRINT MANE)CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY

INDEX No. X-21

VECTICIED.	LAND			
'L D 1 1 L L L 1 1	1 (1)	THUNED		
	LAIND	COMILIA	RESTORATION	

			Ŀ
Indov	ماھ	X-25	
HIGEX	110.		

State of Wisconsin History of original corner establishment: SS. County of Forest

I Thomas R. Arnott do hereby certify that on the 5th day of December , 19.75., I found

Township 36, North, Range 13 - 14 E., Fourth Principal Meridian,

as described hereon; and that from this evidence

I established a new monument and accessories

as described hereon to perpetuate the original

corner of sections 31 & 36

evidence of the 1/1

location of this corner.

Resident witnesses:

emlock	12	N65W	38 Lks.
emlock	10	\$85E	22 Lks.
	0		

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E. Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Ties:

Maple:	
Maple	

17.18 feet



_	_	_	_		
-	_	_	1		
			_	•	

O = Corner monument restored.

Dated at	Crandon	.,,Wis., this	day of	December	, 19 7,5 .
_	homes Dust	Title Land Surv	eyor	Registra	ation No. S-887
_		d Land Surveyor, or other duly			
Office of Re	gister of Deeds, County of	Forest		, I hereby cer	tify that the withi
instrument	was filed in this office for reco	ord on the15th	day o	f December	
at 11 c	o'clock				
2			_		400
\mathcal{L}	and my so hate	1MAX	. Docume	nt Number	10830

FOREST COUNTY, WI CORTNEY BRITTEN CLEEREMAN REGISTER OF DEEDS RECEIVED FOR RECORD

MAY 13 2021

Time: L: 00 P M.
Vol. Corner Responding
Page Number: Z - 3

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Note: This form is intended and designed to fulfill all requirements of the Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added if necessary to conform with said requirements.

(a) CORNER LOCATION:

Meander Comer on the south line of

Section 31, westerly shore of Lake Metonga

Township 36 North

Range 13 East

Town of Lincoln County of Forest

Wisconsin

COORDINATES

North:

Control Station:

Latitude:

Longitude: Datum:

Method:

(b) HISTORY OF ORIGINAL CORNER ESTABLISHMENT

Original Surveyor: Alfred Millard; set meander post

Date of Survey: Commenced - May 1858

Completed - June 1858

Original B.T.'S - 18" Yellow Pine; S15°W; 80 links

- 18" Yellow Pine; N40°E; 127 links

AKE


SECTION 31

(f)(g)(h) DESCRIPTION OF MONUMENT FOUND AT THIS CORNER AND IF IT WAS ACCEPTED, STATE ALL EVIDENCE (MATERIAL, TESTIMONIAL, OCCUPATIONAL, PLATS, RECORDS, OTHER MONUMENTS) USED AS A BASIS FOR ESTABLISHING LOCATION. IF NOT ACCEPTED OF IF NOTHING WAS FOUND, STATE EVIDENCE USED AS BASIS FOR ESTABLISHING LOCATION. IF REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS, INDICATE ALL MONUMENTS, DISTANCES AND DIRECTIONS USED TO ESTABLISH. INDICATE TYPE OF MONUMENT AND SIGN POST FOUND OR SET.

October 9, 2007 - Michael A. Treml, Registered Land Surveyor No. S-2197, notes an "existing 1-1/2" iron pipe" for the Meander Corner on his Dwg. No. 743-07.

September 2, 2010 - I, James D. Rein, Registered Land Surveyor No. S-1234, found a 2.0" O.D. iron pipe near the westerly shore of Lake Metonga and accept its location as said Meander Corner. I made four (4) new scribed bearing trees as shown in the sketch below.

(c)(d)(e) PLAN VIEW OF CORNER WITH TIES TO AT LEAST 4 WITNESS MONUMENTS. IF IN DISAGREEMENT WITH PREVIOUSLY ESTABLISHED CORNER, SHOW THE DISTANCE BETWEEN THE TWO CORNERS AND ALSO INDICATE THE TIES TO THE DISPUTED CORNER.

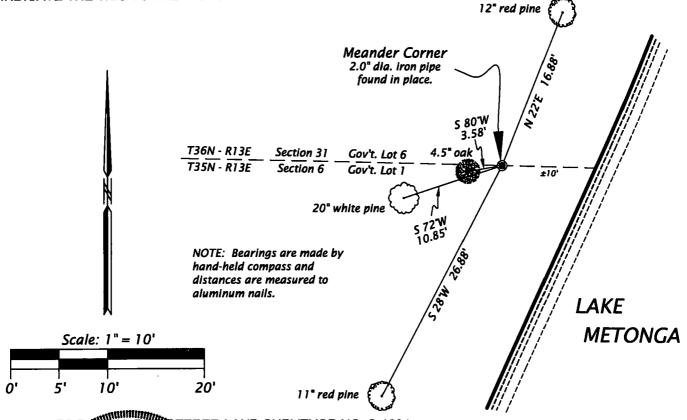

(i) I, JAMES CONTROL OF THAT THE TEND LAND SURVEYOR NO. S-1234
HEREBY CONTROL OF THAT THE CORD OF THAT THE SUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND CREEK AND

BELIEFE S-1234


Nov. 2nd, 2010

43613310020

NDEX NO. \



189324

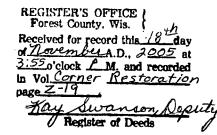

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(AS REQUIRED BY S. A-E 5.02, WI ADM. CODE)

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATIONS AND DESCRIPTION OF ANY RECORD, MONUMENT, OCCUPATIONAL, TESTIMONIAL, OR OTHER EVIDENCE CONSIDERED:

1858 - ALFRED MILLARD, SURVEYOR, SET POST

SET THE FOLLOWING WITNESSES:
YELLOW BIRCH 12" N58"W 31 LINKS
HEMLOCK 24" S20"W 5 LINKS

1938 - C.E. WALKER, SET 2" IRON PIPE 5' LONG WITH BRASS CAP.

1976 - THOMAS R. ARNOTT, SURVEYOR, S-887, FOUND MONUMENT SET BY C.E. WALKER.

SET THE FOLLOWING WITNESSES: MAPLE 8" N56"W 12.66 FEET MAPLE 8" N79°E 30.56 FEET

CORNER WAS: (CHECK ALL THAT APPLY)

☐RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED LOCATION

□RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION

CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDING A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)

RESTORED OF REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OF REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THIS CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)

FOUND 2° IRON PIPE W/BRASS CAP.

FOUND THE FOLLOWING WITNESSES:


SUGAR MAPLE 12" NORTH 28.77 FEET - SET D.H. NAIL IN TREE. SUGAR MAPLE 11" N82"E 30.62 FEET - SET D.H. NAIL IN TREE.

SET THE FOLLOWING WITNESSES:


SUGAR MAPLE 7° N47°E 25.46 FEET - SET D.H. NAIL IN TREE. SUGAR MAPLE 6° S33°W 6.87 FEET - SET D.H. NAIL N TREE. SUGAR MAPLE 7° N33°W 6.29 FEET - SET D.H. NAIL IN TREE.

ALL TREES HAVE CHEST & STUMP BLAZES.

THE SOUTH 1/4 CORNER OF SECTION 35 T. 36 N., R. 13 E., FOREST COUNTY, WISCONSIN

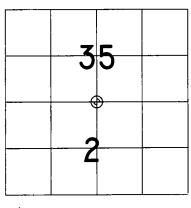

= LOCATION OF CORNER

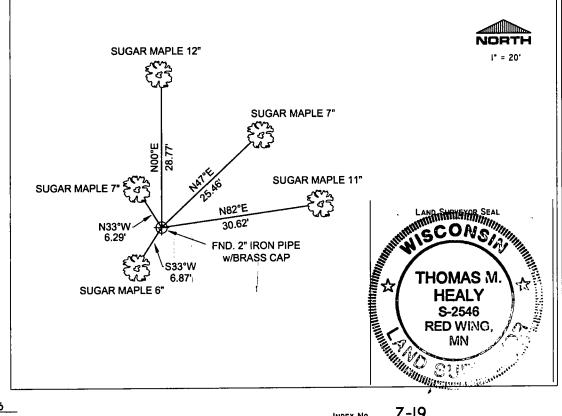

THOMAS M. HEALY R.L.S. 2546

THE CORNER LOCATION SHOWN ON THIS ABOVE RECORD WAS DETERMINED BY CONTROL AND THAT THIS U.S. PUBLIC LAND SURVEY MONIMENT RECORD HE BEST OF MY KNOWLEDGE AND BELIEF.

Z-19 INDEX No. ___

43413350020

:FRTIFIFD	LAND	CORNER	RESTORAT	ION

Index No. 2223

State of Wisconsin SS.

Forest County of.....

I Thomas R. Arnott, do hereby certify that on the 5th day of December , 19.75., I found evidence of the....1/1. corner of sections 1 & 36 Township 35-36 North, Range E Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original

Resident witnesses:	

location of this corner.

1		ł	ı
1		l	1
!		i	I
	I	1	I
		,- -	T
i		1	I
1	1	ı	ı
	C.	T.C	1
•	51	ĮC.	
		; ·	†
i .	3	16	1
		1	,
i			
		I	ı
	 	!	
	•		
	I	ı	1
	l	l	1
	I	i	1
			<u> </u>

O = Corner monument restored.

History of original corner establishment:

Y. Birch N52W 12 Lks. S37E Hemlock 40 Lks.

Description of corner evidence found:

2" iron pipe 5' long with brass cap set by C.E.Walker in 1938

Description of monument and accessories I established to perpetuate the original location of this corner.

Left monument set by Walker

Toes:

Maple Maple 16.75 Feet 18.37 feet

ARNOTT 5-887

ann.	a		1 mar.	. 1	December	12 25
	don , Wis.					
Signature Thomas	a Ruot	Title Land	Surveyo	or	Registration	No. S-887
(Count	y Surveyor, Registered Land	d Surveyor, or ot	her duly author	orized official	1)	
Office of Register of De	eds. County of	Fore	est		, I hereby certify	that the within
instrument was filed in	eds, County ofthis office for record on	the	15th	day of	December	19. 75
at 11 o'clock	A. M.			•		
	(Register of Deeds)	c.L.	Dod	cument 1	Number 1083	82
	(Register of Deeds)	7				

.Deputy