

4301108 0020 2026

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to it if necessary to conform with said requirements.

(a) Corner Location:

Wisconsin Corner ID: 43011080020

Type of Monument: Survey Nail

Location: South Quarter Corner

Langlade County Coordinates NAD83(2011):

Northing: 321062.55

Easting: 609354.18


Section 8, Township 30 North, Range 11 East,

Town of Rolling, Langlade County, Wisconsin

RTK GPS direct observation

Calibrated to HMP DP2817 (Rolling NW GPS)

3 position average on 4/24/2026

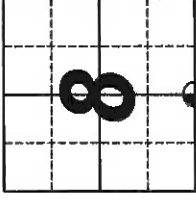

T30N-R11E

I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Chad A. Besaw

6/11/2026


Date



(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablishment through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- ORIGINAL - Oct. 1853 - Bradley, W. J. - Set quarter post Elm 14 SSE 19 lks, Maple 8 N39W 30 lks.
- 1881 - Old FB 140 page 106 - B.F. Dorr at corner.
- Aug. 1990 - William F Kelly set a RR spike and 3" witness monument
- Mar. 1994 - CSM V.5 P.193 - Doc. #308228 - Daniel Higginbotham set PK Nail 2631.40' from SW corner.
- Jan. 2000 - CSM V.9 P.44 - Doc. #342161 - David Osterbrink found Railroad spike 2630.13' from SE corner Sec 8, and 2660.90' from center of section 17.
- May 2002 - CSM V.10 P.146 - Doc. #357797, - Daniel Higginbotham set survey nail from ties 2630.50' from SW corner.
- June 2002 CSM V.10 P.155 - Doc. #358540 - Daniel Higginbotham set survey nail from ties 2630.50' from SW corner.
- Feb. 2003 - Daniel Higginbotham - Tie Sheet - made references to corner and notes: August 1990 Kelly set a RR spike and 3" witness monument, but his location does not matchup with a N-S fence line to the South or any of the 40 line fences in the area. In March 1994 Higginbotham and Brinkmeier located fencelines in the area and set a PK Nail on the extension of a N-S fence at centerline of C.T.H. "G". In May 2002 Gerry Bahar used Higginbotham's location for the N1/4 (PK was gone due to resurfacing of the road) set a survey nail and tied out.
- Dec. 2006 - Map #30565 - David Renaud - Found Survey Marker Pin 2661.86 feet from the center of Section 17.
- Aug. 2016 - CSM V.18 P.45 - Doc. #437022 - Timothy Rusch found iron rod 5303.77' from North 1/4 corner.
- 4/24/2026 - Chad Besaw - Found a Survey Nail at corner location, matches Higginbotham's 2003 witnesses and 2002 distances to the SE corner of Section 7. Nail was paved over, with a 0.75' iron rod 1.1' SE from corner. Made new references as shown below.

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

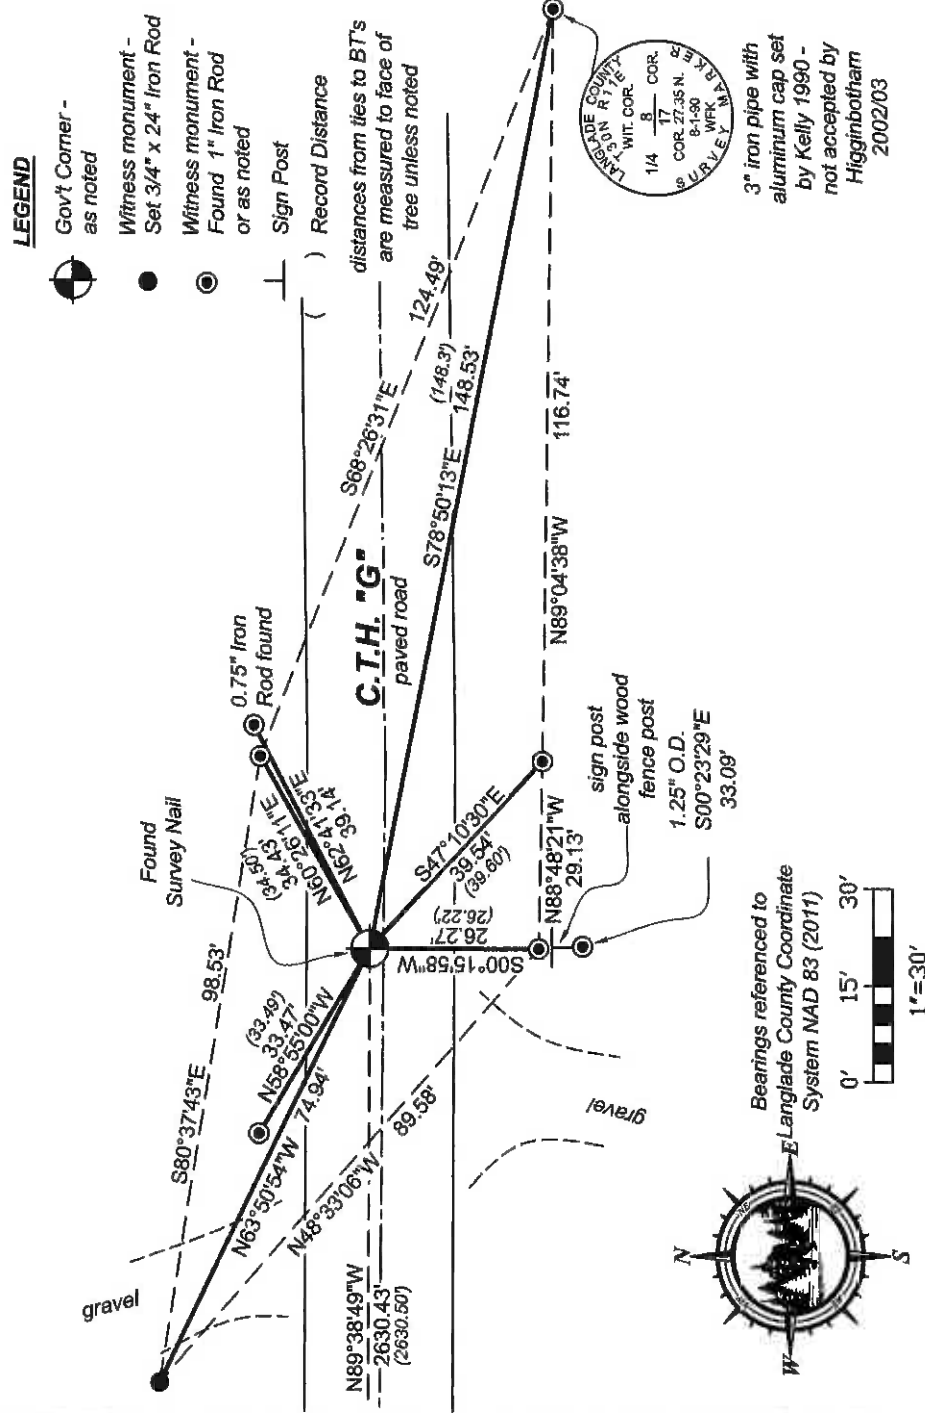


U.S. PUBLIC LAND SURVEY MONUMENT RECORD

43011080020

HISTORY OF ORIGINAL CORNER ESTABLISHMENT AND SUBSEQUENT RESTORATION AND DESCRIPTION OF ANY RECORD, MONUMENT OCCUPATIONAL, TESTIMONIAL OR OTHER EVIDENCE CONSIDERED:

The original corner was established in 1853 by William T. Bradley. Original BT's: Elm 14" S6E 19lks., Maple 8" N39W 30lks. In August 1990, Kelly set a RR Spike and a 3" Witness Monument, but his location does not match up with a N-S fenceline to the South or any of the 40 line fences in the area. In March 1994 Higginbotham and Brinkmeier located fencelines in the area and set a PK Nail on the extension of a N-S fence at centerline of CTH G. In May 2002, Gerry Bahar used Higginbotham's location for the N1/4 (PK Nail was gone due to resurfacing of the road) set a survey nail and tied out.

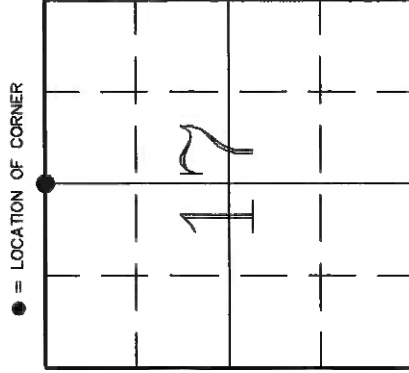


SECTION 17
TOWNSHIP 30 NORTH, RANGE 11 EAST
TOWN OF ROLLING
LANGLADE COUNTY, WISCONSIN

CORNER WAS: (CHECK ALL THAT APPLY)

- ☐ RESTORED THROUGH ACCEPTANCE OF AN OBLITERATED EVIDENCE LOCATION
- ☐ RESTORED THROUGH ACCEPTANCE OF A FOUND PERPETUATED LOCATION
- ☐ CONSIDERED A LOST CORNER AND REESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS (INCLUDE A PLAN VIEW DRAWING SHOWING DISTANCES AND DIRECTIONS TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR PROPORTIONING AND DETERMINING THE CORNER LOCATION)
- ☒ RESTORED OR REESTABLISHED IN A LOCATION THAT DIFFERS FROM A PREVIOUS RESTORATION OR REESTABLISHMENT (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND)
- ☐ CHECK IF THERE IS ADDITIONAL INFORMATION ON BACK

DESCRIBE THE MONUMENT AND ACCESSORIES USED TO PERPETUATE THE LOCATION OF THE CORNER. (INCLUDE A PLAN VIEW DRAWING AND INDICATE WHAT WAS SET AND/OR FOUND) ALSO INCLUDE FOUR TES TO THE SECTION CORNER AND DESCRIPTION OF THE TES.

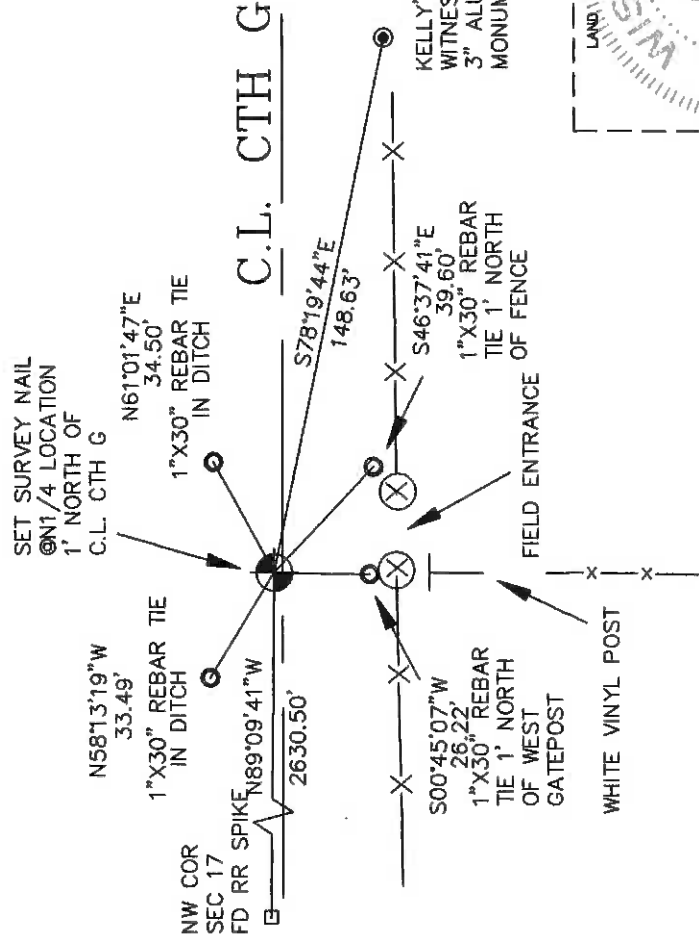

DANIEL E. HIGGINBOTHAM

(Type or print name) CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS RECORD WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL, AND THAT THIS U.S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

D. E. Higginbotham
SIGNATURE

2/12/03
DATE



INDEX NO.

57

430110600000


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
O = Corner monument restored.

ORIG. COR. ESTABLISHED BY
WM. BRADLEY, OCT 1853

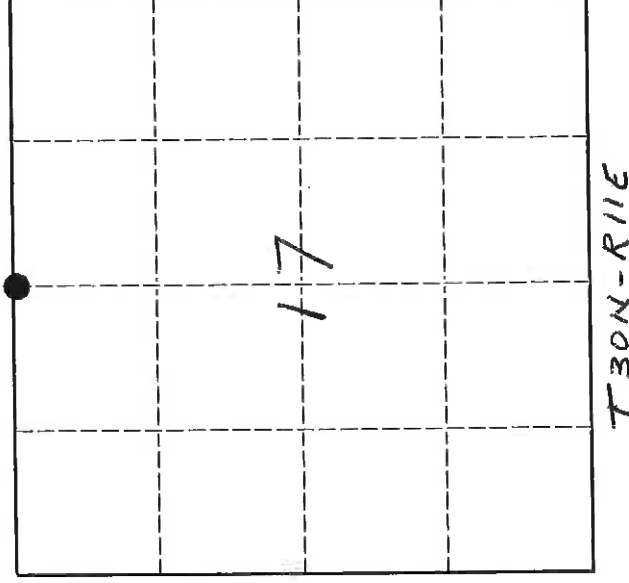



T30N-R11E

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

FOUND P.K. NAIL OVER IRON IN E HWY. G. SET R/R SPIKE OVER IRON & SET 3" AL. WITNESS MONUMENT.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

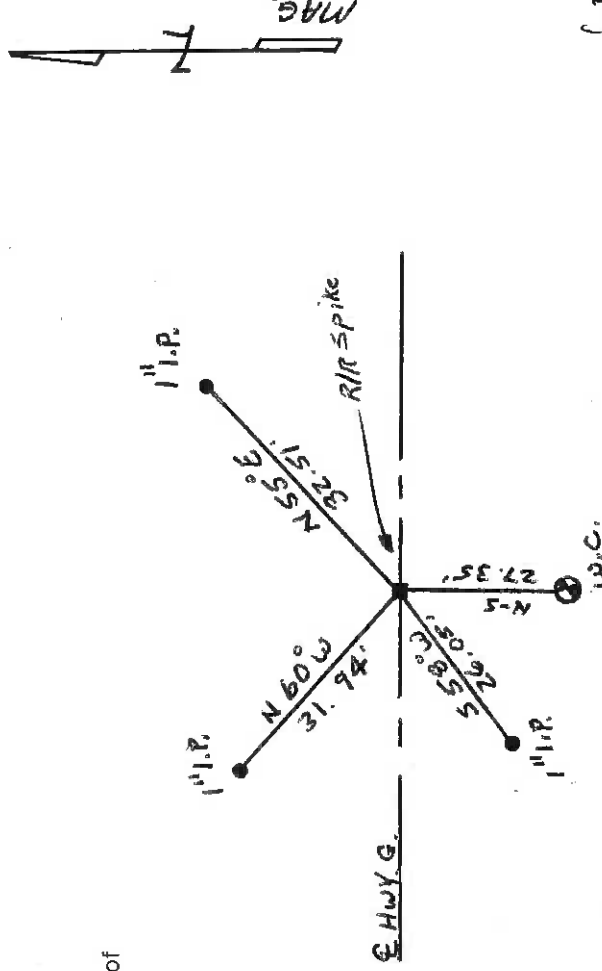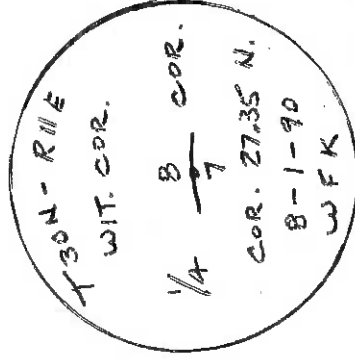

J-7


Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location.?

FOUND PERPETUATED LOCATION

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location. NO

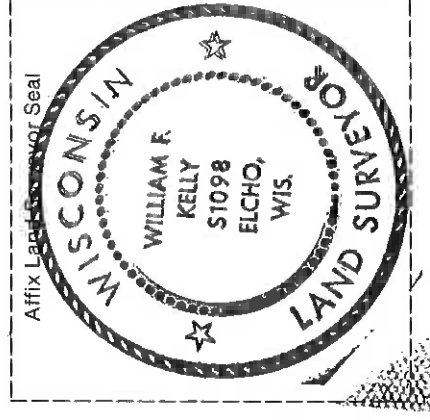

(i) I, WILLIAM F. KELLY
(type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

William F. Kelly
Signature

8/27/90
Date