

4301108 2000 2026

U.S. PUBLIC LAND SURVEY MONUMENT RECORD - LANGLADE COUNTY

Note: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3)(a)(b)(c)(d)(e)(f)(g)(h)(i). An additional sheet may be added to it if necessary to conform with said requirements.

(a) Corner Location:

Wisconsin Corner ID: 43011082000

Type of Monument: 1.25" O.D. Iron Pipe

Location: East Quarter Corner

Langlade County Coordinates NAD83(2011):


Northing: 323652.90

Easting: 612007.14

RTK GPS direct observation

Calibrated to HMP DP2817 (Rolling NW GPS)

3 position average on 4/24/2026

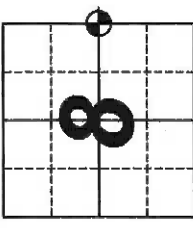

T30N-R11E

I, Chad A. Besaw, Wisconsin Professional Land Surveyor #S3029, hereby certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Chad A. Besaw

6/11/2026


Date



(b)(f)(g)(h) Description of monument found at this corner and if it was accepted, state all evidence (material, testimonial, occupational, plats, records, other monuments) used as a basis for accepting. If not accepted or if nothing was found, state evidence used as basis for establishing location. If reestablishment through lost corner proportionate methods, indicate all monuments, distances and directions used to establish. Indicate type of monument found or set and sign post.

- ORIGINAL - Oct. 1853 - Bradley, W. J. - Set quarter post Elm 14 S24E 29 lks, Iron Wood 8 N71W 21 lks.
- 1902 - FB 139 page 20, F8 126 page 53 - Webley at corner.
- Aug. 1993 - Tie Sheet - Thomas Arnott used old fence line leading west. Also used the center of C.T.H. "G" and a town road leading south and a town road leading north as best possible location. Set 1" iron pipe for corner. Made new witnesses.
- June 1995 - Map # 10436 - Edwin Abendroth found a 1" iron pipe 2681.29' from NE corner.
- April 2003 - CSM V.11 P.72 - Doc. #365315 - Daniel Higginbotham found 1" iron pipe 5295.30' from West 1/4 Corner.
- Jan 2023 - CSM V.20 P.107 - Doc. #467217 - Charley Brinkmeier found 1" iron pipe 5295.24' from West 1/4 Corner.
- Oct. 2004 - CSM V.12 P.55 - Doc. #377237 - Timothy Rusch found iron pipe 2681.24' from NE corner and 2596.93' from SW corner.
- 4/24/2026 - Chad Besaw - Found and accepted Arnott's iron pipe from 1993. Made new references.

(c)(d)(e) Plan view of corner with ties to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed corner.

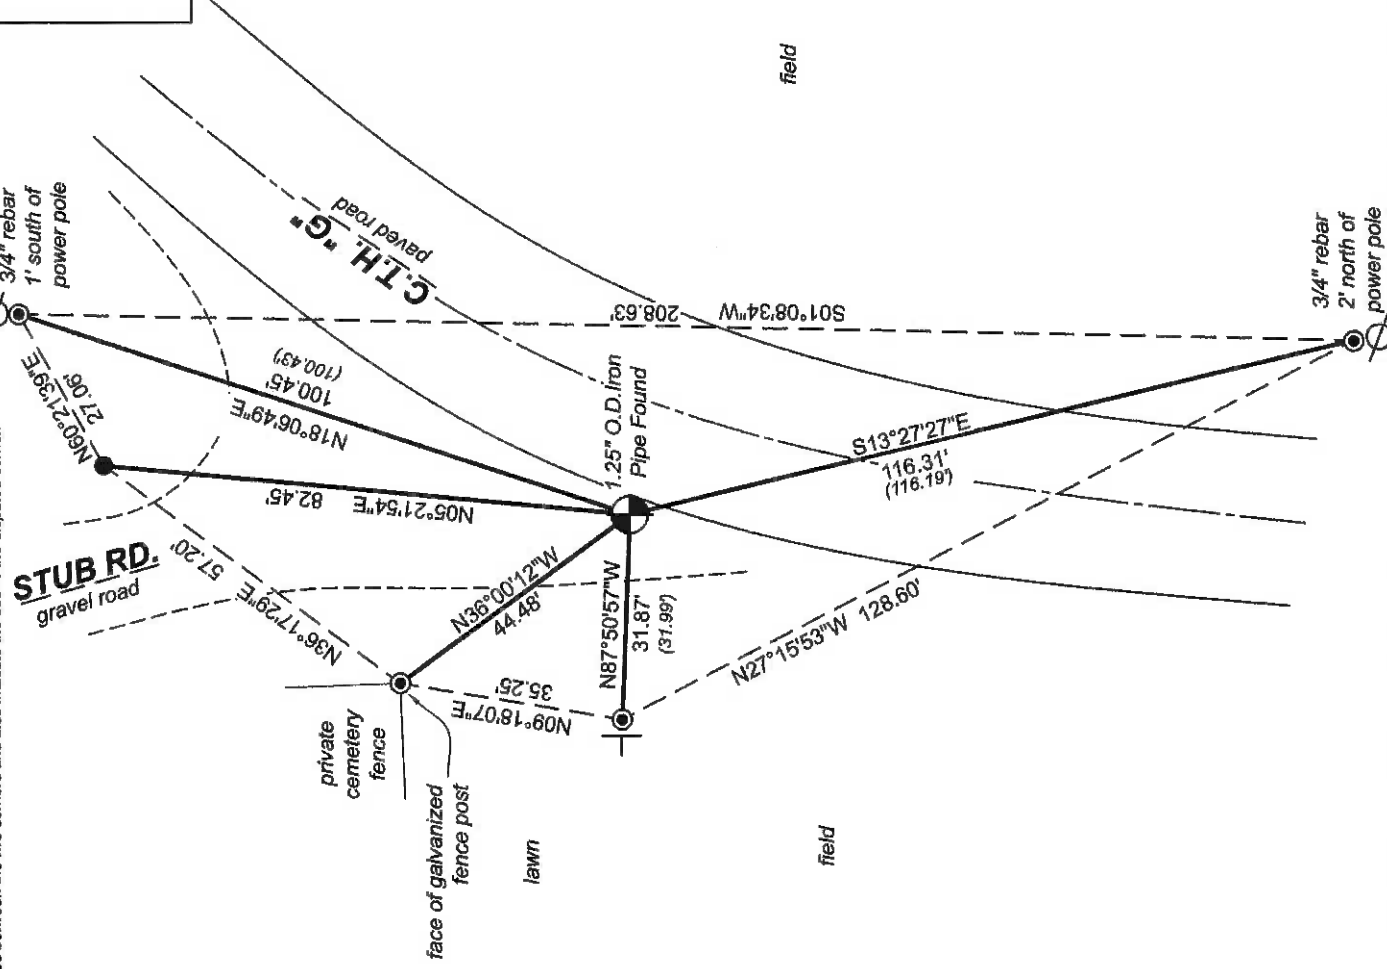

LEGEND

Gov't Corner - as noted


Witness monument - Set 3/4" x 24" Iron Rod

Witness monument - Found as noted


Sign Post

() Record Distance

distances from ties to BT's are measured to face of tree unless noted

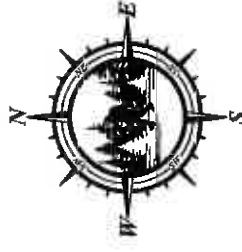

Bearings referenced to Langlade County Coordinate System NAD 83 (2011)

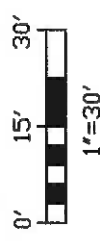

1"=30'

43011082000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.


$\frac{1}{4}$ cor 8 & 9
T30N, R11E

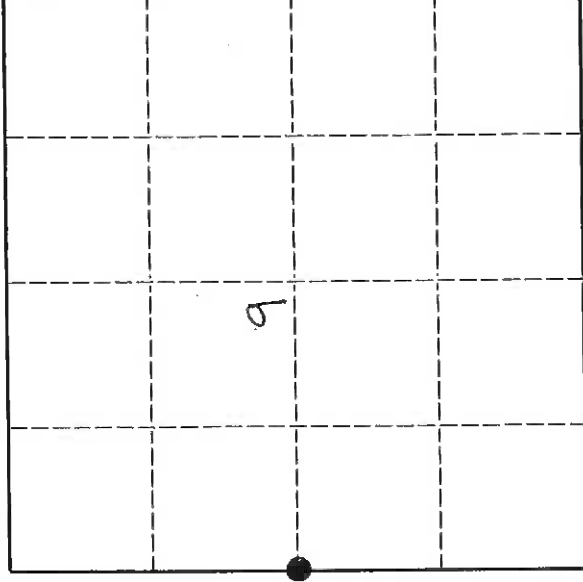

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Used old fence line leading west. Also used the center of C.T.H. "G" and a town road leading south and a town road leading north as best possible location. Set 1" iron pipe for corner.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

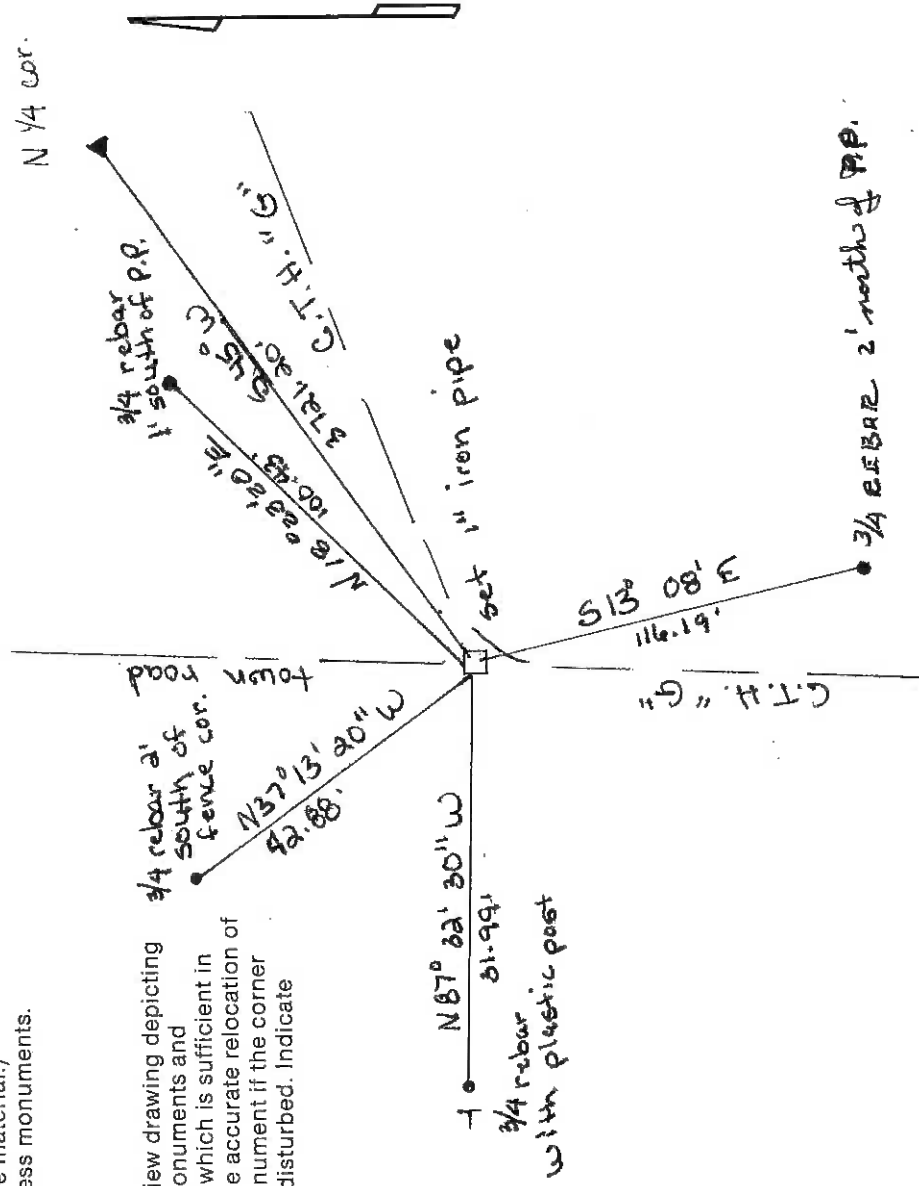

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

G 9

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

No. 1

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.

No

(i) I, Thomas R. Arnott, S-887
(type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U. S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Thomas Arnott
Signature

13 Aug 93
Date

