


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter Corner Common To Sections 28 and 29,
Township 33 North, Range 14 East, Langlade
County, State of Wisconsin.

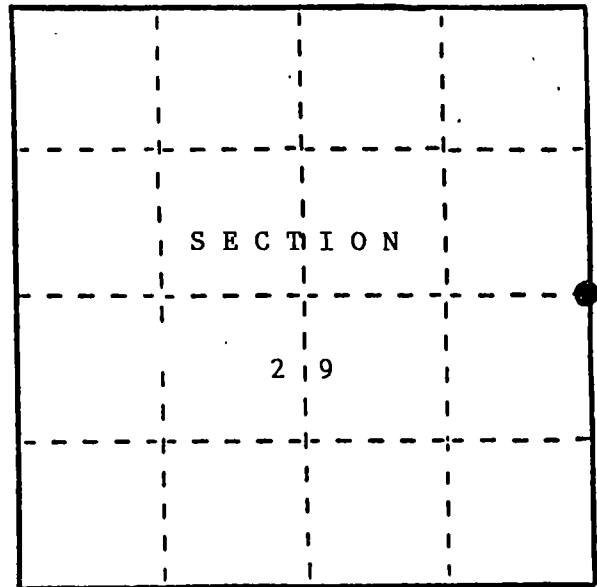

T 33 N R 14 E

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1865, J. L. Nowlin set a wood post with the following corner references:


Sugar 20" N29°E 18 lks. Sugar 15" S55°W 16 lks.

In 1989, John Schulke found 6"X6" square cedar post extending 4½ ft. from the ground with a metal location tag. Found stump holes N29°E 11.9 ft. and S55°W 10.6 ft. Found 8"X8" square wood post N0°05'E a distance of 1299.5 ft. (Set as N 1/16 of Sections 28 and 29.) I accept the position of the wood post as the best available evidence of the original corner.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2 1/2" dia. X 36" aluminum magnetic cap monument stamped to identify the corner.
2. Sugar Maple 7" N58°W 11.35 ft.
3. Sugar Maple 6" N08°E 36.52 ft.
4. Sugar Maple 7" S56°E 21.60 ft.
5. Sugar Maple 10" S13°W 11.30 ft.
6. Steel sign post Northeast 0.7 ft.

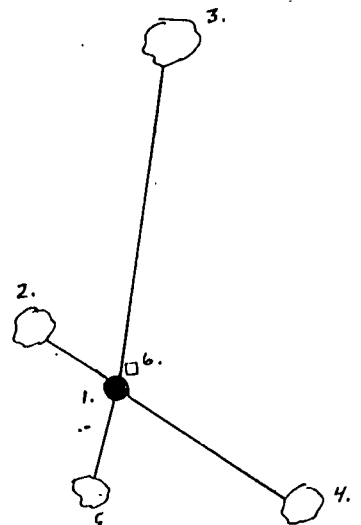

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


No.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


No.

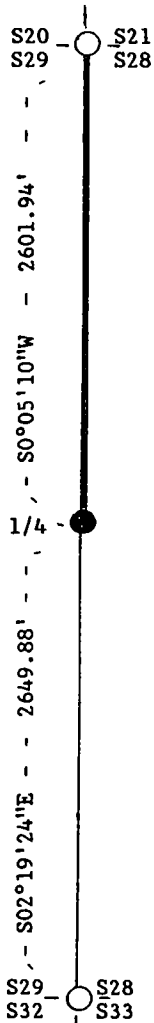

LEGEND

— Boundary line marked to Forest Service standard.

NOTE: Bearings are referenced to solar observations.

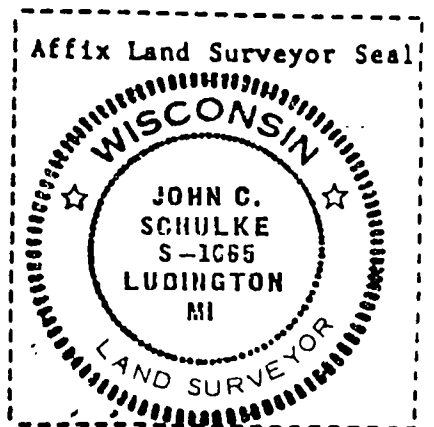

Checked W.S. Kelly 12-1-89

(1) I, John Schulke (RLS-1665) (type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke Oct 23rd, 1989
Signature Date

Certificate ready for filing:

mm *ll*
District Ranger