

State of Wisconsin }  
County of Forest } ss.

I L. ERNEST GEORGE, do hereby certify that on the SIXTEENTH day of OCTOBER 1968, I established the CENTER OF THE NORTHWEST QUARTER OF SECTION 5, TOWNSHIP 34 NORTH, RANGE 14 EAST, Fourth Principal Meridian as described hereon.


History: Slowe's Second Plat of Roberts Lake surveyed by Chas. E. Walker in 1942 shows that a wooden post was set for this corner.

Description of monument and accessories I established to perpetuate the location of this corner:  
At the point determined for the location of the corner I emplaced a:

GALVANIZED IRON PIPE, THREE FEET LONG, ONE INCH IN DIAMETER, WITH ALUMINUM CAP DENOTED AS, "KIMBERLY-CLARK CORP. T34N CENTER NW¼ 5 R14E GEORGE RLS S-0309 10/16/68.  
W.C. - CORNER IS 25.00 FEET SOUTH - W.C."  
The pipe is witnessed by:

Maple 11 S 63°W 15 links. (SCRIBED S5 WC BT)  
Maple 4 N 65°E 105 links. (SCRIBED S5 WC BT)

Description as to how corner was located: From recent survey work I located the post set as the W 1/16th on the east-west quarter line of section 5 by Chas. E. Walker, County Surveyor for Forest County, when he surveyed "Slowe's Second Plat of Roberts Lake" in 1942. Also located four other posts on the W 1/16th line of section 5 as shown on the plat. Two of these posts were rotted off but located the point where they were set by the remaining portion still in the ground. I did not find the post set as the center of the Northwest quarter. From the northern-most post located on the W 1/16th line, this post being 885 feet north of the southeast corner of Slowe's plat, measured north 415 feet to where the center of the northwest quarter should be. This point is on the edge of the Town road used for access to Slowe's Plat. 22.93 feet north of this point was located a short, square wooden post. I believe this short, square post was set to mark the East-West position of the West 1/16th line of section 5 and that the center of the northwest quarter was set on the edge of the road and has been destroyed through the grading and improvement of the road.

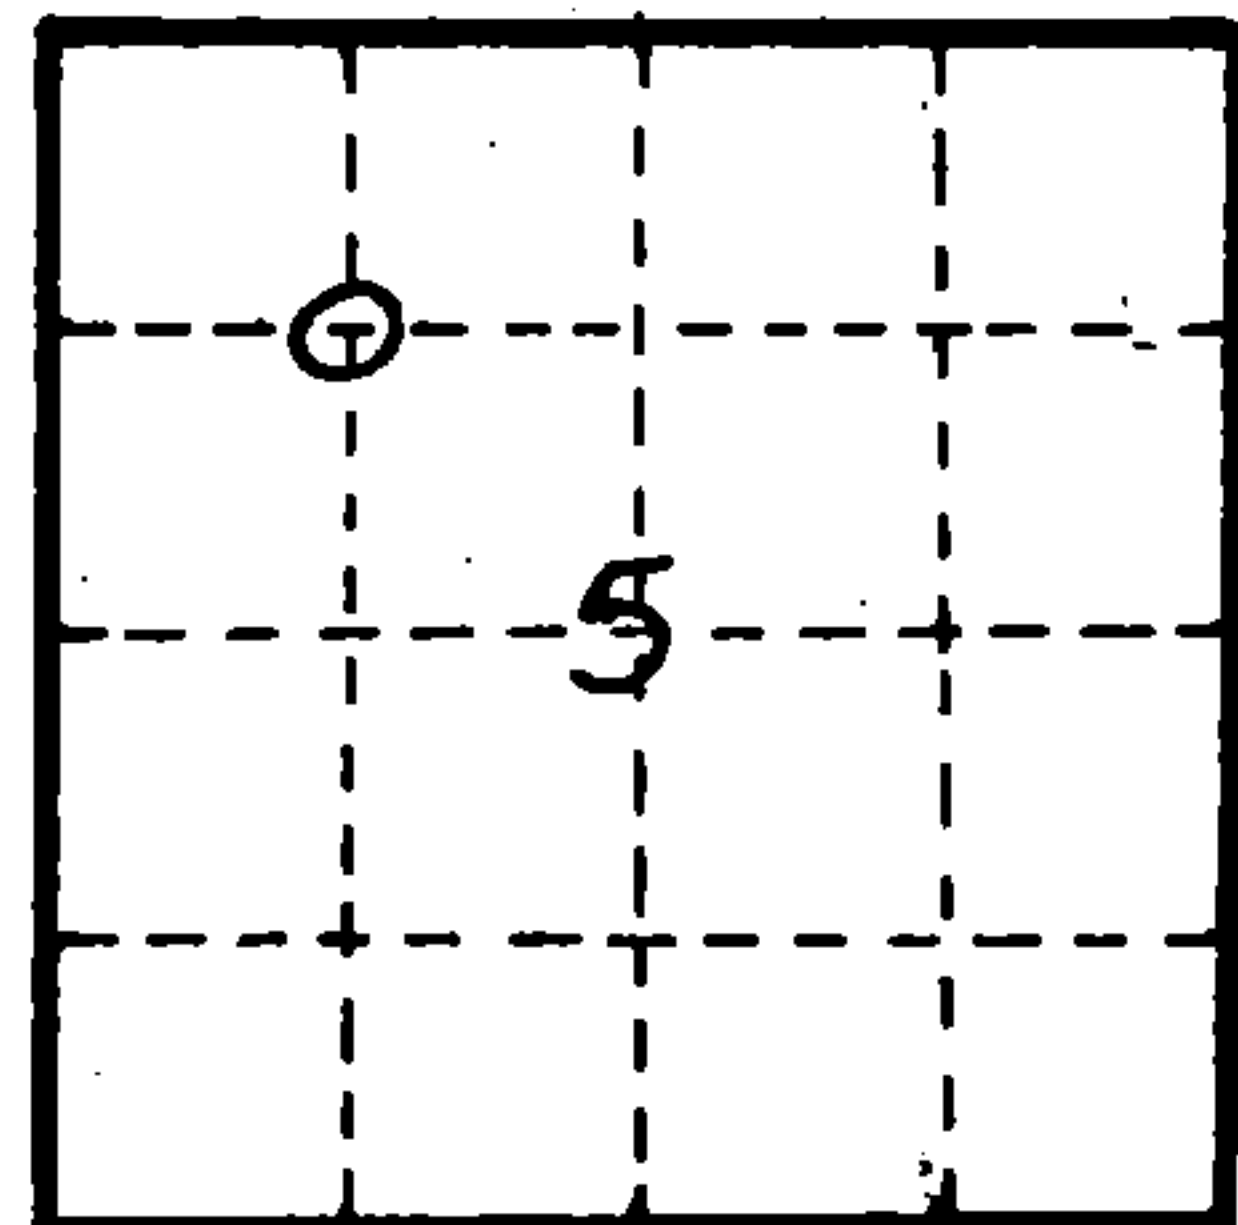

O = Corner monument restored

I have accepted the work of Chas. Walker as being correct and have reset a 3/8ths inch by 12 inch iron "spike" as the center of the north west quarter. This "spike" is located 22.93 feet south of and on a straight line between the short, square post mentioned above and the W 1/16th of section 5. The center of the northwest quarter is also located as follows; it is 1176.59 feet south of the W 1/16th between sections 5 and 32, 1298.88 feet north of the W 1/16th of section 5, and is located 2.10 feet west of a straight line between these two corners.  
(continued on back)

Resident witnesses \_\_\_\_\_

Dated at Crandon, Wisconsin, this 18th day of March, 1974.

Signature L. Ernest George

Title Registered Land Surveyor Registration No. S 0309

Office of Register of Deeds County of Forest

I hereby certify that the within instrument was filed in this office for record on the 19th day of March 1974, and was filed in Book No. Corner Page No. B-6 of County Records. Restorations

DOCUMENT NUMBER

105004

Signature Eugene Stutzman Title Register of Deeds

43414053030

Surveyor's Seal

Index No. B 6

I also set a Witness Corner to the center of the northwest quarter of section 5. This Witness Corner is stamped "W.C. Corner is 25.00 feet south W.C." and has two bearing trees located as stated above.