NOV 082023

**CORTNEY BRITTEN CLEEREMAN** REGISTER OF DEEDS

## U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fufill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monu

A-E 7.08(3)(a) Identity of corner: SOUTHEAST CORNER SECTION 18, TOWNSHIP 34 NORTH, RANGE 14 EAST OF THE 4TH PM, TOWN OF FREEDOM, COUNTY OF FOREST

WISCRS - FOREST COUNTY N: 516,633.297 USft (XXX,XXX.XXX) E: 867,408.653 USft (XXX,XXX.XXX) Datum: NAD83 (2011) **GNSS Method RTK GNSS Control WISCORS VRS** 



The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Coordinates shown in parenthesis are previously published values.

A-E 7.08(3)(b)

Original Surveyor: James McBride

Date of Original Survey Commenced: Completed:

August 10, 1859 August 20, 1859

Original Accessories: N 5° W Birch R 27 Links N 52° E 10 Links 10 Birch S 28° E 12 16 Links Maple Maple

See previous - CERTIFIED LAND CORNER RESTORATION - N-5 - July 11, 1963 - Surveyor 802 - Jean F. Resvick - THENCE:

1978 - Surveyor 802 - Jean F. Resvick - indicates this position as "2 inch inside diameter galvanized iron pipe capped with a 3 inch diameter brass tablet stamped to identify corner" on Forest Co. Surveyor File #341420-19780000.

1982-1984 - Surveyor 1558 - Milo E. Stefan - indicates this position as "2" iron pipe with 3" brass cap - forest service" on Forest Co. Surveyor File

#341419-19841228

1986 - Surveyor 1651 - Alan D. Harrison - indicate this position as "2" iron pipe 36" long filled with concrete, with brass cap" on Forest Co. Surveyor File #341417-19861203.

May 28, 2004 - Surveyor 1792 - Albert B. Simpson - indicates this position as "found 2.5" O.D. I.P. W/brass cap" on Forest Co. Surveyor File #341417-20040528. December 12, 2005 - Surveyor 2197 - Michael A. Treml - indicates this position as "existing 2" iron pipe w/brass cap" on Certified Survey Map #193041. July 15, 2008 - Surveyor 2197 - Michael A. Treml - indicates this position as "existing 2" iron pipe w/brass cap" on Certified Survey Map #198179. June 6, 2015 - Surveyor 1301 - Hugh W. Guy Jr. - indicates this position as "found 2" pipe with forest service cap" on Forest Co. Surveyor File #341417-20150606.

May 10, 2023 - I found a 2.5" diarneter galvanized iron pipe with a 3" diameter brass cap, stamped to identify the corner. Monument extends ±19" above grade. I also found 3 of Resvicks bearing trees, 2 alive and in good condition (1 is dead but standing), and his steel sign post. I established 3 new reference monuments as shown below.

A-E 7.08(3)(c)(d) Plan view of corner with references to at least 4 witness monuments.

BEARINGS LISTED TO THE NEAREST SECOND ARE REFERENCED TO WISCONSIN COUNTY COORDINATE REFERENCE SYSTEM - FOREST COUNTY ZONE. ALL OTHER BEARINGS ARE MAGNETIC.



OLD B.T. 8" MAPLE (NOW STANDING DEAD) (N54°W 26.67') 2.5" DIAMETER GALVANIZED IRON PIPE. WITH 3" DIAMETER BRASS CAP, STAMPED 2" DIAMETER IRON PIPE, FOUND N50°E, ±0.34" NEW RT - 9" MAPLE OF MONUMENT. N 590 HORIZONTAL NAIL 16.19. SET IN NE SIDE. N 89°32'45" E\_\_\_\_\_\_ n OLD B.T. - 22" OAK (4") S62°E, 4.53' (S70°30'E, 5.93') VERTICAL NAIL SET IN NW SIDE. TOP & BOTTOM BLAZE VISIBLE WONR - BM S53°26'14"E, 14.26'

10" MAPLE (6") HORIZONTAL NAIL SET IN SE SIDE. TOP & BOTTOM BLAZE VISIBLE



THIS CORNER

2.4" diameter iron pipe, found (0)

WDNR - BM - 6" diameter concrete monument with 3.75" diameter aluminum tablet found

1 Steel fence post, found ±0.5 feet SW of corner




A-E 7.08(3)(e) 1859 Surveyor set a post, 1963 Surveyor set a 2" inside diameter galvanized iron pipe with a brass cap. From 1963 - 2015, Surveyors have found the same. 2023, I found a 2.5" outside diameter galvanized iron pipe with a 3" diameter brass cap.

A-E 7.08(3)(f) I accept this monument as a FOUND PERPETUATED LOCATION of the corner. A-E 7.08(3)(g)(h) This corner was not determined through lost-corner-proportionate methods.

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief.

May 11, 2023 DATE

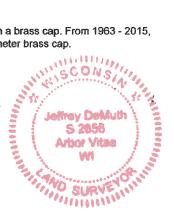

SIGNATURE

CERTIFIED LAND CORNER RESTORATION

80.00 ch. north between Sec. 19 and 20, set wood post from which

Iron pipe,  $1\frac{1}{2}$  diam. 4-ft. long alongside of point of post.

History of original corner establishment: Surveyed in 1859 by James McBride

Birch 5", N5°W, 27 Lks

Birch 10", N52°E, 16 Lks

Maple 12", S28°E, 16 Lks

Maple 8", S65°W, 26 Lks

Description of corner evidence found:

Top of post 5-inches square lying by pipe.


(Register of Deeds)

1.00 ch. east to lake

State of Wisconsin		
State of Wisconsin  County of Forest	> SS.	
Jean F. Resvick		

I Jean F. Resvick , do hereby certify that on the 11th day of July , 19.63 , I found evidence of the Section corner of Sections 17, 18, 19 and 20 Township 34 , North, Range 14 East , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:	
	,
•••••	

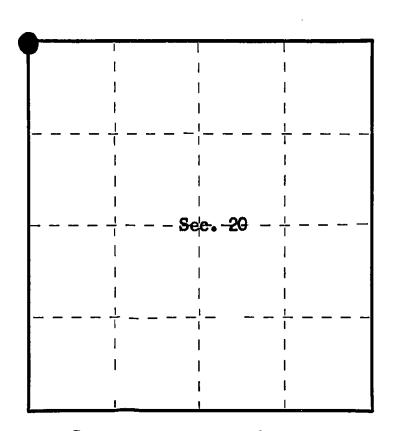

O = Corner monument restored.