


## U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.  
 O = Corner monument restored.

Quarter corner common to Sections 27 and 34,  
 T.34N., R.15E., Forest County, Wisconsin.

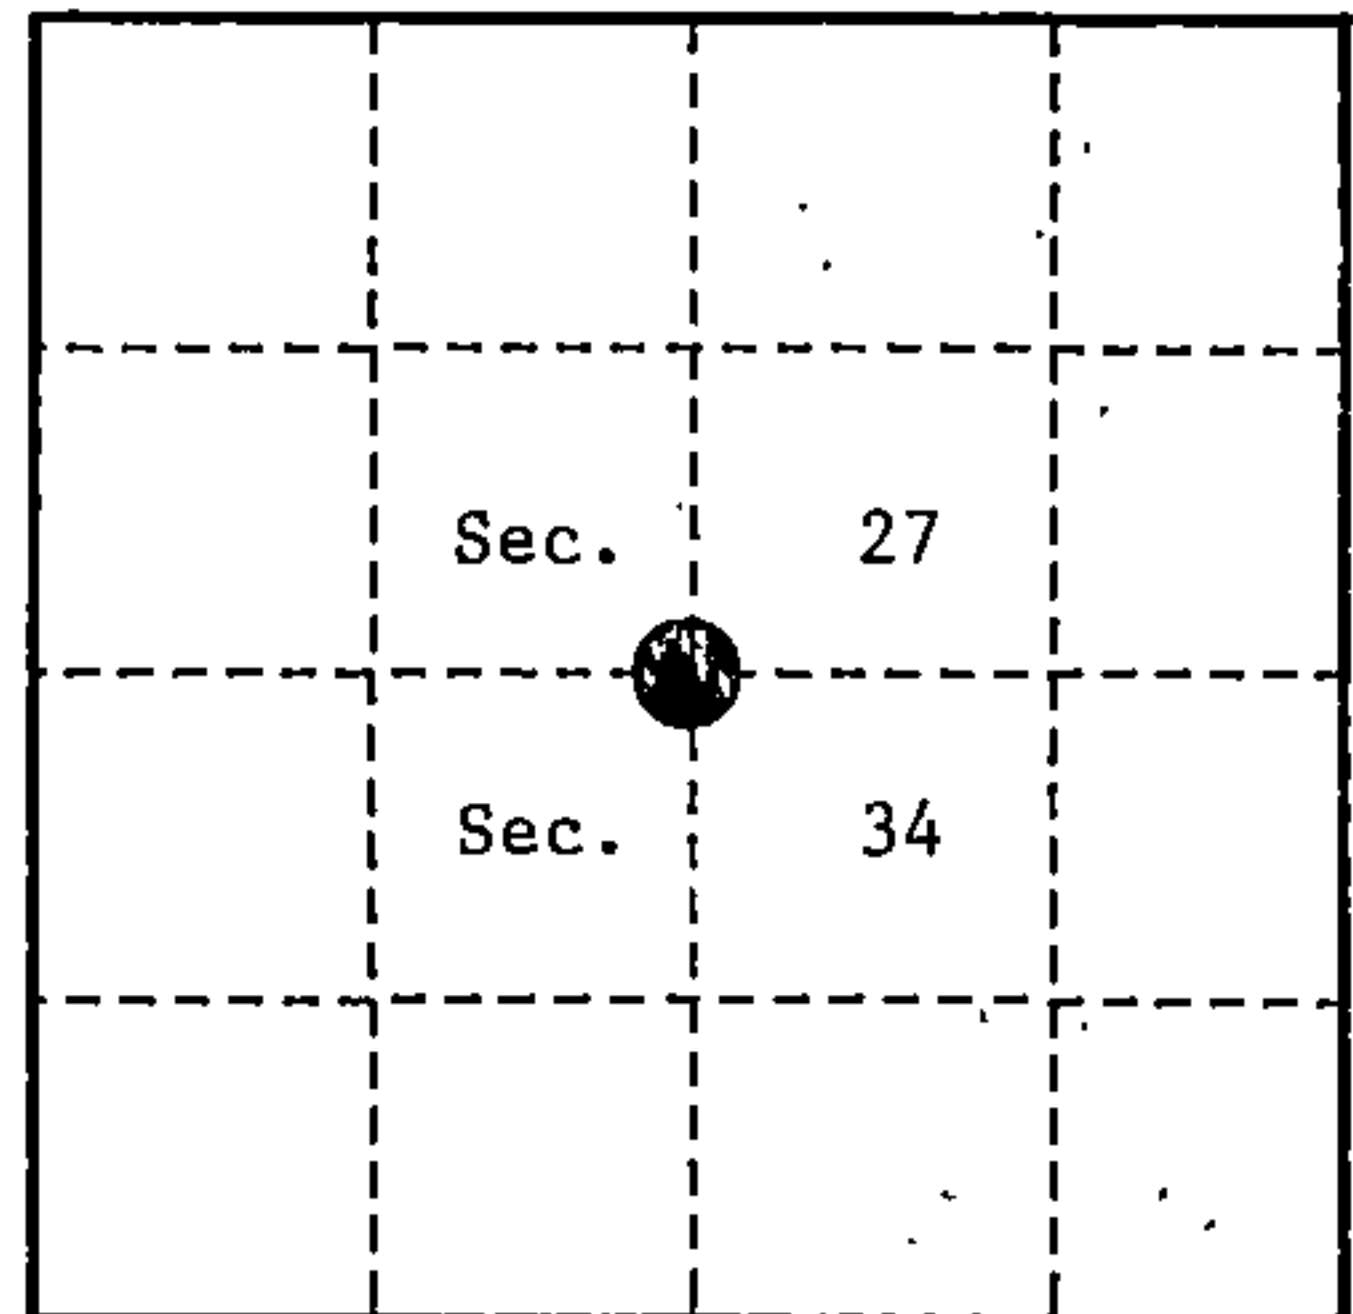

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set corner post and the following bearing trees: Hemlock, 12", N.31°W., 5 links (3.30 feet), Birch, 12", S.32°W., 45 links (29.70 feet), West, 2.00 chains, enter swamp, bears Northwest-Southeast.


In 1906 and 1910, Nathan Smith (RLS) surveyed roads from the Southwest Section Corner of Section 27 to the South Quarter Corner of Section 27.

On August 25, 1993, Alan D. Harrison (RLS) restored the corner using the intersection of Forest Road #2143 from the North and an old woods road from the West. The old road from the West appears on aerial photos to have been built on N. Smith's 1906 highway survey. The Forest Road North appears on aerial photos to have been built on N. Smith's 1910 highway survey.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" Aluminum monument with tablet stamped to identify corner.
2. West Fork, Twin Maple, 9", S.72°E., 46.63 feet.
3. Maple, 10", S.29°W., 32.09 feet.
4. Maple, 7", N.30°W., 41.34 feet.
5. Steel Sign Post, West, 0.82 feet.

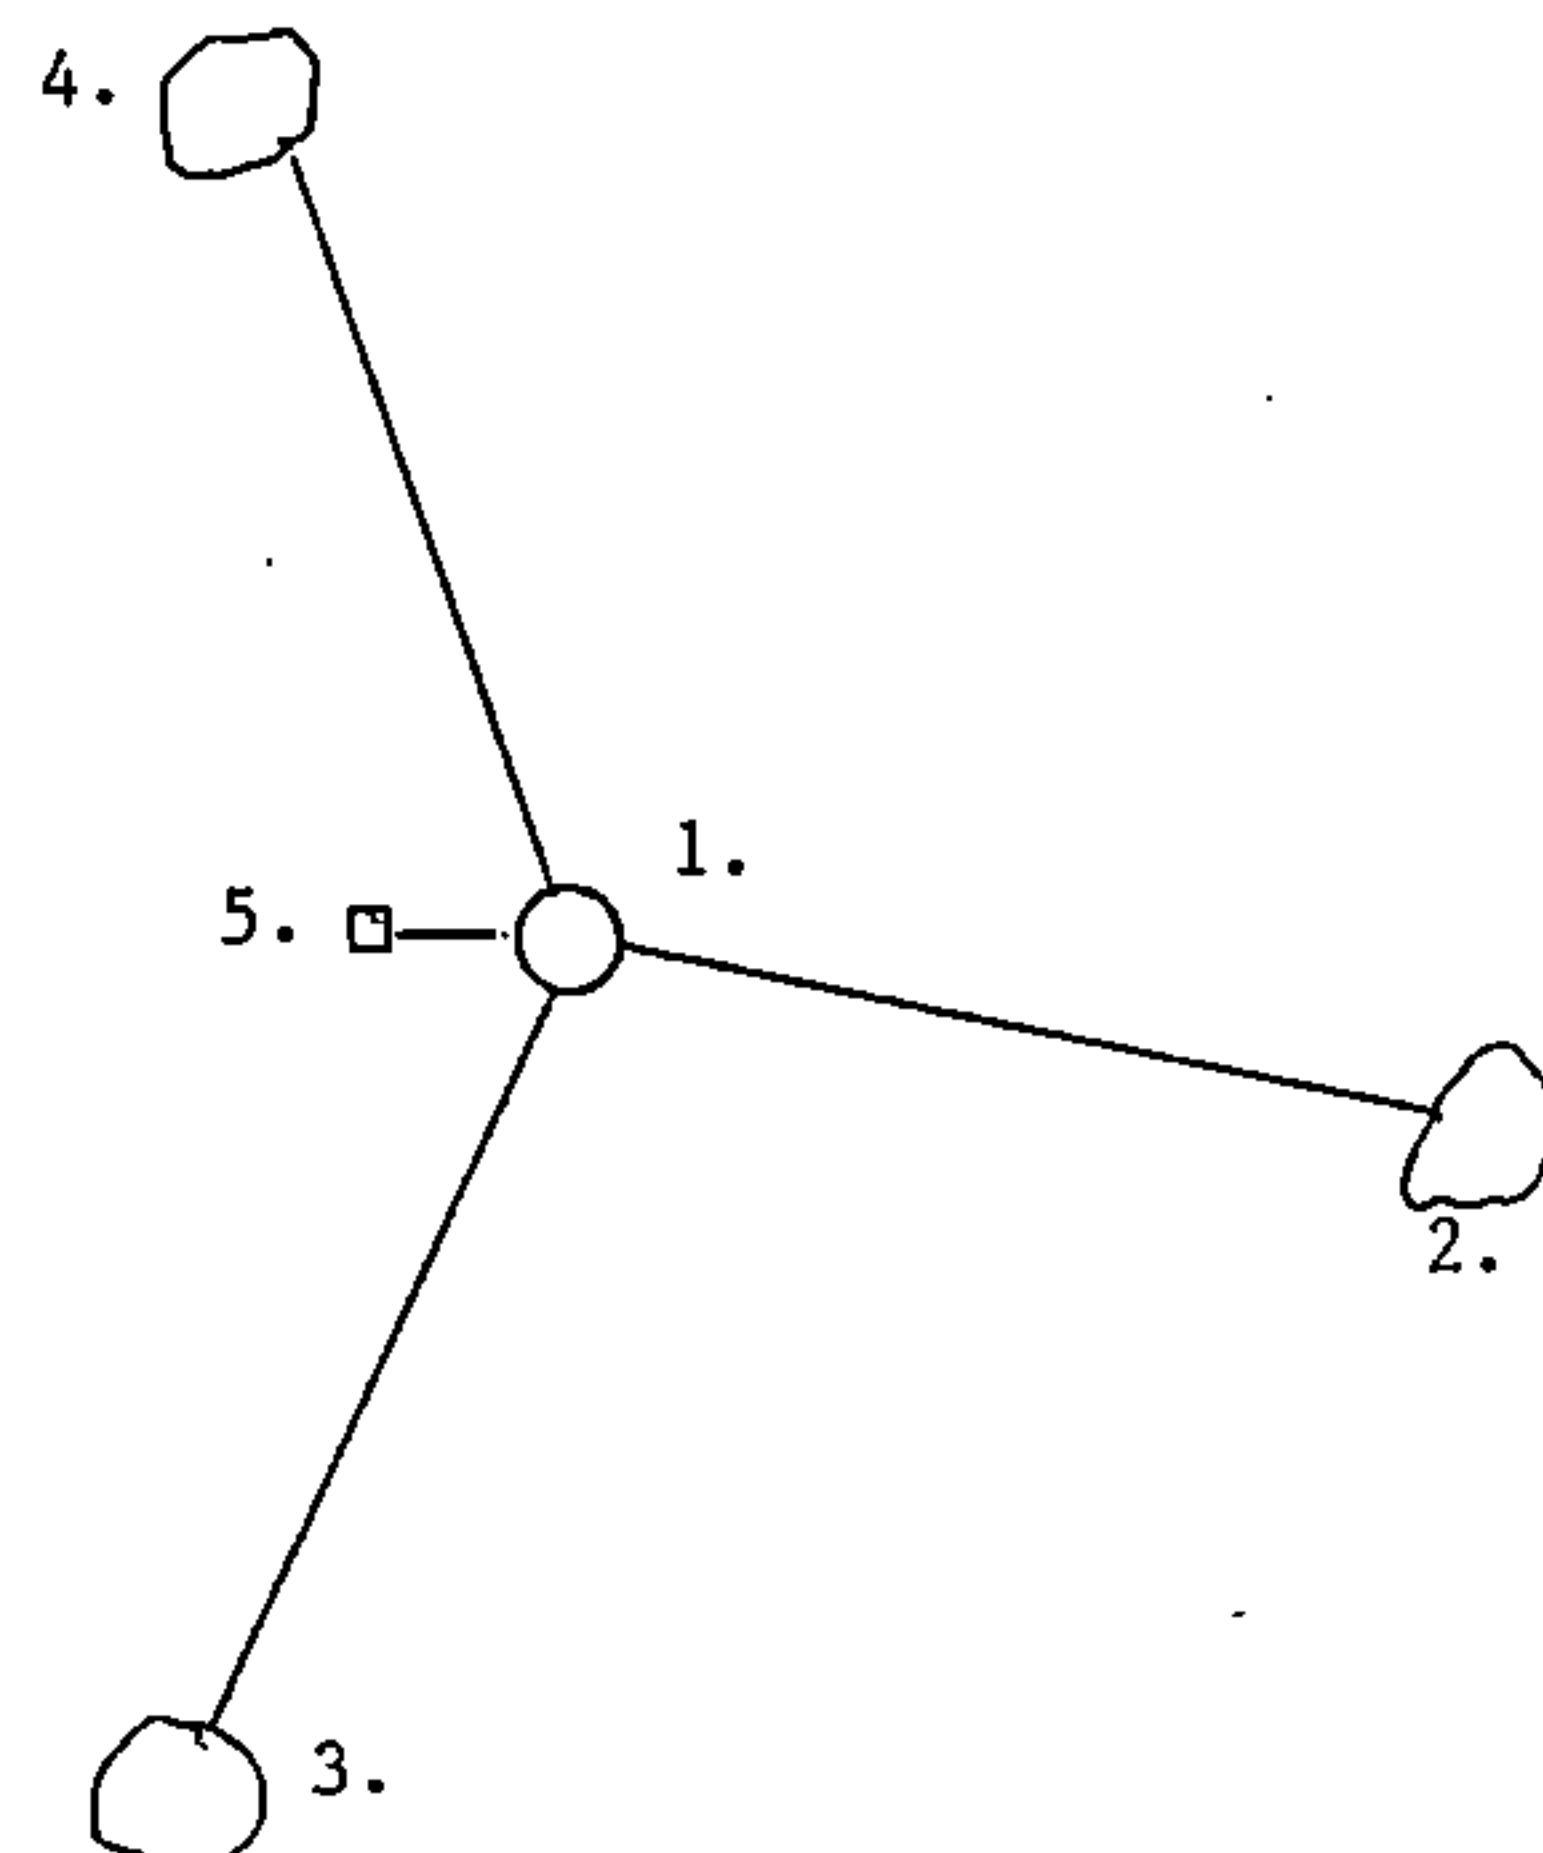

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(1) an obliterated evidence location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

REGISTER'S OFFICE  
Forest County, Wis.  
Received for record this 15<sup>th</sup> day  
of September A.D., 19 94 at  
1:00 o'clock P.M. and recorded  
in Vol. Corral Restorations  
page 15  
Paul Chittie, Deputy  
Register of Deeds

(1) I, Alan D. Harrison  
(type or print name) certify that the corner location shown  
on this record was determined by me or under my direction and  
control and that this U.S. Public Land Survey Monument Record is  
correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

