

DOCUMENT NUMBER 129848

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).


- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Quarter corner to Sections 1 and 12, T.35N., R.15E.

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 14th day
of March A.D., 1986 at
10:25 o'clock A.M. and recorded
in Vol. CORNER RESTORATIONS
page E-23
Paul Aschenbrenner
Register of Deeds

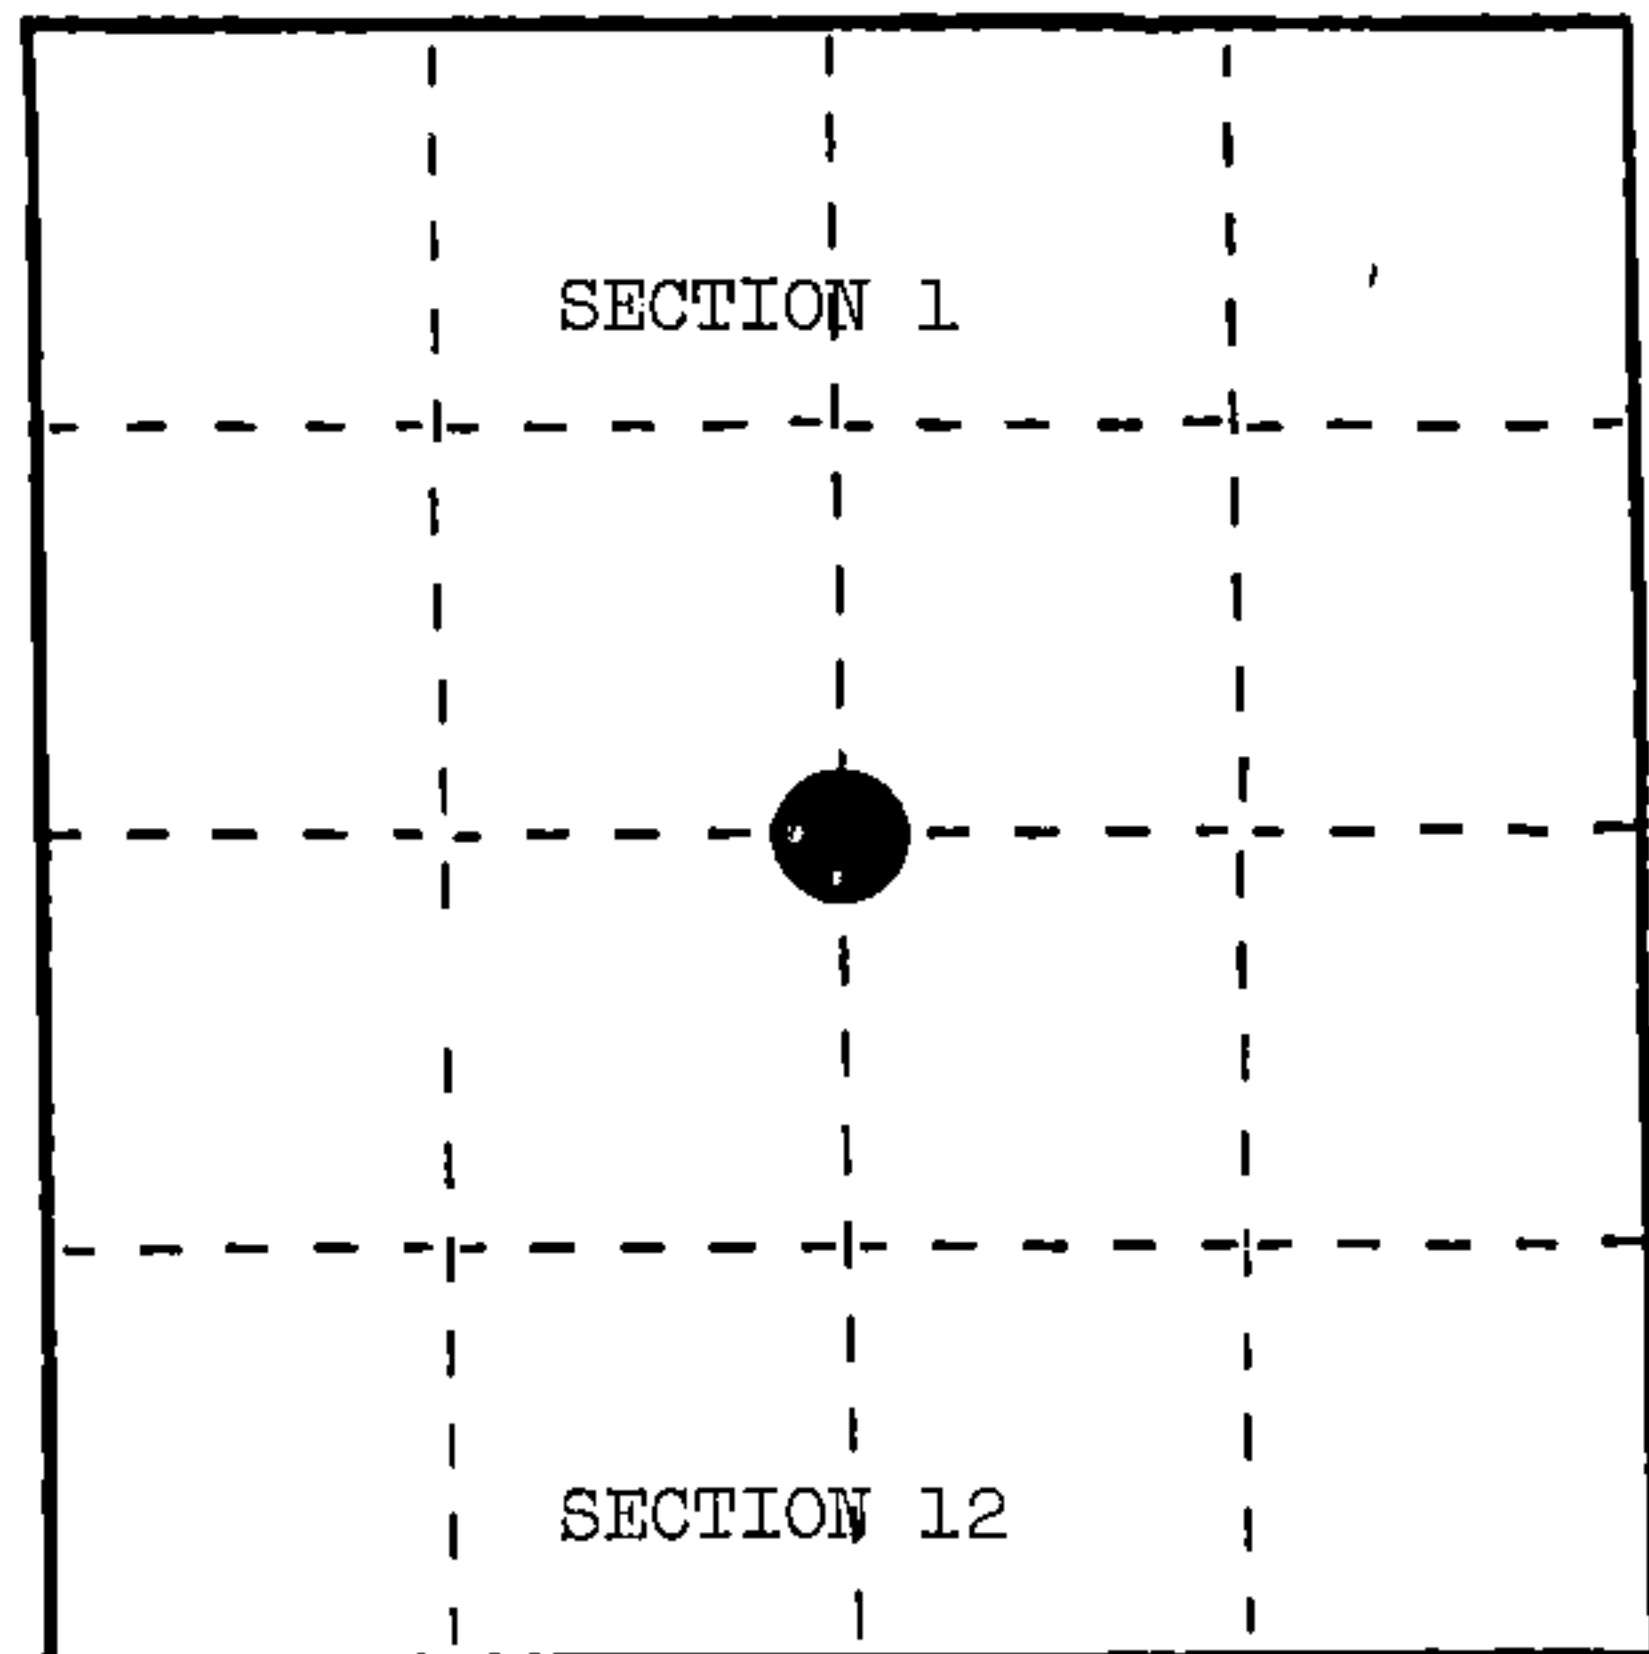

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post and made the following BTs: Birch, 10", N.15°E., 19 links; Fir, 10", S.33°W., 11 links.

In 1905, N. Smith found original corner and Birch BT standing (green).


In the 1930s, R. Reinike found Spruce post in good condition and scribed Hemlock BT, S.32°E., 23 links. Placed location poster on Aspen, 5", S.72°E., 9 links.

In 1982, Milo Stefan found mound of rock with post hole--from which a broken-off Aspen with location tag at base was found, S.72°E., 5.9 feet and remains of original Birch stump, N.15°E., 12.5 feet. Set monument and new references.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" x 36" aluminum monument stamped to identify the corner location.
2. Hemlock, 15", N.42°E., 42.64 feet
3. Spruce, 12", S.24°W., 12.73 feet
4. Red Pine, 6", N.17°W., 48.73 feet
5. Steel Sign Post SE 1.46 feet.

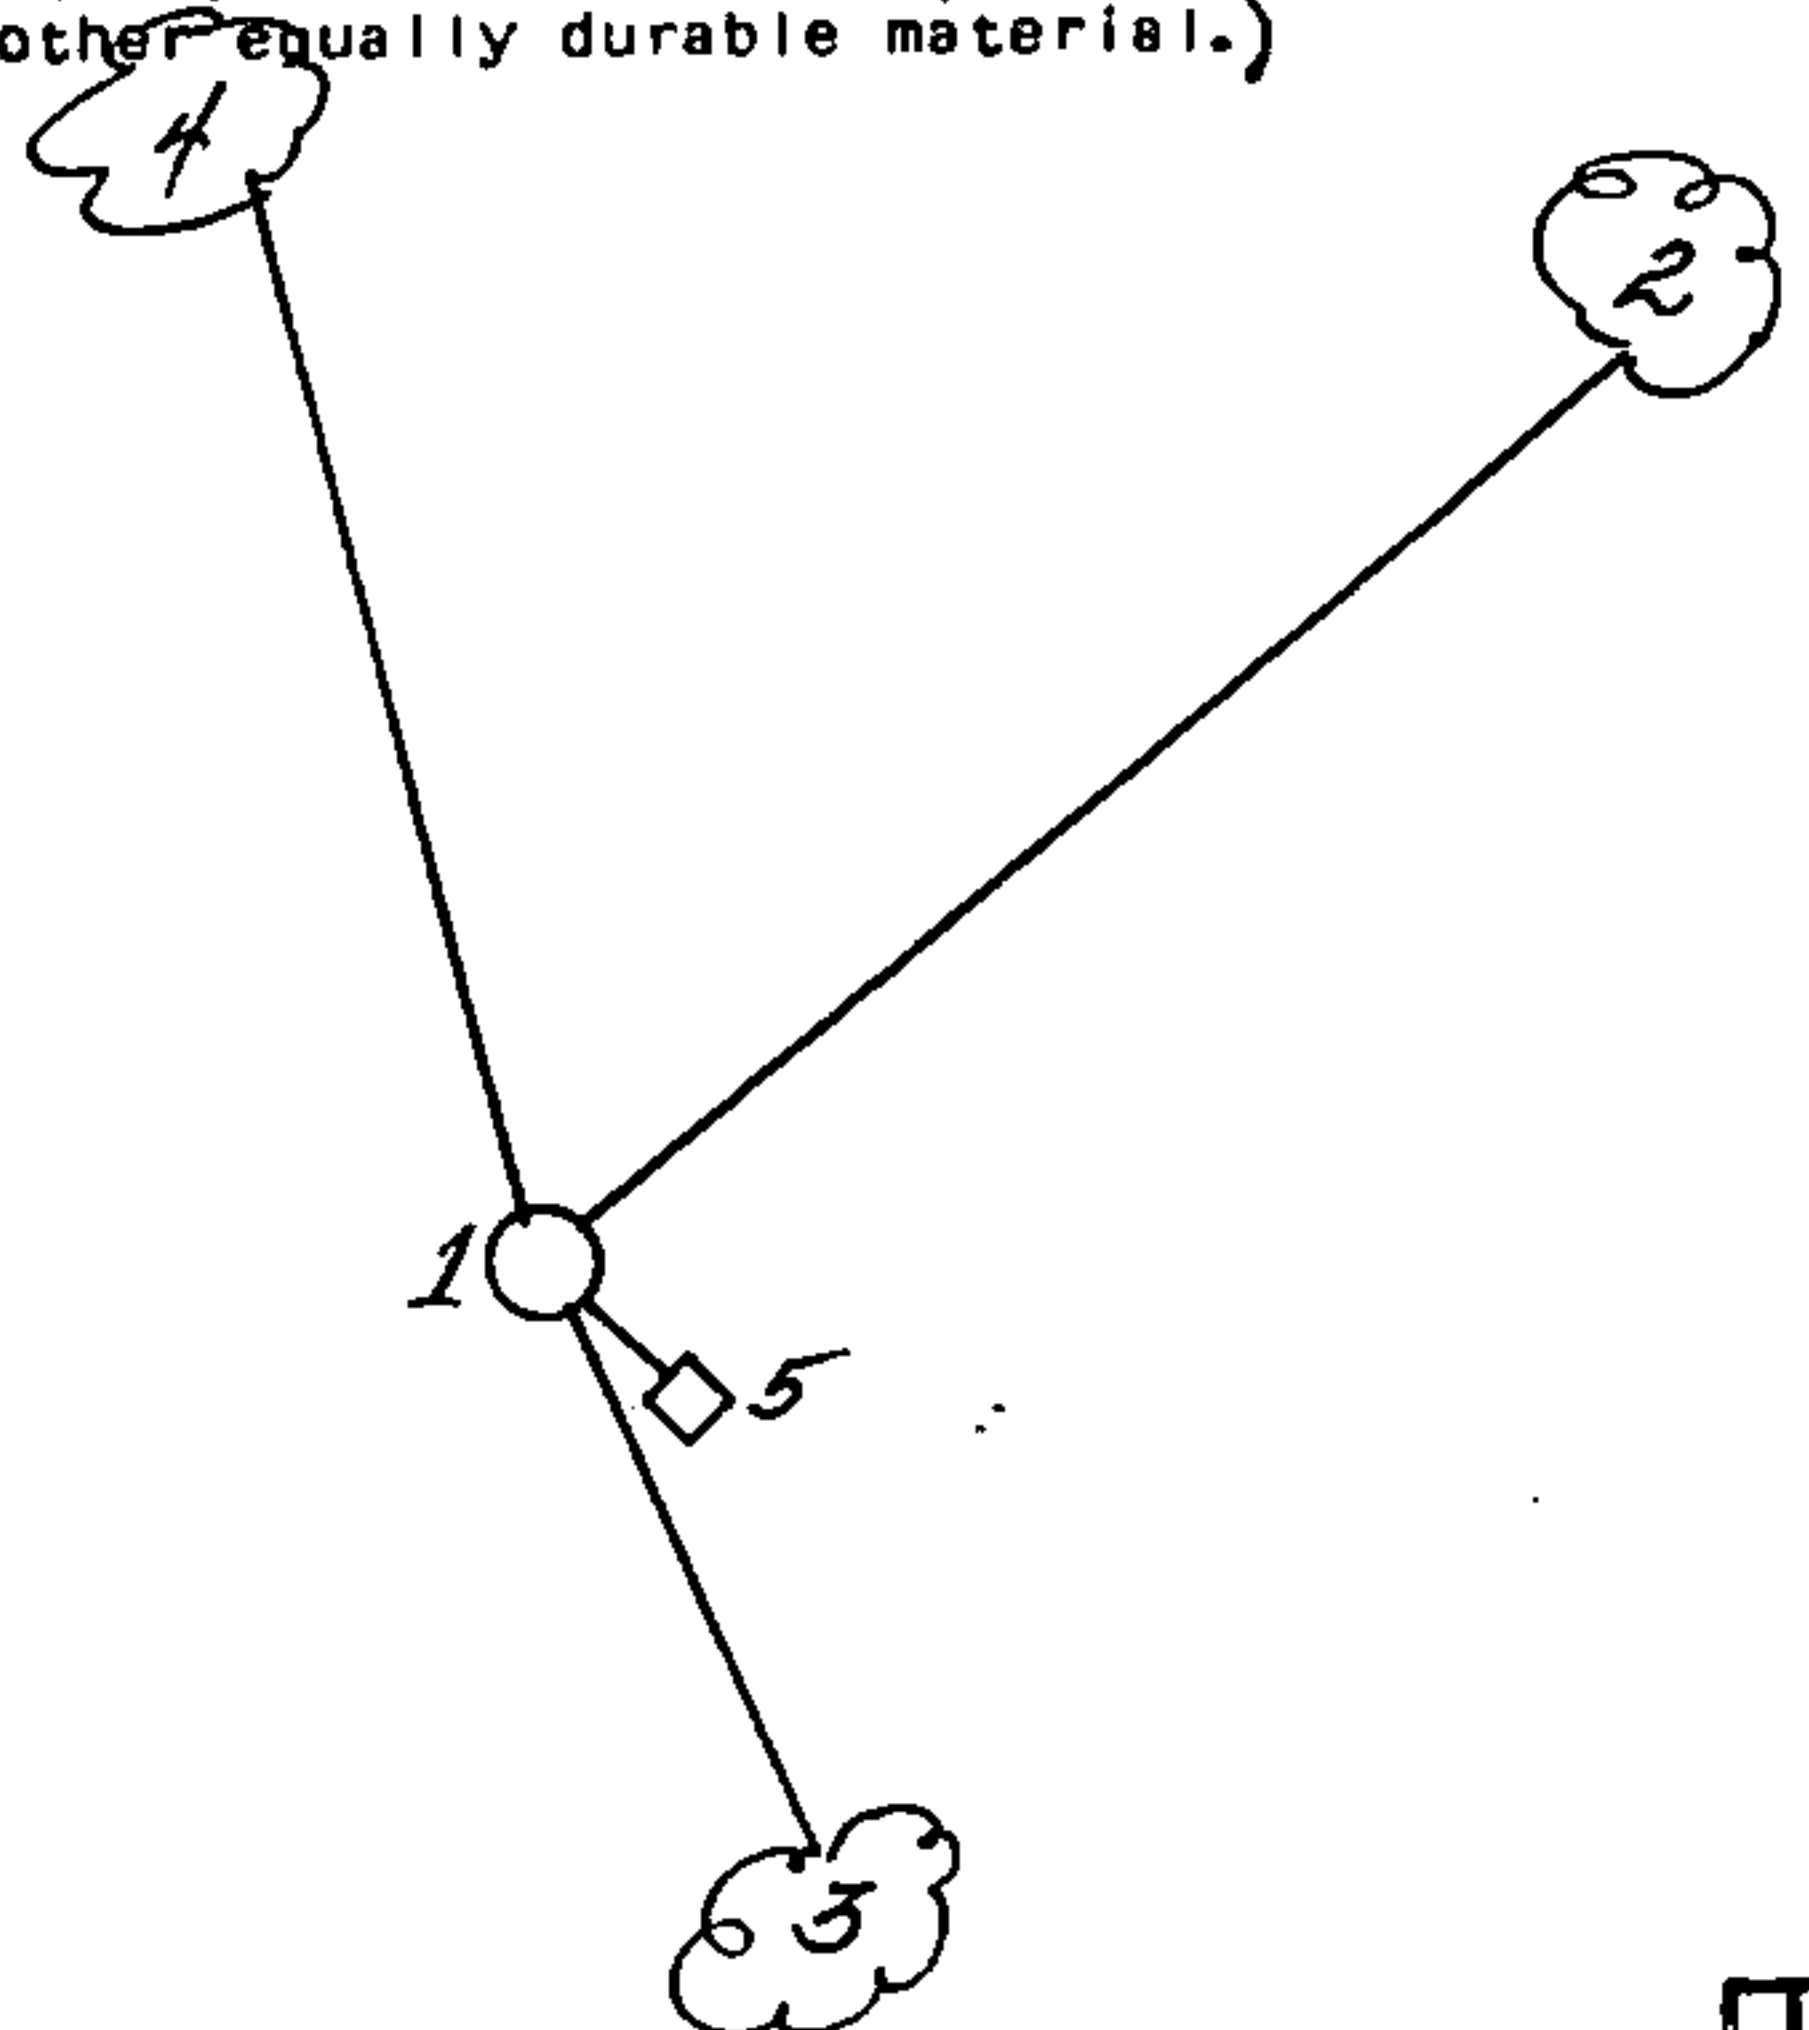

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Milo E. Stefan
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Milo E. Stefan
Signature

3/11/86
Date



U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:


This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

Quarter Corner Common to Sections 1 and 12,
 T.35N., R.15E., Forest County, Wisconsin.

State Plane Coordinates
 Wisconsin North Zone
 N - 137893.81701
 E - 2336963.49303

Geographic Coordinates
 N - 45 - 32 - 008.44463
 W - 088 - 33 - 43.51821

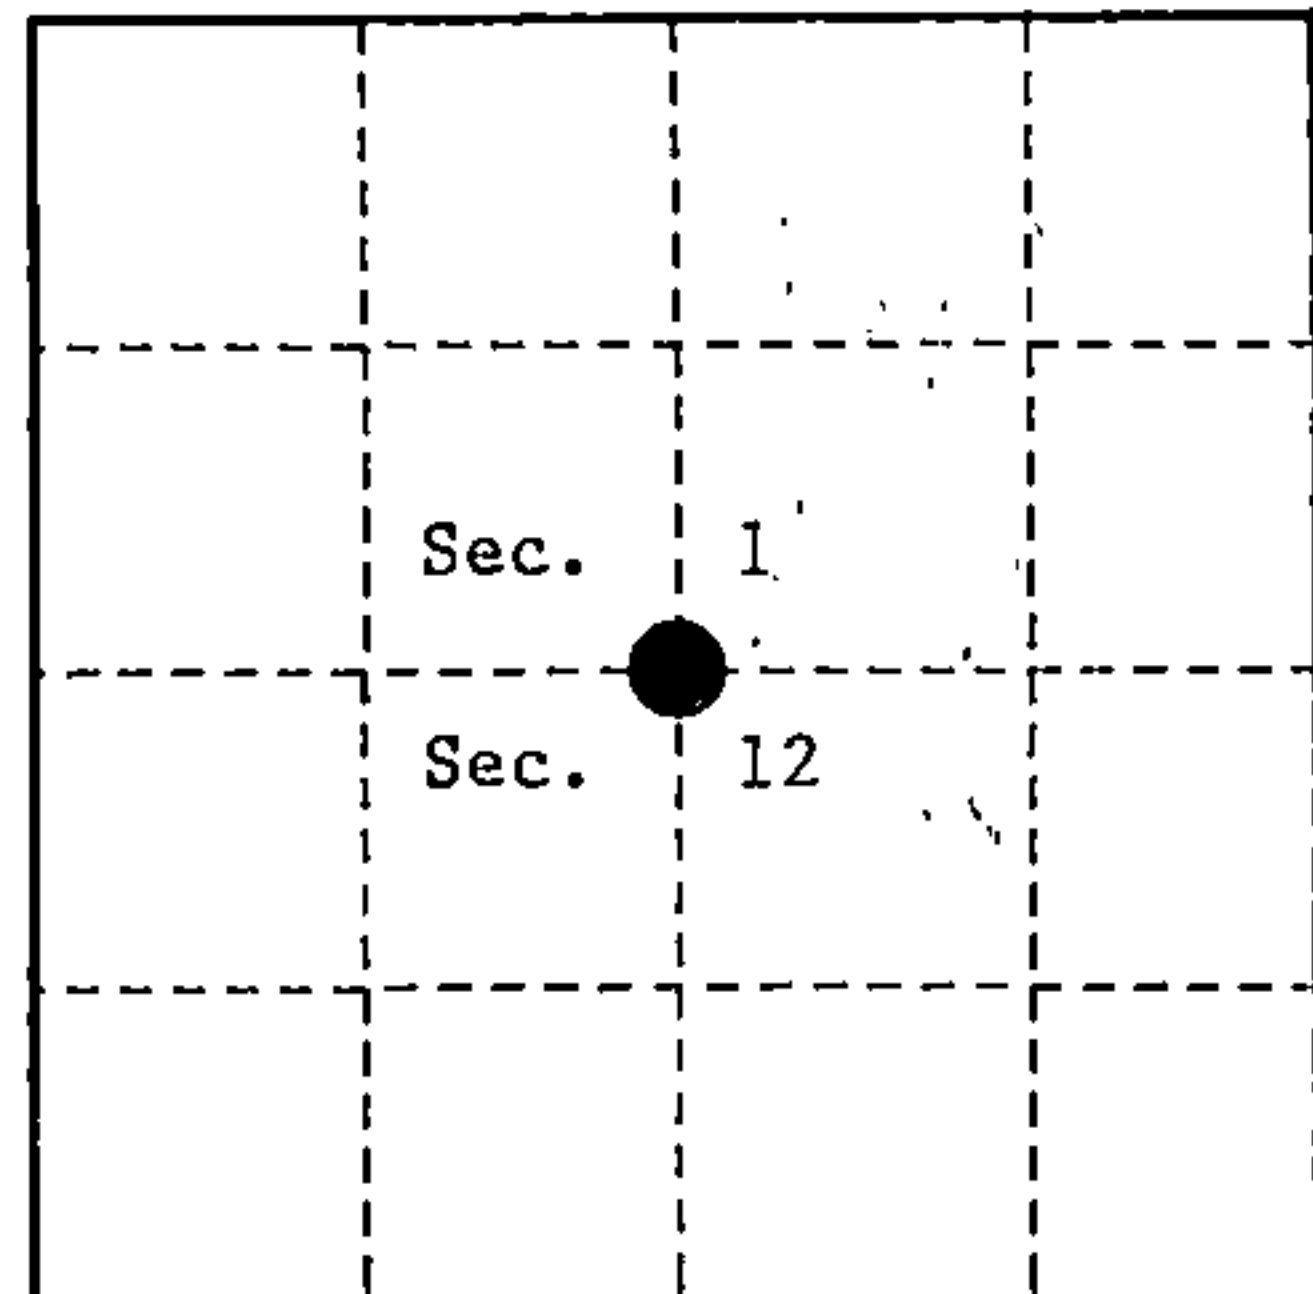

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1859, James McBride set wood post and made the following B.T.'s; Birch, 10", N.15°E., 19 links, Fir, 10", S.33°W., 11 links.

In 1905, N. Smith found original corner and Birch BT standing (green).

In the 1930s, R. Reinike found Spruce post in good condition and scribed Hemlock B.T., S.32°E., 23 links, Placed location poster on Aspen, 5", S.72°E., 9 links.


In 1982, Milo Stefan found mound of rock with post hole--from which a broken-off Aspen with location tag at base was found, S.72°E., 5.9 feet and remains of original Birch stump, N.15°E., 12.5 feet. Set monument and new references.

In 1994, Alan Harrison, RLS, found the monument and corner references as set by Milo Stefan in 1982. Made 2 new bearing trees; Hemlock, 16", S.78°E., 72.43 feet, Spruce, 12", S.05°E., 62.23 feet.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2" X 36" Aluminum Monument Stamped to identify corner.
2. Hemlock, 15", N.42°E., 42.64 feet.
3. Hemlock, 16", S.78°E., 72.43 feet.
4. Spruce, 12", S.05°E., 62.23 feet.
5. Spruce, 12", S.24°W., 12.73 feet.
6. Red Pine, 6", N.17°W., 48.73 feet.
7. Steel Sign Post, Southeast, 1.46 feet.

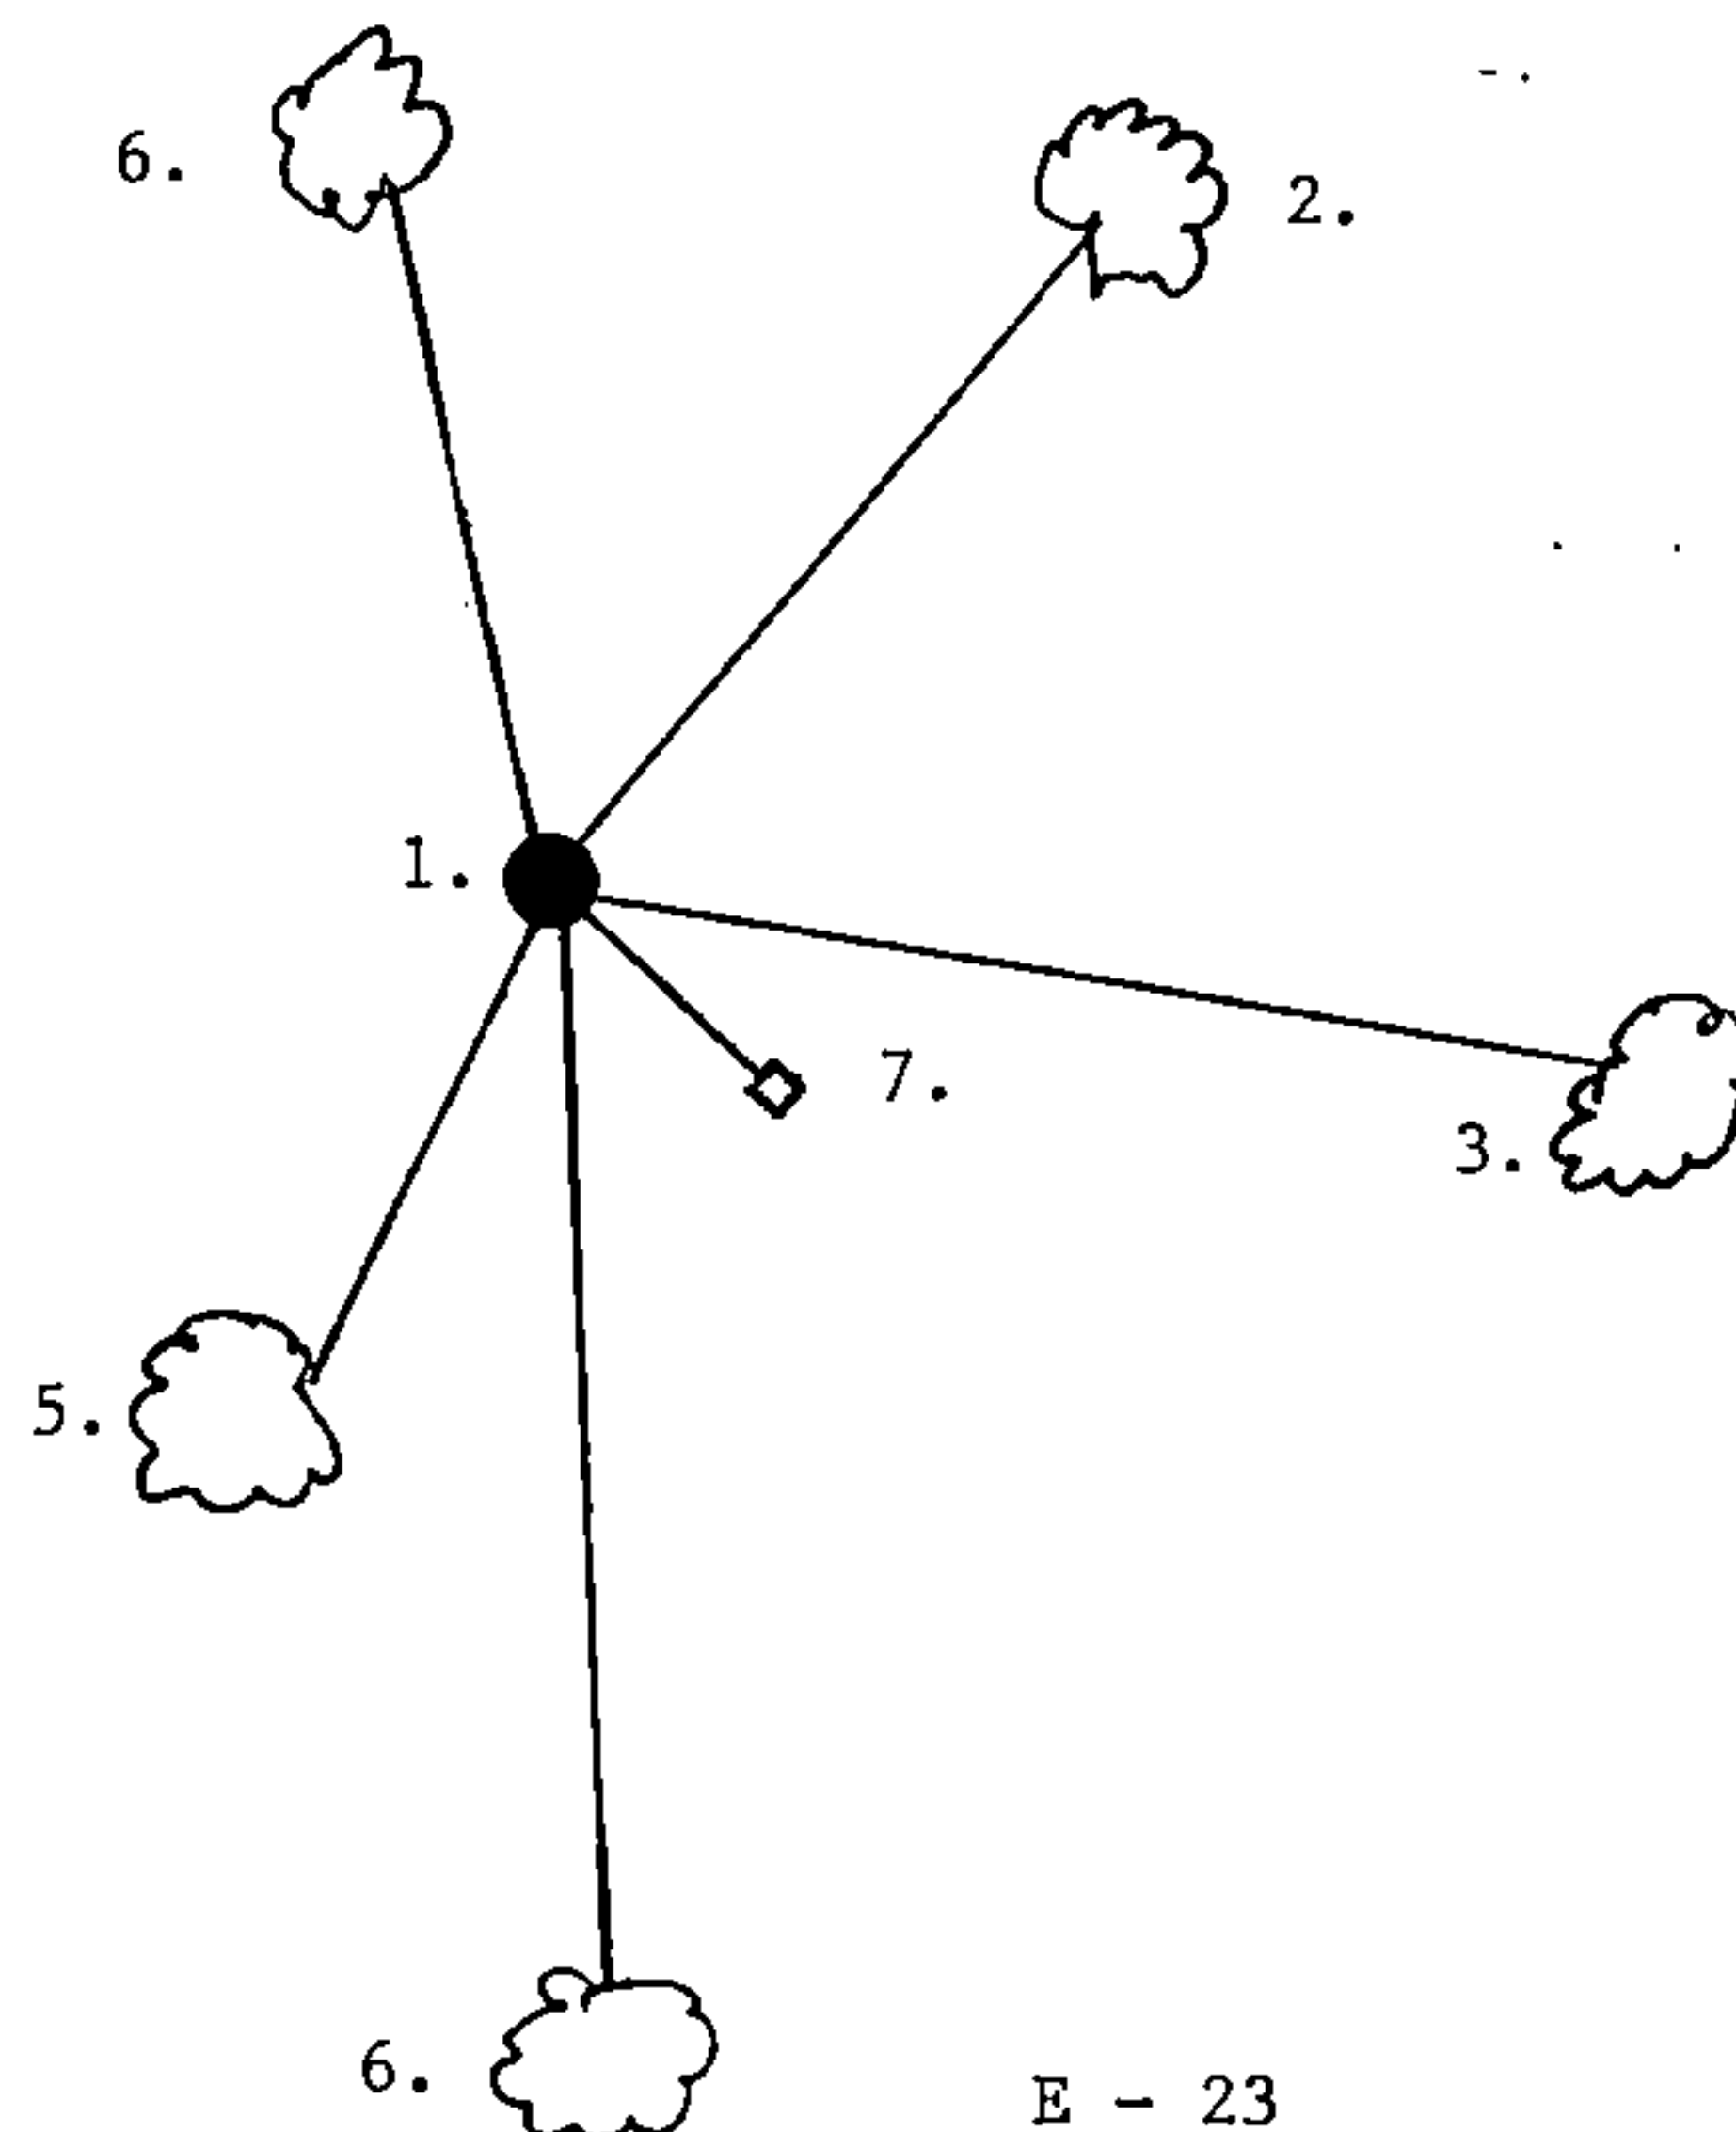

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE
Forest County, Wis.

Received for record this 10th day
of May A.D. 1995 at
8:30 o'clock A.M. and recorded
in Vol. Corr. Restorations
page 3-15, E-23

Shel Chittles Deputy
Register of Deeds

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

