

# U. S. PUBLIC LAND SURVEY MONUMENT RECORD

## INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.  
 O = Corner monument restored.

Quarter Corner between Sections 5 & 6, T.35N., R.15E., Forest County WI.

State Plane Coordinates Wisconsin North Zone


N - 140327.43092

E - 2313248.57533

Geographic Coordinates

N - 45-32-36.56962

W - 88-39-16.04004

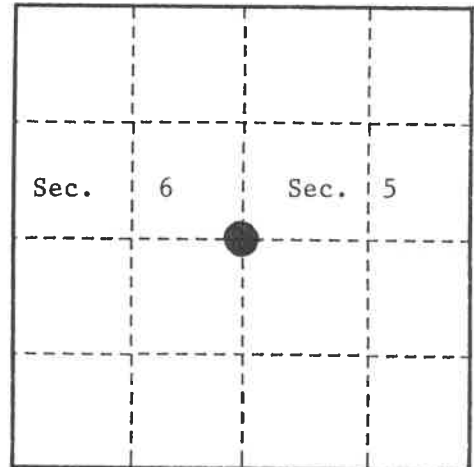

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1859 by James McBride. Set wood post and the following bearing trees; Birch, 10", N.67°E., 24 links, Birch, 8", N.48°W., 37 links.


In 1965, Jean Resvick (RLS) restored the corner position at the intersection of the center-line of a North-South road, and fence lines East and West. Set a 1" square head bolt at the corner position. Set a 2" X 60" galvanized iron pipe West 33.00 feet from corner position for witness corner.

In 1995, Alan Harrison (RLS) found corner position in blacktop of County Hwy "H". Found witness corner monument S.82°W., 31.78 feet. Set a steel sign post 1.00 feet West of W.C. Monument. Blazed and scribed 2 new bearing trees as listed below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. P.K. nail in blacktop for corner position.
2. Tamarack, 7", N.76°E., 29.80 feet (NBT)
3. Tamarack, 10", N.37°W., 65.02 feet (NBT)
4. 2" X 60" W.C. Monument, S.82°W., 31.78 feet
5. C/L County Hwy "H", East, 1.80 feet
6. Steel Sign Post, 1.00 feet West of W.C. Monument

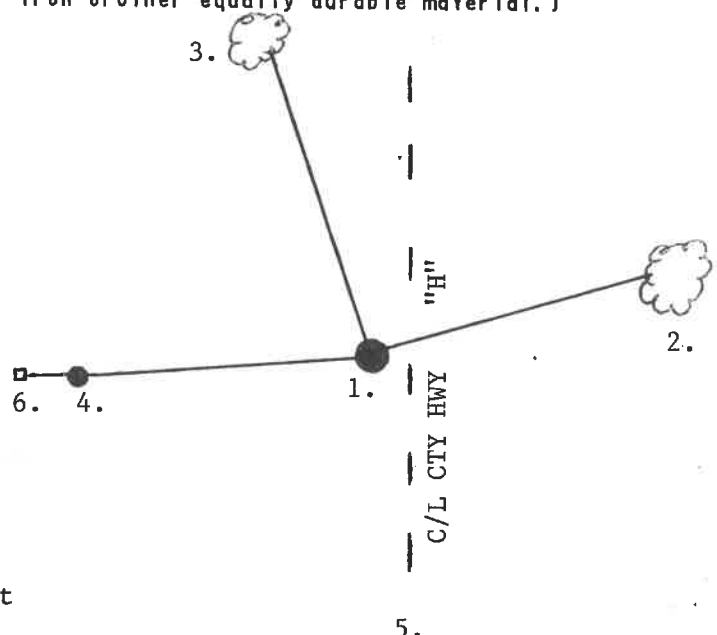

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2)

- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

REGISTER'S OFFICE /  
Forest County, Wis. ( )  
Received for record this 22<sup>nd</sup> day  
of November A.D., 19 95 at  
9:30 o'clock A.M. and recorded  
in Vol. Case Restorations  
page 35-15-C-5  
Paul C. H. Deputy  
Register of Deeds

(1) I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Date

CERTIFICATE READY FOR FILING:

District Ranger

